



# HEIDENHAIN



## TNC 620

User's Manual  
Setup, Testing and Running  
NC Programs

NC Software  
817600-08  
817601-08  
817605-08

English (en)  
01/2021







## Controls and displays

### Keys






If you are using a TNC 620 with touch control, you can replace some keystrokes with gestures.

**Further information:** "Operating the touchscreen", Page 461



### Keys on the screen

Key	Function
	Select screen layout
	Toggle the display between machine operating mode, programming mode, and a third desktop
	Soft keys for selecting functions on screen
  	Switch the soft-key rows






 









### Machine operating modes

Key	Function
	Manual operation
	Electronic handwheel
	Positioning with Manual Data Input
	Program Run, Single Block
	Program Run, Full Sequence


 
### Programming modes

Key	Function
	Programming
	Test Run





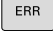
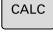
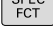

### Entering and editing coordinate axes and numbers

Key	Function
 ... 	Select the coordinate axes or enter them in the NC program
 ... 	Numbers
 	Decimal separator / Reverse algebraic sign
 	Polar coordinate entry / Incremental values
	Q parameter programming / Q parameter status
	Capture actual position
	Skip dialog questions, delete words
	Confirm entry and resume dialog
	Conclude the NC block, end your input
	Clear entries or error message
	Abort dialog, delete program section



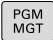



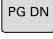
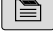
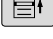
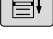
### Tool functions

Key	Function
	Define tool data in the NC program
	Call tool data





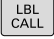

## Managing NC programs and files, control functions

Key	Function
	Select or delete NC programs or files, external data transfer
	Define program call, select datum and point tables
	Select MOD functions
	Display help text for NC error messages, call TNCguide
	Display all current error messages
	Show calculator
	Show special functions
	Currently not assigned

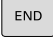



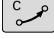
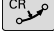
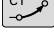
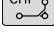
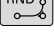
## Navigation keys

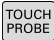Key	Function
 	Position the cursor
	Go directly to NC blocks, cycles, and parameter functions
	Navigate to the beginning of a program or table
	Navigate to the end of the program or table row
	Navigate up one page
	Navigate down one page
	Select the next tab in forms
 	Up/down one dialog box or button

## Cycles, subprograms and program section repeats

Key	Function
	Define touch probe cycles
 	Define and call cycles
 	Enter and call subprograms and program section repeats
	Enter program stop in an NC program

## Programming path contours

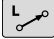Key	Function
	Contour approach and departure
	FK free contour programming
	Straight line
	Circle center/pole for polar coordinates
	Circular arc with center
	Circular arc with radius
	Circular arc with tangential transition
 	Chamfer/rounding arc

## Potentiometer for feed rate and spindle speed

Feed rate	Spindle speed
	





Contents

1 Basic information.....25

2 First steps.....45

3 Fundamentals.....57

4 Tools..... 125

5 Setup..... 163

6 Testing and running..... 243

7 Special functions..... 309

8 Pallets.....315

9 MOD functions.....337

10 HEROS functions..... 365

11 Operating the touchscreen.....461

12 Tables and overviews.....477



<b>1</b>	<b>Basic information.....</b>	<b>25</b>
<b>1.1</b>	<b>About this manual.....</b>	<b>26</b>
<b>1.2</b>	<b>Control model, software and features.....</b>	<b>28</b>
	Software options.....	30
	New functions 81760x-08.....	34

<b>2</b>	<b>First steps.....</b>	<b>45</b>
<b>2.1</b>	<b>Overview.....</b>	<b>46</b>
<b>2.2</b>	<b>Switching on the machine.....</b>	<b>47</b>
	Acknowledging the power interruption and moving to the reference points.....	47
<b>2.3</b>	<b>Graphically testing the workpiece (option 20).....</b>	<b>48</b>
	Selecting the Test Run operating mode.....	48
	Selecting the tool table.....	48
	Selecting the NC program.....	49
	Selecting the screen layout and the view.....	49
	Starting the test run.....	50
<b>2.4</b>	<b>Setting up tools.....</b>	<b>51</b>
	Selecting the Manual operation mode.....	51
	Preparing and measuring tools.....	51
	Editing the TOOL.T tool table.....	52
	Editing the TOOL_PTCH pocket table.....	53
<b>2.5</b>	<b>Workpiece setup.....</b>	<b>54</b>
	Selecting the correct operating mode.....	54
	Clamping the workpiece.....	54
	Presetting with a 3-D touch probe (option number 17).....	54
<b>2.6</b>	<b>Machining the workpiece.....</b>	<b>56</b>
	Selecting the Program run, single block or Program run, full sequence operating mode.....	56
	Selecting the NC program.....	56
	Starting an NC program.....	56

<b>3</b>	<b>Fundamentals.....</b>	<b>57</b>
<b>3.1</b>	<b>The TNC 620.....</b>	<b>58</b>
	HEIDENHAIN Klartext and DIN/ISO.....	58
	Compatibility.....	58
	Data security and data protection.....	59
<b>3.2</b>	<b>Visual display unit and operating panel.....</b>	<b>61</b>
	Display screen.....	61
	Setting the screen layout.....	62
	Control panel.....	62
	Screen keypad.....	63
<b>3.3</b>	<b>Modes of operation.....</b>	<b>64</b>
	Manual Operation and El. Handwheel.....	64
	Positioning with Manual Data Input.....	64
	Programming.....	65
	Test Run.....	65
	Program Run, Full Sequence and Program Run, Single Block.....	66
<b>3.4</b>	<b>Status displays.....</b>	<b>67</b>
	General status display.....	67
	Additional status displays.....	70
<b>3.5</b>	<b>File management.....</b>	<b>78</b>
	Files.....	78
	Displaying externally generated files on the control.....	80
	Directories.....	80
	Paths.....	80
	Calling the file manager.....	81
	Additional functions.....	82
	Selecting drives, directories and files.....	83
	Choosing one of the last files selected.....	85
	USB devices on the control.....	85
	Data transfer to or from an external data carrier.....	87
	The control within the network.....	88
	Data backup.....	89
	Importing a file from an iTNC 530.....	89
	Additional tools for management of external file types.....	90
<b>3.6</b>	<b>Error messages and help system.....</b>	<b>99</b>
	Error messages.....	99
	TNCguide context-sensitive help system.....	106
<b>3.7</b>	<b>NC fundamentals.....</b>	<b>111</b>
	Position encoders and reference marks.....	111

Programmable axes.....	111
Reference systems.....	112
<b>3.8 Accessories: HEIDENHAIN 3-D touch probes and electronic handwheels.....</b>	<b>122</b>
3-D touch probes (option 17).....	122
HR electronic handwheels.....	123

<b>4</b>	<b>Tools.....</b>	<b>125</b>
<b>4.1</b>	<b>Tool data.....</b>	<b>126</b>
	Tool number, tool name.....	126
	Tool length L.....	126
	Tool radius R.....	127
	Tool table fundamentals.....	128
	Creating and activating an INCH-based tool table.....	132
	Entering tool data into the table.....	133
	Importing tool tables.....	137
	Overwriting tool data from an external PC.....	139
	Pocket table for tool changer.....	140
	Tool change.....	143
	Tool usage test.....	144
<b>4.2</b>	<b>Tool management.....</b>	<b>147</b>
	Basics.....	147
	Calling tool management.....	148
	Editing tool management.....	149
	Available tool types.....	152
	Importing and exporting tool data.....	154
<b>4.3</b>	<b>Tool carrier management.....</b>	<b>157</b>
	Fundamentals.....	157
	Saving tool carrier templates.....	157
	Parameterizing tool carriers.....	158
	Assigning a tool carrier.....	161

<b>5</b>	<b>Setup.....</b>	<b>163</b>
<b>5.1</b>	<b>Switching on/off.....</b>	<b>164</b>
	Switch-on.....	164
	Traversing reference points.....	166
	Switching off.....	168
<b>5.2</b>	<b>Moving the machine axes.....</b>	<b>169</b>
	Note.....	169
	Moving the axis with the axis direction keys.....	169
	Incremental jog positioning.....	170
	Traversing with electronic handwheels.....	171
<b>5.3</b>	<b>Spindle speed S, feed rate F and miscellaneous function M.....</b>	<b>181</b>
	Application.....	181
	Entering values.....	181
	Changing the spindle speed and feed rate.....	182
	Feed-rate limit F MAX.....	183
<b>5.4</b>	<b>Integrated functional safety (FS).....</b>	<b>184</b>
	Miscellaneous.....	184
	Safety functions.....	185
	Functional safety (FS) status displays.....	185
	Checking the axis positions.....	187
	Activating feed-rate limits.....	188
<b>5.5</b>	<b>Preset management.....</b>	<b>189</b>
	Note.....	189
	Creating and activating an INCH-based preset table.....	190
	Saving presets in the table.....	191
	Protecting presets from being overwritten.....	195
	Activating a preset.....	197
<b>5.6</b>	<b>Presetting without a 3-D touch probe.....</b>	<b>198</b>
	Note.....	198
	Preparation.....	198
	Presetting with an end mill.....	199
	Using touch probe functions with mechanical probes or measuring dials.....	200
<b>5.7</b>	<b>Using a 3-D touch probe (option 17).....</b>	<b>201</b>
	Introduction.....	201
	Overview.....	203
	Suppressing touch probe monitoring.....	205
	Functions in touch probe cycles.....	206
	Selecting the probing cycle.....	209
	Recording measured values from the touch probe cycles.....	209



Writing measured values from the touch probe cycles to a datum table.....	210
Writing measured values from the touch probe cycles to the preset table.....	211
<b>5.8 Calibrating 3-D touch probes (option 17).....</b>	<b>212</b>
Introduction.....	212
Calibrating the effective length.....	213
Calibrating the effective radius and compensating center misalignment.....	214
Displaying calibration values.....	217
<b>5.9 Compensating workpiece misalignment with 3-D touch probe (option 17).....</b>	<b>218</b>
Introduction.....	218
Measuring a basic rotation.....	220
Saving the basic rotation in the preset table.....	220
Compensation of workpiece misalignment by rotating the table.....	221
Showing basic rotation and offset.....	222
Rescinding basic rotation or offset.....	222
Determining a 3-D basic rotation.....	223
Comparison of offset and 3-D basic rotation.....	226
<b>5.10 Presetting with a 3-D touch probe (option number 17).....</b>	<b>227</b>
Overview.....	227
Presetting on any axis.....	228
Corner as preset.....	229
Circle center as preset.....	230
Setting a center line as preset.....	233
Measuring workpieces with a 3-D touch probe.....	234
<b>5.11 Tilting the working plane (option 8).....</b>	<b>237</b>
Application, function.....	237
Position display in a tilted system.....	238
Limitations on working with the tilting function.....	238
Activating manual tilting.....	239
Setting the tool-axis direction as the active machining direction.....	241
Setting a preset in a tilted coordinate system.....	241

<b>6</b>	<b>Testing and running.....</b>	<b>243</b>
<b>6.1</b>	<b>Graphics (option 20).....</b>	<b>244</b>
	Application.....	244
	View options.....	246
	Tool.....	247
	View.....	248
	Rotating, zooming and moving a graphic.....	250
	Setting the speed of the Test Run mode.....	251
	Repeating graphic simulation.....	251
	Shifting the sectional plane.....	252
<b>6.2</b>	<b>Monitoring for collisions.....</b>	<b>253</b>
	Application.....	253
<b>6.3</b>	<b>Measurement of machining time (option 20).....</b>	<b>254</b>
	Application.....	254
<b>6.4</b>	<b>Showing the workpiece blank in the working space (option 20).....</b>	<b>255</b>
	Application.....	255
<b>6.5</b>	<b>Measuring.....</b>	<b>257</b>
	Application.....	257
<b>6.6</b>	<b>Optional program-run interruption.....</b>	<b>258</b>
	Application.....	258
<b>6.7</b>	<b>Skipping NC blocks.....</b>	<b>259</b>
	Test Run and Program Run.....	259
	Positioning w/ Manual Data Input.....	260
<b>6.8</b>	<b>Exporting a finished part.....</b>	<b>261</b>
	Application.....	261
<b>6.9</b>	<b>Test run.....</b>	<b>262</b>
	Application.....	262
	Test run execution.....	264
	Executing a Test Run up to a certain NC block.....	265
	Using the GOTO key.....	266
	Scrollbar.....	267
<b>6.10</b>	<b>Program run.....</b>	<b>268</b>
	Application.....	268
	Running an NC program.....	268
	Structuring NC programs.....	269
	Checking and changing Q parameters.....	270
	Interrupting, stopping or aborting machining.....	272

Compensation during the program run.....	274
Moving the machine axes during an interruption.....	275
Resuming program run after an interruption.....	276
Retraction after a power interruption.....	277
Any entry into the NC program: Block scan.....	280
Returning to the contour.....	286
<b>6.11 Running CAM programs.....</b>	<b>288</b>
From 3-D model to NC program.....	288
Considerations required for post processor configuration.....	289
Please note the following for CAM programming.....	291
Possibilities for intervention on the control.....	293
ADP motion control.....	293
<b>6.12 Functions for program display.....</b>	<b>294</b>
Overview.....	294
<b>6.13 Automatic program start.....</b>	<b>295</b>
Application.....	295
<b>6.14 Positioning w/ Manual Data Input operating mode.....</b>	<b>296</b>
Positioning with manual data input (MDI).....	297
Saving NC programs from \$MDI.....	299
<b>6.15 Entering miscellaneous functions M and STOP.....</b>	<b>300</b>
Fundamentals.....	300
<b>6.16 Miscellaneous functions for program run inspection, spindle and coolant.....</b>	<b>301</b>
Overview.....	301
<b>6.17 Miscellaneous functions for coordinate entries.....</b>	<b>302</b>
Programming machine-referenced coordinates: M91/M92.....	302
Moving to positions in a non-tilted input coordinate system with a tilted working plane: M130.....	304
<b>6.18 Miscellaneous functions for path behavior.....</b>	<b>305</b>
Superimposing handwheel positioning during program run: M118 (option 21).....	305
Deleting basic rotation: M143.....	306
Automatically retracting the tool from the contour at an NC stop: M148.....	307

<b>7</b>	<b>Special functions.....</b>	<b>309</b>
<b>7.1</b>	<b>Active Chatter Control (ACC) (option 145).....</b>	<b>310</b>
	Application.....	310
	Activating ACC.....	311
<b>7.2</b>	<b>Defining a counter.....</b>	<b>312</b>
	Application.....	312
	Defining FUNCTION COUNT.....	313

<b>8</b>	<b>Pallets.....</b>	<b>315</b>
<b>8.1</b>	<b>Pallet management (option number 22).....</b>	<b>316</b>
	Application.....	316
	Selecting a pallet table.....	319
	Inserting or deleting columns.....	319
	Executing a pallet table.....	320
<b>8.2</b>	<b>Pallet preset management.....</b>	<b>322</b>
	Fundamentals.....	322
	Using pallet presets.....	322
<b>8.3</b>	<b>Tool-oriented machining.....</b>	<b>323</b>
	Fundamentals of tool-oriented machining.....	323
	Sequence of tool-oriented machining.....	325
	Mid-program startup with block scan.....	326
<b>8.4</b>	<b>Batch Process Manager (option 154).....</b>	<b>327</b>
	Application.....	327
	Fundamentals.....	327
	Opening the Batch Process Manager.....	330
	Creating a job list.....	333
	Editing a job list.....	334

<b>9</b>	<b>MOD functions.....</b>	<b>337</b>
<b>9.1</b>	<b>MOD function.....</b>	<b>338</b>
	Selecting MOD functions.....	338
	Changing the settings.....	338
	Exiting MOD functions.....	338
	Overview of MOD functions.....	339
<b>9.2</b>	<b>Display software numbers.....</b>	<b>340</b>
	Application.....	340
<b>9.3</b>	<b>Entering the code number.....</b>	<b>341</b>
	Application.....	341
	Functions provided to the machine tool builder by the code number dialog.....	341
<b>9.4</b>	<b>Loading the machine configuration.....</b>	<b>342</b>
	Application.....	342
<b>9.5</b>	<b>Selecting the position display.....</b>	<b>343</b>
	Application.....	343
<b>9.6</b>	<b>Setting the unit of measure.....</b>	<b>345</b>
	Application.....	345
<b>9.7</b>	<b>Graphic settings.....</b>	<b>346</b>
<b>9.8</b>	<b>Setting the counter.....</b>	<b>348</b>
<b>9.9</b>	<b>Changing the machine settings.....</b>	<b>349</b>
	Selecting the kinematics.....	349
	Entering traverse limits.....	350
	Generating a tool usage file.....	352
	Permitting or restricting external access.....	352
<b>9.10</b>	<b>Setting up touch probes.....</b>	<b>355</b>
	Introduction.....	355
	Setting up a touch probe with radio transmission.....	355
	Setting up a touch probe from within the MOD function.....	356
	Touch probe with radio transmission configuration.....	357
<b>9.11</b>	<b>Configuring the HR 550FS radio handwheel.....</b>	<b>359</b>
	Application.....	359
	Assigning the handwheel to a specific handwheel holder.....	359
	Setting the transmission channel.....	360
	Selecting the transmitter power.....	360
	Statistical data.....	361

<b>9.12</b>	<b>Changing the system settings.....</b>	<b>362</b>
	Set the system time.....	362
<b>9.13</b>	<b>Diagnostic functions.....</b>	<b>363</b>
	Bus diagnosis.....	363
	TNCdiag.....	363
	Drive diagnosis.....	363
	Hardware configuration.....	363
	HeROS information.....	363
<b>9.14</b>	<b>Displaying operating times.....</b>	<b>364</b>
	Application.....	364

<b>10 HEROS functions.....</b>	<b>365</b>
<b>10.1 Remote Desktop Manager (option 133).....</b>	<b>366</b>
Introduction.....	366
Configuring a connection: Windows Terminal Service (RemoteFX).....	367
Configuring a connection: VNC.....	371
Shutting down or restarting an external computer.....	372
Starting and stopping the connection.....	374
Exporting and importing connections.....	375
Private connections.....	376
<b>10.2 Additional tools for ITCs.....</b>	<b>377</b>
<b>10.3 Window manager.....</b>	<b>379</b>
Overview of taskbar.....	380
Portscan.....	384
Remote Service.....	385
Printer.....	387
State Reporting Interface (option 137).....	389
VNC.....	392
Backup and restore.....	395
<b>10.4 Firewall.....</b>	<b>398</b>
Application.....	398
<b>10.5 Setting up data interfaces.....</b>	<b>401</b>
Serial interfaces on the TNC 620.....	401
Application.....	401
Setting the RS-232 interface.....	401
Set BAUD RATE (baud rate no. 106701).....	401
Set protocol (protocol no. 106702).....	402
Set data bits (dataBits no. 106703).....	402
Check parity (parity no. 106704).....	402
Set stop bits (stopBits no. 106705).....	402
Set handshake (flowControl no. 106706).....	403
File system for file operation (fileSystem no. 106707).....	403
Block check character (bccAvoidCtrlChar no. 106708).....	403
Condition of RTS line (rtsLow no. 106709).....	403
Define behavior after receipt of ETX (noEotAfterEtx no. 106710).....	403
Settings for the transmission of data using PC software TNCserver.....	404
Setting the operating mode of the external device (fileSystem).....	404
Software for data transfer.....	405
<b>10.6 Ethernet interface.....</b>	<b>407</b>
Introduction.....	407
Connection possibilities.....	407



General network settings.....	407
Settings for network drives.....	414
<b>10.7 SELinux security software.....</b>	<b>417</b>
<b>10.8 User administration.....</b>	<b>418</b>
Introduction.....	418
Configuring the user administration.....	419
Local LDAP database.....	424
LDAP on remote computer.....	424
Connection to a Windows domain.....	425
Creating further users.....	428
Password settings in user administration.....	430
Access rights.....	432
HEIDENHAIN function users.....	433
Definition of roles.....	434
Privileges.....	437
Enabling Autologin.....	438
User authentication from external applications.....	439
Login to user administration.....	443
Switching or logging out users.....	446
Screensaver with lockout.....	446
HOME directory.....	448
'public' directory.....	448
Current User.....	450
Dialog for requesting additional rights.....	452
<b>10.9 HEIDENHAIN OPC UA NC Server (options 56 to 61).....</b>	<b>453</b>
Introduction.....	453
IT Security.....	453
Machine configuration.....	454
Setting up the connection.....	454
Application development.....	456
Access to directories.....	457
PKI Admin.....	458
<b>10.10 Changing the HEROS conversational language.....</b>	<b>460</b>

<b>11</b>	<b>Operating the touchscreen.....</b>	<b>461</b>
<b>11.1</b>	<b>Display unit and operation.....</b>	<b>462</b>
	Touchscreen.....	462
	Operating panel.....	463
<b>11.2</b>	<b>Gestures.....</b>	<b>465</b>
	Overview of possible gestures.....	465
	Navigating in the table and NC programs.....	466
	Operating the simulation.....	467
	Using the HEROS menu.....	468
	Operating the CAD viewer.....	469
<b>11.3</b>	<b>Functions in the taskbar.....</b>	<b>475</b>
	Icons of the taskbar.....	475
	Touchscreen configuration.....	476
	Touchscreen cleaning.....	476

<b>12 Tables and overviews.....</b>	<b>477</b>
<b>12.1 Machine-specific user parameters.....</b>	<b>478</b>
Application.....	478
List of user parameter.....	480
<b>12.2 Pin layout and cables for data interfaces.....</b>	<b>495</b>
RS-232-C/V.24 interface for HEIDENHAIN devices.....	495
Non-HEIDENHAIN devices.....	497
Ethernet interface RJ45 socket.....	497
<b>12.3 Specifications.....</b>	<b>498</b>
User functions.....	501
Accessories.....	504
<b>12.4 Differences between the TNC 620 and the iTNC 530.....</b>	<b>505</b>
Comparison: Specifications.....	505
Comparison: Data interfaces.....	505
Comparison: PC software.....	506
Comparison: User functions.....	506
Comparison: Touch probe cycles in the Manual operation and Electronic handwheel operating modes.....	511
Comparison: Differences in programming.....	512
Comparison: Differences in Test Run, functionality.....	515
Comparison: Differences in Test Run, operation.....	516
Comparison: Differences in Manual Operation, functionality.....	517
Comparison: Differences in Manual Operation, operation.....	518
Comparison: Differences in Program Run, operation.....	518
Comparison: Differences in Program Run, traverse movements.....	519
Comparison: Differences in MDI operation.....	524
Comparison: Differences in programming station.....	524



# 1

## Basic information

## 1.1 About this manual

### Safety precautions

Comply with all safety precautions indicated in this document and in your machine tool builder's documentation!

Precautionary statements warn of hazards in handling software and devices and provide information on their prevention. They are classified by hazard severity and divided into the following groups:

#### **DANGER**

**Danger** indicates hazards for persons. If you do not follow the avoidance instructions, the hazard **will result in death or severe injury**.

#### **WARNING**

**Warning** indicates hazards for persons. If you do not follow the avoidance instructions, the hazard **could result in death or serious injury**.

#### **CAUTION**

**Caution** indicates hazards for persons. If you do not follow the avoidance instructions, the hazard **could result in minor or moderate injury**.

#### **NOTICE**

**Notice** indicates danger to material or data. If you do not follow the avoidance instructions, the hazard **could result in property damage**.

### Sequence of information in precautionary statements

All precautionary statements comprise the following four sections:

- Signal word indicating the hazard severity
- Type and source of hazard
- Consequences of ignoring the hazard, e.g.: "There is danger of collision during subsequent machining operations"
- Escape – Hazard prevention measures

### Informational notes

Observe the informational notes provided in these instructions to ensure reliable and efficient operation of the software.

In these instructions, you will find the following informational notes:



The information symbol indicates a **tip**.  
A tip provides additional or supplementary information.



This symbol prompts you to follow the safety precautions of your machine tool builder. This symbol also indicates machine-dependent functions. Possible hazards for the operator and the machine are described in the machine manual.



The book symbol represents a **cross reference** to external documentation, e.g. the documentation of your machine tool builder or other supplier.

### Have you found any errors or would you like to suggest changes?

We continuously strive to improve our documentation for you.

Please help us by sending your suggestions to the following e-mail address:

**tnc-userdoc@heidenhain.de**

## 1.2 Control model, software and features

This manual describes functions for setting up the machine as well as for testing and running your NC programs. These functions are provided by controls as of the following NC software numbers.

Control model	NC software number
TNC 620	817600-08
TNC 620 E	817601-08
TNC 620 Programming Station	817605-08

The suffix E indicates the export version of the control. The following software option is unavailable or only available to a limited extent in the export version:

- Advanced Function Set 2 (option 9) limited to four-axis interpolation

The machine manufacturer adapts the usable features of the control to his machine by setting appropriate machine parameters. Some of the functions described in this manual may therefore not be among the features provided by the control on your machine tool.

Control functions that may not be available on your machine include:

- Tool measurement with the TT

In order to find out about the actual features of your machine, please contact the machine manufacturer.

Many machine manufacturers, as well as HEIDENHAIN, offer programming courses for the HEIDENHAIN controls. Participation in one of these courses is recommended to familiarize yourself thoroughly with the control's functions.



### User's Manual for Programming of Machining Cycles:

All functions provided by the machining cycles are described in the User's Manual for **Programming of Machining Cycles**. Please contact HEIDENHAIN if you need this User's Manual.  
ID: 1303427-xx



### User's Manual for Programming of Measuring Cycles for Workpieces and Tools:

All functions provided by the touch-probe cycles are described in the User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**. Please contact HEIDENHAIN if you need this User's Manual.  
ID: 1303431-xx



**User's Manuals for Klartext Programming and ISO Programming:**

All information regarding NC programming (except touch probe cycles and machining cycles) is provided in the User's Manuals for **Klartext Programming** and **ISO Programming**. Please contact HEIDENHAIN if you need these User's Manuals.

ID for Klartext Programming: 1096883-xx

ID for ISO Programming: 1096887-xx

## Software options

The TNC 620 features various software options, each of which can be enabled separately by your machine tool builder. The respective options provide the functions listed below:

---

### Additional Axis (option 0 and option 1)

---

<b>Additional axis</b>	Additional control loops 1 and 2
------------------------	----------------------------------

---

### Advanced Function Set 1 (option 8)

---

<b>Advanced functions (set 1)</b>	<b>Machining with rotary tables</b> <ul style="list-style-type: none"> <li>■ Cylindrical contours as if in two axes</li> <li>■ Feed rate in distance per minute</li> </ul> <b>Coordinate conversions:</b> Tilting the working plane
-----------------------------------	--

---

### Advanced Function Set 2 (option 9)

---

<b>Advanced functions (set 2)</b> Export license required	<b>3-D machining:</b> <ul style="list-style-type: none"> <li>■ 3-D tool compensation through surface-normal vectors</li> <li>■ Using the electronic handwheel to change the angle of the swivel head during program run; the position of the tool point remains unchanged (TCPM = Tool Center Point Management)</li> <li>■ Keeping the tool normal to the contour</li> <li>■ Tool radius compensation normal to the tool direction</li> <li>■ Manual traverse in the active tool-axis system</li> </ul> <b>Interpolation:</b> Linear in > 4 axes (export license required)
--	---

---

### Touch Probe Functions (option 17)

---

<b>Touch probe functions</b>	<b>Touch probe cycles:</b> <ul style="list-style-type: none"> <li>■ Compensation of tool misalignment in automatic mode</li> <li>■ Set the preset in the <b>Manual operation</b> mode of operation</li> <li>■ Presetting in automatic mode</li> <li>■ Automatically measuring workpieces</li> <li>■ Tools can be measured automatically</li> </ul>
------------------------------	--

---

### HEIDENHAIN DNC (option 18)

---

Communication with external PC applications over COM component

---

### Advanced Programming Features (option 19)

---

<b>Expanded programming functions</b>	<b>FK free contour programming:</b> Programming in HEIDENHAIN conversational format with graphic support for workpiece drawings not dimensioned for NC
---------------------------------------	---

---

**Advanced Programming Features (option 19)****Fixed cycles:**

- Peck drilling, reaming, boring, counterboring, centering
- Milling internal and external threads
- Milling of rectangular and circular pockets and studs
- Clearing level and oblique surfaces
- Milling of straight and circular slots
- Circular and linear point patterns
- Contour train, contour pocket, trochoidal contour slot
- Engraving
- OEM cycles (special cycles developed by the machine tool builder) can be integrated

**Advanced Graphic Features (option 20)****Expanded graphic functions****Program-verification graphics, program-run graphics**

- Plan view
- Projection in three planes
- 3-D view

**Advanced Function Set 3 (option 21)****Expanded functions Group 3****Tool compensation:**

M120: Radius-compensated contour look ahead for up to 99 NC blocks (LOOK AHEAD)

**3-D machining:**

M118: Superimpose handwheel positioning during program run

**Pallet Management (option 22)****Pallet management**

Processing workpieces in any sequence

**CAD Import (option 42)****CAD import**

- Support for DXF, STEP and IGES
- Adoption of contours and point patterns
- Simple and convenient specification of presets
- Selecting graphical features of contour sections from conversational programs

**KinematicsOpt (option 48)****Optimizing the machine kinematics**

- Backup/restore active kinematics
- Test active kinematics
- Optimize active kinematics

**OPC UA NC Server (1 to 6) (options 56 to 61)****Standardized interface**

The OPC UA NC Server provides a standardized interface (OPC UA) for external access to the control's data and functions

These software options allow you to create up to six parallel client connections

**Extended Tool Management (option 93)**

<b>Extended tool management</b>	Python-based
---------------------------------	--------------

**Remote Desktop Manager (option 133)**

<b>Remote operation of external computer units</b>	<ul style="list-style-type: none"> <li>■ Windows on a separate computer unit</li> <li>■ Incorporated in the control's interface</li> </ul>
--	--

**State Reporting Interface – SRI (option 137)**

<b>HTTP accesses to the control status</b>	<ul style="list-style-type: none"> <li>■ Reading out the times of status changes</li> <li>■ Reading out the active NC programs</li> </ul>
--	---

**Cross Talk Compensation – CTC (option 141)**

<b>Compensation of axis couplings</b>	<ul style="list-style-type: none"> <li>■ Determination of dynamically caused position deviation through axis acceleration</li> <li>■ Compensation of the TCP (<b>T</b>ool <b>C</b>enter <b>P</b>oint)</li> </ul>
---------------------------------------	--

**Position Adaptive Control – PAC (option 142)**

<b>Adaptive position control</b>	<ul style="list-style-type: none"> <li>■ Adaptation of the control parameters depending on the position of the axes in the working space</li> <li>■ Adaptation of the control parameters depending on the speed or acceleration of an axis</li> </ul>
----------------------------------	---

**Load Adaptive Control – LAC (option 143)**

<b>Adaptive load control</b>	<ul style="list-style-type: none"> <li>■ Automatic determination of workpiece weight and frictional forces</li> <li>■ Adaptation of the control parameters depending on the current mass of the workpiece</li> </ul>
------------------------------	--

**Active Chatter Control – ACC (option 145)**

<b>Active chatter control</b>	Fully automatic function for chatter control during machining
-------------------------------	---

**Machine Vibration Control – MVC (option 146)**

<b>Vibration damping for machines</b>	<p>Damping of machine oscillations for improving the workpiece surface quality through the following functions:</p> <ul style="list-style-type: none"> <li>■ Active Vibration Damping (<b>AVD</b>)</li> <li>■ Frequency Shaping Control (<b>FSC</b>)</li> </ul>
---------------------------------------	---

**Batch Process Manager (option 154)**

<b>Batch process manager</b>	Planning of production orders
------------------------------	-------------------------------

**Component Monitoring (option 155)**

<b>Component monitoring without external sensors</b>	Monitoring configured machine components for overload
--	---

**Opt. contour milling (option 167)**

<b>Optimized contour cycles</b>	Cycles for machining any pockets and islands using trochoidal milling
---------------------------------	---

**Further options available**

HEIDENHAIN offers further hardware enhancements and software options that can be configured and implemented only by your machine tool builder. This includes functional safety (FS), for example.

For more information, please refer to your machine tool builder's documentation or the HEIDENHAIN brochure titled **Options and Accessories**.

ID: 827222-xx

**Feature Content Level (upgrade functions)**

Along with software options, significant further improvements of the control software are managed via the **Feature Content Level** upgrade functions. If you install a software update on your control you do not automatically have the functions available as covered by the FCL.



All upgrade functions are available to you without surcharge when you receive a new machine.

Upgrade functions are identified in the manual as **FCL n**. The **n** signifies the serial number of the development status.

You can purchase a code number in order to permanently enable the FCL functions. For more information, contact your machine tool builder or HEIDENHAIN.

**Intended place of operation**

The control complies with the limits for a Class A device in accordance with the specifications in EN 55022, and is intended for use primarily in industrially-zoned areas.

**Legal information**

The control software contains open-source software that is subject to special terms of use. These special terms of use have priority.

Further information is available on the control as follows:

- ▶ Press the **MOD** key
- ▶ Select the **General information** group in the MOD menu
- ▶ Select the **License information** MOD function

Furthermore, the control software contains binary libraries of the OPC UA software from Softing Industrial Automation GmbH. For these libraries, additionally and preferentially the terms of use agreed between HEIDENHAIN and Softing Industrial Automation GmbH shall apply.

When using the OPC UA NC server or DNC server, you can influence the behavior of the control. Therefore, before using these interfaces for productive purposes, verify that the control can still be operated without malfunctions or drops in performance. The manufacturer of the software that uses these communication interfaces is responsible for performing system tests.

## New functions 81760x-08



### Overview of new and modified software functions

Further information about the previous software versions is presented in the **Overview of New and Modified Software Functions** documentation. Please contact HEIDENHAIN if you need this documentation.

ID: 1322094-xx

**Further information:** User's Manual for **Klartext Programming** or **ISO Programming**

- The **BLK FORM FILE** function allows you to use STL files to define the workpiece blank, and optionally the finished part, by specifying the path of the files. This enables you to use, e.g., 3-D models from the CAD system in your NC program
- **FUNCTION MODE SET** allows you to activate settings defined by the machine tool builder (e.g., changes to the range of traverse) from within the NC program
- The function **PRESET SELECT** allows you to activate a preset from the preset table. You can choose to retain active transformations and select the preset to which the function should apply.
- The function **PRESET COPY** allows you to copy a preset defined in the preset table to another row. You can optionally activate the copied preset and retain the active transformations.
- The function **PRESET CORR** allows you to correct the active preset.
- The function **OPEN FILE** allows the control to open different file formats (e.g., PNG files) using a suitable additional tool.
- The function **POLARKIN** allows you to activate a polar kinematic model. In a polar kinematic model, the control performs movements using a rotary axis and two linear axes. You define the positioning behavior of the rotary axis, as well as whether machining is allowed at the center of rotation of the rotary axis.

- The function **TABDATA** allows you to access the tool table and the compensation tables (\*.tco and \*.wco) during program run. In order to access the compensation tables, you need to activate them.
  - The function **TABDATA READ** allows you to read a value from a table and save it to a Q, QL, QR, or QS parameter.
  - The function **TABDATA WRITE** allows you to write a value from a Q, QL, QR, or QS parameter into a table.
  - The function **TABDATA ADD** allows you to add a value from a Q, QL, or QR parameter to a value contained in a table.
- The function **MONITORING** allows you to visualize the monitoring of a defined machine component.
- The **APPLY FILE NAME** soft key has been added to the selection window provided by the **SELECT FILE** soft key. If the called file is located in the same directory as the file you are calling it from, pressing this soft key loads the name of the file without its path.
- In the mask file of the **FN 16: F-PRINT** (ISO: **D16**) function, you can define whether the control shows or hides blank lines for undefined QS parameters.
- The **FN 18: SYSREAD** functions (ISO:D18) have been enhanced:
  - **FN 18: SYSREAD (D18) ID50**: values in the tool table
    - **NR45**: value in the **RCUTS** column
    - **NR46**: value in the **LU** column
    - **NR47**: value in the **RN** column
  - **FN 18: SYSREAD (D18) ID950**: values in the tool table of the current tool
    - **NR45**: value in the **RCUTS** column
    - **NR46**: value in the **LU** column
    - **NR47**: value in the **RN** column
  - **FN 18: SYSREAD (D18) ID1070 NR1**: active feed-rate limit through the **F MAX** soft key

- The function **SYSSTR( ID10321 NR20 )** allows you to determine the number of the current week in accordance with ISO 8601
- When you double-click a layer in the **CAD-Viewer**, the control marks the first contour element of this layer.
- You can transfer the data from the CAD Import clipboard to an NC program as well as to other applications (e.g., **Leafpad**).
- **HEIDENHAIN OPC UA NC Server** (options 56 to 61)  
 OPC UA provides a standardized interface for secure data exchange between products independent of the manufacturer. HEIDENHAIN provides the **HEIDENHAIN OPC UA NC Server** for data exchange with the control. These software options allow you to create up to six parallel client connections.  
 The **Connection Assistant** function has been added to the HEROS menu for setting up the connection. If user administration is active, you link the connections to specific users.  
**Further information:** "HEIDENHAIN OPC UA NC Server (options 56 to 61)", Page 453
- As part of the **HEIDENHAIN OPC UA NC Server** (options 56 to 61), the machine parameter **CfgMachineInfo** (no. 131700), which allows you to define information about the machine, has been added.  
**Further information:** "Application", Page 478
- If you use **TARGET** in the **BLK FORM FILE** function to define a finished part, you can show or hide it by soft key in the **Test Run** operating mode (option 20)  
**Further information:** "View options", Page 246
- In **Test Run** operating mode, you can use the **EXPORT WORKPIECE** soft key to export the current status of the motion simulation as a 3-D model in STL format.  
**Further information:** "Exporting a finished part", Page 261
- In **Test Run** operating mode, the control provides an extended collision monitoring function that checks for collisions between the workpiece and the tool or tool holder. You can activate extended collision monitoring by soft key.  
**Further information:** "Monitoring for collisions ", Page 253
- You can use M3D and STL files (e.g., from the CAD system) as tool carrier files.  
**Further information:** "Assigning a tool carrier", Page 161
- The control supports USB data media with the NTFS file system.  
**Further information:** "USB devices on the control", Page 85
- The control includes the additional tool **Parole**, which allows you to open video files.
- If a feed-rate limit has been activated with the **F MAX** soft key, the control displays an exclamation mark after the feed-rate value in the general status display.  
**Further information:** "General status display", Page 67
- When the **PARAXCOMP DISPLAY** function is active, the control displays a corresponding icon in the general status display.  
**Further information:** "General status display", Page 67



- When the **PARAXCOMP MOVE** function is active, the control displays a corresponding icon in the general status display.  
**Further information:** "General status display", Page 67
- When the functions **PARAXMODE** oder **POLARKIN** are active, the control displays a corresponding icon in the general status display.  
**Further information:** "General status display", Page 67
- In the **RCUTS** column of the tool table, you define the front-face cutting width of a tool (e.g., for indexable inserts).  
**Further information:** "Entering tool data into the table", Page 133
- You define the usable length of a tool in the **LU** column of the tool table. The usable length limits the plunging depth of the tool in cycles.  
**Further information:** "Entering tool data into the table", Page 133
- You define the neck radius of the tool in the **RN** column of the tool table. This allows the control to display the tool neck correctly in the simulation (e.g., for side milling cutters).  
**Further information:** "Entering tool data into the table", Page 133
- A link to the **Firewall settings** HEROS function has been added to the **External access** MOD function.  
**Further information:** "Firewall", Page 398
- A link to the **OPC UA NC Server - License Settings** HEROS function (options 56 to 61) has been added within the **External access** MOD function.  
**Further information:** "HEIDENHAIN OPC UA NC Server (options 56 to 61)", Page 453
- If the machine tool builder has defined the parameter **CfgOemInfo** (no. 131700), then the control displays the **Info about machine manufacturer** area in the **General information** MOD group.  
**Further information:** "Overview of MOD functions", Page 339
- If the machine operator has defined the **CfgMachineInfo** parameter (no. 131600), the control shows the **Machine information** area within the **General information** MOD group.  
**Further information:** "Overview of MOD functions", Page 339
- **Remote Desktop Manager** (option 133) allows you to create private connections if user administration is active. Private connections are visible to and usable by the creator only.  
**Further information:** "Private connections", Page 376
- When user administration is active, the control automatically disables the LSV2 connections of the serial interfaces (COM1 and COM2) for security purposes.  
**Further information:** "Serial interfaces on the TNC 620", Page 401

- When user administration is active, you can create user-specific private network drive connections. **Single Sign On** allows you to connect to an encrypted network drive while logging on to the control.

**Further information:** "Adding a network drive", Page 415

- When configuring the user administration, you can use the **Autologin** function to define a user who will automatically be logged on by the control during booting.

**Further information:** "Enabling Autologin", Page 438

- The machine parameter **CfgTTRectStylus** (no. 114300) has been added. This parameter allows you to define settings for a tool touch probe with a cuboid probe contact.

**Further information:** "Application", Page 478

**Changed functions 81760x-08**

**Further information:** User's Manual for **Klartext Programming** or **ISO Programming**

- You can use the **RND** element (ISO: **G24**) to connect circles that are perpendicular to the machining plane instead of lying in the machining plane.
- The **M109** function allows the control to keep the feed rate constant at the cutting edge, including during approach and departure.
- The function **M120** (option 21) for look-ahead calculation of a radius-compensated contour is no longer reset by milling cycles (option 19)
- You can use UTF-8 character encoding in the mask file of **FN 16: F-PRINT** (ISO: **D16**)
- The priority of arithmetic operations has been changed in the Q parameter formula
- Scrolling in the structure window works in the same way as scrolling in the NC program You can define the position of the active structure block by soft key.
- The control uses the active unit of measure (mm or inches) for calculations in the cutting data calculator.
- Path finding between individual drilling positions has been optimized in the **CAD-Viewer**
- If, after a hardware change or an update, an error occurs when the control is booting, the control will automatically open the error window and display a question-type error. The control displays soft keys providing different response options.
- The **FILTER** soft key in the error window allows the control to classify both error messages and warnings. As a result, the list of pending messages becomes shorter and easier to read.
- In pallet tables (option 22), the control can also open NC programs containing blank spaces.

- Option 146 has been renamed as **Machine Vibration Control MVC**  
The Frequency Shaping Control (**FSC**) function has been added; it allows the control to suppress low-frequency machine vibrations.
- The control uses hatch marking to depict threads in the simulation.
- In the operating modes **Program run, single block** and **Program run, full sequence**, the **Batch Process Manager** (option 154) shows up to two statuses next to each other in the first column.  
**Further information:** "Batch Process Manager (option 154)", Page 327
- In **Program run, single block** operating mode, the control interprets the workpiece blank definition as a single NC block only.  
**Further information:** "Application", Page 268
- The control displays the tool index in the block scan pop-up window if needed.
- The control takes into account manual axes when returning to the contour.  
**Further information:** "Returning to the contour", Page 286
- When the **PARAXCOMP DISPLAY** function or the **PARAXCOMP MOVE** function is active, the control displays **(D)** or **(M)** after the respective axis designations on the **Overview** tab and the **POS** tab of the additional status display.  
**Further information:** "Additional status displays", Page 70
- On the **FS** tab of the additional status display, the control displays the active limits defined by the specific safety-related operating modes for every axis.  
**Further information:** "Functional safety (FS) status displays", Page 185
- On the **TT** tab of the additional status display, the control displays the tilt angle of the tool touch probe as well as information about the cuboid probe contacts.  
**Further information:** "Additional status displays", Page 70
- In **Test Run** operating mode, the control displays the **M** tab of the additional status display when the screen layout **PROGRAM + STATUS** is active.
- When you activate a handwheel with display, the control automatically activates the override potentiometer of the handwheel.  
**Further information:** "Traversing with electronic handwheels", Page 171
- In the operating modes **Manual Operation** and **Positioning w/ Manual Data Input**, you can activate a handwheel with display while a macro or a manual tool change is being executed.
- You can activate or deactivate the **F MAX** soft key for reducing the feed rate. The defined value is retained.  
**Further information:** "Feed-rate limit F MAX", Page 183

- By default, the control calculates the basic rotation in the input coordinate system (I-CS). If the axis angles and tilt angles don't coincide, the control calculates the basic rotation in the workpiece coordinate system (W-CS).

**Further information:** "Introduction", Page 218

- In the compensation tables (\*.tco and \*.wco), the input range for all columns containing numerical values has been changed from +/- 999.999 to +/- 999.9999
- From within the **Diagnostic functions** MOD group, you can access **TNCdiag** and **Hardware configuration** without a code number.

**Further information:** "Diagnostic functions", Page 363

- The name of a connection in the **Remote Desktop Manager** (option 133) must not contain characters other than letters, numbers, and underscores.

**Further information:** "Remote Desktop Manager (option 133)", Page 366

- The **HEIDENHAIN OPC UA NC Server** enables you to access the directories **TNC:** and **PLC:**, including while the NC software is switched off. The contents displayed vary depending on the assigned user's permissions.

**Further information:** "Access to directories", Page 457

- If, when configuring the user administration, you use the **Connection to Windows domain** function, the **Use LDAPs** check box allows you to set up a secure connection.

**Further information:** "Connection to a Windows domain", Page 425

- If a remote log-in takes place while user administration is inactive, for example via SSH, the control automatically assigns the **HEROS.LegacyUserNoCtrlfct** role.

**Further information:** "Definition of roles", Page 434

- When user administration is active, the NC.SetupProgramRun permission is required for the **ACC** (option 145) functions.

**Further information:** "Privileges", Page 437

- If you deactivate the user administration and select the **Delete existing user databases** check box, the control also deletes the .home folder in the **TNC:** directory.

**Further information:** "Configuring the user administration", Page 419

- If you enter a password or code number with Caps Lock active, then the control issues a message.
- The machine parameter **spindleDisplay** (no. 100807) has been enhanced. The control can also display the spindle position on the **Overview** tab of the additional status display when the spindle is in jog mode.

**Further information:** "Application", Page 478

### New cycle functions 81760x-08

**Further information:** User's Manual for **Programming of Machining Cycles**

- Cycle **277 OCM CHAMFERING** (ISO: **G277**, option 167)  
This cycle allows the control to deburr contours that were last defined, roughed, or finish-machined with other OCM cycles.
- Cycle **1271 OCM RECTANGLE** (ISO: **G1271**, option 167)  
This cycle allows you to define a rectangle that is then used as a pocket, island, or boundary for face milling in conjunction with other OCM cycles.
- Cycle **1272 OCM CIRCLE** (ISO: **G1272**, option 167)  
This cycle allows you to define a circle that is then used as a pocket, island, or boundary for face milling in conjunction with other OCM cycles.
- Cycle **1273 OCM SLOT / RIDGE** (ISO: **G1273**, option 167)  
This cycle allows you to define a slot that is then used as a pocket, island, or boundary for face milling in conjunction with other OCM cycles.
- Cycle **1278 OCM POLYGON** (ISO: **G1278**, option 167)  
This cycle allows you to define a polygon that is then used as a pocket, island, or boundary for face milling in conjunction with other OCM cycles.
- Cycle **1281 OCM RECTANGLE BOUNDARY** (ISO: **G1281**, option 167)  
This cycle allows you to define a rectangular boundary for islands or open pockets that you previously programmed with the standard OCM forms.
- Cycle **1282 OCM CIRCLE BOUNDARY** (ISO: **G1282**, option 167)  
This cycle allows you to define a circular boundary for islands or open pockets that you previously programmed with the standard OCM forms.
- The control offers an **OCM cutting data calculator** with which you can determine the optimum cutting data for the **272 OCM ROUGHING** cycle (ISO: **G272**, option 167). Press the **OCM CUTTING DATA** soft key to open the cutting data calculator during cycle definition. You can load the results directly into the cycle parameters.

**Changed cycle functions 81760x-08****Further information:** User's Manual for **Programming of Machining Cycles**

- Cycle **225 ENGRAVING** (ISO: **G225**) allows you to use system variables to engrave the number of the current week.
- Cycles **202 BORING** (ISO: **G202**) and **204 BACK BORING** (ISO: **G204**, option 19) restore the spindle status after machining to that which was active before the cycle.
- If the defined usable length in column **LU** of the tool table is less than the depth, the control displays an error message.  
The following cycles monitor the usable length **LU**:
  - All cycles for drilling and boring
  - All cycles for tapping
  - All cycles for the machining of pockets and studs
  - Cycle 22 **ROUGH-OUT** (ISO: **G122**, option 19)
  - Cycle 23 **FLOOR FINISHING** (ISO: **G123**, option 19)
  - Cycle 24 **SIDE FINISHING** (ISO: **G124**, option 19)
  - Cycle 233 **FACE MILLING** (ISO: **G233**, option 19)
  - Cycle 272 **OCM ROUGHING** (ISO: **G272**, option 167)
  - Cycle 273 **OCM FINISHING FLOOR** (ISO: **G273**, option 167)
  - Cycle 274 **OCM FINISHING SIDE** (ISO: **G274**, option 167)
- Cycles **251 RECTANGULAR POCKET** (ISO: **G251**), **252 CIRCULAR POCKET** (ISO: **G252**, option 19), and **272 OCM ROUGHING** (ISO: **G272**, option 167) take into consideration a cutting width defined in the column **RCUTS** when calculating the plunging path.
- Cycles **208 BORE MILLING** (ISO: **G208**), **253 SLOT MILLING** (ISO: **G208**), and **254 CIRCULAR SLOT** (ISO: **G254**, option 19) monitor a cutting width defined in the column **RCUTS** of the tool table. If the center of a tool that is not a center-cut tool would contact the workpiece surface, the control issues an error message.
- The machine manufacturer can hide Cycle **238 MEASURE MACHINE STATUS** (ISO: **G238**, option 155).
- An input value of 2 has been added to parameter **Q569 OPEN BOUNDARY** in Cycle **271 OCM CONTOUR DATA** (ISO: **G271**, option 167). The control uses this value to interpret the first contour within the **CONTOUR DEF** function as a boundary block of a pocket.

- Cycle **272 OCM ROUGHING** (ISO: **G272**, option 167) was expanded:
  - The parameter **Q576 SPINDLE SPEED** allows you to define a spindle speed for the roughing tool.
  - The parameter **Q579 PLUNGING FACTOR S** allows you to define a factor for the spindle speed during plunging.
  - Use the parameter **Q575 INFEEED STRATEGY** to define whether the control machines the contour from top to bottom or vice versa.
  - The maximum input range of parameter **Q370 TOOL PATH OVERLAP** has been changed. Old: from 0.01 to 1. New: from 0.04 to 1.99.
  - If helical plunging is not possible, the control attempts a reciprocating plunging motion with the tool.
- Cycle **273 OCM FINISHING FLOOR** (ISO: **G273**, option 167) was expanded.  
The following parameters have been added:
  - **Q595 STRATEGY**: machining with equal path distances or constant tool angle
  - **Q577 APPROACH RADIUS FACTOR**: factor for the tool radius in order to adapt the approach radius

**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**

- Cycles **480 CALIBRATE TT** (ISO: **G480**) and **484 CALIBRATE IR TT** (ISO: **G484**, option 17) can be used to calibrate a tool touch probe with cuboid probe contacts.
- For rotating tools, Cycle **483 MEASURE TOOL** (ISO: **G483**, option 17) first measures the tool length and then the tool radius.
- By default, Cycles **1410 PROBING ON EDGE** (ISO: **G1410**) and **1411 PROBING TWO CIRCLES** (ISO: **G1411**, option 17) calculate the basic rotation in the input coordinate system (I-CS). If the axis angles and tilt angles don't coincide, the cycles calculate the basic rotation in the workpiece coordinate system (W-CS).



# 2

**First steps**

## 2.1 Overview

This chapter is intended to help you quickly learn to handle the most important procedures on the control. For more information on the respective topic, see the section referred to in the text.

The following topics are included in this chapter:

- Switching on the machine
- Graphically testing the workpiece
- Setting up tools
- Workpiece setup
- Machining the workpiece



The User's Manuals for Klartext Programming and ISO Programming cover the following topics:

- Switching on the machine
- Programming the workpiece

## 2.2 Switching on the machine

### Acknowledging the power interruption and moving to the reference points

#### DANGER

##### Caution: hazard to the user!


Machines and machine components always pose mechanical hazards. Electric, magnetic, or electromagnetic fields are particularly hazardous for persons with cardiac pacemakers or implants. The hazard starts when the machine is powered up!

- ▶ Read and follow the machine manual
- ▶ Read and follow the safety precautions and safety symbols
- ▶ Use the safety devices



Refer to your machine manual!

Switching on the machine and traversing the reference points can vary depending on the machine tool.

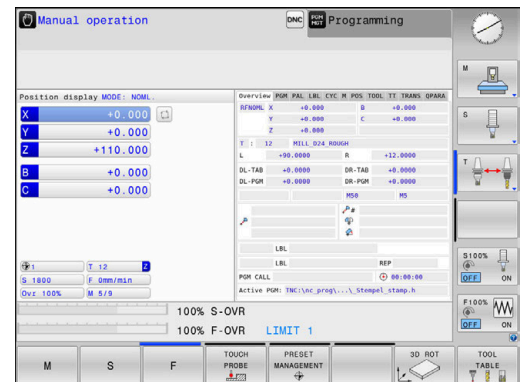

To switch on the machine, proceed as follows:

- ▶ Switch on the power supply for the control and the machine
- > The control starts the operating system. This process may take several minutes.
- > The control will then display the "Power interrupted" message in the screen header.

**CE**

- ▶ Press the **CE** key
- > The control compiles the PLC program.

**I**

- ▶ Switch on the machine control voltage
- > The control checks operation of the emergency stop circuit and goes into Reference Run mode.



- ▶ Cross the reference point manually in the prescribed sequence: For each axis press the **START** key. If you have absolute linear and angle encoders on your machine there is no need for a reference run
- > The control is now ready for operation in the **Manual operation** mode.

#### Further information on this topic

- Approaching reference points  
**Further information:** "Switch-on", Page 164
- Operating modes  
**Further information:** "Programming", Page 65

## 2.3 Graphically testing the workpiece (option 20)

### Selecting the Test Run operating mode


You can test NC programs in the **Test Run** operating mode:



- ▶ Press the operating mode key
- ▶ The control switches to the **Test Run** operating mode.

#### Further information on this topic

- Operating modes of the control  
**Further information:** "Modes of operation", Page 64
- Testing NC programs  
**Further information:** "Test run", Page 262

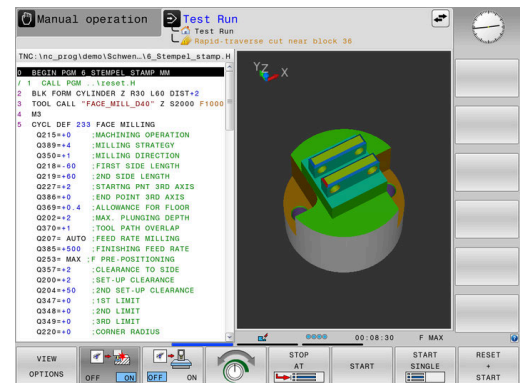

### Selecting the tool table

If you have not yet activated a tool table in **Test Run** mode, then you must carry out this step now.



- ▶ Press the **PGM MGT** key
- ▶ The control opens the file manager.



- ▶ Press the **SELECT TYPE** soft key
- ▶ The control shows a soft-key menu for selection of the file type to be displayed.



- ▶ Press the **DEFAULT** soft key
- ▶ The control shows all saved files in the right-hand window.



- ▶ Move the cursor to the left onto the directories



- ▶ Move the cursor to the **TNC:\table** directory



- ▶ Move the cursor to the right onto the files



- ▶ Position the cursor on the **TOOL.T** file (active tool table)



- ▶ Confirm with the **ENT** key
- ▶ **TOOL.T** is assigned the status **S** and is thus active for the **Test Run**.



- ▶ Press the **END** key to close the file manager

#### Further information on this topic

- Tool management  
**Further information:** "Entering tool data into the table", Page 133
- Testing NC programs  
**Further information:** "Test run", Page 262

Selecting the NC program



- ▶ Press the **PGM MGT** key
- > The control opens the file manager.



- ▶ Press the **LAST FILES** soft key
- > The control opens a pop-up window with the most recently selected files.
- ▶ Use the arrow keys to select the NC program that you want to test.



- ▶ Accept with the **ENT** key

Selecting the screen layout and the view



- ▶ Press the **Screen layout** key
- > The control displays all available alternatives in the soft-key row.



- ▶ Press the **PROGRAM + WORKPIECE** soft key
- > In the left half of the screen the control shows the NC program; in the right half it shows the workpiece blank.



- ▶ Press the **VIEW OPTIONS** soft key

The control provides the following views:

Soft key	Function
	Plan view
	Projection in three planes
	3-D view

Further information on this topic

- Graphic functions  
**Further information:** "Graphics (option 20)", Page 244
- Performing a test run  
**Further information:** "Test run", Page 262

## Starting the test run



- ▶ Press the **RESET + START** soft key
- > The control resets the previously active tool data.
- > The control simulates the active NC program up to a programmed interruption or to the program end.
- ▶ While the simulation is running, you can use the soft keys to change views



- ▶ Press the **STOP** soft key
- > The control interrupts the test run.



- ▶ Press the **START** soft key
- > The control resumes the test run after an interruption.

## Further information on this topic

- Performing a test run  
**Further information:** "Test run", Page 262
- Graphic functions  
**Further information:** "Graphics (option 20)", Page 244
- Adjusting the simulation speed  
**Further information:** "Setting the speed of the Test Run mode", Page 251

## 2.4 Setting up tools

### Selecting the Manual operation mode


Tools are set up in the **Manual operation** mode:



- ▶ Press the operating mode key
- ▶ The control switches to the **Manual operation** mode.

#### Further information on this topic

- Operating modes of the control  
**Further information:** "Modes of operation", Page 64

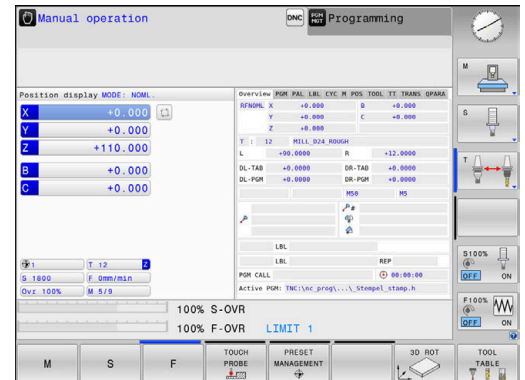

### Preparing and measuring tools

- ▶ Clamp the required tools in their tool holders
- ▶ When measuring with an external tool presetter: Measure the tools, note down the length and radius, or transfer them directly to the machine through a transfer program
- ▶ When measuring on the machine: store the tools in the tool changer

**Further information:** "Editing the TOOL\_PTCH pocket table", Page 53

## Editing the TOOL.T tool table



Refer to your machine manual!


The procedure for calling the tool management may differ from that described below.

In the TOOL.T tool table (permanently stored under **TNC:\table\**), you can save tool data such as length and radius, as well as further tool-specific information that the control needs in order to execute a wide variety of functions.

To enter tool data in the tool table TOOL.T, proceed as follows:



- ▶ Press the **TOOL TABLE** soft key
- > The control shows the tool table.

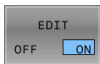

- ▶ Set the **EDIT** soft key to **ON**
- ▶ With the upward or downward arrow keys you can select the tool number that you want to edit
- ▶ With the rightward or leftward arrow keys you can select the tool data that you want to edit



- ▶ Press the **END** key
- > The control closes the tool table and saves the changes.

T	NAME	L	R	R2	DL	M
0	NULLWerkzeug	0	0	0	0	
1	D2	30	1	0		
2	D4	40	2	0		
3	D6	50	3	0		
4	D8	60	4	0		
5	D10	60	5	0		
6	D12	60	6	0		
7	D14	70	7	0		
8	D16	80	8	0		
9	D18	90	9	0		
10	D20	90	10	0		
11	D22	90	11	0		
12	D24	90	12	0		
13	D26	90	13	0		
14	D28	100	14	0		
15	D30	100	15	0		
16	D32	100	16	0		
17	D34	100	17	0		
18	D36	100	18	0		
19	D38	100	19	0		

### Further information on this topic

- Operating modes of the control  
**Further information:** "Modes of operation", Page 64
- Working with the tool table  
**Further information:** "Entering tool data into the table", Page 133
- Using the tool management (option 93)  
**Further information:** "Calling tool management", Page 148



## Editing the TOOL\_P.TCH pocket table



Refer to your machine manual!

The function of the pocket table depends on the machine.


In the pocket table TOOL\_P.TCH (permanently saved under **TNC:\table\**) you specify which tools your tool magazine contains. To enter data in the pocket table TOOL\_P.TCH, proceed as follows:



- ▶ Press the **TOOL TABLE** soft key
- > The control shows the tool table.




- ▶ Press the **POCKET TABLE** soft key
- > The control shows the pocket table.

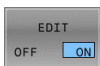

- ▶ Set the **EDIT** soft key to **ON**
- ▶ With the upward or downward arrow keys you can select the pocket number that you want to edit
- ▶ With the rightward or leftward arrow keys you can select the data that you want to edit



- ▶ Press the **END** key

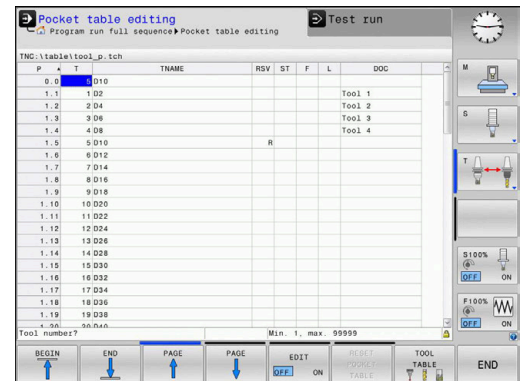

### Further information on this topic

- Operating modes of the control  
**Further information:** "Modes of operation", Page 64
- Working with the pocket table  
**Further information:** "Pocket table for tool changer", Page 140

## 2.5 Workpiece setup

### Selecting the correct operating mode

Workpieces are set up in the **Manual operation** or **Electronic handwheel** operating mode



- ▶ Press the operating mode key
- ▶ The control switches to the **Manual operation** mode.

#### Further information on this topic

- The **Manual operation** mode  
**Further information:** "Moving the machine axes", Page 169

### Clamping the workpiece

Mount the workpiece with a fixture on the machine table. If you have a 3-D touch probe on your machine, then you do not need to clamp the workpiece parallel to the axes.

If you do not have a 3-D touch probe available, you have to align the workpiece so that it is fixed with its edges parallel to the machine axes.

#### Further information on this topic

- Presetting with a 3-D touch probe  
**Further information:** "Presetting with a 3-D touch probe (option number 17)", Page 227
- Presetting without 3-D touch probe  
**Further information:** "Presetting without a 3-D touch probe", Page 198

### Presetting with a 3-D touch probe (option number 17)

#### Inserting a 3-D touch probe



- ▶ Select the **Positioning w/ Manual Data Input** operating mode



- ▶ Press the **TOOL CALL** key
- ▶ Enter the tool data



- ▶ Press the **ENT** key
- ▶ Enter the tool axis **Z**



- ▶ Press the **ENT** key



- ▶ Press the **END** key




- ▶ Press the **NC Start** key


### Setting a preset



- ▶ Select the **Manual operation** mode

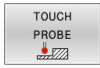

- ▶ Press the **TOUCH PROBE** soft key
- ▶ The control displays the available functions in the soft-key row.

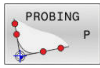

- ▶ Set the preset at a workpiece corner, for example
- ▶ Use the axis direction keys to position the touch probe near the first touch point on the first workpiece edge
- ▶ Select the probing direction via soft key
- ▶ Press the **NC Start** key
- ▶ The touch probe moves in the defined direction until it contacts the workpiece and then automatically returns to its starting point.
- ▶ Use the axis direction keys to pre-position the touch probe near the second touch point on the first workpiece edge
- ▶ Press the **NC start** key
- ▶ The touch probe moves in the defined direction until it contacts the workpiece and then automatically returns to its starting point.
- ▶ Use the axis direction keys to pre-position the touch probe near the first touch point on the second workpiece edge
- ▶ Select the probing direction via soft key
- ▶ Press the **NC start** key
- ▶ The touch probe moves in the defined direction until it contacts the workpiece and then automatically returns to its starting point.
- ▶ Use the axis direction keys to pre-position the touch probe near the second touch point on the second workpiece edge
- ▶ Press the **NC start** key
- ▶ The touch probe moves in the defined direction until it contacts the workpiece and then automatically returns to its starting point.
- ▶ The control then displays the coordinates of the measured corner point.



- ▶ Set to 0: Press the **SET PRESET** soft key
- ▶ Press the **END** soft key to close the menu

### Further information on this topic

- Presetting  
**Further information:** "Presetting with a 3-D touch probe (option number 17)", Page 227

## 2.6 Machining the workpiece

### Selecting the Program run, single block or Program run, full sequence operating mode


You can run NC programs either in the **Program run, single block** or the **Program run, full sequence** operating mode:



- ▶ Press the operating mode key
- ▶ The control switches to the **Program run, single block** operating mode and runs the NC program block by block.
- ▶ You have to confirm each NC block with the **NC start** key



- ▶ Press the **Program run, full sequence** key
- ▶ The control switches to the **Program run, full sequence** operating mode and runs the NC program, after pressing the NC start key, up to a program interruption or to the end of the program.

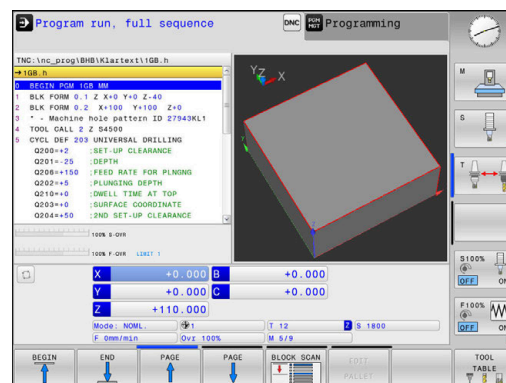

#### Further information on this topic

- Operating modes of the control  
**Further information:** "Modes of operation", Page 64
- Running NC programs  
**Further information:** "Program run", Page 268

### Selecting the NC program



- ▶ Press the **PGM MGT** key
- ▶ The control opens the file manager.



- ▶ Press the **LAST FILES** soft key
- ▶ The control opens a pop-up window with the most recently selected files.
- ▶ If required, use the arrow keys to select the NC program you want to run. Load with the **ENT** key

### Starting an NC program



- ▶ Press the **NC start** key
- ▶ The control runs the active NC program.

#### Further information on this topic

- Running NC programs  
**Further information:** "Program run", Page 268

# 3

## Fundamentals

### 3.1 The TNC 620

HEIDENHAIN TNC controls are workshop-oriented contouring controls that enable you to program conventional milling and drilling operations right at the machine in easy-to-use Klartext conversational language. They are designed for milling, drilling, and boring machines, as well as for machining centers, with up to 6 axes. You can also change the angular position of the spindle under program control.

Keyboard and screen layout are clearly arranged in such a way that the functions are fast and easy to use.



#### HEIDENHAIN Klartext and DIN/ISO

HEIDENHAIN Klartext, the dialog-guided programming language for workshops, is an especially easy method of writing programs. Programming graphics illustrate the individual machining steps for programming the contour. If no NC-dimensioned drawing is available, then the FK free contour programming will help. Workpiece machining can be graphically simulated either during a test run or during a program run.

It is also possible to program in ISO format.

You can also enter and test one NC program while another NC program is machining a workpiece.

**Further information:** User's Manual for Klartext Programming or ISO Programming

#### Compatibility

NC programs created on HEIDENHAIN contouring controls (starting from the TNC 150 B) may not always run on the TNC 620. If the NC blocks contain invalid elements, the control will mark these as ERROR blocks or with error messages when the file is opened.



Please also note the detailed description of the differences between the iTNC 530 and the TNC 620.

**Further information:** "Differences between the TNC 620 and the iTNC 530", Page 505

## Data security and data protection

The availability of data as well as their guaranteed confidentiality, integrity, and authenticity are decisive for your company's success. HEIDENHAIN therefore places the utmost importance on the protection of relevant data against loss, manipulation, and unauthorized publication.

To ensure that your data is protected actively on the control, HEIDENHAIN offers integrated, state-of-the-art software solutions.

Your control supports the following software solutions:

- SELinux  
**Further information:** "SELinux security software", Page 417
- Firewall  
**Further information:** "Firewall", Page 398
- Sandbox  
**Further information:** "Sandbox tab", Page 413
- Integrated browser  
**Further information:** "Displaying Internet files", Page 93
- Management of external access  
**Further information:** "Permitting or restricting external access", Page 352
- Monitoring of TCP and UDP ports  
**Further information:** "Portscan", Page 384
- Remote diagnosis  
**Further information:** "Remote Service", Page 385
- User administration  
**Further information:** "User administration", Page 418

These solutions protect the control effectively, but cannot replace company-specific IT security and an integrated overall strategy. In addition to the solutions provided, HEIDENHAIN recommends implementing a company-specific security strategy. This way you ensure effective protection of your data and information, even after they have been exported from the control.

To ensure data security also in the future, HEIDENHAIN recommends informing yourself regularly about product updates and updating the software to the current version.

### DANGER

#### Caution: hazard to the user!

Manipulated data records or software can lead to an unexpected behavior of the machine. Malicious software (viruses, Trojans, malware, or worms) can cause changes to data records and software.

- ▶ Check any removable memory media for malicious software before using them
- ▶ Start the internal web browser only from within the sandbox

**Virus scanners**

Virus scanners can negatively affect the behavior of an NC control. Possible negative effects are feed rate drops or system crashes, for example. Such negative effects are unacceptable in numerical controls for machine tools. HEIDENHAIN therefore does not offer a virus scanner for the control and does not recommend using a virus scanner.

The control provides the following alternatives:

- SELinux
- Firewall
- Sandbox
- Locking from external access
- Monitoring of TCP and UDP ports

If properly configured, these options ensure extremely effective protection for the data of the control.

If you insist on using a virus scanner, you must operate the control in a protected network (with a gateway and a virus scanner). The subsequent installation of a virus scanner is not possible.



## 3.2 Visual display unit and operating panel

### Display screen

The control is available either as a compact version or with a separate display unit and operating panel. Both variants of the control come with a 15-inch TFT color flat-panel display.

#### 1 Header

When the control is on, the screen displays the selected operating modes in the header: The machine operating mode at left and the programming mode at right. The currently active mode is displayed in the larger field of the header, where the dialog prompts and messages also appear (exception: if the control only displays graphics).

#### 2 Soft keys

In the footer the control indicates additional functions in a soft-key row. You can select these functions by pressing the keys immediately below them. The thin bars immediately above the soft-key row indicate the number of soft-key rows that can be called with the keys to the right and left that are used to switch the soft keys. The bar representing the active soft-key row is blue.

#### 3 Soft-key selection keys

#### 4 Keys for switching the soft keys


#### 5 Setting the screen layout

#### 6 Key for switchover between machine operating modes, programming modes, and a third desktop

#### 7 Soft-key selection keys for machine tool builders

#### 8 Keys for switching the soft keys for machine tool builders

#### 9 USB connection

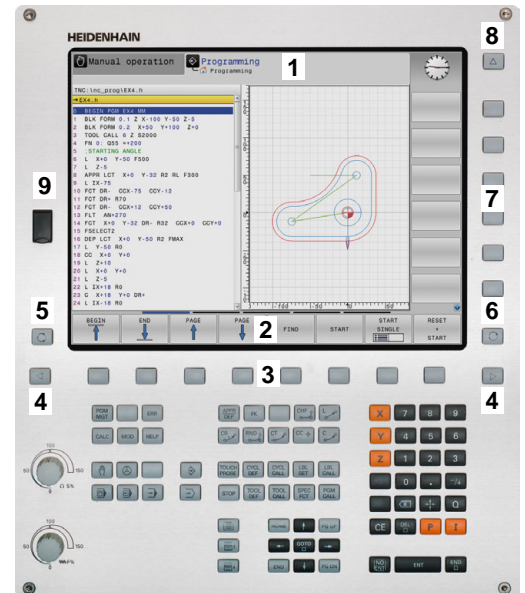

If you are using a TNC 620 with touch control, you can replace some keystrokes with gestures.

**Further information:** "Operating the touchscreen", Page 461

## Setting the screen layout

You select the screen layout yourself. In the **Programming** operating mode, for example, you can have the control show the NC program blocks in the left window while the right window displays programming graphics. You could also display the program structure in the right window instead, or display only the NC program blocks in one large window. The available screen windows depend on the selected operating mode.

Setting up the screen layout:



- Press the **screen layout** key: The soft-key row shows the available layout options

**Further information:** "Modes of operation", Page 64



- Select the desired screen layout with a soft key

## Control panel

The TNC 620 can be supplied with an integrated operating panel. As an alternative, the TNC 620 is also available with a separate display unit and an external operating panel with alphabetic keyboard.

- 1 Alphabetic keyboard for entering texts and file names, as well as for ISO programming
- 2 ■ File management
- Calculator
- MOD function
- HELP function
- Show error messages
- Toggle between the operating modes
- 3 Programming modes
- 4 Machine operating modes
- 5 Initiating programming dialogs
- 6 Navigation keys and **GOTO** jump command
- 7 Numerical input and axis selection
- 8 Touchpad
- 9 Mouse buttons
- 10 Machine operating panel



**More information** Machine manual

The functions of the individual keys are described on the inside front cover.



If you are using a TNC 620 with touch control, you can replace some keystrokes with gestures.

**Further information:** "Operating the touchscreen", Page 461

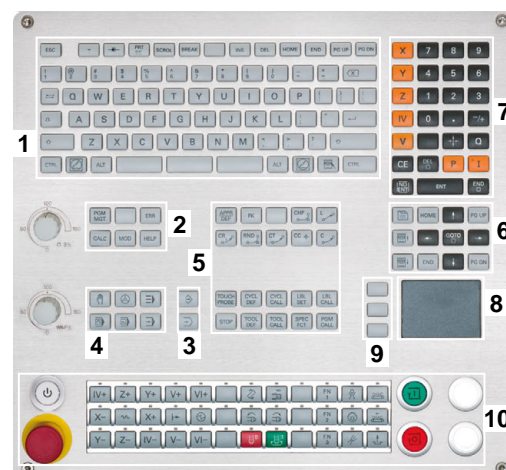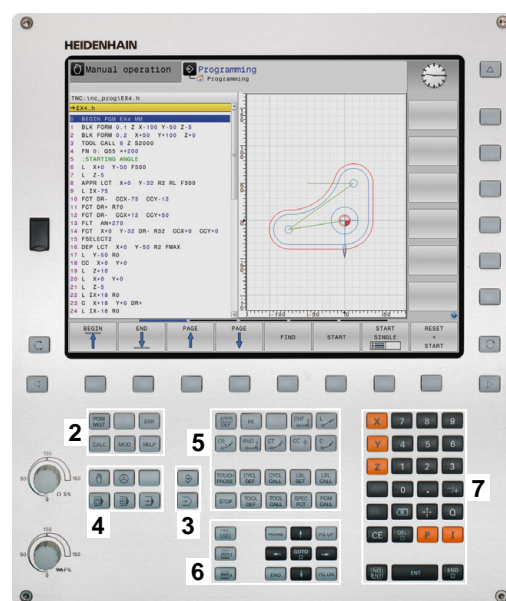



Refer to your machine manual!  
Some machine tool builders do not use the standard HEIDENHAIN operating panel.  
External keys, e.g. **NC START** or **NC STOP**, are described in your machine manual.


Cleaning



Refer to your machine manual!  
Follow the cleaning instructions of the machine tool builder.  
The keyboard unit and the integrated machine operating panel must be cleaned only with anionic or nonionic cleaning agents.

Screen keypad

If you are using the compact version of the control (without alphabetic keyboard), you can enter letters and special characters with the screen keypad or with an alphabetic keyboard connected to the USB port.

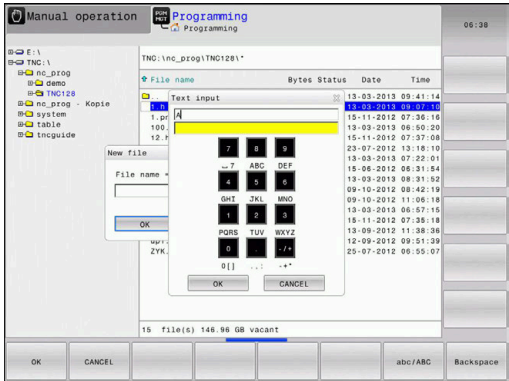

Entering text with the screen keypad

Proceed as follows to use the screen keypad:



- ▶ Press the **GOTO** key if you want to enter letters, e.g. a program name or directory name, using the screen keypad.
- ▶ The control opens a window in which the numeric keypad of the control is displayed with the corresponding letters assigned.



- ▶ Press the numerical key until the cursor is on the desired letter
- ▶ Wait until the control transfers the selected character before you enter the next character



- ▶ Use the **OK** soft key to load the text into the open dialog field

Use the **abc/ABC** soft key to select upper or lower case. If your machine tool builder has defined additional special characters, you can call them with the **SPECIAL CHARACTERS** soft key and insert them. Use the **BACKSPACE** soft key to delete individual characters.

### 3.3 Modes of operation

#### Manual Operation and El. Handwheel

In the **Manual operation** mode of operation, you can set up the machine. You can position the machine axes manually or incrementally, and you can set presets.

If option 8 is active, you can tilt the working plane.

The **Electronic handwheel** operating mode supports manual traverse of machine axes with the HR electronic handwheel.

#### Soft keys for selecting the screen layout



Soft key	Window
POSITION	Positions
POSITION + STATUS	Left: positions, right: status display
POSITION + WORKPIECE	Left: positions, right: workpiece (option 20)

#### Positioning with Manual Data Input

This mode of operation is used for programming simple traversing movements, such as for face milling or pre-positioning.

#### Soft keys for selecting the screen layout

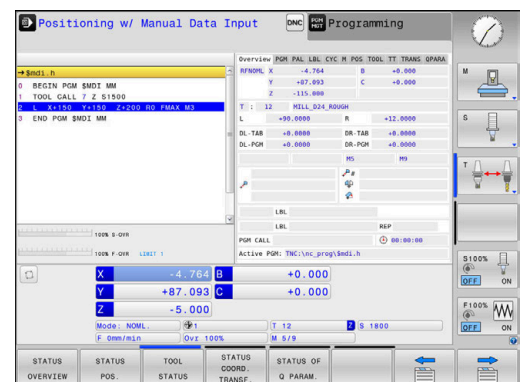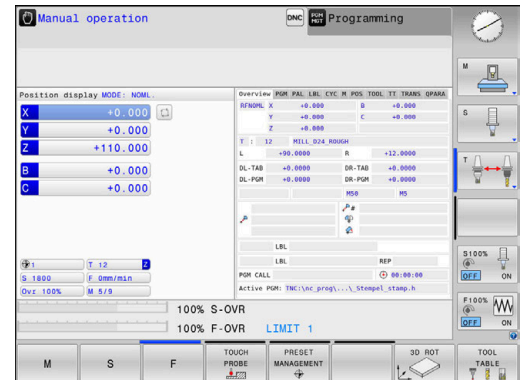


Soft key	Window
PGM	NC program
PROGRAM + STATUS	Left: NC program, right: status display
PROGRAM + WORKPIECE	Left: NC program, right: workpiece (option 20)




## Programming

In this mode of operation you create NC programs. The FK free programming feature, the various cycles and the Q parameter functions help you with programming and add necessary information. If desired, you can have the programming graphics show the programmed paths of traverse.

## Soft keys for selecting the screen layout

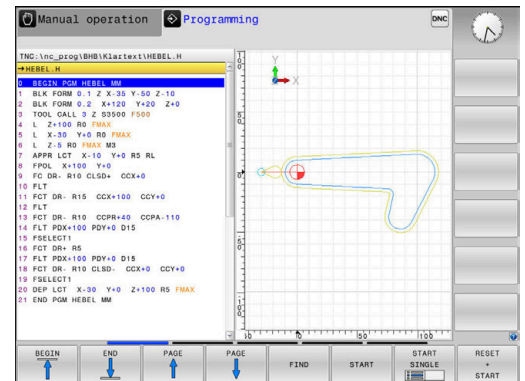



Soft key	Window
	NC program
	Left: NC program, right: program structure
	Left: NC program, right: programming graphics




## Test Run

  In the **Test Run** operating mode, the control simulates NC programs and program sections in order to check them for errors, such as geometrical incompatibilities, missing or incorrect data within the NC program, or violations of the working space. This simulation is supported graphically in different display modes. (option 20)

## Soft keys for selecting the screen layout

Soft key	Window
	NC program
	Left: NC program, right: status display
	Left: NC program, right: workpiece (option 20)
	Workpiece (Option 20)

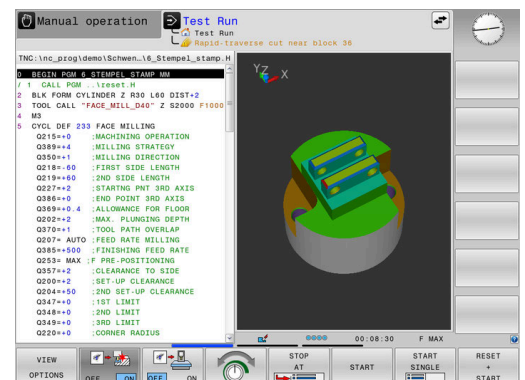

## Program Run, Full Sequence and Program Run, Single Block

In the **Program Run Full Sequence** operating mode, the control runs an NC program continuously to its end or to a manual or programmed stop. You can resume program run after an interruption.


In the **Program Run Single Block** operating mode, you execute each NC block separately by pressing the **NC start** key. With point pattern cycles and **CYCL CALL PAT**, the control stops after each point. The workpiece blank definition will be interpreted as a separate NC block.

### Soft keys for selecting the screen layout

Soft key	Window
PGM	NC program
PROGRAM + SECTS	Left: NC program, right: structure
PROGRAM + STATUS	Left: NC program, right: status display
PROGRAM + WORKPIECE	Left: NC program, right: workpiece (option 20)
WORKPIECE	Workpiece (option 20)

### Soft keys for screen layout with pallet tables(option 22 Pallet management)

Soft key	Window
PALLET	Pallet table
PROGRAM + PALLET	Left: NC program, right: pallet table
PALLET + STATUS	Left: pallet table, right: status display
PALLET + GRAPHICS	Left: pallet table, right: graphics
BPM	Batch Process Manager

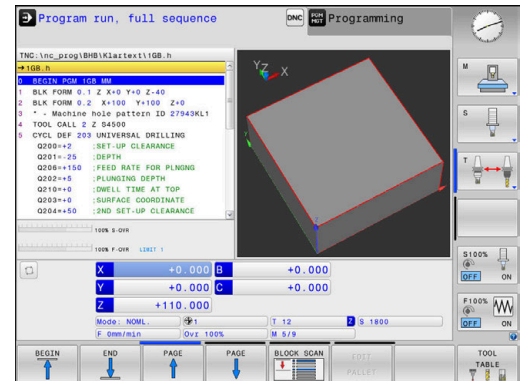




### 3.4 Status displays

#### General status display


The general status display in the lower part of the screen informs you of the current state of the machine. The control displays information about axes and positions, as well as technology values and icons for active functions.

The control displays the status in the following operating modes:

- Program run, single block
- Program run, full sequence
- Positioning w/ Manual Data Input




If the **GRAPHICS** screen layout is selected, the status display is not shown.

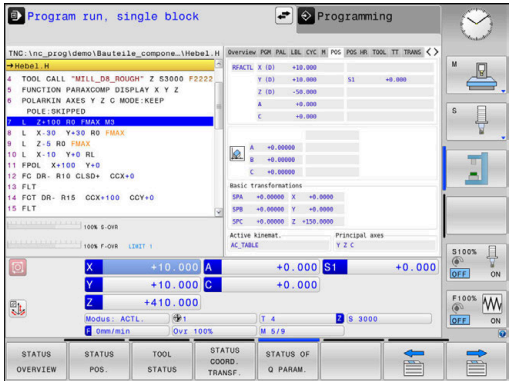



In the **Manual operation** and **Electronic handwheel** operating modes, the control shows the status display in the large window.



#### Axis display and position display












Refer to your machine manual!  
The sequence and number of displayed axes is defined by the machine tool builder.

Icon	Meaning
ACTL	Position display mode (e.g., actual or nominal coordinates of the current position) <b>Further information:</b> "Selecting the position display", Page 343
X Y Z	Machine axes The selected axis is highlighted
m	The control displays auxiliary axes in lowercase letters
X?	Axis has not been homed
X!	Axis is not in safe operation or it is simulated
	Axis is locked
	Axis can be moved with the handwheel








 

### Preset and technology values


 
Symbol	Meaning
	Number of the active preset from the preset table If the preset was set manually, the control displays the text <b>MAN</b> behind the symbol
<b>T</b>	Number of the active tool
<b>S</b>	Spindle speed S
<b>F</b>	Feed rate F The displayed feed rate in inches corresponds to one tenth of the effective value. If a feed-rate limit is active, the control displays an exclamation mark behind the feed rate-value. <b>Further information:</b> "Feed-rate limit F MAX", Page 183
<b>M</b>	Active M functions
	The spindle is controlled from within a cycle (e.g., during tapping)

### Icons for active functions

Icon	Meaning
	<b>RL</b> tool radius compensation is active While the <b>BLOCK SCAN</b> function is active, the icon is transparent
	<b>RR</b> tool radius compensation is active While the <b>BLOCK SCAN</b> function is active, the icon is transparent
	<b>R+</b> tool radius compensation is active While the <b>BLOCK SCAN</b> function is active, the icon is transparent
	<b>R-</b> tool radius compensation is active While the <b>BLOCK SCAN</b> function is active, the icon is transparent
	3-D tool compensation is active While the <b>BLOCK SCAN</b> function is active, the icon is transparent
	A basic rotation is active in the active preset
	Axes are moving, taking the basic rotation into account
	A 3-D basic rotation is active in the active preset
	Axes are moving, taking the setting in the 3-D ROT menu into account



Icon	Meaning
	Axes are mirrored and moved
<b>TCPM</b>	The <b>M128</b> function or <b>TCPM FUNCTION</b> is active
	The function for traversing in the tool-axis direction is active
	No NC program selected, NC program reselected, NC program aborted via internal stop, or NC program terminated  In this state, the control has no modally effective program information (i.e., contextual reference), so that all actions are possible (e.g., cursor movements or modification of Q parameters).
	NC program started, execution runs  For safety reasons, the control permits no actions in this state.
	NC program stopped (e.g., in <b>Program run, full sequence</b> operating mode after pressing the <b>NC Stop</b> key)  For safety reasons, the control permits no actions in this state.
	NC program interrupted (e.g., in <b>Positioning w/ Manual Data Input</b> operating mode, following the error-free execution of an NC block)  In this state, the control permits various actions (e.g., cursor movements or the modification of Q parameters). These actions, however, may lead to the control losing the modally effective program information (i.e., the contextual reference). Loss of this contextual reference may result in undesired tool positions!  <b>Further information:</b> "Positioning w/ Manual Data Input operating mode", Page 296 and "Program-controlled interruptions", Page 273
	NC program aborted or terminated
<b>ACC</b>	The Active Chatter Control (ACC) function is active
	The pulsing spindle speed function is active
	The active linear principal axes do not correspond to X, Y, and Z because the <b>PARAXMODE</b> or <b>POLARKIN</b> function is active.

Icon	Meaning
	<p><b>i</b> An active <b>PARAXMODE</b> or <b>POLARKIN</b> icon hides the <b>PARAXCOMP DISPLAY</b> icon.</p> <p>The <b>PARAXCOMP DISPLAY</b> function is active</p>
	<p><b>i</b> An active <b>PARAXMODE</b> or <b>POLARKIN</b> icon hides the <b>PARAXCOMP MOVE</b> icon.</p> <p>The <b>PARAXCOMP MOVE</b> function is active</p>
<p><b>i</b> The order of icons can be changed with the optional <b>iconPrioList</b> machine parameter (no. 100813). Only the icon for control-in-operation (STIB) is always visible and cannot be configured.</p>	

## Additional status displays

The additional status displays contain detailed information on the program run. This can be called in all operating modes except for the **Programming** mode. In the **Test Run** operating mode, only a limited status display is available.

### Activating the additional status display



- Display the soft key row for screen layout



- Select the layout option for the additional status display
- In the right half of the screen, the control shows the **Overview** status form.

### Selecting an additional status display



- Toggle through the soft key rows until the **STATUS** soft keys appear



- Either select the additional status display directly with the soft key, e.g. positions and coordinates; or



- Use the toggle soft keys to select the desired view

Select the status displays described below as follows:

- Directly with the corresponding soft key
- Via the toggle soft keys
- Or by using the **next tab** key



Please note that some of the status information described below is not available unless the associated software option is enabled on your control.



Overview

The control displays the **Overview** status form after startup if you selected the **PROGRAM + STATUS** (or **POSITION + STATUS**) screen layout. The overview form contains a summary of the most important status information, which you can also find on the various detail forms.

Soft key	Meaning
<div>STATUS OVERVIEW</div>	Position display Possible additional information following the axis designations: <ul style="list-style-type: none"><li>■ <b>(D): PARAXMODE DISPLAY</b> function active</li><li>■ <b>(M): PARAXMODE MOVE</b> function active</li></ul>
	Spindle position Depends on the <b>spindleDisplay</b> machine parameter (no. 100807)
	Tool information
	Active M functions
	Active coordinate transformations
	Active subprogram
	Active program-section repeat
	NC-program called with <b>PGM CALL</b>
	Current machining time
	Name and path of the active main program

General program information (PGM tab)

Soft key	Meaning
No direct selection possible	Name and path of the active main program
	Actual/nominal value counters
	Circle center CC (pole)
	Dwell time counter
	Current machining time
	Current time
	Called NC programs

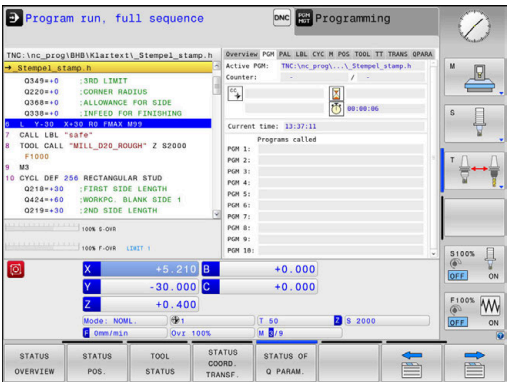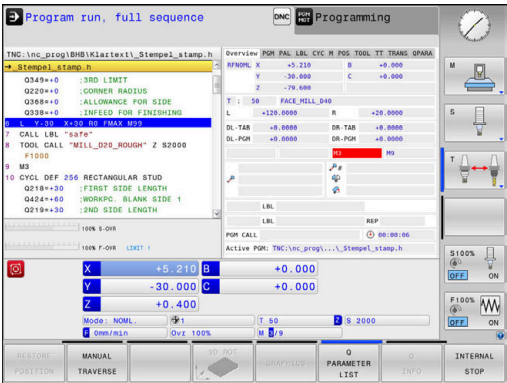

### Pallet information (PAL tab)




The control displays this tab only if the function is active on your machine.

#### Soft key

#### Meaning

No direct selection possible

Number of the active pallet preset

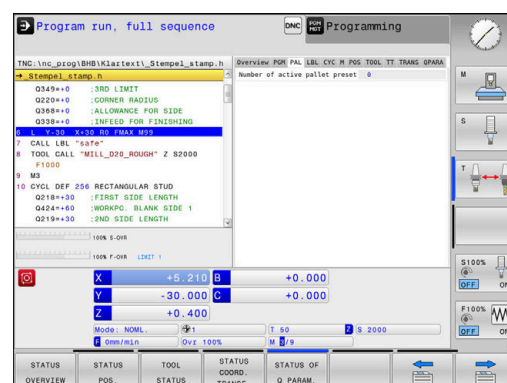

### Program-section repeats and subprograms (LBL tab)


#### Soft key

#### Meaning

No direct selection possible

Active program section repeats with block number, label number, and number of programmed repeats/repeats yet to be run

Active subprograms with number of block in which the subprogram was called and the label number that was called

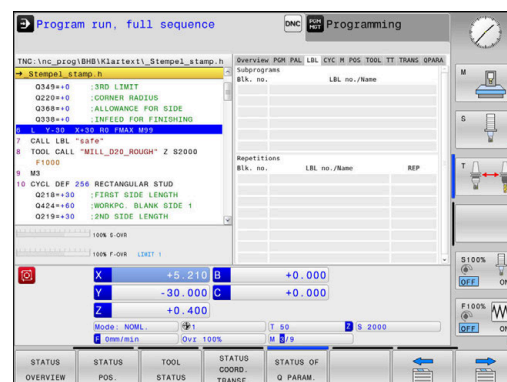

### Information on standard cycles (CYC tab)

#### Soft key

#### Meaning


No direct selection possible

Active machining cycle

Active path and angle tolerances

Depending on which path and angle tolerances are active, the following values are displayed:

- Values of Cycle **32 TOLERANCE**
- Values defined by the machine tool builder

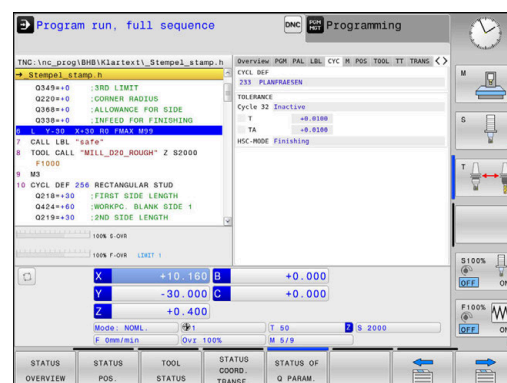

### Active M functions (miscellaneous functions, M tab)


#### Soft key

#### Meaning

No direct selection possible


List of the active M functions with fixed functionality

List of the active M functions (adapted by your machine tool builder)

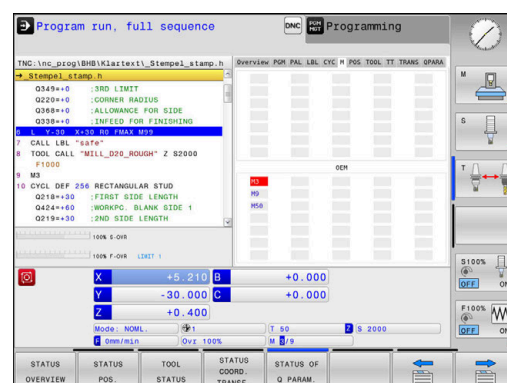


Positions and coordinates (POS tab)

Soft key	Meaning
<div>STATUS POS.</div>	Type of position display (e.g., actual position)
	Axis positions
	Spindle position
	Depends on the <b>spindleDisplay</b> machine parameter (no. 100807)
	Tilt angle of the working plane
	Angle of basic transformations
	Active kinematics
	<b>Principal axes</b> if they have been defined using the <b>PARAXMODE</b> or <b>POLARKIN</b> function instead of the standard <b>XYZ</b> .

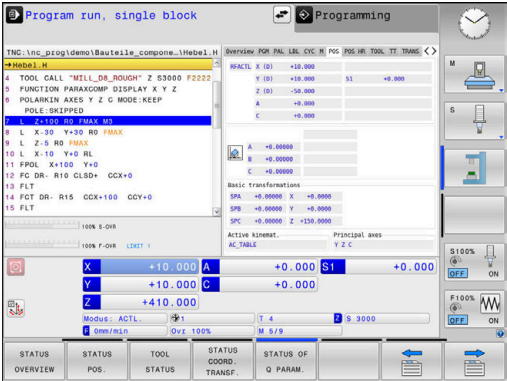

Global Program Settings (POS HR tab)


Soft key	Meaning
No direct selection possible	Current values of <b>Handwheel superimp.</b> <ul style="list-style-type: none"><li>Active coordinate system<ul style="list-style-type: none"><li>With <b>M118</b>: always the machine coordinate system</li><li>Selectable with <b>GPS</b> (Global Program Settings)</li></ul></li><li>Max. val. is defined by <b>M118</b> or <b>GPS</b></li><li>Max. val. and Actl.val. of the selected axes</li><li>Status of the <b>Reset VT value</b> function</li></ul>

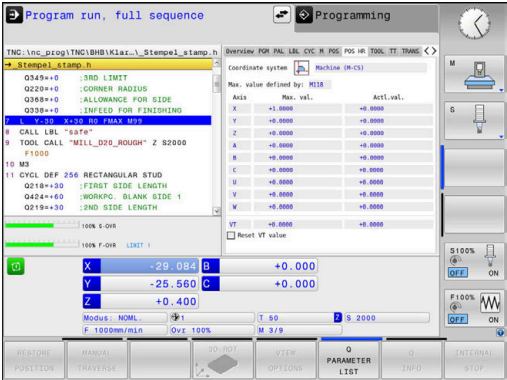

The values of all other settings provided by the Global Program Settings function are displayed on the **GS** tab.

Information on the tools (TOOL tab)

Soft key	Meaning
<div>TOOL STATUS</div>	Display of active tool: <ul style="list-style-type: none"><li>T: Tool number and tool name</li><li>RT: Number and name of a replacement tool</li></ul>
	Tool axis
	Tool length and tool radii
	Finishing allowances (delta values) from the tool table (TAB) and <b>TOOL CALL</b> (PGM)
	Tool life, maximum tool life (TIME 1) and maximum tool life for <b>TOOL CALL</b> (TIME 2)
	Display of programmed tool and replacement tool

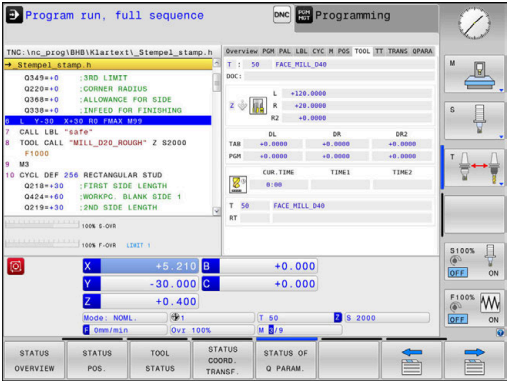

### Tool measurement (TT tab)




The control displays this tab only if the function is active on your machine.

Soft key	Meaning
No direct selection possible	Active tool
	Minimum tilt angle (MIN) of the tool touch probe
	Maximum tilt angle (MAX) of the tool touch probe
	Tolerance for tilt angle (DYN)
	Measurement results of the cycle:
Field	Meaning
1	Tilt angle of positive X direction
2	Tilt angle of positive Y direction
3	Tilt angle of negative X direction
4	Tilt angle of negative Y direction
11	X position of tool touch probe in machine coordinate system (M-CS)
12	Y position of tool touch probe in machine coordinate system (M-CS)
13	Z position of tool touch probe in machine coordinate system (M-CS)
14	Diameter or edge length of probe contact
15	Angle of misalignment



Your machine tool builder defines the tolerance for the tilt angle in the optional machine parameter **tippingTolerance** (no. 114319). The control will determine the tilt angle automatically only if a tolerance is defined.

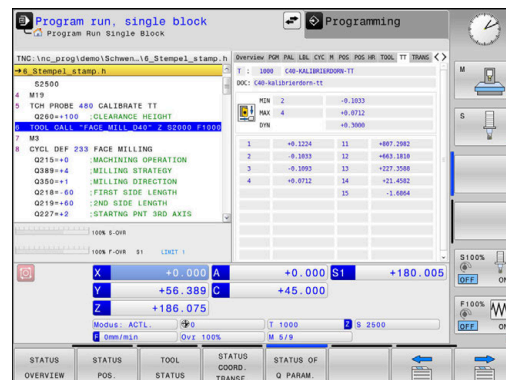



## Coordinate transformations

Soft key	Meaning
STATUS COORD. TRANSF.	Name of the active datum table
	Number of active datum ( <b>#</b> ), comment from the active line of the active datum ( <b>DOC</b> ) from Cycle <b>7</b>
	Active datum shift (Cycle <b>7</b> ); the control displays an active datum shift in up to 8 axes
	Mirrored axes (Cycle <b>8</b> )
	Active angle of rotation (Cycle <b>10</b> )
	Active scaling factor/factors (Cycle <b>11</b> ) (Cycle <b>26</b> ); the control displays an active scaling factor in up to 6 axes.
	Scaling datum


**i** In the machine parameter **CfgDisplayCoordSys** (no. 127501), the machine tool builder specifies the coordinate system in which the status display shows an active datum shift.

**Further information:** User's Manual for **Programming of Machining Cycles**

**Further information:** User's Manuals for Klartext Programming and ISO Programming



### Display of Q parameters (QPARA tab)

Soft key	Meaning
STATUS OF Q PARAM.	Display the current values of the defined Q parameters
	Display the character strings of the defined string parameters

 Press the **Q PARAMETER LIST** soft key. The control opens a pop-up window. For each parameter type (Q, QL, QR, QS), define the parameter numbers you wish to check. Separate single Q parameters with commas and connect sequential Q parameters with a hyphen (e.g., 1,3,200-208). The maximum number of characters per parameter type is 132.

The display in the **QPARA** tab always contains eight decimal places. The result of **Q1 = COS 89.999** is shown by the control as 0.00001745, for example. Very large and very small values are displayed by the control in exponential notation. The result of **Q1 = COS 89.999 \* 0.001** is shown by the control as +1.74532925e-08, whereby e-08 corresponds to the factor of  $10^{-8}$ .

The display of QS parameters is restricted to the first 30 characters, i.e. the contents might be truncated.

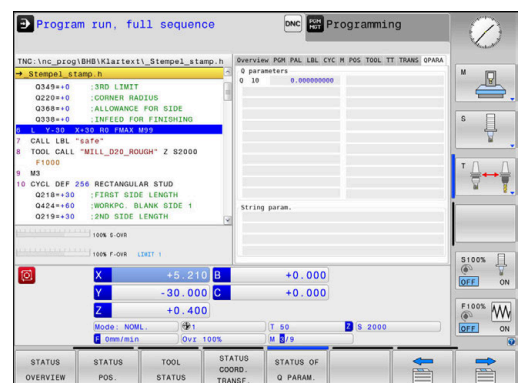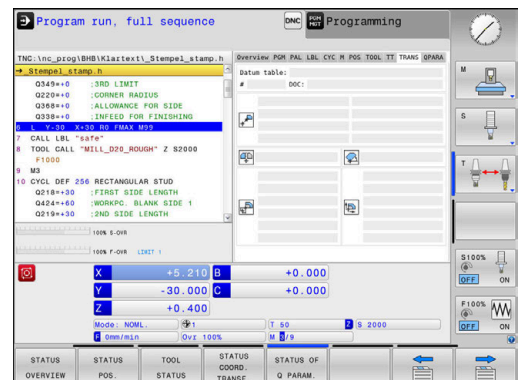

## Monitoring of configured machine components (MON and MON Detail tabs, option 155)



The control displays these tabs only if the software option has been enabled on your machine.

Your machine tool builder can define up to ten components to be monitored.

For any detected overload conditions, the machine tool builder has configured component-specific automated responses, e.g. stop of the current execution.

### MON tab

Soft key	Meaning
No direct selection possible	<b>MON status</b> Active if at least one monitoring component has been defined by the machine tool builder
	<b>Monitoring tasks:</b> All monitored components with their defined names and a color-coded status display <ul style="list-style-type: none"> <li>Green: component works under conditions defined as safe</li> <li>Yellow: component works under warning zone conditions</li> <li>Red: Overload condition</li> </ul>

#### Diagram:


Combined display of all monitoring tasks

- The red line shows the error limit defined by the machine tool builder
- The yellow line shows the warning limit defined by the machine tool builder
- The black line follows the condition of the component that is subjected to the highest load
  - Above the red line, as soon as at least one of the monitored components reaches the overload zone
  - Above the green line, as soon as at least one of the monitored components reaches the warning zone

#### Diagram zones:

- Area above the red line: overload zone
- Area between the red and green lines: warning zone
- Area below the green line: zone of conditions defined as safe

Alternatively, the machine tool builder can define only warning limits or error limits. If no limits have been defined, the corresponding red or yellow line is not displayed.

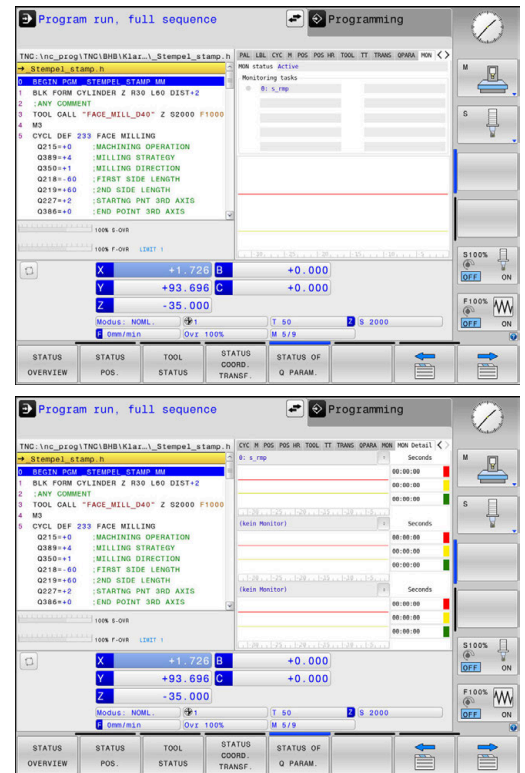



**MON Detail tab**

Soft key	Meaning
No direct selection possible	<p>Three identical areas for the display of detailed information related to three freely selectable monitored components.</p> <hr/> <p>The monitored components can be selected via the pull-down menus above the diagrams. Once you select a component, the display indicates its name and an index (order of definition).</p> <hr/> <p>Diagram:</p> <ul style="list-style-type: none"> <li>Individual view of the selected monitoring task</li> <li>■ The red line shows the error limit defined by the machine tool builder</li> <li>■ The yellow line shows the warning limit defined by the machine tool builder</li> <li>■ The black line corresponds to the current load condition</li> </ul> <p>Alternatively, the machine tool builder can define only warning limits or error limits. If no limits have been defined, the corresponding red or yellow line is not displayed.</p> <hr/> <p><b>Seconds:</b></p> <ul style="list-style-type: none"> <li>Individual display of the load duration</li> <li>■ Red: duration in the overload zone</li> <li>■ Yellow: duration in the warning zone</li> <li>■ Green: duration in the zone defined as safe</li> </ul>



With **Component Monitoring** (option 155), the control provides automatic monitoring of configured machine components.

If configured correctly, the system will display warning messages indicating an imminent overload condition and error messages indicating that an overload condition was detected. By responding in time to these messages, you can take countermeasures to protect the machine components from damage.

If configured badly, inappropriate error messages will impede or even prevent further work. In this case, you can use the **CfgMonUser** (no. 129400) machine parameter to influence the configured overload responses.

**Further information:** "List of user parameter", Page 480

## 3.5 File management

### Files

Files in the control	Type
<b>NC programs</b>	
in HEIDENHAIN format	.H
in DIN/ISO format	.I
<b>Compatible NC programs</b>	
HEIDENHAIN unit programs	.HU
HEIDENHAIN contour programs	.HC
<b>Tables for</b>	
Tools	.T
Tool changers	.TCH
Datums	.D
Points	.PNT
Presets	.PR
Touch probes	.TP
Backup files	.BAK
Dependent data (e.g. structure items)	.DEP
Freely definable tables	.TAB
Pallets	.P
<b>Texts as</b>	
ASCII files	.A
Text files	.TXT
HTML files, e.g. result logs of touch probe cycles	.HTML
Help files	.CHM
<b>CAD files as</b>	
ASCII files	.DXF .IGES .STEP

When you write an NC program on the control, you must first enter a program name. The control saves the NC program to the internal memory as a file with the same name. The control can also save texts and tables as files.

The control provides a special file management window in which you can easily find and manage your files. Here you can call, copy, rename and erase files.

With the control, you can manage and save files up to a total size of **2 GB**.



Depending on the setting, the control generates backup files with the extension \*.bak after editing and saving of NC programs. This reduces the available memory space.

### File names

When you store NC programs, tables and texts as files, the control adds an extension to the file name, separated by a point. This extension indicates the file type.

File name	File type
PROG20	.H

File names, drive names and directory names on the control must comply with the following standard: The Open Group Base Specifications Issue 6 IEEE Std 1003.1, 2004 Edition (POSIX Standard).

The following characters are permitted:

A B C D E F G H I J K L M N O P Q R S T U V W X Y Z a b c d e f g  
h i j k l m n o p q r s t u v w x y z 0 1 2 3 4 5 6 7 8 9 \_ -

The following characters have special meanings:

Character	Meaning
.	The last period (dot) in a file name is the extension separator
\ and /	Directory separators
:	Separates the drive name from the directory

Do not use any other characters. This helps to prevent file transfer problems, etc.



The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.



The maximum permitted path length is 255 characters. The path length consists of the drive characters, the directory name and the file name, including the extension.

**Further information:** "Paths", Page 80

## Displaying externally generated files on the control

The control features several additional tools which you can use to display the files shown in the table below. Some of the files can also be edited.

File types	Type
PDF files	pdf
Excel tables	xls
	csv
Internet files	html
Text files	txt
	ini
Graphics files	bmp
	gif
	jpg
	png

**Further information:** "Additional tools for management of external file types", Page 90

## Directories

To ensure that you can easily find your NC programs and files, we recommend that you organize your internal memory into directories (folders). You can divide a directory into further directories, which are called subdirectories. With the **-/+** key or **ENT** you can show or hide the subdirectories.

## Paths

A path indicates the drive and all directories and subdirectories under which a file is saved. The individual names are separated by a backslash \.




The maximum permitted path length is 255 characters. The path length consists of the drive characters, the directory name and the file name, including the extension.

### Example

The directory AUFTR1 was created on the **TNC** drive. Then, in the AUFTR1 directory, the directory NCPROG was created and the NC program PROG1.H was copied into it. The NC program now has the following path:

**TNC:\AUFTR1\NCPROG\PROG1.H**

The chart at right illustrates an example of a directory display with different paths.

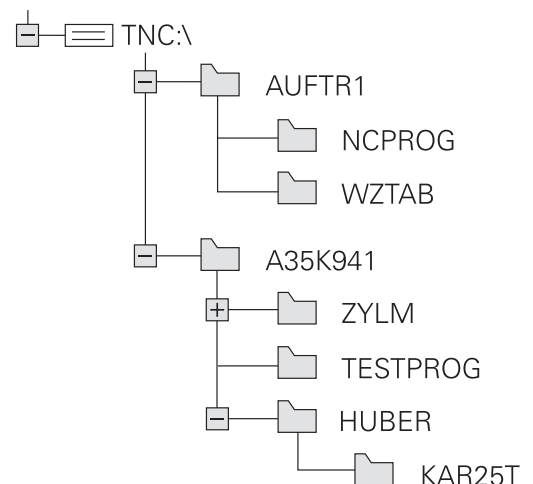

## Calling the file manager




- Press the **PGM MGT** key
- The control displays the file management window (see figure for default setting. If the control displays a different screen layout, press the **WINDOW** soft key).

The narrow window on the left shows the available drives and directories. Drives designate devices with which data are stored or transferred. A drive is the internal memory of the control. Other drives are the interfaces (RS232, Ethernet) to which you can connect a PC for example. A directory is always identified by a folder symbol to the left and the directory name to the right. Subdirectories are shown to the right of and below their parent directories. If there are subdirectories, you can show or hide them using the **-/+** key.

If the directory tree is longer than the screen, navigate using the scroll bar or a connected mouse.

The wide window on the right shows you all files that are stored in the selected directory. Each file is shown with additional information, illustrated in the table below.

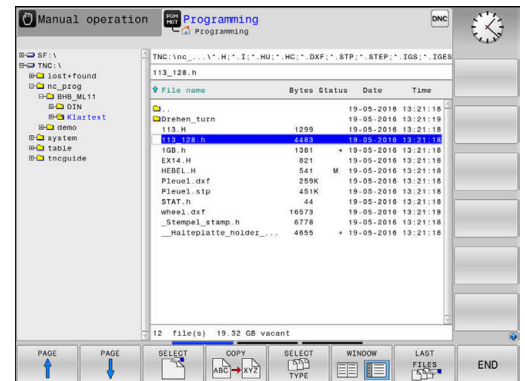

Display	Meaning
<b>File name</b>	File name and file type
<b>Bytes</b>	File size in bytes
<b>Status</b>	File properties:
E	File is selected in the <b>Programming</b> operating mode
S	File is selected in the <b>Test Run</b> operating mode
M	The file is selected in a Program Run operating mode
+	File has non-displayed dependent files with the extension DEP, e.g. with use of the tool usage test
	File is protected against erasing and editing
	File is protected against erasing and editing, because it is being run
<b>Date</b>	Date that the file was last edited
<b>Time</b>	Time that the file was last edited



To display the dependent files, set the machine parameter **dependentFiles** (no. 122101) to **MANUAL**.

## Additional functions

### Protecting a file and canceling file protection

- Place the cursor on the file you want to protect



- Select the additional functions:  
Press the **MORE FUNCTIONS** soft key



- Activate file protection:  
Press the **PROTECT** soft key



- The file is tagged with the "protected" symbol.



- Cancel file protection:  
Press the **UNPROTECT** soft key

### Selecting the editor

- Place the cursor on the file you want to open



- Select the additional functions:  
Press the **MORE FUNCTIONS** soft key




- Select the editor:  
Press the **SELECT EDITOR** soft key
- Mark the desired editor
  - **TEXT EDITOR** for text files (e.g., **.A** or **.TXT**)
  - **PROGRAM EDITOR** for NC programs **.H** and **.I**
  - **TABLE EDITOR** for tables (e.g., **.TAB** or **.T**)
  - **BPM EDITOR** for pallet tables **.P**
- Press the **OK** soft key

### Connecting and removing USB storage devices

The control automatically detects connected USB devices with a supported file system.

To remove a USB device, proceed as follows:

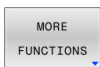

- Move the cursor to the left-hand window
- Press the **MORE FUNCTIONS** soft key



- Remove the USB device

**Further information:** "USB devices on the control", Page 85

### ADVANCED ACCESS RIGHTS

The **ADVANCED ACCESS RIGHTS** function can only be used in connection with user administration. This function requires the **public** directory.

**Further information:** "Setting advanced file access rights", Page 448

Upon the first activation of user administration, the **public** directory below the TNC partition will be connected.



Access rights can only be defined for files located in the **public** directory.

For all files stored on the TNC partition instead of the **public** directory, the **user** function user will automatically be assigned as the owner.

**Further information:** "'public' directory", Page 448

### Selecting drives, directories and files

PGM  
MGT

- Call the file manager by pressing the **PGM MGT** key

Navigate with a connected mouse or use the arrow keys or the soft keys to move the cursor to the desired position on the screen:



- Moves the cursor from the left to the right window, and vice versa



- Moves the cursor up and down within a window



- Moves the cursor one page up or down within a window



#### Step 1: Select drive

- Move the highlight to the desired drive in the left window



- Select a drive: Press the **SELECT** soft key, or



- Press the **ENT** key

#### Step 2: Select a directory

- Move the highlight to the desired directory in the left window
- > The right-hand window automatically shows all files stored in the highlighted directory

**Step 3: Select a file**

- ▶ Press the **SELECT TYPE** soft key



- ▶ Press the **SHOW ALL** soft key
- ▶ Move the highlight to the desired file in the right window



- ▶ Press the **SELECT** soft key, or



- ▶ Press the **ENT** key
- ▶ The control opens the selected file in the operating mode from which you called the file manager.



If you enter the first letter of the file you are looking for in the file manager, the cursor automatically jumps to the first NC program with the same letter.

**Filtering the display**

To filter the displayed files, proceed as follows:



- ▶ Press the **SELECT TYPE** soft key



- ▶ Press the soft key for the desired file type

Alternative:



- ▶ Press the **SHOW ALL** soft key
- ▶ The control displays all files in this folder.

Alternative:



- ▶ Use wildcards, such as **4\*.H**
- ▶ The control will show all files of file type .h whose name starts with 4.

Alternative:



- ▶ Enter the file name extension, e.g. **\*.H;\*.D**
- ▶ The control will show all files of file type .h and .d.

Any display filter you have set will remain effective even after a control restart,



## Choosing one of the last files selected



- Call the file manager: Press the **PGM MGT** key.




- Display the last ten files selected: Press the **LAST FILES** soft key

Press the arrow keys to move the cursor to the file you wish to select:




- Moves the cursor up and down within a window

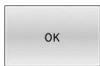

- Select the file: Press the **OK** soft key, or



- Press the **ENT** key

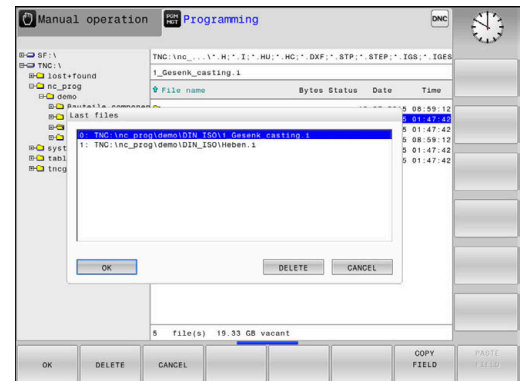

The **COPY FIELD** soft key allows you to copy the path of a marked file. You can reuse the copied path later (e.g., when calling a program with the **PGM CALL** key).

## USB devices on the control



Use the USB port only for file transfer and backup. Before editing or running an NC program, save it to the hard disk of the control. This helps to avoid duplicate data maintenance and prevents potential problems resulting from data transfer during program run.

Backing up data from or loading onto the control is especially easy with USB devices. The control supports the following USB block devices:

- Floppy disk drives with FAT/VFAT file system
- Memory sticks with the FAT/VFAT or exFAT file system
- USB sticks with NTFS file system
- Hard disks with the FAT/VFAT file system
- CD-ROM drives with the Joliet (ISO 9660) file system

The control automatically detects these USB devices when they are plugged in. If the file system is not supported, the control issues an error message as soon as the stick is plugged in.



If an error message is displayed when connecting a USB data medium, check the setting in the SELinux security software.

**Further information:** "SELinux security software", Page 417

If the control displays the **USB: TNC does not support device** error message when using a USB hub, ignore and acknowledge the message with the **CE** key.

If the control repeatedly fails to correctly detect a USB device with the FAT/VFAT or exFAT file system, connect another device to check the port. If this resolves the problem, use the properly working device.

### Working with USB devices



Refer to your machine manual!


Your machine tool builder can assign permanent names for USB devices.

The USB devices appear as separate drives in the directory tree, so you can use the file management functions described in the earlier chapters.

If a larger file is transferred to a USB device in the file manager, the control displays the **Write access on USB device** dialog until the file transfer is completed. You can close the dialog with the **HIDE** soft key, but the file transfer continues in the background. The control displays a warning until the file transfer is completed.

### Removing USB devices

To remove a USB device, proceed as follows:

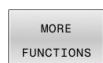

- ▶ Move the cursor to the left-hand window
- ▶ Press the **MORE FUNCTIONS** soft key



- ▶ Remove the USB device

## Data transfer to or from an external data carrier




Before you can transfer data to an external data medium, you must set up the data interface.

**Further information:** "Setting up data interfaces", Page 401



- ▶ Press the **PGM MGT** key

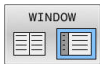

- ▶ Press the **WINDOW** soft key to select the screen layout for the file transfer



- ▶ Use the arrow keys to move the cursor to the file you want to transfer



- ▶ The control moves the cursor up and down within a window.



- ▶ The control moves the cursor from the right to the left window, and vice versa.



If you wish to copy a file from the control to the external data carrier, move the cursor in the left window to the file to be transferred.


If you wish to copy from the external data medium to the control, move the cursor in the right window to the file to be transferred.



- ▶ Press the **SHOW TREE** soft key to select another drive or directory
- ▶ Use the arrow keys to select the desired directory




- ▶ Press the **SHOW FILES** soft key
- ▶ Use the arrow keys to select the desired file

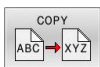


- ▶ Press the **COPY** soft key



- ▶ Confirm with the **ENT** key
- ▶ A status window appears on the control, informing about the copying progress.

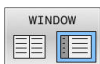

- ▶ Alternative: Press the **WINDOW** soft key
- ▶ The control displays the standard file manager window again.

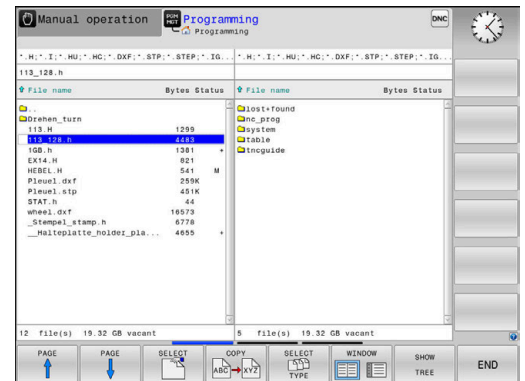

### Preventing incomplete NC programs

The control checks all NC programs for completeness before machining. The control displays a warning if the **END PGM** NC block is missing.

When you start the incomplete NC program in **Program run, single block** or **Program run, full sequence** operating mode, the control aborts with an error message.

Proceed as follows to edit the NC program:

- ▶ Select the NC program in **Programming** operating mode
- > The control opens the NC program and automatically adds the **END PGM** NC block.
- ▶ Check the NC program, and complete it if necessary
- ▶ Press the **SAVE AS** soft key
- > The control saves the NC program with the **END PGM** NC block that has been added.



### The control within the network



Protect your data and your control by running your machines in a secure network.

You connect the control to the network via an Ethernet interface. On the control, you can define general network settings and connect network drives.

**Further information:** "Ethernet interface ", Page 407


When the control is connected to a network and the file shares are connected, the control displays additional drives in the directory window. The functions for selecting a drive, copying files, etc. also apply to the network drives, provided that the corresponding permission is available.



The control logs any error messages that occur during network operation.



Network drives do not protect from undesired data manipulation. HEIDENHAIN recommends that you run NC programs from the drive **TNC:**.

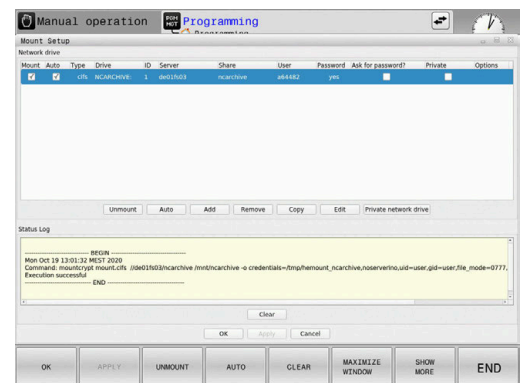

## Data backup

HEIDENHAIN recommends backing up new NC programs and files created on the control to a PC at regular intervals.

The free-of-charge **TNCremo** software from HEIDENHAIN is a simple and convenient method for backing up data stored on the control.

You can also backup files directly from the control.

**Further information:** "Backup and restore", Page 395

You additionally need a data medium on which all machine-specific data, such as the PLC program, machine parameters, etc., are stored. Ask your machine manufacturer for assistance, if necessary.



Take the time occasionally to delete any unneeded files so that the control always has enough hard-disk space for system files (such as the tool table).

## Importing a file from an iTNC 530



Refer to your machine manual!

The machine tool builder can adapt the **ADAPT NC PGM / TABLE** function.

The machine tool builder can define update rules that make it possible, for example, to automatically remove umlauts from tables and NC programs.

If you export a file from an iTNC 530 and import it into a TNC 620, depending on the file type you have to adapt its format and content before you can use the file.

The machine tool builder defines which file types you will be able to import when using the **ADAPT NC PGM / TABLE** function. The control converts the contents of the imported file to a format valid for the TNC 620 and saves the changes to the selected file.

**Further information:** "Importing tool tables", Page 137

## Additional tools for management of external file types

The additional tools enable you to display or edit various externally created file types on the control.

File types	Description
PDF files (pdf)	Page 91
Excel spreadsheets (xls, csv)	Page 92
Internet files (htm, html)	Page 93
ZIP archives (zip)	Page 95
Text files (ASCII files, e.g. txt, ini)	Page 96
Video files (ogg, oga, ogv, ogx)	Page 97
Graphic files (bmp, gif, jpg, png)	Page 97



Files with the extensions pdf, xls, zip, bmp, gif, jpg and png must be transmitted in binary format from the PC to the control. Adjust the setting in the **TNCremo** software, if required (menu item >**Extras** > **Configuration** > **Mode**).



If you are using a TNC 620 with touch control, you can replace some keystrokes with gestures.

**Further information:** "Operating the touchscreen", Page 461

## Displaying PDF files

To open PDF files directly on the control, proceed as follows:




- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the directory in which the PDF file is saved
- ▶ Move the cursor to the PDF file
- ▶ Press the **ENT** key
- ▶ The control opens the PDF file in its own application using the **PDF viewer** additional tool.



With the key combination ALT+TAB, you can always return to the control's user interface while leaving the PDF file open. Alternatively, you can also click the corresponding icon in the task bar to switch back to the user interface of the control.



If you position the mouse pointer over a button, a brief tool tip explaining the function of this button will be displayed. More information on how to use the **PDF viewer** is provided in **Help**.

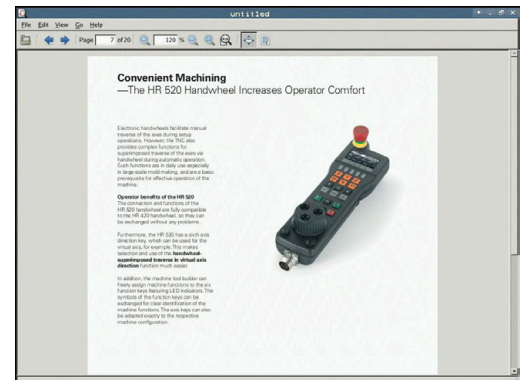

Proceed as follows to exit the **PDF viewer**:

- ▶ Use the mouse to select the **File** menu item
- ▶ Select **Close**
- ▶ The control returns to the file manager.

If you are not using a mouse, proceed as follows to close the **PDF viewer**:



- ▶ Press the key for switching the soft keys
- ▶ The **PDF viewer** opens the **File** pull-down menu.
- ▶ Move the cursor to the **Close** menu item



- ▶ Press the **ENT** key
- ▶ The control returns to the file manager.



If you are using a TNC 620 with touch operation, the full-screen mode is automatically terminated after five seconds.

### Displaying and editing Excel files

Proceed as follows to open and edit Excel files with the extension **xls**, **xlsx** or **csv** directly on the control:



- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the directory in which the Excel file is saved
- ▶ Move the cursor to the Excel file
- ▶ Press the **ENT** key
- > The control opens the Excel file in its own application using the **Gnumeric** additional tool.



With the key combination ALT+TAB, you can always return to the control's user interface while leaving the Excel file open. Alternatively, you can also click the corresponding icon in the task bar to switch back to the user interface of the control.



If you position the mouse pointer over a button, a brief tool tip explaining the function of this button will be displayed. More information on how to use **Gnumeric** is provided in **Help**.

Proceed as follows to exit **Gnumeric**:

- ▶ Use the mouse to select the **File** menu item
- ▶ Select **Close**
- > The control returns to the file manager.

If you are not using a mouse, proceed as follows to close the additional **Gnumeric** tool:



- ▶ Press the key for switching the soft keys
- > The **Gnumeric** additional tool opens the **File** pull-down menu.



- ▶ Move the cursor to the **Close** menu item



- ▶ Press the **ENT** key
- > The control returns to the file manager.



## Displaying Internet files




The network must ensure protection against viruses and malicious software. The same applies to access to the Internet or other networks.

The protective measures for this network are the responsibility of the machine tool builder and the respective network administrator, for example through a firewall.



Configure and use the sandbox on your control. For safety and security reasons, always open the browser in the sandbox.

**Further information:** "Sandbox tab", Page 413

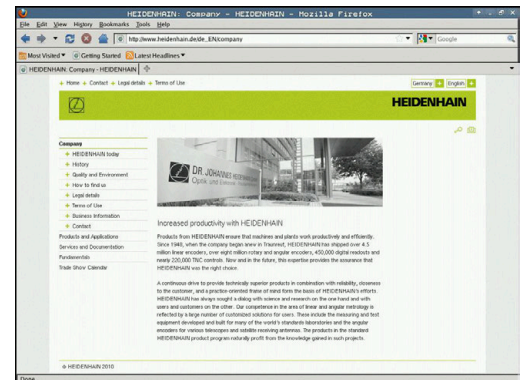

Proceed as follows to open Internet files with the extension **htm** or **html** directly on the control:

PGM  
MGT

- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the directory in which the Internet file is saved

- ▶ Move the cursor to the Internet file

ENT

- ▶ Press the **ENT** key
- ▶ The control opens the Internet file in its own application using the **Web Browser** additional tool.



With the key combination ALT+TAB, you can always return to the control's user interface while leaving the browser open. Alternatively, you can also click the corresponding icon in the task bar to switch back to the user interface of the control.



If you position the mouse pointer over a button, a brief tool tip explaining the function of this button will be displayed. More information on how to use **Web Browser** is available in **Help**.

When you start the web browser, it checks at regular intervals whether updates are available.

You can update the web browser only if you deactivate the SELinux security software during this time and you are connected to the Internet.



Reactivate SELinux after running the update.

Proceed as follows to close the **web browser**:

- ▶ Use the mouse to select the **File** menu item
- ▶ Select **Quit**
- > The control returns to the file manager.

If you are not using a mouse, proceed as follows to close the **web browser**:



- ▶ Press the key for switching the soft keys: The **web browser** opens the **File** pull-down menu



- ▶ Move the cursor to the **Quit** menu item



- ▶ Press the **ENT** key
- > The control returns to the file manager.

## Working with ZIP archives

Proceed as follows to open ZIP archives with the extension **zip** directly on the control:

PGM  
MGT

- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the directory in which the archive file is saved
- ▶ Move the cursor to the archive file
- ▶ Press the **ENT** key
- ▶ The control opens the archive file in its own application using the **Xarchiver** additional tool.


ENT



With the key combination ALT+TAB, you can always return to the control's user interface while leaving the archive file open. Alternatively, you can also click the corresponding icon in the task bar to switch back to the user interface of the control.



If you position the mouse pointer over a button, a brief tool tip explaining the function of this button will be displayed. More information on how to use the **Xarchiver** function is provided under **Help**.

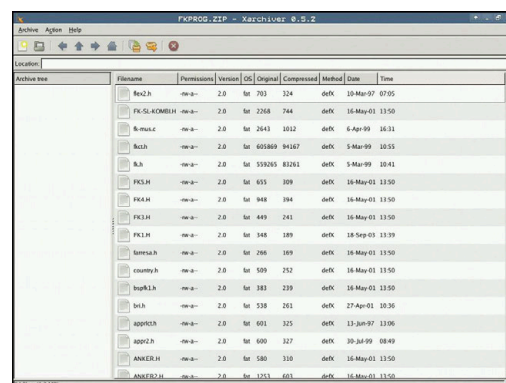

To exit **Xarchiver**, proceed as follows:

- ▶ Use the mouse to select the **ARCHIVE** menu item
- ▶ Select **Exit**
- ▶ The control returns to the file manager.

If you are not using a mouse, proceed as follows to close the **Xarchiver**:



- ▶ Press the key for switching the soft keys
- ▶ **Xarchiver** opens the **ARCHIVE** pull-down menu.



- ▶ Move the cursor to the **Exit** menu item

ENT

- ▶ Press the **ENT** key
- ▶ The control returns to the file manager.

## Displaying or editing text files

Use the internal text editor to open and edit text files (ASCII files, e.g. with the extension **txt**). Proceed as follows:

PGM  
MGT

- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the drive and the directory in which the text file is saved
- ▶ Move the cursor to the text file
- ▶ Press the **ENT** key
- ▶ The control opens the text file with the internal text editor.

ENT



Alternatively, you can also open the ASCII files using the **Leafpad** additional tool. The shortcuts you are familiar with from Windows, which you can use to edit texts quickly (CTRL+C, CTRL+V,...), are available within **Leafpad**.




With the key combination ALT+TAB, you can always return to the control's user interface while leaving the text file open. Alternatively, you can also click the corresponding icon in the task bar to switch back to the user interface of the control.

Proceed as follows to open **Leafpad**:

- ▶ Use the mouse to select the **Menu HEIDENHAIN** icon from the task bar
- ▶ Select the **Tools** and **Leafpad** menu items in the pull-down menu

Proceed as follows to exit **Leafpad**:

- ▶ Use the mouse to select the **File** menu item
- ▶ Select **Exit**
- ▶ The control returns to the file manager.

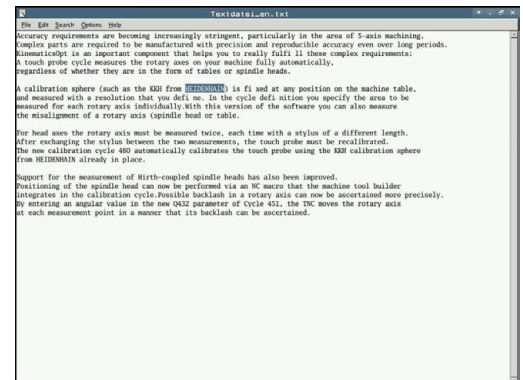

### Displaying video files



This function must be enabled and adapted by the machine tool builder.

Proceed as follows to open video files with the extension **ogg**, **oga**, **ogv** or **ogx** directly on the control:

PGM  
MGT

- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the directory in which the video file is saved
- ▶ Move the cursor to the video file
- ▶ Press the **ENT** key
- ▶ The control opens the video file in its own application.

ENT



The paid-for Fluendo Codec Pack is required for other formats, such as for MP4 files.



Any additional software will be installed by your machine tool builder.

### Displaying graphics files

Proceed as follows to open graphics files with the extension **bmp**, **gif**, **jpg** or **png** directly on the control:

PGM  
MGT

- ▶ Call the file manager: Press the **PGM MGT** key
- ▶ Select the directory in which the graphics file is saved
- ▶ Move the cursor to the graphics file
- ▶ Press the **ENT** key
- ▶ The control opens the graphics file in its own application using the **Ristretto** additional tool.

ENT



With the key combination ALT+TAB, you can always return to the control's user interface while leaving the graphics file open. Alternatively, you can also click the corresponding icon in the task bar to switch back to the user interface of the control.



More information on how to use the **ristretto** function is provided under **Help**.



Proceed as follows to exit **Ristretto**:

- ▶ Use the mouse to select the **File** menu item
- ▶ Select **Exit**
- > The control returns to the file manager.

If you are not using a mouse, proceed as follows to close the **Ristretto** tool:



- ▶ Press the key for switching the soft keys
- > **Ristretto** opens the **File** pull-down menu.



- ▶ Move the cursor to the **Exit** menu item



- ▶ Press the **ENT** key
- > The control returns to the file manager.



If you are using a TNC 620 with touch operation, the full-screen mode is automatically terminated after five seconds.

## 3.6 Error messages and help system

### Error messages






#### Display of errors

The control displays error messages in the following cases, for example:

- Incorrect data input
- Logical errors in the NC program
- Contour elements that are impossible to machine
- Incorrect use of touch probes
- Hardware updates

When an error occurs, the control displays it in the header.

The control uses different icons and text colors for different error classes.

Icon	Text color	Error class
	Red	Errors
	Red	Errors Question type
	Yellow	Warning
	Green	Notes
	Blue	Information

The control displays an error message in the header until it is cleared or replaced by a higher-priority error (higher error class). Information that appears only briefly is always displayed.

The control displays long and multi-line error messages in abbreviated form. The complete information on all pending errors is shown in the error window.

An error message that contains an NC block number was caused by an error in the indicated NC block or in the preceding NC block.

#### Opening the error window

When you open the error window, the complete information on all pending errors will be shown.



- ▶ Press the **ERR** key
- > The control opens the error window and displays all accumulated error messages.

### Detailed error messages

The control displays possible causes of the error and suggestions for solving the problem:


- ▶ Open the error window
- ▶ Position the cursor on the corresponding error message



- ▶ Press the **MORE INFO** soft key
- ▶ The control opens a window with information on the error cause and corrective action.



- ▶ Exit the info: Press the **MORE INFO** soft key again

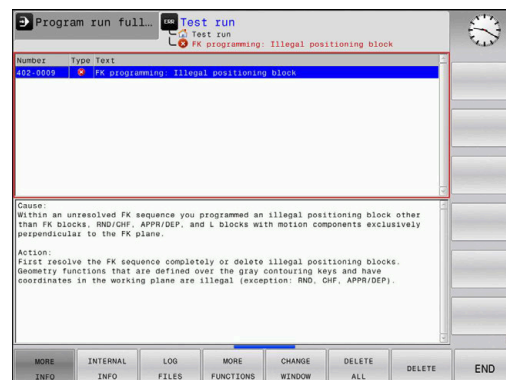

### High-priority error messages

When an error message occurs at switch-on of the control due to hardware changes or updates, the control will automatically open the error window. The control displays an error of the question type.

You can correct this error only by pressing the corresponding soft key to acknowledge the question. If necessary, the control continues the dialog until the cause or correction of the error has been clearly determined.

If a rare **processor check error** should occur, the control will automatically open the error window. You cannot correct such an error.

Proceed as follows:

- ▶ Shut down the control
- ▶ Restart

### INTERNAL INFO soft key

The **INTERNAL INFO** soft key supplies information on the error message. This information is only required if servicing is needed.


- ▶ Open the error window
- ▶ Position the cursor on the corresponding error message



- ▶ Press the **INTERNAL INFO** soft key
- ▶ The control opens a window with internal information about the error.



 

 

- ▶ Exit the detailed information: Press the **INTERNAL INFO** soft key again

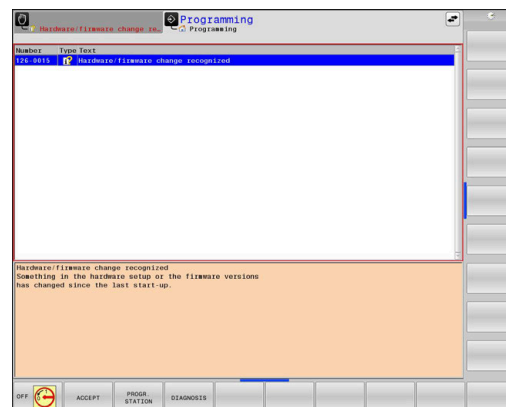



 
 

 

**FILTER soft key**

The **FILTER** soft key allows you to group identical warnings and error messages in the error window. The grouping makes the list of messages shorter and easier to read.

-  ► Open the error window
-  ► Press the **MORE FUNCTIONS** soft key
-  ► Press the **FILTER** soft key
  - > The control groups identical warnings and error messages.
  - > The number of occurrences of the individual messages is indicated in parentheses in the respective line.
-  ► Exit the filter: Press the **GO BACK** soft key

**ACTIVATE AUTOMATIC SAVING soft key**

Using the **ACTIVATE AUTOMATIC SAVING** soft key, you can specify error numbers that cause the control to save a service file if an error with that number occurs.

-  ► Open the error window
-  ► Press the **MORE FUNCTIONS** soft key
-  ► Press the **ACTIVATE AUTOMATIC SAVING** soft key
  - > The control opens the **ACTIVATE AUTOMATIC SAVING** pop-up window.
  - Define the entries
    - **Error number:** Enter the desired error number
    - **active:** Enable this option to automatically create the service file
    - **Comment:** Enter a comment on this error number, if required
-  ► Press the **STORE** soft key
  - > If an error with the specified error number occurs, a service file will be saved automatically.
-  ► Press the **GO BACK** soft key

## Deleting errors

### Clearing errors automatically



The control can automatically clear pending warning or error messages when an NC program is selected or restarted. The machine tool builder specifies in the optional machine parameter **CfgClearError** (no. 130200) whether these messages will automatically be cleared.

The factory default setting of the control defines that warning and error messages in the **Test Run** and **Programming** operating modes will be cleared automatically from the error window. Messages issued in the machine operating modes will not be cleared.

### Clearing errors outside of the error window



- ▶ Press the **CE** key
- > The control clears the errors or notes being displayed in the header.



In certain situations you cannot use the **CE** key for clearing the errors because the key is used for other functions.

### Clearing errors

- ▶ Open the error window
- ▶ Position the cursor on the corresponding error message



DELETE

- ▶ Press the **DELETE** soft key



DELETE  
ALL

- ▶ As an alternative, clear all errors: Press the **DELETE ALL** soft key



If the cause of the error has not been corrected, the error message cannot be cleared. In this case, the error message remains in the window.

### Error log

The control stores errors occurred and important events (e.g., system start) in an error log. The capacity of the error log is limited. When the log is full, the control uses a second file. When this is also full, the first error log is deleted and newly written etc. If required, switch from **CURRENT FILE** to **PREVIOUS FILE** to view the history.


- Open the error window



- Press the **LOG FILES** soft key



- Open the error log file: Press the **ERROR LOG** soft key

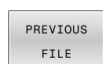

- Set the previous error log if required: Press the **PREVIOUS FILE** soft key



 



- Set the current error log if required: Press the **CURRENT FILE** soft key

The oldest entry is at the beginning of the log file, and the most recent entry is at the end.




 
 



### Keystroke log

The control stores each key pressed and important events (e.g., system start) in a keystroke log. The capacity of the keystroke log is limited. When the keystroke log is full, the control switches to a second keystroke log. When this is also full, the first keystroke log is deleted and newly written, etc. If required, switch from **CURRENT FILE** to **PREVIOUS FILE** to view the history of the inputs.

	▶ Press the <b>LOG FILES</b> soft key
	▶ Open the keystroke log file: Press the <b>KEYSTROKE LOG</b> soft key
	▶ Set the previous keystroke log if required: Press the <b>PREVIOUS FILE</b> soft key
	▶ Set the current keystroke log if required: Press the <b>CURRENT FILE</b> soft key

The control saves each key pressed during operation in a keystroke log. The oldest entry is at the beginning, and the most recent entry is at the end of the file.

### Overview of the keys and soft keys for viewing the log

Soft key/ Keys	Function
	Go to beginning of keystroke log
	Go to end of keystroke log
	Find text
	Current keystroke log
	Previous keystroke log
	Up/down one line
	
	Return to main menu

### Informational texts

If an operating error occurred, e.g. pressing an impermissible key or entering a value outside of a validity range, the control displays an information text in the header to inform you of the operating error. The control deletes this information text with the next valid entry.

### Saving service files

If necessary, you can save the current status of the control and make it available to a service technician for evaluation. A group of service files is saved (error and keystroke logs as well as other files that contain information about the current status of the machine and the machining).



In order to facilitate sending service files via email, the control will only save active NC programs with a size of up to 10 MB in the service file. If the NC program is bigger, it will not be added to the created service file.

If you repeat the **SAVE SERVICE FILES** function with the same file name, the previously saved group of service files will be overwritten. Therefore, use a different file name when re-executing the function.

### Saving service files

ERR

- ▶ Open the error window

LOG  
FILES

- ▶ Press the **LOG FILES** soft key

SAVE  
SERVICE  
FILES

- ▶ Press the **SAVE SERVICE FILES** soft key
- > The control opens a pop-up window in which you can enter a file name or a complete path for the service file.

OK

- ▶ Press the **OK** soft key
- > The control saves the service file.

### Closing the error window

To close the error window again, proceed as follows:

END

- ▶ Press the **END** soft key

ERR

- ▶ Alternative: Press the **ERR** key
- > The control closes the error window.

## TNCguide context-sensitive help system

### Application




Before you can use the TNCguide, you need to download the help files from the HEIDENHAIN home page

**Further information:** "Downloading current help files", Page 110

The **TNCguide** context-sensitive help system contains the user documentation in HTML format. The TNCguide is called with the **HELP** key, and the control often immediately displays the information specific to the condition from which the help was called (context-sensitive call). Even if you are editing an NC block and press the **HELP** key, you are usually brought to the exact place in the documentation that describes the corresponding function.



The control tries to start the TNCguide in the language that you have selected as the conversational language. If the required language version is not available, the control automatically opens the English version.

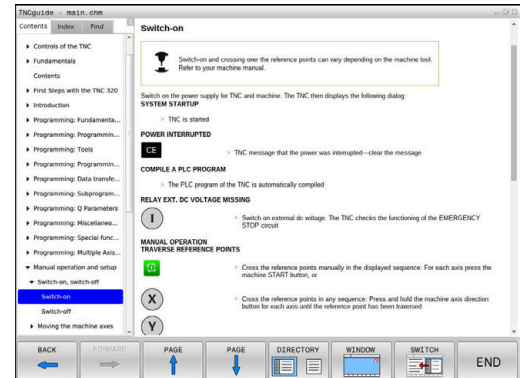

The following user documentation is available in TNCguide:

- User's Manual for Klartext Programming (**BHBKlartext.chm**)
- User's Manual for ISO programming (**BHBIso.chm**)
- User's Manual for Setup, Testing and Running NC Programs (**BHBoperate.chm**)
- User's Manual for Programming of Machining Cycles (**BHBcycle.chm**)
- User's Manual for Programming of Measuring Cycles for Workpieces and Tools (**BHBtchprobe.chm**)
- User's Manual for the TNCdiag application, if necessary (**TNCdiag.chm**)
- List of All Error Messages (**errors.chm**)

In addition, the **main.chm** "book" file is available, in which all existing .chm files are shown in one place.



As an option, your machine tool builder can embed machine-specific documentation in **TNCguide**. These documents then appear as a separate book in the **main.chm** file.

## Working with TNCguide

### Calling TNCguide

You have several options for starting the TNCguide:

- Use the **HELP** key
- First click the help symbol in the lower right-hand corner of the screen, then click the appropriate soft key
- Open a help file (.chm file) via the file management. The control can open any .chm file, even if it is not saved in the control's internal memory



On the Windows programming station, the TNCguide is opened in the internally defined standard browser.


For many soft keys there is a context-sensitive call through which you can go directly to the description of the soft key's function. This functionality requires using a mouse.

Proceed as follows:

- Select the soft-key row containing the desired soft key
- Click with the mouse on the help symbol that the control displays just above the soft-key row
- The mouse pointer turns into a question mark.
- Move the question mark to the soft key for which you want an explanation
- The control opens the TNCguide. If there is no entry point for the selected soft key, then the control opens the book file **main.chm**. You can search for the desired explanation using full text search or by using the navigation.

Even if you are editing an NC block, context-sensitive help is available:

- Select any NC block
- Select the desired word
- Press the **HELP** key.
- The control opens the Help system and shows the description of the active function. This does not apply for miscellaneous functions or cycles from your machine tool builder.

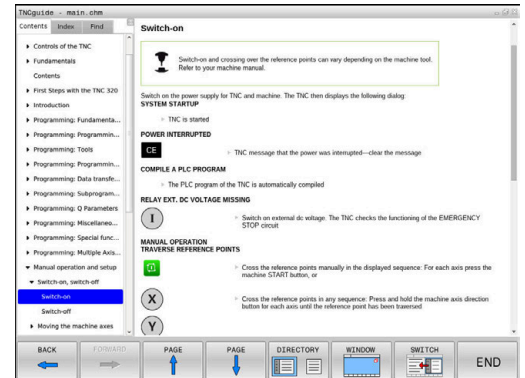













### Navigating in the TNCguide



 

It's easiest to use the mouse to navigate in TNCguide. A table of contents appears on the left side of the screen. By clicking the rightward pointing triangle you open subordinate sections, and by clicking the respective entry you open the individual pages. It is operated in the same manner as the Windows Explorer.

Linked text positions (cross references) are shown underlined and in blue. Clicking the link opens the associated page.

Of course you can also operate TNCguide through keys and soft keys. The following table contains an overview of the corresponding key functions.


Soft key	Function
	<ul style="list-style-type: none"> <li>■ If the table of contents at left is active: Select the entry above it or below it</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the text window at right is active: Move the page downward or upward if texts or graphics are not shown completely</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the table of contents at left is active: Open up the table of contents</li> <li>■ If the text window at right is active: No function</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the table of contents at left is active: Close the table of contents</li> <li>■ If the text window at right is active: No function</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the table of contents at left is active: Use the cursor key to show the selected page</li> <li>■ If the text window at right is active: If the cursor is on a link, jump to the linked page</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the table of contents at left is active: Switch the tab between the display of the table of contents, display of the subject index, and the full-text search function and switching to the screen half at right</li> <li>■ If the text window at right is active: Jump back to the window at left</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the table of contents at left is active: Select the entry above it or below it</li> </ul>
	<ul style="list-style-type: none"> <li>■ If the text window at right is active: Jump to next link</li> </ul>
	Select the page last shown
	Page forward if you have used the <b>Select page last shown</b> function
	Move up by one page
	Move down by one page



Soft key	Function
	Display or hide table of contents
	Switch between full-screen display and reduced display. With the reduced display you can see some of the rest of the control window
	The focus is switched internally to the control application so that you can operate the control when the TNCguide is open. If the full screen is active, the control reduces the window size automatically before the change of focus
	Exit TNCguide


Subject index

 
The most important subjects in the Manual are listed in the subject index (**Index** tab). You can select them directly by mouse or with the arrow keys.  
The left side is active.

- 
- ▶ Select the **Index** tab
  - ▶ Use the arrow keys or the mouse to select the desired keyword
- Alternative:
- ▶ Enter the first few characters
  - ▶ The control synchronizes the subject index and creates a list in which you can find the subject more easily.
  - ▶ Use the **ENT** key to call the information on the selected keyword


Full-text search

On the **Find** tab, you can search all of TNCguide for a specific word.  
The left side is active.

- 
- ▶ Select the **Find** tab
  - ▶ Activate the **Find:** entry field
  - ▶ Enter the search word
  - ▶ Press the **ENT** key
  - ▶ The control lists all sources containing the word.
  - ▶ Use the arrow keys to navigate to the desired source
  - ▶ Press the **ENT** key to go to the selected source



The full-text search only works for single words.  
If you activate the **Search only in titles** function, the control searches only through headings and ignores the body text. To activate the function, use the mouse or select it and then press the space bar to confirm.

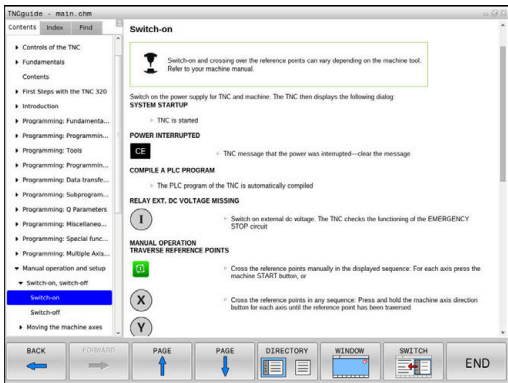

### Downloading current help files

You'll find the help files for your control software on the HEIDENHAIN homepage:

**[http://content.heidenhain.de/doku/tnc\\_guide/html/en/index.html](http://content.heidenhain.de/doku/tnc_guide/html/en/index.html)**

Navigate to the suitable help file as follows:

- ▶ TNC Controls
- ▶ Series, e.g. TNC 600
- ▶ Desired NC software number, e.g. TNC 620 (81760x-07)
- ▶ Select the desired language version from the **TNCguide online help** table
- ▶ Download the ZIP file
- ▶ Extract the ZIP file
- ▶ Move the extracted CHM files to the **TNC:\tncguide\en** directory or the respective language subdirectory on the control



When using **TNCremo** to transfer the CHM files to the control, select the binary mode for files with the **.chm** extension.

Language	TNC directory
German	TNC:\tncguide\de
English	TNC:\tncguide\en
Czech	TNC:\tncguide\cs
French	TNC:\tncguide\fr
Italian	TNC:\tncguide\it
Spanish	TNC:\tncguide\es
Portuguese	TNC:\tncguide\pt
Swedish	TNC:\tncguide\sv
Danish	TNC:\tncguide\da
Finnish	TNC:\tncguide\fi
Dutch	TNC:\tncguide\nl
Polish	TNC:\tncguide\pl
Hungarian	TNC:\tncguide\hu
Russian	TNC:\tncguide\ru
Chinese (simplified)	TNC:\tncguide\zh
Chinese (traditional)	TNC:\tncguide\zh-tw
Slovenian	TNC:\tncguide\sl
Norwegian	TNC:\tncguide\no
Slovak	TNC:\tncguide\sk
Korean	TNC:\tncguide\kr
Turkish	TNC:\tncguide\tr
Romanian	TNC:\tncguide\ro

3.7 NC fundamentals


Position encoders and reference marks

The machine axes are equipped with position encoders that register the positions of the machine table or tool. Linear axes are usually equipped with linear encoders, rotary tables and tilting axes with angle encoders.

When a machine axis moves, the corresponding position encoder generates an electrical signal. The control evaluates this signal and calculates the precise actual position of the machine axis.

If there is a power interruption, the calculated position will no longer correspond to the actual position of the machine slide. To recover this assignment, incremental position encoders are provided with reference marks. When a reference mark is crossed over, a signal identifying a machine-based reference point is transmitted to the control. This enables the control to re-establish the assignment of the displayed position to the current machine position. For linear encoders with distance-coded reference marks, the machine axes need to move by no more than 20 mm, for angle encoders by no more than 20°.


With absolute encoders, an absolute position value is transmitted to the control immediately upon switch-on. In this way the assignment of the actual position to the machine slide position is re-established directly after switch-on.

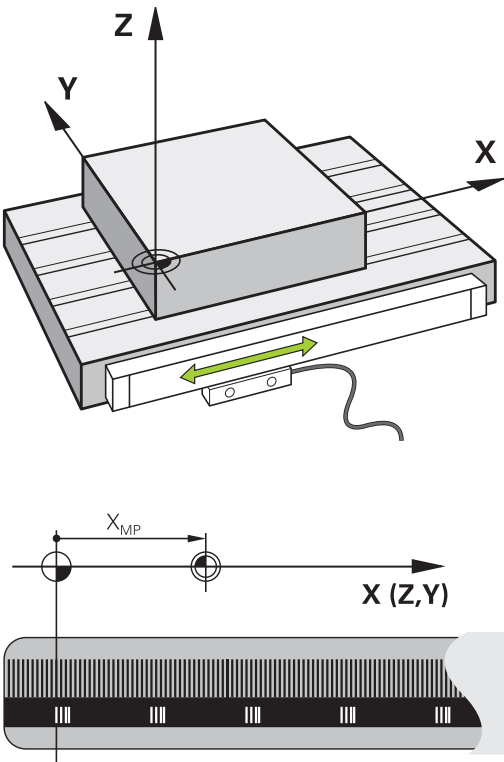

Programmable axes

In the default setting, the programmable axes of the control are in accordance with the axis definitions specified in DIN 66217. The designations of the programmable axes are given in the table below.


Principal axis	Parallel axis	Rotary axis
X	U	A
Y	V	B
Z	W	C



Refer to your machine manual!

The number, designation and assignment of the programmable axes depend on the machine.

Your machine tool builder can define further axes, such as PLC axes.

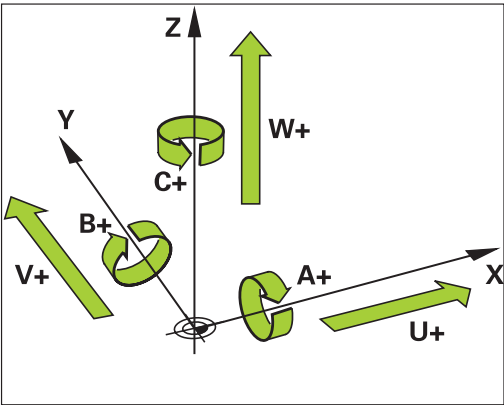

## Reference systems

For the control to move an axis in accordance with a defined path, it requires a **reference system**.

A paraxially mounted linear encoder on a machine tool serves as a simple reference system for linear axes. The linear encoder represents a **number ray**, a one-dimensional coordinate system.

To approach a point on the **plane**, the control requires two axes and therefore a reference system with two dimensions.

To approach a point in **space**, the control requires three axes and therefore a reference system with three dimensions. If these three axes are arranged perpendicularly to each other, this creates a **three-dimensional Cartesian coordinate system**.



According to the right-hand rule the fingertips point in the positive directions of the three principal axes.

For a point to be uniquely determined in space, a **coordinate origin** is needed in addition to the arrangement of the three dimensions. The common intersection serves as the coordinate origin in a 3-D coordinate system. This intersection has the coordinates **X+0, Y+0, and Z+0**.

In order, for example, for the control to always perform a tool change at the same position, as well as always execute a machining operation referenced to the current workpiece position, the control must be able to differentiate between different reference systems.




The control differentiates between the following reference systems:

- Machine coordinate system M-CS:  
**M**achine **C**oordinate **S**ystem
- Basic coordinate system B-CS:  
**B**asic **C**oordinate **S**ystem
- Workpiece coordinate system W-CS:  
**W**orkpiece **C**oordinate **S**ystem
- Working plane coordinate system WPLCS:  
**W**orking **P**lane **C**oordinate **S**ystem
- Input coordinate system I-CS:  
**I**nterface **C**oordinate **S**ystem
- Tool coordinate system T-CS:  
**T**ool **C**oordinate **S**ystem



All reference systems build upon each other. They are subject to the kinematic chain of the specific machine tool.

The machine coordinate system is the reference system.

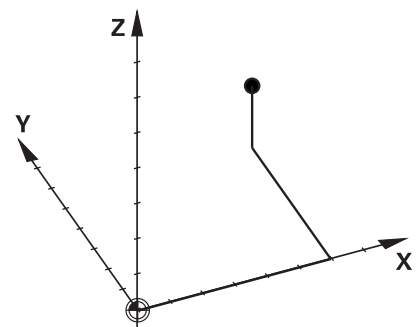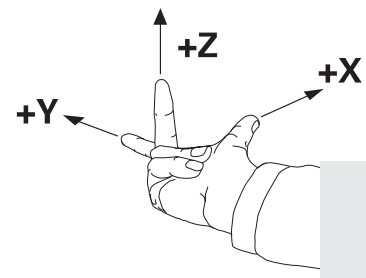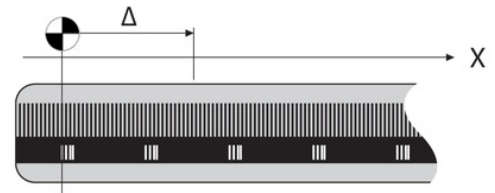

Machine coordinate system M-CS



The machine coordinate system corresponds to the description of kinematics and therefore to the actual mechanical design of the machine tool.

Because the mechanics of a machine tool never precisely correspond to a Cartesian coordinate system, the machine coordinate system consists of several one-dimensional coordinate systems. These one-dimensional coordinate systems correspond to the physical machine axes that are not necessarily perpendicular to each other.

The position and orientation of the one-dimensional coordinate systems are defined with the aid of translations and rotations based on the spindle tip in the description of kinematics.

The position of the coordinate origin, the machine datum, is defined by the machine manufacturer during machine configuration. The values in the machine configuration define the zero positions of the encoders and the corresponding machine axes. The machine datum does not necessarily have to be located in the theoretical intersection of the physical axes. It can therefore also be located outside of the traverse range.

Because the machine configuration values cannot be modified by the user, the machine coordinate system is used for determining constant positions, e.g. the tool change point.

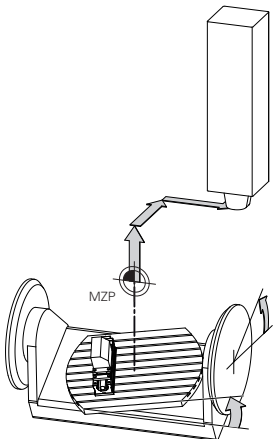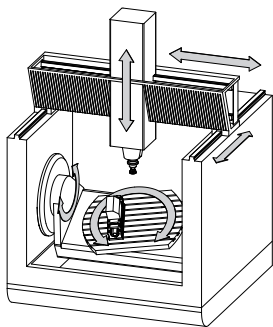


Machine datum (MCP)

Soft key      Application

**BASE TRANSFORM. OFFSET**      The user can define shifts in the machine coordinate system according to the specific axis with use of the **OFFSET** values of the preset table.

     The machine tool builder configures the **OFFSET** columns of the preset management in accordance with the machine.

Further information: "Preset management", Page 189

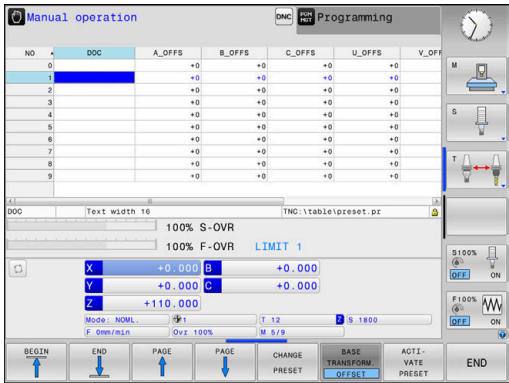

**NOTICE**

**Danger of collision!**

Your control may feature an additional pallet preset table, depending on the machine. In this table the machine tool builder can define **OFFSET** values that take effect before the **OFFSET** values you specify in the preset table become effective. The **PAL** tab of the additional status display indicates whether a pallet preset is active, and which one. Since the **OFFSET** values of the pallet preset table are neither shown nor editable, there is a risk of collision during all movements!

- ▶ Refer to the machine tool builder's documentation
- ▶ Use pallet presets only in conjunction with pallets
- ▶ Check the display of the **PAL** tab before you start machining



Another feature is **OEM-OFFSET**, which is available only to the machine tool builder. **OEM-OFFSET** can be used to define additive axis shifts for rotary and parallel axes.

The sum of all **OFFSET** values (from all the above **OFFSET** input options) results in the difference between the **ACTL.** position and the **RFACTL** position of an axis.

The control converts all movements in the machine coordinate system, independent of the reference system used for value input.

Example of a 3-axis machine tool with a Y axis as oblique axis, not arranged perpendicularly to the ZX plane:

- ▶ In the **Positioning w/ Manual Data Input** operating mode, run an NC block with **L IY+10**
- > The control determines the required axis nominal values from the defined values.
- > During positioning the control moves the **Y and Z** machine axes.
- > The **RFACTL** and **RFNOML** displays show movements of the Y axis and Z axis in the machine coordinate system.
- > The **ACTL.** and **NOML.** displays only show one movement of the Y axis in the input coordinate system.
- ▶ In the **Positioning w/ Manual Data Input** operating mode, run an NC block with **L IY-10 M91**
- > The control determines the required axis nominal values from the defined values.
- > During positioning the control only moves the **Y** machine axis.
- > The **RFACTL** and **RFNOML** displays only show one movement of the Y axis in the machine coordinate system.
- > The **ACTL.** and **NOML.** displays show movements of the Y axis and Z axis in the input coordinate system.

The user can program positions related to the machine datum, e.g. by using the miscellaneous function **M91**.


Basic coordinate system B-CS

The basic coordinate system is a 3-D Cartesian coordinate system. Its coordinate origin is the end of the kinematics model.


The orientation of the basic coordinate system in most cases corresponds to that of the machine coordinate system. There may be exceptions to this if a machine manufacturer uses additional kinematic transformations.

The kinematic model and thus the position of the coordinate origin for the basic coordinate system is defined by the machine manufacturer in the machine configuration. The user cannot modify the machine configuration values.

The basic coordinate system serves to determine the position and orientation of the workpiece coordinate system.

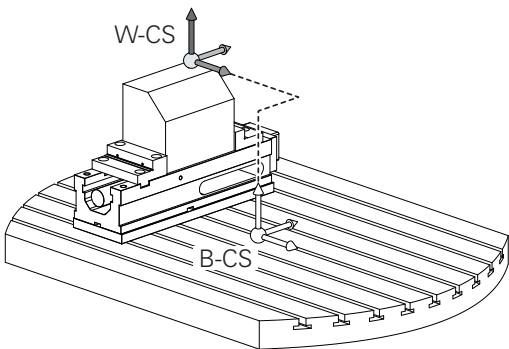

Soft key	Application
<div><div>BASE TRANSFORM OFFSET</div></div>	The user determines the position and orientation of the workpiece coordinate system by using a 3-D touch probe, for example. The control saves the values determined with respect to the basic coordinate system as <b>BASE TRANSFORM</b> values in the preset management.
<div><div>⚙</div></div>	The machine tool builder configures the <b>BASE TRANSFORM</b> columns of the preset management in accordance with the machine.

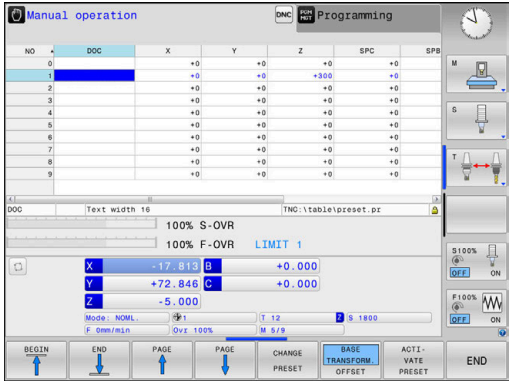

Further information: "Preset management", Page 189

NOTICE

**Danger of collision!**

Your control may feature an additional pallet preset table, depending on the machine. In this table the machine tool builder can define **BASE TRANSFORM** values that take effect before the **BASE TRANSFORM** values you specify in the preset table become effective. The **PAL** tab of the additional status display indicates whether a pallet preset is active, and which one. Since the **BASE TRANSFORM** values of the pallet preset table are neither visible nor editable, there is danger of collision during all movements!

- ▶ Refer to the machine tool builder's documentation
- ▶ Use pallet presets only in conjunction with pallets
- ▶ Check the display of the **PAL** tab before you start machining

### Workpiece coordinate system W-CS

The workpiece coordinate system is a 3-D Cartesian coordinate system. Its coordinate origin is the active reference point.


The position and orientation of the workpiece coordinate system depend on the **BASE TRANSFORM.** values of the active line in the preset table.

#### Soft key

#### Application



The user determines the position and orientation of the workpiece coordinate system by using a 3-D touch probe, for example. The control saves the values determined with respect to the basic coordinate system as **BASE TRANSFORM.** values in the preset management.

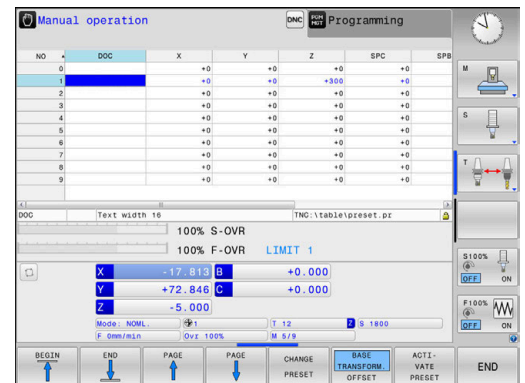

**Further information:** "Preset management", Page 189

In the workpiece coordinate system the user defines the position and orientation of the working plane coordinate system with use of transformations.

Transformations in the workpiece coordinate system:

- **3D ROT** functions
  - **PLANE** functions
  - Cycle **19 WORKING PLANE**
- Cycle **7 DATUM SHIFT**  
(shifting **before** tilting the working plane)
- Cycle **8 MIRRORING**  
(mirroring **before** tilting the working plane)





The result of transformations built up on each other depends on the programming sequence.

In every coordinate system, program only the specified (recommended) transformations. This applies to both setting and resetting the transformations. Any other use may lead to unexpected or undesired results. Please observe the following programming notes.

Programming notes:

- Transformations (mirroring and shifting) that are programmed before the **PLANE** functions (except for **PLANE AXIAL**) will change the position of the tilt datum (origin of the working plane coordinate system WPL-CS) and the orientation of the rotary axes
  - If you just program a shift, then only the position of the tilt datum will change
  - If you just program mirroring, then only the orientation of the rotary axes will change
- When used in conjunction with **PLANE AXIAL** and Cycle **19**, the programmed transformations (mirroring, rotation, and scaling) do not affect the position of the tilt datum or the orientation of the rotary axes

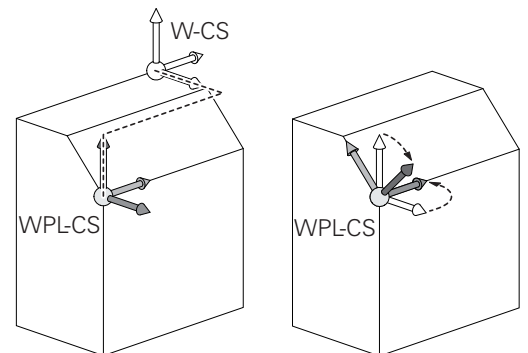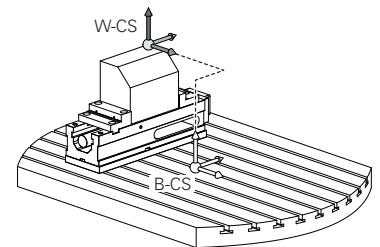





Without active transformations in the workpiece coordinate system, the position and orientation of the working plane coordinate system and workpiece coordinate system are identical.

There are no transformations in the workpiece coordinate system on 3-axis machine tools or with pure 3-axis machining. The **BASE TRANSFORM.** values of the active line of the preset table have a direct effect on the working plane coordinate system with this assumption.

Other transformations are of course possible in the working plane coordinate system

**Further information:** "Working plane coordinate system WPLCS", Page 118

### Working plane coordinate system WPL-CS



The working plane coordinate system is a 3-D Cartesian coordinate system.

The position and orientation of the working plane coordinate system depend on the active transformations in the workpiece coordinate system.



Without active transformations in the workpiece coordinate system, the position and orientation of the working plane coordinate system and workpiece coordinate system are identical.

There are no transformations in the workpiece coordinate system on 3-axis machine tools or with pure 3-axis machining. The **BASE TRANSFORM.** values of the active line of the preset table have a direct effect on the working plane coordinate system with this assumption.

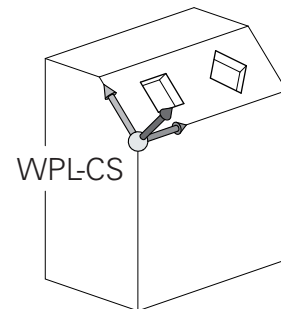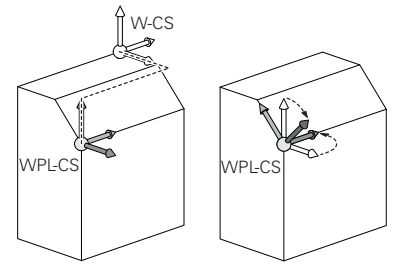

In the working plane coordinate system the user defines the position and orientation of the input coordinate system with use of transformations.

Transformations in the working plane coordinate system:

- Cycle **7 DATUM SHIFT**
- Cycle **8 MIRRORING**
- Cycle **10 ROTATION**
- Cycle **11 SCALING FACTOR**
- Cycle **26 AXIS-SPECIFIC SCALING**
- **PLANE RELATIVE**



As a **PLANE** function, the **PLANE RELATIVE** is effective in the workpiece coordinate system and aligns the working plane coordinate system.

The values of additive tilting always relate to the current working plane coordinate system.




The result of transformations built up on each other depends on the programming sequence.



Without active transformations in the working plane coordinate system, the position and orientation of the input coordinate system and working plane coordinate system are identical.

In addition, there are no transformations in the workpiece coordinate system on 3-axis machine tools or with pure 3-axis machining. The **BASE TRANSFORM.** values of the active line of the preset table have a direct effect on the input coordinate system with this assumption.

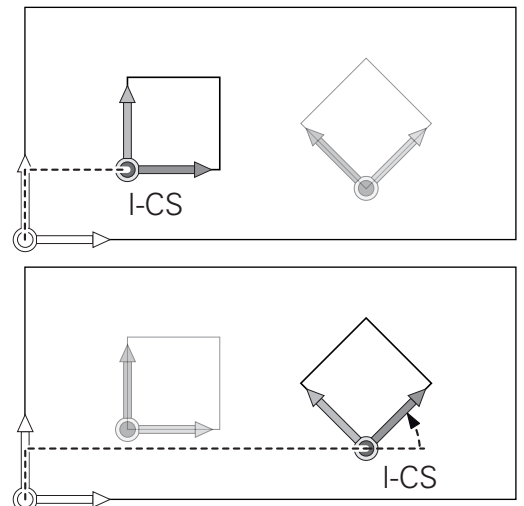

### Input coordinate system I-CS

The input coordinate system is a 3-D Cartesian coordinate system. The position and orientation of the input coordinate system depend on the active transformations in the working plane coordinate system.



Without active transformations in the working plane coordinate system, the position and orientation of the input coordinate system and working plane coordinate system are identical.

In addition, there are no transformations in the workpiece coordinate system on 3-axis machine tools or with pure 3-axis machining. The **BASE TRANSFORM.** values of the active line of the preset table have a direct effect on the input coordinate system with this assumption.

With the aid of positioning blocks in the input coordinate system, the user defines the position of the tool and therefore the position of the tool coordinate system.



The **NOML.**, **ACTL.**, **LAG**, and **ACTDST** displays are also based on the input coordinate system.

Positioning blocks in input coordinate system:

- Paraxial positioning blocks
- Positioning blocks with Cartesian or polar coordinates
- Positioning blocks with Cartesian coordinates and surface normal vectors

#### Example

```
7 X+48 R+
```

```
7 L X+48 Y+102 Z-1.5 R0
```

```
7 LN X+48 Y+102 Z-1.5 NX-0.04658107 NY0.00045007  
NZ0.8848844 R0
```






The position of the tool coordinate system is determined by the Cartesian coordinates X, Y and Z also for positioning blocks with surface normal vectors.

In conjunction with 3-D tool compensation, the position of the tool coordinate system can be shifted along the surface normal vectors.



Orientation of the tool coordinate system can be performed in various reference systems.

**Further information:** "Tool coordinate system T-CS", Page 120

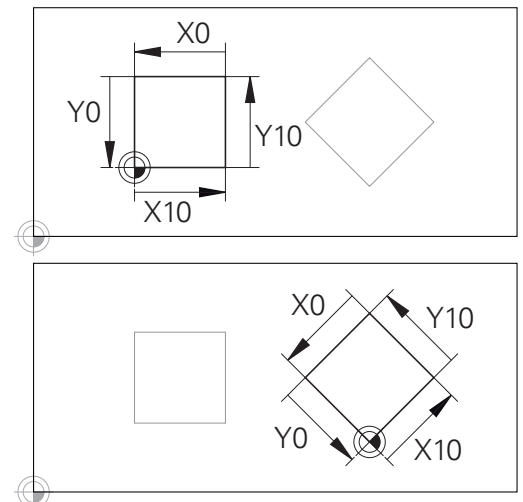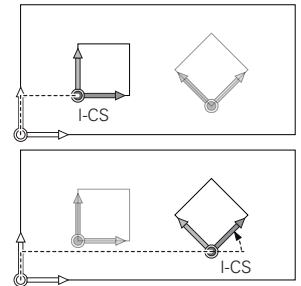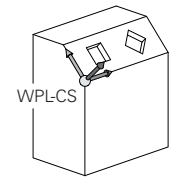

A contour referencing the input coordinate system origin can easily be transformed any way you need.


### Tool coordinate system T-CS

The tool coordinate system is a 3-D Cartesian coordinate system. Its coordinate origin is the tool reference point. The values of the tool table, **L** and **R** with milling tools and **ZL**, **XL** and **YL** with turning tools, are referenced to this point.

**Further information:** "Entering tool data into the table", Page 133


In accordance with the values from the tool table, the coordinate origin of the tool coordinate system is shifted to the tool center point TCP. TCP stands for **T**ool **C**enter **P**oint.

If the NC program is not referenced to the tool tip, the tool center point must be shifted. The required shift is implemented in the NC program using the delta values during a tool call.

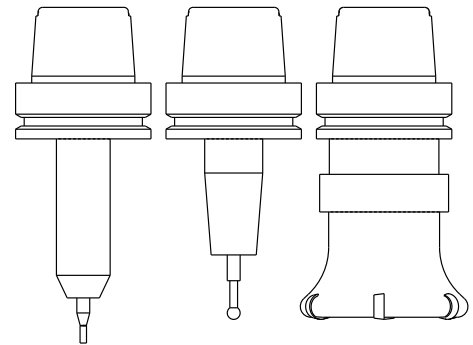

**i** The position of the TCP as shown in the diagram is obligatory in conjunction with the 3-D tool compensation.

**i** With the aid of positioning blocks in the input coordinate system, the user defines the position of the tool and therefore the position of the tool coordinate system.

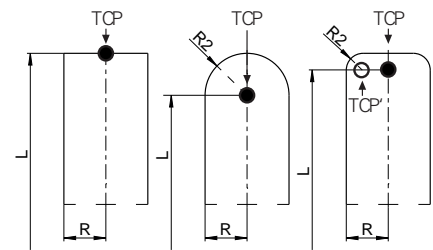

If the **TCPM** function or miscellaneous function **M128** is active, the orientation of the tool coordinate system depends on the tool's current angle of inclination.

The user defines the tool's angle of inclination either in the machine coordinate system or in the working plane coordinate system.

Tool angle of inclination in the machine coordinate system:

#### Example

```
7 L X+10 Y+45 A+10 C+5 R0 M128
```

Tool angle of inclination in the working plane coordinate system:


#### Example

```
6 FUNCTION TCPM F TCP AXIS SPAT PATHCTRL AXIS
```

```
7 L A+0 B+45 C+0 R0 F2500
```

```
7 LN X+48 Y+102 Z-1.5 NX-0.04658107 NY0.00045007
  NZ0.8848844 TX-0.08076201 TY-0.34090025 TZ0.93600126 R0
  M128
```

```
7 LN X+48 Y+102 Z-1.5 NX-0.04658107 NY0.00045007
  NZ0.8848844 R0 M128
```

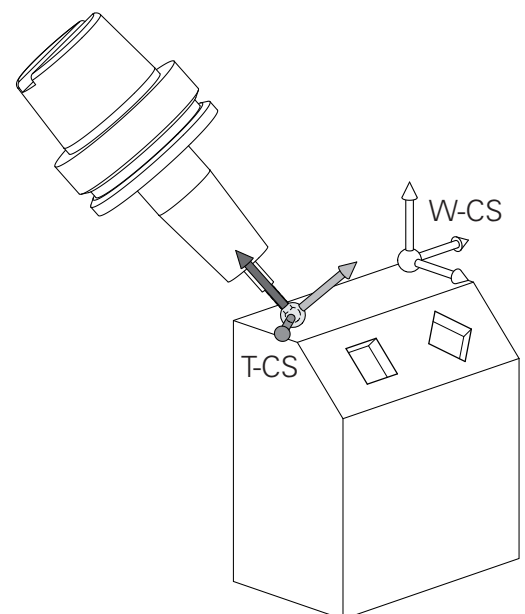




With the shown positioning blocks with vectors, 3-D tool compensation is possible with compensation values **DL**, **DR** and **DR2** from the **TOOL CALL** block or from the **.tco** compensation table.

The methods of function of the compensation values depend on the type of tool.

The control detects the various tool types with the columns **L**, **R** and **R2** of the tool table:

- $R2_{TAB} + DR2_{TAB} + DR2_{PROG} = 0$   
→ end mill
- $R2_{TAB} + DR2_{TAB} + DR2_{PROG} = R_{TAB} + DR_{TAB} + DR_{PROG}$   
→ radius cutter or ball cutter
- $0 < R2_{TAB} + DR2_{TAB} + DR2_{PROG} < R_{TAB} + DR_{TAB} + DR_{PROG}$   
→ toroid cutter or toroidal cutter

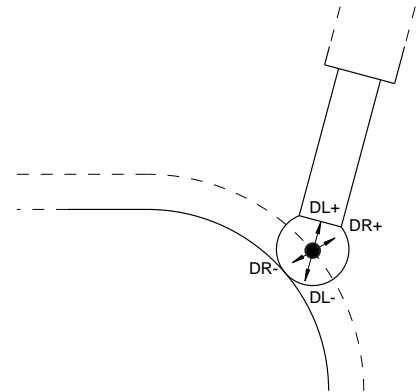

Without the **TCPM** function or miscellaneous function **M128**, orientation of the tool coordinate system and input coordinate system is identical.

## 3.8 Accessories: HEIDENHAIN 3-D touch probes and electronic handwheels

### 3-D touch probes (option 17)

Applications for HEIDENHAIN 3-D touch probes:

- Automatically align workpieces
- Quickly and precisely set presets
- Measure the workpiece during program run
- Measure and inspect tools



All functions provided by the touch-probe cycles are described in the User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**. Please contact HEIDENHAIN if you need this User's Manual. ID: 1303431-xx

#### Touch trigger probes TS 260, TS 444, TS 460, TS 642 and TS 740

The TS 248 and TS 260 touch probes are particularly cost-effective and transmit the trigger signals via a cable.

The wireless TS 740 and TS 642 touch probes as well as the smaller TS 460 and TS 444 touch probes are suitable for use on machines with tool changers. All of the above touch probes feature infrared signal transmission. TS 460 also supports wireless transmission and offers optional collision protection. Thanks to an integrated air turbine generator, the TS 444 touch probe is battery-free.

HEIDENHAIN touch trigger probes feature either a wear-resistant optical switch or several high-precision pressure sensors (TS 740) that detect the deflection of the stylus. On deflection, a trigger signal is generated, which causes the control to store the current position of the touch probe as the actual value.

#### Tool touch probes TT 160 and TT 460

The TT 160 and TT 460 touch probes are designed for the efficient and precise measurement and inspection of tool dimensions.

The control offers cycles that enable you to determine the tool length and radius while the spindle is rotating or stationary. The tool touch probe features a particularly rugged design and a high degree of protection, which make it insensitive to coolants and swarf.

A wear-resistant optical switch generates the trigger signal. With the TT 160, signal transmission is by cable. The TT 460 supports infrared and radio transmission.



## HR electronic handwheels

Electronic handwheels facilitate manual traversing of the axis slides. A wide range of traverses per handwheel revolution is available. The portable HR 510, HR 520 and HR 550FS handwheels are available from HEIDENHAIN in addition to the HR 130 and HR 150 panel-mounted handwheels.

**Further information:** "Traversing with electronic handwheels",  
Page 171



Several electronic handwheels can also be connected simultaneously and used alternatively on controls with the **(HSCI: HEIDENHAIN Serial Controller Interface)** serial interface for control components.  
Configuration is performed via the machine tool builder.







# 4

**Tools**

## 4.1 Tool data

### Tool number, tool name

Each tool is identified by a number between 0 and 32767. If you are working with tool tables, you can also enter a tool name for each tool. Tool names can have up to 32 characters.



**Permitted characters:** # \$ % & , - \_ . 0 1 2 3 4 5 6 7 8 9  
@ A B C D E F G H I J K L M N O P Q R S T U V W X Y Z

The control automatically replaces lowercase letters with corresponding uppercase letters during saving.

**Impermissible characters:** <blank space> ! " ' ( ) \* + : ;  
< = > ? [ / ] ^ ` { | } ~

The tool number 0 is automatically defined as the zero tool with the length  $L=0$  and the radius  $R=0$ . In tool tables, tool T0 should also be defined with  $L=0$  and  $R=0$ .


### Tool length L

Always enter the tool length **L** as an absolute value based on the tool reference point.



The absolute tool length is essential for the control in order to perform numerous functions (e.g., material removal simulation or **Dynamic Collision Monitoring (DCM)**).

The absolute length of the touch probe is always referenced to the tool reference point. The machine tool builder usually defines the spindle nose as the tool reference point.

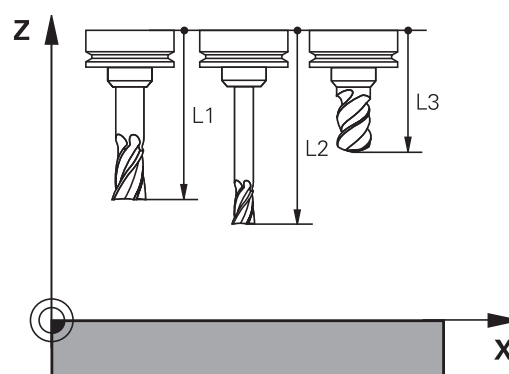

### Measuring the tool length

You can measure your tools in the machine (e.g., with a tool touch probe) or externally with a tool presetter. If such measurements are not possible, you can determine the tool length.

You have the following options for determining the tool length:

- With a gauge block
- With a calibration pin (inspection tool)



Before you determine tool length, you have to set the preset in the spindle axis.

### Determining the tool length with a gauge block



You can only set the preset with a gauge block if the tool reference point is at the spindle nose.


Place the preset on the surface you want to touch off with the tool. This surface might have to be created first.

Proceed as follows to set the datum with a gauge block:

- ▶ Place the gauge block on the machine table
- ▶ Position the spindle nose next to the gauge block
- ▶ Gradually move in **Z+** direction until you can just slide the gauge block under the spindle nose
- ▶ Set the datum in **Z**

To determine the tool length, proceed as follows:

- ▶ Insert the tool
- ▶ Touch off the surface
- > The control displays the absolute tool length as the actual position in the position display.

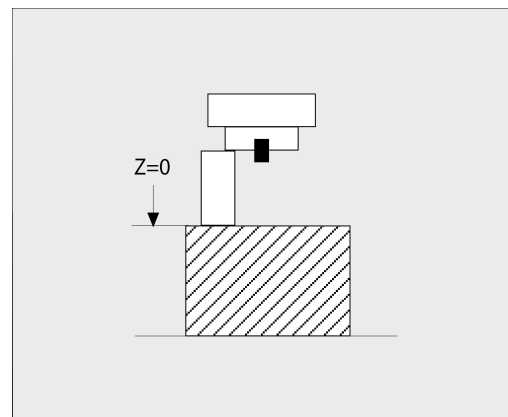


### Determining the tool length with a calibration pin and a tool setter

Proceed as follows to set the preset with a calibration pin and a tool setter:

- ▶ Clamp the tool setter onto the machine table.
- ▶ Bring the flexible inner ring of the tool setter to the same height as the fixed outer ring.
- ▶ Set the gauge to 0
- ▶ Move the calibration pin onto the flexible inner ring.
- ▶ Set the datum in **Z**

To determine the tool length, proceed as follows:

- ▶ Insert the tool
- ▶ Move the tool onto the flexible inner ring until the gauge displays 0.
- > The control displays the absolute tool length as the actual position in the position display.

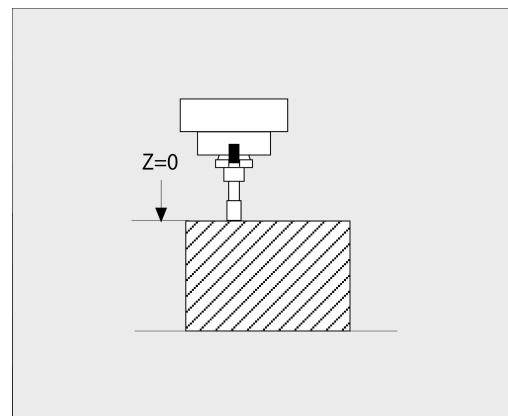

### Tool radius R

You can enter the tool radius R directly.

## Tool table fundamentals

You can define and store up to 32 767 tools and their tool data in a tool table.

You must use tool tables if:

- you wish to use indexed tools such as stepped drills with more than one length compensation value

**Further information:** "Indexed tool", Page 129

- your machine has an automatic tool changer
- you want to apply fine roughing with Cycle **22**

**Further information:** User's Manual for **Programming of Machining Cycles**

- you want to work with Cycles **251** to **254**

**Further information:** User's Manual for **Programming of Machining Cycles**

### NOTICE

#### Caution: Data may be lost!

Deleting line 0 from the tool table will destroy the structure of the table. As a result, locked tools might no longer be recognized as locked and, consequently, the search for a replacement tool will not work, either. The problem cannot be solved by reinserting a line 0. The original tool table will be permanently damaged!

- ▶ Restore the tool table
  - Add a new line 0 to the defective tool table
  - Copy the defective tool table (e.g. toolcopy.t)
  - Delete the defective tool table (current tool.t)
  - Copy the copied tool table (toolcopy.t) as tool.t
  - Delete the copied tool table (toolcopy.t)
- ▶ Contact HEIDENHAIN Service (NC helpline)



All table names must start with a letter. Please keep this in mind when creating and managing additional tables.

You can select the table view with the **Screen Layout** key. You can choose between a list view and a form view.


Other settings, such as **SORT/ HIDE COLUMNS**, can be made after the file has been opened.

### Indexed tool

Step drills, T-slot milling cutters, side milling cutters and, in general, all tools that require the input of multiple length and radius data cannot be fully defined in a single line of the tool table. Each line of the table permits the definition of one length and one radius.

In order to assign multiple compensation data to a tool (multiple tool table lines), add an indexed tool number (such as **T 5.1**) to an existing tool definition (**T 5**). Each additional line of the table thus comprises the original tool number, a period and an index (in ascending order from 1 to 9). The original tool table line contains the maximum tool length; the tool lengths in the subsequent table lines are given in descending order of their distance to the tool holder point.

To create an indexed tool number (table line), proceed as follows:

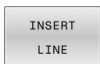

- ▶ Open the tool table
- ▶ Press the **Insert Line** soft key
- ▶ The control opens the **Insert Line** pop-up window
- ▶ In the **Number of new lines** = input field, enter the number of lines to add
- ▶ Enter the original tool number into the **Tool number** input field
- ▶ Confirm with **OK**
- ▶ The control adds the additional lines to the tool table.

### Quick search for the tool name:

If the **EDIT** soft key is set to **OFF**, you can search for a tool name. Proceed as follows:

- ▶ Enter the first few characters of the tool name, e.g. **MI**
- ▶ The control shows a dialog box with the entered text and jumps to the first match.
- ▶ Enter additional characters to narrow down the search result, e.g. **MILL**
- ▶ If the control cannot find any more matches for the entered search string, you can press the last entered character (e.g., **L**) to jump between matches, as with the cursor keys.

The quick search can also be used for tool selection in the **TOOL CALL** block.








### Displaying only specific tool types (filter setting)

- ▶ Press the **TABLE FILTER** soft key
- ▶ Select the desired tool type by soft key
- > The control displays only tools of the selected type.
- ▶ Cancel the filter: Press the **SHOW ALL** soft key



Refer to your machine manual!

The machine tool builder adapts the features of the filter function to the requirements of your machine.

Soft key	Filter functions of the tool table
	Select the filter function
	Cancel the filter settings and show all tools
	Use the default filter
	Show all drills in the tool table
	Show all cutters in the tool table
	Show all taps/thread cutters in the tool table
	Show all touch probes in the tool table

### Hiding or sorting the tool table columns

You can adapt the layout of the tool table to your needs. Columns that are not to be displayed can be simply hidden:

- ▶ Press the **SORT/ HIDE COLUMNS** soft key
- ▶ Select the appropriate column name with the arrow key
- ▶ Press the **HIDE COLUMN** soft key to remove this column from the table view

You can also modify the sequence of columns in the table:

- ▶ You can also modify the sequence of columns in the table with the **Move before:** dialog. The entry highlighted in **Displayed columns:** is moved in front of this column

Use a connected mouse or the navigation keys to work in the form.

Proceed as follows:



- ▶ Press the navigation keys to go to the input fields
- ▶ Use the arrow keys to navigate within an input field
- ▶ Press the **GOTO** key to open drop-down menus



The function **freeze number of columns** enables you to determine how many columns (0-3) the control will freeze to the left border of the screen. These columns will remain visible when you navigate to the right within the table.

## Creating and activating an INCH-based tool table



If you choose to switch the units for your control to **INCH**, the tool table unit of measure will not be adjusted automatically.

If you want to change the unit of measure in the table as well, you need to create a new tool table.

To create and activate an **INCH**-based tool table, proceed as follows:



- ▶ Select the **Positioning w/ Manual Data Input** operating mode
- ▶ Call the zero tool (T0)
- ▶ Restart the control
- ▶ Do **not** confirm **Power interrupted** with **CE**




- ▶ Select the **Programming** operating mode



- ▶ Open the file manager
- ▶ Open the **TNC:\table** folder
- ▶ Rename the **tool.t** file, e.g. to **tool\_mm.t**
- ▶ Create a new file and name it **tool.t**



- ▶ Select the **INCH** unit of measure
- > The control opens the new, empty tool table.

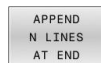

- ▶ Append lines, e.g. 100 lines
- > The control adds the lines
- ▶ Position the cursor in column **L** of line **0**
- ▶ Enter **0**
- ▶ Position the cursor in column **R** of line **0**
- ▶ Enter **0**



- ▶ Confirm your input



- ▶ Open the file manager
- ▶ Open any NC program



- ▶ Select **Manual operation** mode
- ▶ Confirm **Power interrupted** with **CE**



- ▶ Open the tool table
- ▶ Review the tool table



The preset table is another table whose unit of measure is not adjusted automatically.

**Further information:** "Creating and activating an INCH-based preset table", Page 190



## Entering tool data into the table

### Standard tool data

Parameter	Meaning	Dialog
<b>T</b>	Number by which the tool is called in the NC program (e.g. 5, indexed: 5.2)	-
<b>NAME</b>	Name by which the tool is called in the NC program (max. 32 characters, all capitals, no spaces)	<b>Tool name?</b>
<b>L</b>	Tool length L	<b>Tool length?</b>
<b>R</b>	Tool radius R	<b>Tool radius?</b>
<b>R2</b>	Tool radius R2 for toroid cutters (only for 3-D radius compensation or graphical representation of a machining operation with Ball-nose cutter)	<b>Tool radius 2?</b>
<b>DL</b>	Delta value for tool length L	<b>Tool length oversize?</b>
<b>DR</b>	Delta value for tool radius R	<b>Tool radius oversize?</b>
<b>DR2</b>	Delta value for tool radius R2	<b>Tool radius oversize 2?</b>
<b>TL</b>	Set tool lock ( <b>TL</b> for <b>ToolLocked</b> )	<b>Tool locked? Yes=ENT/No=NOENT</b>
<b>RT</b>	Number of a replacement tool ( <b>RT</b> for <b>ReplacementTool</b> ) An empty field or input <b>0</b> means there is no replacement tool	<b>Replacement tool?</b>
<b>TIME1</b>	Maximum tool life in minutes. This function can vary depending on the individual machine tool. Your machine manual provides more information	<b>Maximum tool age?</b>
<b>TIME2</b>	Maximum tool life in minutes during a tool call: If the current tool age reaches or exceeds this value, the control inserts the replacement tool during the next <b>TOOL CALL</b> (with the tool axis specified)	<b>Max. tool age for TOOL CALL?</b>
<b>CUR_TIME</b>	Current age of the tool in minutes: The control automatically counts the current tool life ( <b>CUR_TIME</b> : For <b>CUR</b> rent <b>TIME</b> ) A starting value can be entered for used tools	<b>Current tool age?</b>
<b>TYPE</b>	Tool type: Press the <b>ENT</b> key to edit the field. The <b>GOTO</b> key opens a window in which you can select the tool type. In the tool management, use the <b>SELECT</b> soft key to open the pop-up window. You can assign tool types to specify the display filter settings such that only the selected type is visible in the table	<b>Tool type?</b>
<b>DOC</b>	Comment on tool (max. 32 characters)	<b>Tool description</b>
<b>PLC</b>	Information on this tool that is to be sent to the PLC	<b>PLC status?</b>
<b>LCUTS</b>	Length of the cutting edge of the tool By entering a value here, you can limit the infeed depth in the cycles	<b>Tooth length in the tool axis?</b>
<b>ANGLE</b>	Maximum plunge angle of the tool for reciprocating plunge-cut in the cycles	<b>Maximum plunge angle?</b>
<b>TMAT</b>	Cutting material of the tool for the cutting data calculator	<b>Tool material?</b>
<b>CUTDATA</b>	Cutting data table for the cutting data calculator	<b>Cutting data table?</b>

Parameter	Meaning	Dialog
NMAX	Limit the spindle speed for this tool. The programmed value is monitored (error message) as well as an increase in the shaft speed via the potentiometer. Function inactive: Enter -. <b>Input range:</b> 0 to +999 999; if function not active: enter -	Maximum speed [rpm]
LIFTOFF	Definition of whether the control should retract the tool in the direction of the positive tool axis at an NC stop in order to avoid leaving dwell marks on the contour. If <b>Y</b> is defined, the control retracts the tool from the contour, provided <b>M148</b> has been activated. <b>Further information:</b> "Automatically retracting the tool from the contour at an NC stop: M148", Page 307	Retract allowed? Yes=ENT/ No=NOENT
TP_NO	Reference to the number of the touch probe in the touch-probe table	Number of the touch probe
T-ANGLE	Point angle of the tool. Is used by Cycle <b>240</b> in order to calculate the centering depth from the diameter input	Point angle
PITCH	Thread pitch of the tool. Is used by Cycles <b>206</b> , <b>207</b> , and <b>208</b> . A positive algebraic sign means a right-hand thread.	Tool thread pitch?
LAST_USE	Date and time that the tool was last inserted via <b>TOOL CALL</b>	Date/time of last tool call
PTYP	Tool type for evaluation in the pocket table Refer to your machine manual! Function is defined by the machine tool builder!	Tool type for pocket table?
ACC	Activate or deactivate active chatter control for the respective tool (Page 310). <b>Input range:</b> N (inactive) and Y (active)	ACC active? Yes=ENT/No=NOENT
KINEMATIC	Use the <b>SELECT</b> soft key to show the tool carrier kinematics. In the tool management, use the <b>SELECT</b> soft key and the <b>OK</b> soft key to adopt the file name and the path <b>Further information:</b> "Assigning a tool carrier", Page 161	Tool-carrier kinematics
OVRTIME	Time for exceeding the tool life in minutes <b>Further information:</b> "Overtime for tool life", Page 144 Refer to your machine manual! Function is defined by the machine tool builder!	Tool life expired

Parameter	Meaning	Dialog
<b>RCUTS</b>	Front-face cutting width of the tool (e.g., for indexable inserts)  Entering a value here influences helical and reciprocating plunging in Cycles <b>251</b> , <b>252</b> , and OCM. <b>Further information:</b> User's Manual for <b>Programming of Machining Cycles</b>	<b>Width of the indexable insert</b>
<b>LU</b>	Usable length of the tool for drilling cycles and Cycles <b>25x</b> By entering a value here, you can limit the plunging depth in the cycles.  If used in conjunction with <b>RN</b> , then <b>LU</b> may also be greater than <b>LCUTS</b> .	<b>Usable length of the tool?</b>
<b>RN</b>	Neck radius for the exact definition of the tool for graphic simulation (e.g., neck of end mills or side milling cutters)  A neck radius <b>RN</b> that is shown in the graphic simulation is possible only if <b>LU &gt; LCUTS</b> .	<b>Neck radius of the tool?</b>

#### Tool data for automatic tool measurement



Refer to your machine manual!

The machine tool builder defines whether the **R-OFFS** offset will be taken into account for a tool with **CUT 0**.

Your machine tool builder defines the default value for the **R-OFFS** and **L-OFFS** columns.

Parameter	Meaning	Dialog
<b>CUT</b>	Number of teeth (99 teeth maximum)	<b>Number of teeth?</b>
<b>LTOL</b>	Permissible deviation from tool length L for wear detection. If the entered value is exceeded, the control locks the tool (status <b>L</b> ). Input range: 0 to 0.9999 mm	<b>Wear tolerance: length?</b>
<b>RTOL</b>	Permissible deviation from tool radius R for wear detection. If the entered value is exceeded, the control locks the tool (status <b>L</b> ). Input range: 0 to 0.9999 mm	<b>Wear tolerance: radius?</b>
<b>R2TOL</b>	Permissible deviation from tool radius R2 for wear detection. If the entered value is exceeded, the control locks the tool (status <b>L</b> ). Input range: 0 to 0.9999 mm	<b>Wear tolerance: Radius 2?</b>
<b>DIRECT</b>	Cutting direction of the tool for measuring the tool during rotation	<b>Cutting direction? M4=ENT/ M3=NOENT</b>
<b>R-OFFS</b>	Tool length measurement: Tool offset between stylus center and tool center.	<b>Tool offset: radius?</b>
<b>L-OFFS</b>	Tool radius measurement: tool offset in addition to <b>offset-ToolAxis</b> between upper surface of stylus and lower surface of tool.	<b>Tool offset: length?</b>
<b>LBREAK</b>	Permissible deviation from tool length <b>L</b> for breakage detection. If the entered value is exceeded, the control locks the tool (status <b>L</b> ). Input range: 0 to 3.2767 mm	<b>Breakage tolerance: length?</b>
<b>RBREAK</b>	Permissible deviation from tool radius R for breakage detection. If the entered value is exceeded, the control locks the tool (status <b>L</b> ). Input range: 0 to 0.9999 mm	<b>Breakage tolerance: radius?</b>



Description of the cycles for automatic tool measurement.

**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**

### Editing the tool tables

The tool table that is active during execution of the part program is designated TOOL.T and must be saved in the **TNC:\table** directory.

Assign different file names with a .T extension to other tool tables that are to be archived or used for test runs. By default, for the **Test Run** and **Programming** operating modes, the control also uses the TOOL.T tool table. In the **Test Run** operating mode, press the **TOOL TABLE** soft key to edit it.

To open the tool table TOOL.T:


- Select any machine operating mode



- Select the tool table: Press the **TOOL TABLE** soft key



- Set the **EDIT** soft key to **ON**

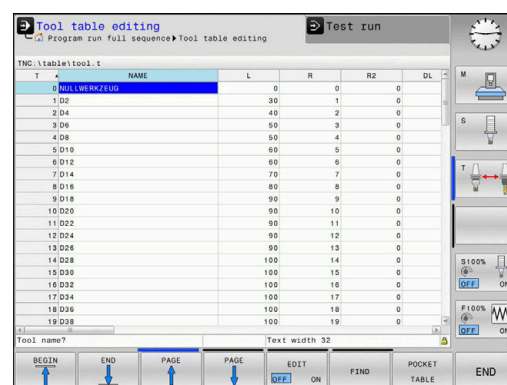






 
 









If you edit the tool table, the selected tool is locked. If this tool is required in the NC program being used, the control shows the message: **Tool table locked**.

If a new tool is created, the length and radius columns remain empty until entered manually. An attempt to insert such a newly created tool will be aborted by the control and an error message will appear. This means you cannot insert a tool for which no geometry data is available yet.

  To use the alphabetic keyboard or a connected mouse for navigation and editing, proceed as follows:

- Cursor keys: move from one cell to the next
- ENT key: jump to the next cell; with selection fields: open the selection dialog
- Mouse click a cell: move to the cell
- Double click a cell: place the cursor in the cell; with selection fields: open the selection dialog

Soft key	Editing functions of the tool table
	Select the beginning of the table
	Select the end of the table
	Select the previous page in the table
	Select the next page in the table

Soft key	Editing functions of the tool table
	Find the text or number
	Go to beginning of line
	Go to end of line
	Copy active field
	Insert copied field
	Add the entered number of lines (tools) at the end of the table
	Insert a line with definable tool number
	Delete the current line (tool)
	Sort the tools according to the content of a selectable column
	Select possible entries from a pop-up window
	Reset the value
	Place the cursor in the current cell

## Importing tool tables



Refer to your machine manual!

The machine tool builder can adapt the **ADAPT NC PGM / TABLE** function.

The machine tool builder can define update rules that make it possible, for example, to automatically remove umlauts from tables and NC programs.

If you export a tool table from an iTNC 530 and import it into a TNC 620, you have to adapt its format and contents before you can use the tool table. On the TNC 620, you can adapt the tool table conveniently with the **ADAPT NC PGM / TABLE** function. The control converts the contents of the imported tool table to a format valid for the TNC 620 and saves the changes to the selected file.

Proceed as follows:

- Save the tool table of the iTNC 530 to the **TNC:\table** directory




- Select the **Programming** operating mode




- Press the **PGM MGT** key



- Move the cursor to the tool table you want to import

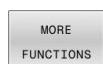

- Press the **MORE FUNCTIONS** soft key

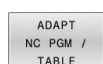

- Press the **ADAPT NC PGM / TABLE** soft key
- > The control asks you whether you want to overwrite the selected tool table.
- Press the **CANCEL** soft key
- Alternative: Press the **OK** soft key to overwrite
- Open the converted table and check its contents
- > New columns in the tool table are highlighted green.
- Press the **REMOVE UPDATE INFO** soft key
- > The green columns are displayed in white again.



The following characters are permitted in the **Name** column of the tool table: # \$ % & , - . 0 1 2 3 4 5 6 7 8 9 @ A B C D E F G H I J K L M N O P Q R S T U V W X Y Z

— During the import, commas will be converted to periods.

The control overwrites the active tool table when importing an external table with the same name. To prevent data loss, back up the original tool table before you start the import!

The procedure for copying tool tables using the file manager is described in the section on file management.

**Further information:** User's Manual for Klartext Programming or ISO Programming

When iTNC 530 tool tables are imported, all defined tool types are imported as well. Tool types not present are imported as type **Undefined**. Check the tool table after the import.

## Overwriting tool data from an external PC

### Application

The **TNCremo** software provides an especially convenient way to overwrite any tool data by using an external PC.

**Further information:** "Software for data transfer", Page 405


This application case occurs if you wish to determine tool data on an external tool presetter and then transfer this to the control.

### Requirements

In addition to Option 18, HEIDENHAIN DNC, **TNCremo** (version 3.1 or higher) is required. During the installation, the **TNCremoPlus** function must be selected.

### Procedure

- ▶ Copy the TOOL.T tool table to the control, for example to TST.T
- ▶ Start the **TNCremo** data transfer software on the PC
- ▶ Connect to the control
- ▶ Transfer the copied tool table TST.T to the PC
- ▶ Use any text editor to reduce TST.T to the lines and columns to be changed (see figure). Make sure that the header is not changed and the data is always flush in the column. The tool number (column T) need not be consecutive
- ▶ In **TNCremo**, select the <Extras> and <TNCcmd> menu items
- ▶ TNCcmd is started.
- ▶ To transfer the TST.T file to the control, enter the following command and confirm with the return key (see figure):  
put tst.t tool.t /m




During transfer, only the tool data defined in the subfile (e.g. TST.T) is overwritten. All other tool data of the table TOOL.T remains unchanged.

The procedure for copying tool tables using the file manager is described in the file management.

**Further information:** User's Manual for Klartext Programming or ISO Programming

BEGIN TST .T MM			
T	NAME	L	R
1		+12.5	+9
3		+23.15	+3.5
[END]			

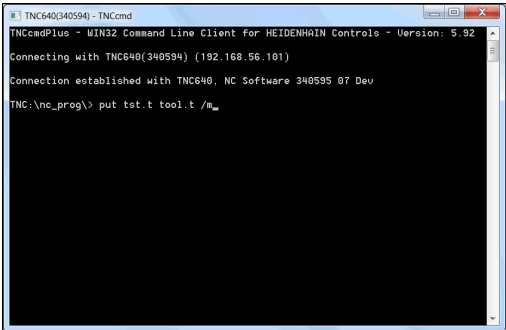


## Pocket table for tool changer



Refer to your machine manual!

The machine tool builder adapts the features of the pocket table to the requirements of your machine.

You need a pocket table for automatic tool changing. You manage the assignment of your tool changer in the pocket table. The pocket table is in the **TNC:\table** directory. The machine manufacturer can amend the name, path, and content of the pocket table. If you wish, you can select different views using the soft keys in the **TABLE FILTER** menu.

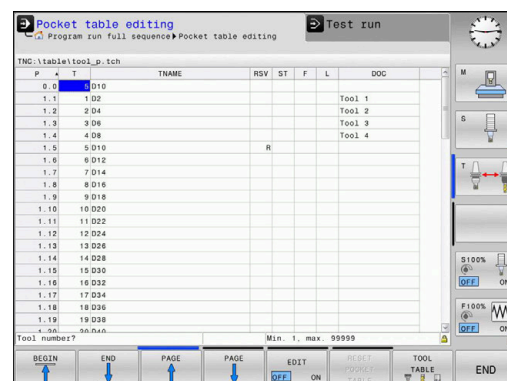

### Editing a pocket table in a Program Run operating mode



- Select the tool table: Press the **TOOL TABLE** soft key



- Press the **POCKET TABLE** soft key



- If required, set the **EDIT** soft key to **ON**










 




### Selecting a pocket table in Programming mode

To select the pocket table in the Programming operating mode, proceed as follows:



- ▶ Call the file manager: Press the **PGM MGT** key.
- ▶ Press the **SHOW ALL** soft key
- ▶ Select a file or enter a new file name
- ▶ Confirm your entry with the **ENT** key or the **SELECT** soft key

Parameter	Meaning	Dialog
<b>P</b>	Pocket number of the tool in the tool magazine	-
<b>T</b>	Tool number	Tool number?
<b>RSV</b>	Pocket reservation for box magazines	Pocket reserv.: Yes = ENT / No = NO ENT
<b>ST</b>	Special tool ( <b>ST</b> ); If your special tool blocks pockets in front of and behind its actual pocket, these additional pockets need to be locked in column L (status L).	Special tool?
<b>F</b>	The tool is always returned to the same pocket in the tool magazine	Fixed pocket? Yes = ENT / No = NO ENT
<b>L</b>	Locked pocket ( <b>L</b> : for <b>L</b> ocked)	Pocket locked Yes = ENT / No = NO ENT
<b>DOC</b>	Display of the comment to the tool from TOOL.T	-
<b>PLC</b>	Information on this tool pocket that is to be sent to the PLC	PLC status?
<b>P1 ... P5</b>	Function is defined by the machine tool builder. The machine tool documentation provides further information	Value?
<b>PTYP</b>	Tool type. Function is defined by the machine tool builder. The machine tool documentation provides further information	Tool type for pocket table?
<b>LOCKED_ABOVE</b>	Box magazine: Lock the pocket above	Lock the pocket above?
<b>LOCKED_BELOW</b>	Box magazine: Lock the pocket below	Lock the pocket below?
<b>LOCKED_LEFT</b>	Box magazine: Lock the pocket at left	Lock the pocket at left?
<b>LOCKED_RIGHT</b>	Box magazine: Lock the pocket at right	Lock the pocket at right?

Soft key	Editing functions for pocket tables
	Select the table start
	Select the table end
	Select the previous page in the table
	Select the next page in the table
	Reset pocket table Depends on optional machine parameter <b>enableReset</b> (no.106102)
	Reset tool number T column Depends on optional machine parameter <b>showResetColumnT</b> (no. 125303)
	Go to beginning of line
	Go to end of line
	Select a tool from the tool table: The control shows the contents of the tool table. Use the arrow keys to select a tool, press <b>OK</b> to transfer it to the pocket table
	Reset the value
	Place the cursor in the current cell
	Sort the view



Refer to your machine manual!

The machine manufacturer defines the features, properties and designations of the various display filters.

## Tool change

### Automatic tool change



Refer to your machine manual!

The tool change function can vary depending on the individual machine tool.

If your machine tool has automatic tool changing capability, the program run is not interrupted. When the control reaches a tool call with **TOOL CALL**, it replaces the inserted tool by another from the tool magazine.

### Automatic tool change if the tool life expires: M101



Refer to your machine manual!

The function of **M101** can vary depending on the individual machine tool.

When the specified tool life has expired, the control can automatically insert a replacement tool and continue machining with it. Activate the miscellaneous function **M101** for this. **M101** is reset with **M102**.

Enter the respective tool life after which machining is to be continued with a replacement tool in the **TIME2** column of the tool table. In the **CUR\_TIME** column the control enters the current tool life.

If the current tool life is higher than the value entered in the **TIME2** column, a replacement tool will be inserted at the next possible point in the program no later than one minute after expiration of the tool life. The change is made only after the NC block has been completed.

## NOTICE

### Danger of collision!

During an automatic tool change with **M101**, the control always retracts the tool in the tool axis first. There is danger of collision when retracting tools for machining undercuts, such as side milling cutters or T-slot milling cutters!

- ▶ Deactivate the tool change with **M102**

After the tool change the control positions the tool according to the following logic, unless otherwise specified by the machine tool builder:

- If the target position in the tool axis is below the current position, the tool axis is positioned last
- If the target position in the tool axis is above the current position, the tool axis is positioned first

### Prerequisites for a tool change with M101



As replacement tools, use only tools with the same radius. The control does not automatically check the radius of the tool.

If you want the control to check the radius of the replacement tool, enter **M108** in the NC program.

The control performs the automatic tool change at a suitable point in the program. The automatic tool change is not performed:

- During execution of machining cycles
- While radius compensation (**RR/RL**) is active
- Directly after an approach function **APPR**
- Directly before a departure function **DEP**
- Directly before and after **CHF** and **RND**
- During execution of macros
- During execution of a tool change
- Directly after a **TOOL CALL** or **TOOL DEF**
- During execution of SL cycles

### Overtime for tool life



This function must be enabled and adapted by the machine tool builder.

The tool condition at the end of planned tool life depends on e.g. the tool type, machining method and workpiece material. In the **OVRTIME** column of the tool table, enter the time in minutes for which the tool is permitted to be used beyond the tool life.

The machine manufacturer specifies whether this column is enabled and how it is used during tool search.

## Tool usage test

### Requirements



Refer to your machine manual!

The tool usage test function must be enabled by your machine tool builder.

To conduct a tool usage test, you must activate **Create tool usage files** in the MOD menu.

**Further information:** "Generating a tool usage file", Page 352

### Generating a tool usage file

Depending on the setting in the MOD menu, you have the following options for generating the tool usage file:

- Simulate the complete NC program in the **Test Run** operating mode
- Run the complete NC program in the **Program Run, Full Sequence/Single Block** operating modes
- In the **Test Run** operating mode, press the **GENERATE TOOL USAGE FILE** soft key (also possible without simulation)

The tool usage file generated is in the same directory as the NC program. It contains the following information:

Column	Meaning
<b>TOKEN</b>	<ul style="list-style-type: none"> <li>■ <b>TOOL</b>: Tool usage time per tool call. The entries are listed in chronological order.</li> <li>■ <b>TTOTAL</b>: Total usage time of a tool</li> <li>■ <b>STOTAL</b>: Call of a subprogram. The entries are listed in chronological order.</li> <li>■ <b>TIMETOTAL</b>: The total machining time of the NC program is entered in the <b>WTIME</b> column. In the <b>PATH</b> column the control saves the path name of the corresponding NC program. The <b>TIME</b> column shows the sum of all <b>TIME</b> entries (feed time without rapid traverse movements). The control sets all other columns to 0</li> <li>■ <b>TOOLFILE</b>: In the <b>PATH</b> column, the control saves the path name of the tool table with which you conducted the test run. This enables the control during the actual tool usage test to detect whether you performed the test run with TOOL.T</li> </ul>
<b>TNR</b>	Tool number (-1: Tool not inserted yet)
<b>IDX</b>	Tool index
<b>NAME</b>	Tool name from the tool table
<b>TIME</b>	Tool usage time in seconds (feed time without rapid traverse movements)
<b>WTIME</b>	Tool-usage time in seconds (total usage time between tool changes)
<b>RAD</b>	<b>Tool radius R + Oversize of tool radius DR</b> from the tool table. (in mm)
<b>BLOCK</b>	Block number in which the <b>TOOL CALL</b> block was programmed
<b>PATH</b>	<ul style="list-style-type: none"> <li>■ <b>TOKEN = TOOL</b>: Path name of the active main program or subprogram</li> <li>■ <b>TOKEN = STOTAL</b>: Path name of the subprogram</li> </ul>
<b>T</b>	Tool number with tool index

Column	Meaning
<b>OVRMAX</b>	Maximum feed rate override that occurred during machining. The control enters the value 100 (%) during the test run
<b>OVRMIN</b>	Minimum feed rate override that occurred during machining. The control enters the value -1 during the test run
<b>NAMEPROG</b>	<ul style="list-style-type: none"> <li>■ 0: The tool number is programmed</li> <li>■ 1: The tool name is programmed</li> </ul>

The control saves the tool usage times in a separate file with the extension **pgmname.H.T.DEP**. This file is not visible unless the machine parameter **dependentFiles** (no. 122101) is set to **MANUAL**


There are two ways to run a tool usage test for a pallet file:

- If the cursor in the pallet file is on a pallet entry, the control runs the tool usage test for the entire pallet.
- If the cursor in the pallet file is on a program entry, the control runs the tool usage test only for the selected NC program.

### Using a tool usage test

Before starting a program in the **Program Run, Full Sequence/ Single Block** operating modes, you can check whether the tools being used in the selected NC program are available and have sufficient remaining tool life. The control then compares the actual tool-life values from the tool table with the nominal values from the tool usage file.

- |  |  |
|--|--|
| <div style="border: 1px solid black; padding: 2px; margin-bottom: 10px; text-align: center;">TOOL<br/>USAGE</div> <div style="border: 1px solid black; padding: 2px; margin-bottom: 10px; text-align: center;">TOOL<br/>USAGE<br/>TEST</div> <div style="border: 1px solid black; padding: 2px; margin-bottom: 10px; text-align: center;">OK</div> <div style="border: 1px solid black; padding: 2px; text-align: center;">ENT</div> | <ul style="list-style-type: none"> <li>▶ Press the <b>TOOL USAGE</b> soft key</li> <li>▶ Press the <b>TOOL USAGE TEST</b> soft key</li> <li>▶ The control opens the <b>Tool usage test</b> pop-up window indicating the result of the usage test.</li> <li>▶ Press the <b>OK</b> soft key</li> <li>▶ The control closes the pop-up window.</li> <li>▶ Alternative: Press the <b>ENT</b> key</li> </ul> |
|--|--|

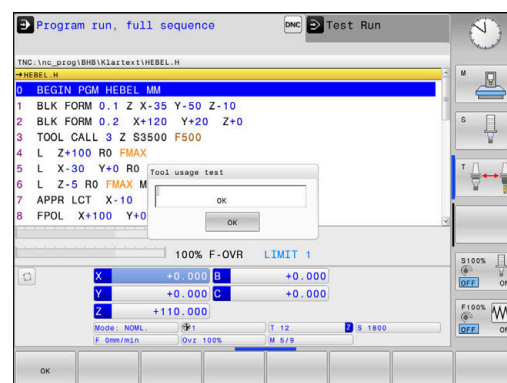

You can query the tool usage test with the **FN 18 ID975 NR1** function.

## 4.2 Tool management

### Basics



Refer to your machine manual!

Tool management is a machine-dependent function, which may be partly or completely deactivated. The machine tool builder defines the exact range of functions.

In tool management, your machine manufacturer can provide a wide range of functions for tool handling. Examples:


- Display and editing of all tool data from the tool table and the touch probe table
- Easily readable and adaptable representation of the tool data in fillable forms
- Any description of the individual tool data in the new table view
- Mixed representation of data from the tool table and the pocket table
- Fast sorting of all tool data by mouse
- Use of graphic aids, e.g. color coding of tool or magazine status
- Copying and pasting of all tool data pertaining to a tool
- Graphic depiction of tool type in the table view and in the detail view for a better overview of the available tool types

The Expanded Tool Management (option 93) additionally provides:

- Program-specific or pallet-specific usage order of all tools
- Program-specific or pallet-specific tooling list of all tools



If you edit a tool in tool management, the selected tool is locked. If this tool is required in the NC program being used, the control shows the message: **Tool table locked**.

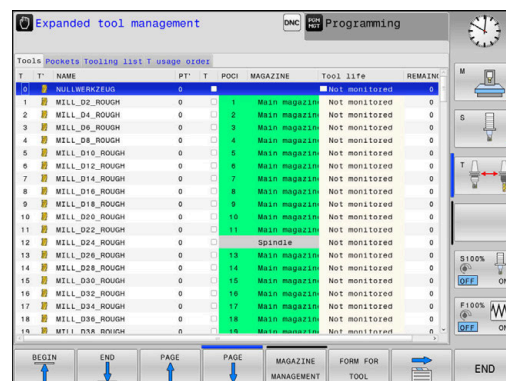

## Calling tool management



Refer to your machine manual!

The procedure for calling the tool management may differ from that described below.



- ▶ Select the tool table: Press the **TOOL TABLE** soft key



- ▶ Scroll through the soft-key row



- ▶ Press the **TOOL MANAGEMENT** soft key
- ▶ The control switches to the new table view.

Expanded tool management

T	T#	NAME	PT	T	POCI	MAGAZINE	Tool life	REMAIN
1	0	MTL_02_ROUGH	0	0	0	1	Main magazine	Not monitored
2	0	MTL_04_ROUGH	0	0	0	2	Main magazine	Not monitored
3	0	MTL_06_ROUGH	0	0	0	3	Main magazine	Not monitored
4	0	MTL_08_ROUGH	0	0	0	4	Main magazine	Not monitored
5	0	MTL_10_ROUGH	0	0	0	5	Main magazine	Not monitored
6	0	MTL_12_ROUGH	0	0	0	6	Main magazine	Not monitored
7	0	MTL_14_ROUGH	0	0	0	7	Main magazine	Not monitored
8	0	MTL_16_ROUGH	0	0	0	8	Main magazine	Not monitored
9	0	MTL_18_ROUGH	0	0	0	9	Main magazine	Not monitored
10	0	MTL_20_ROUGH	0	0	0	10	Main magazine	Not monitored
11	0	MTL_22_ROUGH	0	0	0	11	Main magazine	Not monitored
12	0	MTL_24_ROUGH	0	0	0	12	Main magazine	Not monitored
13	0	MTL_26_ROUGH	0	0	0	13	Main magazine	Not monitored
14	0	MTL_28_ROUGH	0	0	0	14	Main magazine	Not monitored
15	0	MTL_30_ROUGH	0	0	0	15	Main magazine	Not monitored
16	0	MTL_32_ROUGH	0	0	0	16	Main magazine	Not monitored
17	0	MTL_34_ROUGH	0	0	0	17	Main magazine	Not monitored
18	0	MTL_36_ROUGH	0	0	0	18	Main magazine	Not monitored
19	0	MTL_38_ROUGH	0	0	0	19	Main magazine	Not monitored
20	0	MTL_40_ROUGH	0	0	0	20	Main magazine	Not monitored
21	0	MTL_42_ROUGH	0	0	0	21	Main magazine	Not monitored
22	0	MTL_44_ROUGH	0	0	0	22	Main magazine	Not monitored
23	0	MTL_46_ROUGH	0	0	0	23	Main magazine	Not monitored
24	0	MTL_48_ROUGH	0	0	0	24	Main magazine	Not monitored
25	0	MTL_50_ROUGH	0	0	0	25	Main magazine	Not monitored
26	0	MTL_52_ROUGH	0	0	0	26	Main magazine	Not monitored
27	0	MTL_54_ROUGH	0	0	0	27	Main magazine	Not monitored
28	0	MTL_56_ROUGH	0	0	0	28	Main magazine	Not monitored
29	0	MTL_58_ROUGH	0	0	0	29	Main magazine	Not monitored
30	0	MTL_60_ROUGH	0	0	0	30	Main magazine	Not monitored
31	0	MTL_62_ROUGH	0	0	0	31	Main magazine	Not monitored
32	0	MTL_64_ROUGH	0	0	0	32	Main magazine	Not monitored
33	0	MTL_66_ROUGH	0	0	0	33	Main magazine	Not monitored
34	0	MTL_68_ROUGH	0	0	0	34	Main magazine	Not monitored
35	0	MTL_70_ROUGH	0	0	0	35	Main magazine	Not monitored
36	0	MTL_72_ROUGH	0	0	0	36	Main magazine	Not monitored
37	0	MTL_74_ROUGH	0	0	0	37	Main magazine	Not monitored
38	0	MTL_76_ROUGH	0	0	0	38	Main magazine	Not monitored
39	0	MTL_78_ROUGH	0	0	0	39	Main magazine	Not monitored
40	0	MTL_80_ROUGH	0	0	0	40	Main magazine	Not monitored
41	0	MTL_82_ROUGH	0	0	0	41	Main magazine	Not monitored
42	0	MTL_84_ROUGH	0	0	0	42	Main magazine	Not monitored
43	0	MTL_86_ROUGH	0	0	0	43	Main magazine	Not monitored
44	0	MTL_88_ROUGH	0	0	0	44	Main magazine	Not monitored
45	0	MTL_90_ROUGH	0	0	0	45	Main magazine	Not monitored
46	0	MTL_92_ROUGH	0	0	0	46	Main magazine	Not monitored
47	0	MTL_94_ROUGH	0	0	0	47	Main magazine	Not monitored
48	0	MTL_96_ROUGH	0	0	0	48	Main magazine	Not monitored
49	0	MTL_98_ROUGH	0	0	0	49	Main magazine	Not monitored
50	0	MTL_100_ROUGH	0	0	0	50	Main magazine	Not monitored

Navigation buttons: BEGIN, END, PAGE, MAGAZINE, FORM FOR TOOL, END

## Tool management view

In the new view, the control presents all tool information in the following four tabs:

- **Tools:** Tool-specific information
- **pockets:** Pocket-specific information

The Expanded Tool Management (option 93) additionally provides:

- **Tooling list:** List of all tools in the NC program that is selected in the Program Run mode (only if you have already created a tool usage file)

**Further information:** "Tool usage test", Page 144

- **T usage order:** List of the sequence of all tools that are inserted in the NC program selected in the Program Run mode (only if you have already created a tool usage file)

**Further information:** "Tool usage test", Page 144








 


 

 





If a pallet table is selected in the Program Run operating mode, the **Tooling list** and **T usage order** are calculated for the entire pallet table.



## Editing tool management

The tool management can be operated by mouse or with the keys and soft keys:

Soft key	Editing functions for tool management
	Select the table start
	Select the table end
	Select the previous page in the table
	Select the next page in the table
	Call the form view of the marked tool. Alternative function: Press the <b>ENT</b> key
	Changing tab: <b>Tools</b> and <b>pockets</b> Option 93 additionally provides: <b>Tooling list</b> and <b>T usage order</b>
	Search function: Here you can select the column to be searched and then the search term either from a list or by entering it
	Import tools
	Export tools
	Delete marked tools
	Add several lines at end of table
	Update table view
	Show the programmed tools column (if the <b>Pockets</b> tab is active)
	Define the settings: <ul style="list-style-type: none"> <li>■ <b>SORT COLUMN</b> active: Click the column header to sort the content of the column</li> <li>■ <b>SHIFT COLUMN</b> active: The column can be moved by drag and drop</li> </ul>
	Reset the manually changed settings (move columns) to the original condition

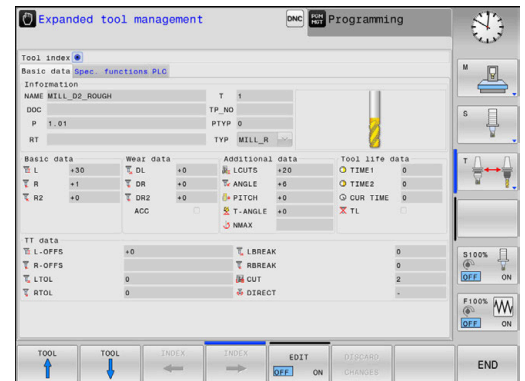



You can edit the tool data only in the form view. To activate the form view, press the **FORM FOR TOOL** soft key or the **ENT** key for the currently highlighted tool.

If you use the tool management without a mouse, then you can activate and deactivate functions with the **-/+** key.






 

 
 

In the tool management, use the **GOTO** key to search for the tool number or pocket number.

In addition, you can perform the following functions by mouse:

- **Sorting function:** You can sort the data in ascending or descending order (depending on the active setting of the soft key) by clicking a column of the table head.
- **Arrange columns.** You can arrange the columns in any sequence you want by clicking a column of the table head and then moving it with the mouse key pressed down. The control does not save the current column sequence when you exit the tool management (depending on the active setting of the soft key).
- **Show miscellaneous information in the form view:** The control displays tool tips when you leave the mouse pointer on an active entry field for more than a second and when you have set the **EDIT ON/OFF** soft key to **ON**

**Editing with active form view**

If the form view is active, the following functions are available to you:

Soft key	Editing functions, form view
	Select the tool data of the previous tool
	Select the tool data of the next tool
	Select previous tool index (only active if indexing is enabled)
	Select the next tool index (only active if indexing is enabled)
	Open a pop-up window for selection (only available for selection fields)
	Discard all changes made since the form was called
	Add tool index
	Delete tool index
	Copy the tool data of the selected tool
	Insert the copied tool data in the selected tool

### Deleting marked tool data

Using this function you can simply delete tool data that you no longer need.

Follow the steps outlined below for deleting:

- ▶ In the tool management you use the arrow keys or mouse to mark the tool data that you wish to delete
- ▶ Press the **DELETE MARKED TOOLS** soft key
- ▶ The control shows a pop-up window listing the tool data to be deleted.
- ▶ Press the **EXECUTE** soft key to start the deletion procedure
- ▶ The control shows a pop-up window with the deletion status.
- ▶ Terminate the delete process by pressing the **END** key or soft key

### NOTICE

#### Caution: Data may be lost!

The **DELETE MARKED TOOLS** function permanently deletes the tool data. The data is not automatically backed up by the control (e.g., to a recycle bin) before being deleted. The data is irreversibly deleted by this function.

- ▶ Regularly back up important data to external drives










The tool data of tools still stored in the pocket table cannot be deleted. The tools must be removed from the magazine first.

















### Available tool types



In tool management, the control only displays the input fields related to the selected tool type.

The tool management displays the various tool types with an icon. The following tool types are available:

Icon	Tool type	Tool type number
	Undefined,****	99
	Milling cutter,MILL	0
	Roughing cutter,MILL_R	9
	Finishing cutter,MILL_F	10
	Ball-nose cutter, BALL	22
	Toroid cutter, TORUS	23
	Drill,DRILL	1

Icon	Tool type	Tool type number
	Tap, TAP	2
	Center drill, CENT	4
	Touch probe, TCHP	21
	Ream, REAM	3
	Countersink, CSINK	5
	Piloted counterbore, TSINK	6
	Boring tool, BOR	7
	Back boring tool, BCKBOR	8
	Thread mill, GF	15
	Thread mill w/ countersink, GSF	16
	Thread mill w/ single thread, EP	17
	Thread mill w/ indxbi insert, WSP	18
	Thread milling drill, BGF	19
	Circular thread mill, ZBGF	20
	Grinding tool	30
	Dressing tool	31

## Importing and exporting tool data

### Importing tool data



Refer to your machine manual!

The machine tool builder can define update rules that make it possible, for example, to automatically remove umlauts from tables and NC programs.

Using this function you can simply import tool data that you have measured externally on a presetting device, for example. The file to be imported must have the CSV format (comma separated value). **CSV** files are text files designed for the exchange of data with a simple structure. Accordingly, the import file must have the following structure:

- **Line 1:** In the first line you define the column names in which the data defined in the subsequent lines is to be placed. The column names are separated with a comma.
- **Other lines:** All the other lines contain the data that you wish to import into the tool table. The order of the data must match the order of the column names in Line 1. The data is separated by commas, decimal numbers are to be defined with a decimal point.

Follow the steps outlined below for importing:

- ▶ Copy the tool table to be imported to the **TNC:\system\tooltab** directory on the hard disk of the control
- ▶ Start expanded tool management
- ▶ Press the **TOOL IMPORT** soft key in tool management
- > The control shows a pop-up window with the CSV files that are saved in the **TNC:\system\tooltab** directory
- ▶ Use the arrow keys or mouse to select the file to be imported and confirm with the **ENT** key
- > The control shows a pop-up window with the content of the CSV file
- ▶ Start the import procedure with the **EXECUTE** soft key.



- The CSV file to be imported must be stored in the **TNC:\system\tooltab** directory.
- If you import the tool data of existing tools (whose numbers are in the pocket table) the control issues an error message. You can then decide whether to skip this data record or insert a new tool. The control inserts a new tool into the first empty line of the tool table.
- If the imported CSV file contains unknown table columns, the control displays a message during import. An additional note informs you that the data will not be transferred.
- Make sure that the column designations have been specified correctly.  
**Further information:** "Entering tool data into the table", Page 133
- You can import any tool data, the associated data record does not have to contain all the columns (or data) of the tool table.
- The column names can be in any order, the data must be defined in the corresponding order.

### Example

T,L,R,DL,DR	Line 1 with column names
4,125.995,7.995,0,0	Line 2 with tool data
9,25.06,12.01,0,0	Line 3 with tool data
28,196.981,35,0,0	Line 4 with tool data

### Exporting tool data

Using this function you can simply export tool data to read it into the tool database of your CAM system, for example. The control stores the exported file in the CSV format (**c**omma **s**eparated **v**alue). **CSV** files are text files designed for the exchange of data with a simple structure. The export file has the following structure:

- **Line 1:** In the first line the control stores the column names of all the relevant tool data to be defined. The column names are separated from each other by commas.
- **Further lines:** All the other lines contain the data of the tools that you have exported. The order of the data matches the order of the column names in Line 1. The data is separated by commas, the control outputs decimal numbers with a decimal point.

Follow the steps outlined below for exporting:

- ▶ In the tool management you use the arrow keys or mouse to mark the tool data that you wish to export
- ▶ Press the **EXPORT TOOL** soft key
- > The control shows a pop-up window
- ▶ Enter a name for the CSV file and confirm it with the **ENT** key
- ▶ Start the export procedure with the **EXECUTE** soft key
- > The control shows a pop-up window with the status of the export process
- ▶ Terminate the export process by pressing the **END** key or soft key



By default the control stores the exported CSV file in the **TNC:\system\tooltab** directory.



## 4.3 Tool carrier management

### Fundamentals

You can create and manage tool carriers using the tool carrier management. The control factors the tool carriers into the calculations.

On 3-axis machines, tool carriers of right-angled angle heads are useful for machining in the tool axes **X** and **Y**, as the control takes the dimensions of the angle heads into account.

In the **Test Run** operating mode, you check the tool carriers for collisions with the workpiece.

**Further information:** "Monitoring for collisions ", Page 253

Along with the **Advanced Function Set 1** software option (option 8), you can tilt the working plane to the angle of the removable angle heads and thus keep working with the **Z** tool axis.

You must carry out the following steps so that the control can factor the tool carriers into the calculations:

- Saving tool carrier templates
- Parameterizing tool carriers
- Assign the tool carrier



If you are using M3D or STL files instead of parameterized tool carriers, the first two steps are not required.

### Saving tool carrier templates

Many tool carriers only differ from others in terms of their dimensions, but their geometric shape is identical. So that you don't have to design all your tool carriers yourself, HEIDENHAIN supplies a range of ready-made tool carrier templates. Tool carrier templates are 3-D models with fixed geometries but changeable dimensions.

The tool carrier templates must be saved in **TNC:\system\Toolkinematics** and have the extension **.cft**.



If the tool carrier templates are not available in your control, please download the data you require from:  
**<http://www.klartext-portal.com/nc-solutions/en>**



If you need further tool carrier templates, please contact your machine manufacturer or third-party vendor.



The tool carrier templates may consist of several sub-files. If the sub-files are incomplete, the control will display an error message.

**Do not use incomplete tool carrier templates!**


## Parameterizing tool carriers






 



Before the control can factor the tool carrier into the calculations, you must give the tool carrier templates the actual dimensions. These parameters are entered in the additional **ToolHolderWizard** tool.

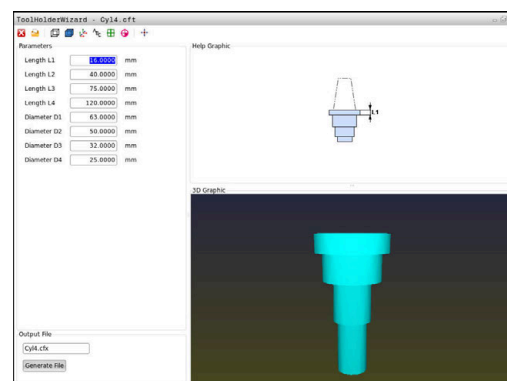Save the parameterized tool carriers with the extension **.cfx** under **TNC:\system\Toolkinematics**.

The additional **ToolHolderWizard** tool is mainly operated with the mouse. Using the mouse, you can also set the desired screen layout by drawing a line between the areas **Parameter**, **Help graphics**, and **3-D graphics** by holding down the left mouse button.

The following icons are available in the additional **ToolHolderWizard** tool:



Icon	Function
	Close the additional tool
	Open file
	Switch between wire frame model and solid object view
	Switch between shaded and transparent view
	Display or hide transformation vectors
	Show or hide names of collision objects
	Display or hide test points
	Show or hide measurement points
	Return to starting view of the 3-D model



If the tool carrier template does not contain any transformation vectors, names, test points, or measurement points, then the additional **ToolHolderWizard** tool does not execute any function when the corresponding icons are activated.

### Parameterizing tool carrier templates in Manual operation mode

To parameterize a tool carrier template and save these parameters, proceed as follows:



- ▶ Press the **Manual operation** key



- ▶ Press the **TOOL TABLE** soft key



- ▶ Press the **EDIT** soft key



- ▶ Move the cursor to the **KINEMATIC** column



- ▶ Press the **SELECT** soft key



- ▶ Press the **TOOL HOLDER WIZARD** soft key
- > The control opens the additional **ToolHolderWizard** tool in a pop-up window.



- ▶ Press the **OPEN FILE** icon
- > The control opens a pop-up window.
- ▶ Select the desired tool carrier template using the preview screen
- ▶ Press the **OK** button
- > The control opens the selected tool carrier template.
- > The cursor goes to the first parameterizable value.
- ▶ Adjust values
- ▶ Enter the name for the parameterized tool holder in the **Output file** area
- ▶ Press the **GENERATE FILE** button
- ▶ If required, reply to the message on the control
- ▶ Press the **CLOSE** icon
- > The control closes the additional tool



### Parameterizing tool carrier templates in Programming operating mode

Proceed as follows to parameterize tool carrier templates and save these parameters:



- ▶ Press the **Programming** key



- ▶ Press the **PGM MGT** key
- ▶ Select the path **TNC:\system\Toolkinematics**
- ▶ Select the tool carrier template
- > The control opens the additional **ToolHolderWizard** tool with the selected tool carrier template.
- > The cursor goes to the first parameterizable value.
- ▶ Adjust values
- ▶ Enter the name for the parameterized tool holder in the **Output file** area
- ▶ Press the **GENERATE FILE** button
- ▶ If required, reply to the message on the control
- ▶ Press the **CLOSE** icon
- > The control closes the additional tool



## Assigning a tool carrier

To allow the control to factor a tool carrier into calculations, you must assign the tool carrier to a tool and **call the tool again**.



Parameterized tool carriers can consist of several subfiles. If the subfiles are incomplete, the control will display an error message.

**Only use fully parameterized tool carriers, error-free STL files or M3D files.**


To assign a tool carrier to a tool, proceed as follows:



- ▶ Operating mode: Press the **Manual operation** key



- ▶ Press the **TOOL TABLE** soft key

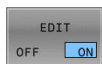

- ▶ Press the **EDIT** soft key




- ▶ Move the cursor to the **KINEMATIC** column of the required tool



- ▶ Press the **SELECT** soft key
- ▶ The control opens a pop-up window with the available tool carriers.
- ▶ Select the desired tool carrier using the preview
- ▶ Press the **OK** soft key
- ▶ The control copies the name of the selected tool carrier to the **KINEMATIC** column.



- ▶ Exit the tool table

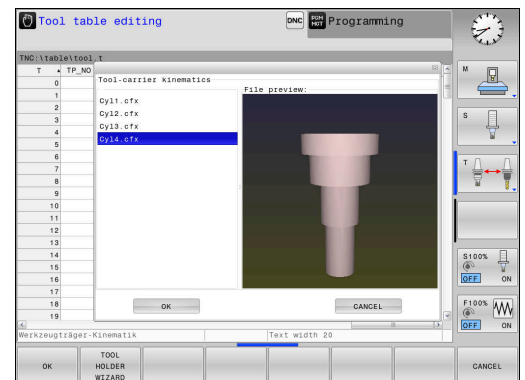



# 5

**Setup**

## 5.1 Switching on/off

### Switch-on

#### DANGER

##### Caution: hazard to the user!

Machines and machine components always pose mechanical hazards. Electric, magnetic, or electromagnetic fields are particularly hazardous for persons with cardiac pacemakers or implants. The hazard starts when the machine is powered up!

- ▶ Read and follow the machine manual
- ▶ Read and follow the safety precautions and safety symbols
- ▶ Use the safety devices



Refer to your machine manual!

Switching on the machine and traversing the reference points can vary depending on the machine tool.

Switch the machine and the control on as follows:

- ▶ Switch on the power supply for the control and the machine
- > The control displays the switch-on status in the subsequent dialogs.
- > If booting was successful, the control displays the **Power interrupted** dialog

**CE**

- ▶ Press the **CE** key to clear the message
- > The control displays the **Compiling PLC program** dialog; the PLC program is compiled automatically
- > The control displays the **Switch on external dc voltage** dialog

**I**

- ▶ Switch on the machine control voltage
- > The control carries out a self-test.

If the control does not register an error, it displays the **Traverse reference points** dialog.

If the control registers an error, it issues an error message.

#### NOTICE

##### Danger of collision!

When the machine is switched on, the control tries to restore the switch-off status of the tilted plane. This is prevented under certain conditions. For example, this applies if axis angles are used for tilting while the machine is configured with spatial angles, or if you have changed the kinematics.

- ▶ If possible, reset tilting before shutting the system down
- ▶ Check the tilted condition when switching the machine back on



### Checking the axis positions



This section applies only to machine axes with EnDat encoders.

If the actual axis position after the machine has been switched on does not match the shutdown position, the control displays a pop-up window.

- ▶ Check the axis position of the affected axis
- ▶ If the current axis position matches that proposed in the display, confirm with **YES**

### NOTICE

#### Danger of collision!

Failure to notice deviations between the actual axis positions and those expected by the control (saved at shutdown) can lead to undesirable and unexpected axis movements. There is risk of collision during the reference run of further axes and all subsequent movements!

- ▶ Check the axis positions
- ▶ Only confirm the pop-up window with **YES** if the axis positions match
- ▶ Despite confirmation, at first only move the axis carefully
- ▶ If there are discrepancies or you have any doubts, contact your machine tool builder

## Traversing reference points

If the control performs the self-test successfully, it then displays the **Traverse reference points** dialog.



Refer to your machine manual!

Switching on the machine and traversing the reference points can vary depending on the machine tool.

If your machine is equipped with absolute encoders, you can leave out crossing the reference points.



If you intend only to edit or graphically simulate NC programs, you can select the **Programming** or **Test Run** operating mode immediately after switching on the control voltage, without needing to home the axes.

You can neither set a preset nor modify a preset via the preset table without having homed the axes. The control issues the **Traverse reference points** message.

You can traverse the reference points later. For this purpose, press the **PASS OVER REFERENCE** soft key in **Manual operation** mode.

Traverse the reference points manually in the displayed sequence:



- ▶ For each axis press the **NC START** button
- > The control is now ready for operation in the **Manual operation** mode.

As an alternative you can cross the reference points in any sequence:



- ▶ Press and hold the axis direction button for each axis until the reference point has been traversed



- > The control is now ready for operation in the **Manual operation** mode.

**Crossing the reference point in a tilted working plane**

If the **Tilt working plane** (option 8) function was active before the control was shut down, then the control will automatically reactivate this function after restarting. This means that movements via the axis keys take place in the tilted working plane. Before traversing the reference points, you must deactivate the **Tilt the working plane** function; otherwise, the control will interrupt the process with a warning. You can also home axes not activated in the current kinematic model without needing to deactivate **Tilt the working plane**, such as a tool magazine.

**Further information:** "Activating manual tilting", Page 239

**NOTICE****Danger of collision!**

The control does not automatically check whether collisions can occur between the tool and the workpiece. Incorrect pre-positioning or insufficient spacing between components can lead to a risk of collision when referencing the axes.

- ▶ Pay attention to the information on the screen
- ▶ If necessary, move to a safe position before referencing the axes
- ▶ Watch out for possible collisions



If the machine does not have any absolute encoders, the position of the rotary axes must be confirmed. The position shown in the pop-up window is the last position before the control was shut down.

## Switching off



Refer to your machine manual!  
Deactivation is a machine-dependent function.

To prevent data from being lost on switch-off, you need to shut down the operating system of the control as follows:



- ▶ Operating mode: Press the **Manual operation** key



- ▶ Press the **OFF** soft key



- ▶ Confirm with the **SHUT DOWN** soft key
- ▶ When the control displays the message **Now you can switch off** in a pop-up window, you may switch off the power supply to the control

### NOTICE

#### Caution: Data may be lost!

The control must be shut down so that running processes can be concluded and data can be saved. Immediate switch-off of the control by turning off the main switch can lead to data loss no matter what state the control was in!

- ▶ Always shut down the control
- ▶ Only operate the main switch after being prompted on the screen

## 5.2 Moving the machine axes

### Note



Refer to your machine manual!

Movement of the axes via the axis direction keys can vary depending on the machine.

### Moving the axis with the axis direction keys



- ▶ Operating mode: Press the **Manual operation** key



- ▶ Press the axis-direction key and hold it down as long as you wish the axis to move



- ▶ Alternatively, move the axis continuously: Press and hold the axis-direction key and press the **NC Start** key



- ▶ To stop: Press the **NC Stop** key

You can move several axes at a time with these two methods. The control then shows the feed rate. You can change the feed rate at which the axes are moved with the **F** soft key.




 





**Further information:** "Spindle speed S, feed rate F and miscellaneous function M", Page 181


If a moving task is active on the machine, the control displays the **control in operation** symbol.

## Incremental jog positioning

With incremental jog positioning you can move a machine axis by a preset distance.

The input range for the infeed is from 0.001 mm to 10 mm.

- 
  - ▶ Operating mode: Press the **Manual operation** or **Electronic handwheel** key
- 
  - ▶ Shift the soft-key row
- 
  - ▶ Select incremental jog positioning: Switch the **INCREMENT** soft key to **ON**
  - ▶ Enter the infeed of the **linear axes**
  - ▶ Confirm with the **CONFIRM VALUE** soft key
- 
  - ▶ Confirm with the **CONFIRM VALUE** soft key
- 
  - ▶ Alternatively, confirm with the **ENT** key
- 
  - ▶ Use the arrow keys to position the cursor on the **rotary axis**
- 
  - ▶ Enter the infeed of the **rotary axes**
  - ▶ Confirm with the **CONFIRM VALUE** soft key
- 
  - ▶ Alternatively, confirm with the **ENT** key
- 
  - ▶ Confirm with the **OK** soft key
  - ▶ The jog increment is active.
  - ▶ The control displays the set values in the upper area of the screen.

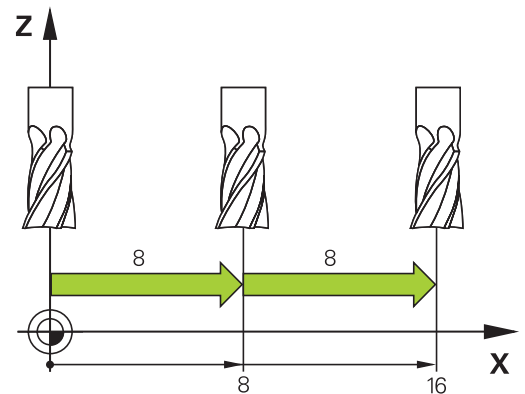

## Canceling incremental jog positioning

- 
  - ▶ Switch **INCREMENT** soft key to **OFF**



If you are in the **Jog increment** menu, you can switch off incremental jog positioning with the **SWITCH OFF** soft key.

## Traversing with electronic handwheels

### **⚠ DANGER**

#### **Caution: hazard to the user!**

Unsecured connections, defective cables, and improper use are always sources of electrical dangers. The hazard starts when the machine is powered up!

- ▶ Devices should be connected or removed only by authorized service technicians
- ▶ Only switch on the machine via a connected handwheel or a secured connection

The control supports traversing with the following electronic handwheels:

- HR 510: Simple handwheel without display, data transfer via cable
- HR 520: Handwheel with display, data transfer via cable
- HR 550FS: Handwheel with display, data transmission via radio

In addition to this, the control continues to support the cable handwheels HR 410 (without display) and HR 420 (with display).



Refer to your machine manual!

Your machine tool builder can make additional functions of the HR 5xx handwheels available.

The HR 520 and HR 550FS portable handwheels are equipped with a display that is used by the control to show different types of information. In addition, you can use the handwheel soft keys for important setup functions, e.g. presetting or entering and running M functions.

As soon as you have activated the handwheel with the handwheel activation key, the operating panel is locked. The control shows this status in a pop-up window on the screen.




If several handwheels are connected to a control the handwheel key is not available on the operating panel. Activate or deactivate the handwheel via the handwheel key on the handwheel. An active handwheel must be deactivated before another handwheel can be selected.



Refer to your machine manual!

This function must be enabled and adapted by the machine tool builder.


- 1 **EMERGENCY STOP** key
- 2 Handwheel display for status and for selecting functions
- 3 Soft keys
- 4 Axis keys; can be exchanged by the machine manufacturer depending on the axis configuration
- 5 Permissive key
- 6 Arrow keys for defining handwheel sensitivity
- 7 Handwheel activation key
- 8 Key for traverse direction of the selected axis
- 9 Rapid traverse superimposing for the axis direction key
- 10 Spindle switch-on (machine-dependent function, key can be exchanged by the machine manufacturer)
- 11 **Generate NC block** key (machine-dependent function, key can be exchanged by the machine manufacturer)
- 12 Spindle switch-off (machine-dependent function, key can be exchanged by the machine manufacturer)
- 13 **CTRL** key for special functions (machine-specific function, key can be exchanged by the machine manufacturer)
- 14 **NC START** key (machine-dependent function, key can be exchanged by the machine manufacturer)
- 15 **NC STOP** key (machine-dependent function, key can be exchanged by the machine manufacturer)
- 16 Handwheel
- 17 Spindle speed potentiometer
- 18 Feed rate potentiometer
- 19 Cable connection, omitted with HR 550FS radio handwheel

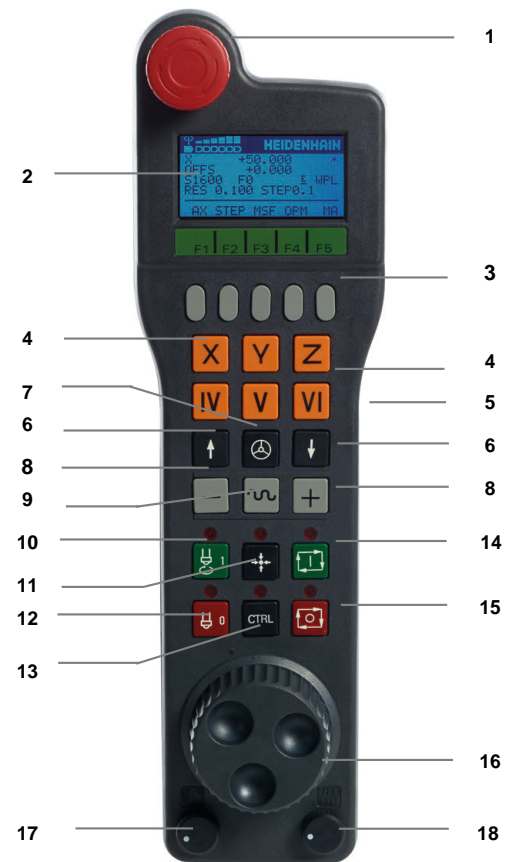



### Handwheel display

- 1 Only with HR 550FS radio handwheel:** Shows whether the handwheel is in the docking station or whether radio operation is active
- 2 Only with HR 550FS** handwheel: Display of field strength, six bars = maximum field strength
- 3 Only with HR 550FS radio handwheel:** Charging state of battery, six bars = maximum charging state. A bar moves from the left to the right during recharging
- 4 X+50.000:** Position of the selected axis
- 5 \*:** STIB (control in operation); program run has been started or axis is in motion
- 6 OFFS +0.000:** Offset values from M118 or from the Global Program Settings (Option 44)
- 7 S1000:** Current spindle speed
- 8 F0:** Feed rate at which the selected axis is moving
- 9 E:** Error message  
If an error message appears on the control, the handwheel display shows the message **ERROR** for three seconds. Then the letter **E** is shown in the display as long as the error is pending on the control.
- 10 WPL:** 3-D-ROT function is active  
Depending on the settings in the 3-D ROT menu, the following is displayed:
  - **VT:** The function for traversing in the tool axis direction is active
  - **WP:** Basic rotation function is active
- 11 RES 0,100:** Active handwheel resolution. Path traversed by the selected axis with a handwheel revolution
- 12 STEP ON or OFF:** Incremental jog active or inactive. If the function is active, the control additionally displays the current traversing step
- 13** Soft-key row: Selection of various functions, described in the following sections

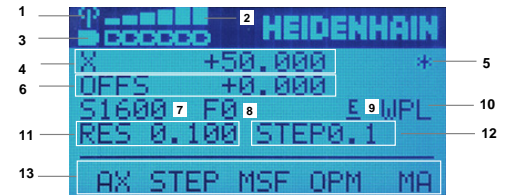

### Special features of the HR 550FS radio handwheel

#### **⚠ DANGER**

##### **Caution: hazard to the user!**

Wireless handwheels, due to their rechargeable batteries and the influence of other wireless devices, are more susceptible to interference than cable-bound connections are. Ignoring the requirements for and information about safe operation leads to endangerment of the user, for example during installation or maintenance work.

- ▶ Check the radio connection of the handwheel for possible overlapping with other wireless devices
- ▶ Switch off the wireless handwheel and the handwheel holder after an operating time of 120 hours at the latest so that the control can run a functional test when it is restarted
- ▶ If more than one wireless handwheel is being used in a workshop, then ensure an unambiguous assignment between the handwheels and the handwheel holders (such as with color-coded stickers)
- ▶ If more than one wireless handwheel is being used in a workshop, then ensure an unambiguous assignment between the handwheels and the respective machine (such as with a functional test)

The HR 550FS radio handwheel features a rechargeable battery. The battery starts charging when you put the handwheel into the holder.

The HRA 551FS handwheel holder and the HR 550FS handwheel together form one functional unit.

The HR 550FS can be operated by battery for up to eight hours, before it needs recharging. When the handwheel is completely discharged, it takes about 3 hours until it is fully recharged in the handwheel holder. If you do not use the HR 550FS, always place it into the handwheel holder intended for this. This way you can ensure that the handwheel batteries are always ready for use thanks to the contact strip on the rear side of the radio handwheel and the recharge control, and that there is a direct contact connection for the emergency stop circuit.

As soon as the handwheel is in its holder, it switches internally to cable operation. This means you can still use it even if the handwheel is fully discharged. The functions are the same as with wireless operation.



Clean the contacts **1** in the handwheel holder and of the handwheel regularly to ensure their proper functioning.

The transmission range is amply dimensioned. If you happen to get close to the limit of the transmission range, for example in very large machines, the HR 550FS sets off a vibrating alarm that is reliably noticed. If this happens you must reduce the distance to the handwheel holder in which the radio receiver is integrated.



**NOTICE****Caution: Danger to the tool and workpiece!**

The wireless handwheel triggers an emergency stop reaction if the radio transmission is interrupted, the battery is fully empty, or if there is a defect. Emergency stop reactions during machining can cause damage to the tool or workpiece.

- ▶ Place the handwheel in the handwheel holder when it is not in use
- ▶ Keep the distance between the handwheel and the handwheel holder small (pay attention to the vibration alarm)
- ▶ Test the handwheel before machining

If the control has triggered an emergency stop you must reactivate the handwheel. Proceed as follows:

MOD

- ▶ Press the **MOD** key
- > The control opens the MOD menu.
- ▶ Select the **Machine settings** group

SET UP  
WIRELESS  
HANDWHEEL

- ▶ Press the **SET UP WIRELESS HANDWHEEL** soft key
- > The control opens a pop-up window where you can set up the wireless handwheel configuration
- ▶ Press the **Start handwheel** button to reactivate the wireless handwheel
- ▶ Select the **END** button

The MOD menu includes a function for initial operation and configuration of the handwheel.

**Further information:** "Configuring the HR 550 FS radio handwheel", Page 359

### Selecting the axis to be moved

You can activate the principal axes X, Y, Z and three other axes defined by the machine manufacturer directly through the axis keys. Your machine tool builder can also place the virtual axis VT directly on one of the free axis keys. If the virtual axis VT is not on one of the axis keys, proceed as follows:

- ▶ Press the handwheel soft key **F1 (AX)**
- The control shows all active axes on the handwheel display. The currently active axis flashes.
- ▶ Select the desired axis with the handwheel soft keys **F1 (->)** or **F2 (<-)** and confirm with the **F3 (OK)** handwheel soft key

### Setting the handwheel sensitivity

The handwheel sensitivity determines which path an axis takes per revolution of the handwheel. The handwheel sensitivity results from the defined handwheel speed of the axis and the speed level used internally by the control. The speed level describes a percentage of the handwheel speed. The control calculates a specific handwheel sensitivity value for each speed level. The resulting handwheel sensitivity values are directly selectable with the handwheel arrow keys (only if incremental jog is not active).

Taking the example of a defined handwheel speed of 1, the following handwheel sensitivity values result from the speed levels for the respective units of measure:

Resulting handwheel sensitivity levels in  
mm/revolution and degrees/revolution:

0.0001/0.0002/0.0005/0.001/0.002/0.005/0.01/0.02/0.05/0.1/0.2/0.5/1

Resulting handwheel sensitivity levels in in/revolution:

0.000127/0.000254/0.000508/0.00127/0.00254/0.00508/0.0127/0.0254/0.0508/0.127/0.254/0.508

### Examples for resulting handwheel sensitivity values:

Defined handwheel speed	Speed level	Resulting handwheel sensitivity
10	0.01 %	0.001 mm/revolution
10	0.01 %	0.001 degrees/revolution
10	0.0127 %	0.00005 in/revolution

**Moving the axes**

- ▶ To activate the handwheel, press the handwheel button on the HR 5xx:
- ▶ Now you can operate the control only via the HR 5xx. The control displays a pop-up window with this information on the screen.
- ▶ Select the desired operating mode with the **OPM** soft key if necessary



- ▶ If required, press and hold the permissive button
- ▶ Use the handwheel to select the axis to be moved. Select the additional axes with the soft keys as required



- ▶ Move the active axis in the positive direction with the + key, or



- ▶ Move the active axis in the negative direction with the - key



- ▶ To deactivate the handwheel, press the handwheel key on the HR 5xx
- ▶ Now you can operate the control via the operating panel again.

**Potentiometer settings****NOTICE****Caution: Possible damage to the workpiece!**

When toggling between the machine operating panel and the handwheel, the feed rate may be reduced. This can cause visible marks on the workpiece.

- ▶ Make sure to retract the tool before toggling between the handwheel and the machine operating panel.

The settings of the override potentiometer on the handwheel may differ from those on the machine operating panel. When you activate the handwheel, the control will automatically activate the override potentiometer of the handwheel.

In order to make sure that the feed rate does not increase while you switch over between the potentiometers, the feed rate is either frozen or reduced.

If the feed rate before switching over is higher than the feed rate after switching over, the control automatically reduces the feed rate to the smaller value.

If the feed rate before switching over is less than the feed rate after switching over, the control automatically freezes the feed rate.

In case the feed rate is frozen, the override potentiometer will only be effective if the potentiometer has been turned back so far that the previous value is reached or undershot.

When you switch off the handwheel, the control will automatically activate the override potentiometer of the machine operating panel.

### Incremental jog positioning

With incremental jog positioning the control moves the currently active handwheel axis by a preset increment defined by you:

- ▶ Press the handwheel soft key **F2 (STEP)**
- ▶ Activate incremental jog positioning: Press handwheel soft key **3 (ON)**
- ▶ Select the desired jog increment by pressing the **F1** or **F2** key. The smallest possible increment is 0.0001 mm (0.00001 inches). The largest possible increment is 10 mm (0.3937 inches).
- ▶ Confirm the selected jog increment with soft key **4 (OK)**
- ▶ With the **+** or **-** handwheel key, move the active handwheel axis in the corresponding direction



If you press and hold the **F1** or **F2** key, each time it reaches a decimal value 0 the control increases the counting increment by a factor of 10.

By also pressing the **CTRL** key, you can increase the counting increment by a factor of 100 when pressing **F1** or **F2**.

### Inputting miscellaneous functions M

- ▶ Press the **F3 (MSF)** handwheel soft key
- ▶ Press the **F1 (M)** handwheel soft key
- ▶ Select the desired M function number by pressing the **F1** or **F2** key
- ▶ Execute the M miscellaneous function with the **NC Start** key

### Entering the spindle speed S

- ▶ Press the **F3 (MSF)** handwheel soft key
- ▶ Press the **F2 (S)** handwheel soft key
- ▶ Select the desired speed by pressing the **F1** or **F2** key
- ▶ Activate the new speed S with the **NC Start** key



If you press and hold the **F1** or **F2** key, each time it reaches a decimal value 0 the control increases the counting increment by a factor of 10.

By also pressing the **CTRL** key, you can increase the counting increment by a factor of 100 when pressing **F1** or **F2**.

### Entering the feed rate F

- ▶ Press the **F3 (MSF)** handwheel soft key
- ▶ Press the **F3 (F)** handwheel soft key
- ▶ Select the desired feed rate by pressing the **F1** or **F2** key
- ▶ Confirm the new feed rate F with the **F3 (OK)** handwheel soft key



If you press and hold the **F1** or **F2** key, each time it reaches a decimal value 0 the control increases the counting increment by a factor of 10.

By also pressing the **CTRL** key, you can increase the counting increment by a factor of 100 when pressing **F1** or **F2**.

### Presetting



Refer to your machine manual!

The machine tool builder can disable presetting in individual axes.

- ▶ Press the **F3 (MSF)** handwheel soft key
- ▶ Press the **F4 (PRS)** handwheel soft key
- ▶ If required, select the axis in which the preset is to be set.
- ▶ Zero the axis with the handwheel soft key **F3 (OK)** or with **F1** and **F2** set the desired value and then confirm with **F3 (OK)**.  
By also pressing the **CTRL** key, you can increase the counting increment to 10

### Switching between operating modes

With the handwheel soft key **F4 (OPM)** you can use the handwheel to switch the operating mode, provided that the current status of the control allows a mode change.

- ▶ Press the **F4 (OPM)** handwheel soft key
- ▶ Select the desired operating mode by handwheel soft key
  - MAN: **Manual operation**
  - MDI: **Positioning w/ Manual Data Input**
  - SGL: **Program run, single block**
  - RUN: **Program run, full sequence**

### Generating a complete traversing block



Refer to your machine manual!

Your machine tool builder can assign any function to the **Generate NC block** handwheel key.

- ▶ Select **Positioning w/ Manual Data Input** operating mode
- ▶ If required, use the arrow keys on the control's keyboard to select the NC block after which the new traversing block is to be inserted
- ▶ Activate the handwheel
- ▶ Press the **Generate NC block** key on the handwheel
- ▶ The control inserts a complete traversing block containing all axis positions selected through the MOD function.

### Features in the program run modes of operation

You can use the following functions in the Program Run modes of operation:

- The **NC Start** key (**NC Start** handwheel key)
- The **NC Stop** key (**NC Stop** handwheel key)
- After the **NC Stop** key has been pressed: Internal stop (handwheel soft keys **MOP** and then **Stop**)
- After the **NC STOP** key has been pressed: Traverse manual axes (handwheel soft keys **MOP** and then **MAN**)
- Returning to the contour after the axes were moved manually during a program interruption (**MOP** and then **REPO** handwheel soft keys). The handwheel soft keys, which function similarly to the screen soft keys, are used for operating.  
**Further information:** "Returning to the contour", Page 286
- On/off switch for the Tilt working plane function (handwheel soft keys **MOP** and then **3D**)



## 5.3 Spindle speed S, feed rate F and miscellaneous function M

### Application

In the **Manual operation** and **Electronic handwheel** operating modes, you can enter the spindle speed S, feed rate F, and the M functions (miscellaneous functions) with soft keys.

**Further information:** "Entering miscellaneous functions M and STOP ", Page 300



Refer to your machine manual!

The machine tool builder defines which miscellaneous functions are available on the machine and which are allowed in the **Manual operation** mode.

### Entering values

#### Spindle speed S, miscellaneous function M

Proceed as follows to enter the spindle speed:



- ▶ Press the **S** soft key
- > The control shows the **Spindle speed S =** dialog in a pop-up window.



- ▶ Enter **1000** (spindle speed)
- ▶ Press the **NC start** key to load the value

The spindle speed with the entered speed **S** is started with a miscellaneous function **M**. Input a miscellaneous function **M** in the same way.

The control shows the current spindle speed in the status display. If the spindle speed is less than 1000, the control also shows a decimal place that has been entered.

### Feed rate F

Proceed as follows to enter the feed rate:



- ▶ Press the **F** soft key
- ▶ The control opens a pop-up window.
- ▶ Enter a feed rate
- ▶ Confirm with the **ENT** key



The following is valid for feed rate F:

- If you enter  $F=0$ , then the feed rate that the machine tool builder has defined as minimum feed rate is effective
- If the feed rate entered exceeds the maximum value that has been defined by the machine tool builder, then the value defined by the machine tool builder is effective
- F is not lost during a power interruption
- The control displays the feed rate.
  - When **3D ROT** is active the machining feed rate is shown if several axes are moved
  - If **3-D ROT** is inactive, the feed rate display remains empty when more than one axis is moved simultaneously

The control shows the current feed rate in the status display.

- If the feed rate is less than 10, the control also shows one of the decimal places that have been entered.
- The control displays two decimal places if the feed rate is less than 1.

### Changing the spindle speed and feed rate

With the potentiometers you can vary the spindle speed **S** and feed rate **F** from 0 % to 150 % of the set value.

The feed-rate potentiometer only reduces the programmed feed rate and not the feed rate calculated by the control.



The override for spindle speed is only functional on machines with infinitely variable spindle drive.



## Feed-rate limit F MAX



Refer to your machine manual!  
The feed-rate limit depends on the machine.

The **F MAX** soft key enables you to reduce the feed rate for all operating modes. The reduction applies to all rapid traverse and feed rate movements. The value you enter remains active after switch-off or switch-on.

If a feed-rate limit is active, the control displays an exclamation mark behind the feed rate-value in the status display.

**Further information:** "General status display", Page 67

The **F MAX** soft key is available in the following operating modes:

- **Program run, single block**
- **Program run, full sequence**
- **Positioning w/ Manual Data Input**

### Procedure


To activate the feed-rate limit F MAX, proceed as follows:



- ▶ Operating mode: Press the **Positioning w/ Manual Data Input** key



- ▶ Set the **F MAX** soft key to **ON**

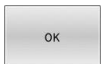

- ▶ Enter the desired maximum feed rate
- ▶ Press the OK soft key
- ▶ The control displays an exclamation mark behind the feed rate-value in the status display.

## 5.4 Integrated functional safety (FS)

### Miscellaneous

Machine tools with HEIDENHAIN controls may be equipped with integrated functional safety (FS) or with external safety. This chapter refers exclusively to machines with integrated functional safety (FS).



Refer to your machine manual!

Your machine tool builder adapts the HEIDENHAIN safety system to your machine.

Every machine tool user is exposed to certain risks. While protective devices can prevent access to dangerous locations, the user must also be able to work on the machine without this protection (e.g. guard door opened).

The HEIDENHAIN safety concepts enables the setup of a system that fulfills the requirements of **Performance Level d, Category 3** in accordance with **DIN EN ISO 13849-1** and **SIL 2 in accordance with IEC 61508 (DIN EN 61508-1)**.

It provides safety-related operating modes, as per **DIN EN ISO 16090-1** (previously DIN EN 12417). Comprehensive operator protection can thus be implemented.

The basis of the HEIDENHAIN safety concept is the dual-channel processor structure, which consists of the main computer (MC) and one or more drive controller modules (CC= control computing unit). All monitoring mechanisms are designed redundantly in the control systems. Safety-relevant system data are subject to a mutual cyclic data comparison.

Safety-relevant errors always lead to safe stopping of all drives through defined stop reactions.

Defined safety functions are triggered and safe operating statuses are achieved via dual-channel safety-relevant inputs and outputs, which have an influence on the process in all operating modes.

In this chapter you will find explanations of the functions that are additionally available on a control with functional safety (FS).





## Safety functions

To ensure the requirements regarding operator protection, the integrated functional safety (FS) provides a number of standardized safety functions.

Description	Meaning	Short description
<b>SS0, SS1, SS1D, SS1F, SS2</b>	Safe Stop	Safe stopping of all drives using different methods
<b>STO</b>	Safe Torque Off	The power supply to the motor is interrupted. Provides protection against unexpected start of the drives
<b>SOS</b>	Safe Operating Stop	Safe operating stop. Provides protection against unexpected start of the drives
<b>SLS</b>	Safely Limited Speed	Safely limited speed. Prevents the drives from exceeding the specified speed limits when the protective door is opened
<b>SLP</b>	Safely Limited Position	Safely limited position. Monitors safe axes to keep them within the limit values of a defined area
<b>SBC</b>	Safe Brake Control	Dual-channel control of the motor holding brakes


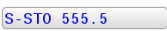

## Functional safety (FS) status displays

The control indicates the active safety-related operating mode by an icon in the vertical soft-key row:

Icon	Safety-related operating mode	Short description
 <b>SOM_1</b>	<b>SOM_1</b> operating mode active	Safe operating mode 1: Automatic mode, production mode
 <b>SOM_2</b>	<b>SOM_2</b> operating mode active	Safe operating mode 2: Set-up mode
 <b>SOM_3</b>	<b>SOM_3</b> operating mode active	Safe operating mode 3: Manual intervention; only for qualified operators
 <b>SOM_4</b>	<b>SOM_4</b> operating mode active This function must be enabled and adapted by the machine tool builder.	Safe operating mode 4: Advanced manual intervention, process monitoring, only for qualified users

## General status display

On a control with functional safety (FS), the status display contains additional safety-related information. The control displays the active operating statuses of speed **S** and feed rate **F** in the general status display.

Icon	Meaning
	Feed rate when stopped
	Spindle when stopped
	Safe axis (not tested)




### Additional status display


The **FS** tab in the additional status display provides the following information:

#### Information on functional safety (FS tab)

Soft key	Meaning
No direct selection possible	A safety-related operating mode is active
FS information:	
Field	Meaning
<b>Axis</b>	Axes of the active kinematics
<b>State</b>	Active safety function
<b>Stop</b>	Stop reaction
<b>SLS2</b>	Maximum speed or feed-rate values for <b>SLS</b> in the <b>SOM_2</b> operating mode
<b>SLS3</b>	Maximum speed or feed-rate values for <b>SLS</b> in the <b>SOM_3</b> operating mode
<b>SLS4</b>	Maximum speed or feed-rate values for <b>SLS</b> in the <b>SOM_4</b> operating mode  This function must be enabled and adapted by the machine tool builder.
<b>Vmax_act</b>	Currently valid limit for speed or feed rate; these are either values from the <b>SLS</b> settings or from the SPLC  If values are greater than 999 999, then the control displays <b>MAX</b>

The control indicates the test status of the axes by means of an icon:

Icon	Meaning
	The axis has been tested or does not need to be tested.
	The axis has not been tested, but must be tested to ensure safe operation. <b>Further information:</b> "Checking the axis positions", Page 187
	The axis is not monitored by functional safety (FS) or is not configured as a safe axis.

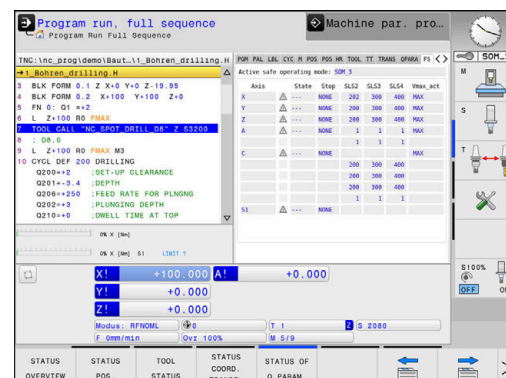

## Checking the axis positions



Refer to your machine manual!

This function must be adapted by your machine manufacturer.

After switch-on, the control checks whether the position of an axis matches the position directly after shutdown. If a deviation occurs or functional safety (FS) detects that a change has been made, this axis is marked on the position display. The control displays a red warning triangle in the status display.

Axes that are marked can no longer be moved while the door is opened. In such cases you must approach a test position for the axes in question.

Proceed as follows:

- ▶ Select **Manual operation** mode
- ▶ Press the **MOVE TO INSPECTION POSITION** soft key
- > The control displays the axes that have not been tested.
- ▶ Press the **SELECT AXIS** soft key
- ▶ Select the desired axis by soft key, if required.
- ▶ Alternative: Press the **POSIT. LOGIC** soft key
- ▶ Press the **NC start** key
- > The axis moves to the test position.
- > After the test position has been reached, the control issues a message.
- ▶ Press the **permissive button** on the machine operating panel
- > The control displays the axis as a tested axis.
- ▶ Repeat this procedure for all axes that you want to move to the test position

### NOTICE

#### Danger of collision!

The control does not automatically check whether collisions can occur between the tool and the workpiece. Incorrect pre-positioning or insufficient spacing between components can lead to a risk of collision while approaching the test positions.

- ▶ If necessary, move to a safe position before approaching the test positions
- ▶ Watch out for possible collisions



Refer to your machine manual!

The location of the test position is specified by your machine tool builder.

## Activating feed-rate limits



Refer to your machine manual!

This function must be adapted by your machine manufacturer.

With this function, you can prevent the SS1 reaction (safe stopping of drives) from being triggered when the guard door is opened.

If you press the **F LIMITED** soft key, the control will limit the speed of the axes and of the spindle(s) to the values defined by the machine tool builder. The limitation depends on the safe SOM\_x operating mode selected with the aid of the keylock switch.

If SOM\_1 is active, the axes and spindles are brought to a stop, because only then will you be allowed to open the guard doors in SOM\_1.



- Select the **Manual operation** mode



- Shift the soft-key row




- Switch on/off feed rate limit




## 5.5 Preset management

### Note




It is essential that you use the preset table in the following cases:

- If your machine is equipped with rotary axes (tilting table or swivel head) and you work with the **Tilt working plane** (option 8) function
- If your machine is equipped with a spindle-head changing system
- If up to now you have been working with older controls with REF-based datum tables
- You wish to machine several identical workpieces that are aligned differently

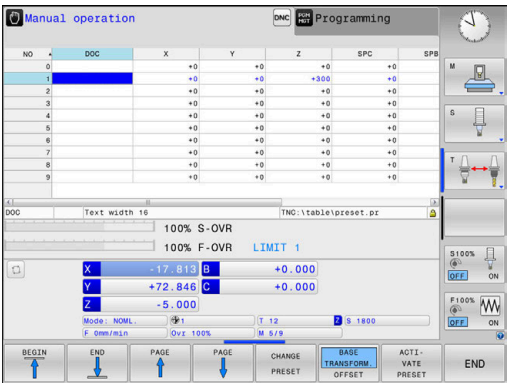

The preset table can contain any number of rows (presets). To optimize the file size and the processing speed, only use as many rows as you need to manage your presets.

For safety reasons, new rows can be inserted only at the end of the preset table.



Refer to your machine manual!  
The machine tool builder specifies the default values to be used for each column of a new line.

### Presets and pallet presets

If you work with pallets, please note that the presets stored in the preset table are relative to an activated pallet preset.

**Further information:** "Pallets", Page 315

## Creating and activating an INCH-based preset table



If you choose to switch the units for your control to **INCH**, the preset table unit of measure will not be adjusted automatically.

If you want to change the unit of measure in the table as well, you need to create a new preset table.


To create and activate an **INCH**-based preset table, proceed as follows:



- ▶ Select the **Programming** operating mode



- ▶ Open the file manager
- ▶ Open the **TNC:\table** folder
- ▶ Rename the **preset.pr** file, e.g. to **preset\_mm.pr**
- ▶ Create a new file and name it **preset\_inch.pr**
- ▶ Select the **INCH** unit of measure
- > The control opens the new, empty preset table.
- > The control displays an error message related to a missing prototype file.
- ▶ Delete the error message
- ▶ Append lines, e.g. 10 lines
- > The control adds the lines
- ▶ Position the cursor in the **ACTNO** column of line **0**
- ▶ Enter **1**
- ▶ Confirm your input

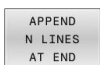

- ▶ Open the file manager
- ▶ Rename the **preset\_inch.pr** file to **preset.pr**
- ▶ Select the **Manual operation** mode



- ▶ Open Preset management
- ▶ Review the preset table



The tool table is another table where the unit of measure is not adjusted automatically.

**Further information:** "Creating and activating an INCH-based tool table", Page 132

## Saving presets in the table



Refer to your machine manual!

The machine tool builder can disable presetting in individual axes.

The machine tool builder can define a different path for the preset table.

The preset table has the name **PRESET.PR**, and is saved in the **TNC:\table\** directory by default.

**PRESET.PR** is editable in the **Manual operation** and **Electronic handwheel** operating modes only after you have pressed the **CHANGE PRESET** soft key. You can open the **PRESET.PR** preset table in the **Programming** operating mode but not edit it.

There are several methods for saving presets and basic rotations in the preset table:

- Manual input
- Using the touch probe cycles in the **Manual operation** and **Electronic handwheel** operating modes
- Using touch probe cycles **400** to **405**, **14xx** and **410** to **419** in automatic mode

**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**



Operating notes:

- In the 3-D ROT menu, you can specify that the basic rotation is also effective in the **Manual Operation** mode.  
**Further information:** "Activating manual tilting", Page 239
- When presetting, the positions of the tilting axes must match the tilted situation.
- The behavior of the control during presetting depends on the setting in the optional machine parameter **chkTiltingAxes** (no. 204601).  
**Further information:** "Introduction", Page 201
- **PLANE RESET** does not reset the active 3-D ROT.
- In row 0 the control always saves the preset that you most recently set manually via the axis keys or via soft key. If the preset set manually is active, the control displays the text **PR MAN(0)** in the status display.

### Copying the preset table

Copying the preset table into another directory (for data backup) is permitted. Write-protected lines are also write-protected in the copied tables.

Do not change the number of lines in the copied tables! If you want to reactivate the table, this may lead to problems.

To activate the preset table copied to another directory you have to copy it back.

If you select a new preset table, you need to reactivate the preset.

### Manually saving the presets in the preset table

Proceed as follows in order to save presets in the preset table:



- ▶ Select the **Manual operation** mode



- ▶ Move the tool slowly until it touches (scratches) the workpiece surface, or position the measuring dial correspondingly



- ▶ Press the **PRESET MANAGEMENT** soft key
- ▶ The control opens the preset table and positions the cursor in the line of the active preset.



- ▶ Press the **CHANGE PRESET** soft key
- ▶ The control displays all available input options in the soft-key row.



- ▶ Select the line in the preset table that you want to change (the line number is the preset number)



 





- ▶ If needed, select the column in the preset table that you want to change








 







- ▶ Use the soft keys to select one of the available input options

## Input options

  Soft key	Function
	Directly transfer the actual position of the tool (the measuring dial) as the new preset: This function only saves the preset in the axis in which the cursor is currently positioned
	Assign any value to the actual position of the tool (the measuring dial): This function only saves the preset in the axis in which the cursor is currently positioned. Enter the desired value in the pop-up window
	Incrementally shift a preset already stored in the table: This function only saves the preset in the axis in which the cursor is currently positioned. Enter the desired compensation value with the correct sign in the pop-up window. If inch display is active: Enter the value in inches, and the control will internally convert the entered value to mm
	Directly enter the new preset without calculation of the kinematics (axis-specific). Only use this function if your machine has a rotary table, and you want to set the preset to the center of the rotary table by entering 0. This function only saves the value in the axis in which the cursor is currently positioned. Enter the desired value in the pop-up window. If inch display is active: Enter the value in inches, and the control will internally convert the entered value to mm
	Select the <b>BASE TRANSFORM./OFFSET</b> view. The default view <b>BASE TRANSFORM.</b> shows the X, Y, and Z columns. Depending on the machine, the columns SPA, SPB, and SPC are displayed in addition. The control saves the basic rotation here (with the Z tool axis the control uses the SPC column). The <b>OFFSET</b> view shows the offset values for the preset.
	Write the currently active preset to a selectable line in the table: This function saves the preset in all axes, and then activates the appropriate line in the table automatically. If inch display is active: Enter the value in inches, and the control will internally convert the entered values to mm

## Editing the preset table

Soft key	Editing function in table mode
	Select the table start
	Select the table end
	Select the previous page in the table
	Select the next page in the table
	Select the functions for entry of presets
	Choose between showing the Basic Transformation or the Axis Offset
	Activate the preset of the selected line of the preset table
	Add several lines at end of table
	Copy the field that is currently highlighted
	Insert the copied field
	Reset the selected line: The control enters - into all columns.
	Insert a line as last line in the table
	Delete the last line in the table

## Protecting presets from being overwritten

You can use the **LOCKED** column to protect any lines in the preset table from being overwritten. The write-protected lines are color-highlighted in the preset table.

If you want to overwrite a write-protected line with a manual touch probe cycle, confirm with **OK** and enter the password (where password-protected).

### NOTICE

#### Caution: Data may be lost!

Lines that were locked with the **LOCK / UNLOCK PASSWORD** function can be unlocked only with the selected password. Forgotten passwords cannot be reset. This means that locked lines would be locked permanently. The preset table would thus no longer be fully usable.

- ▶ Prefer the alternative **LOCK / UNLOCK** function
- ▶ Note down your passwords

Proceed as follows to protect a preset from being overwritten:



- ▶ Press the **CHANGE PRESET** soft key



- ▶ Select the **LOCKED** column



- ▶ Press the **EDIT CURRENT FIELD** soft key

Protection for a preset without using a password:




- ▶ Press the **LOCK / UNLOCK** soft key
- ▶ The control writes an **L** in the **LOCKED** column.

Use a password to protect a preset:



- ▶ Press the **LOCK / UNLOCK PASSWORD** soft key

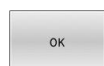

- ▶ Enter the password in the pop-up window
- ▶ Confirm with the **OK** soft key or with the **ENT** key:
- ▶ The control writes **###** in the **LOCKED** column.

### Canceling write-protection

To edit a line you have previously write-protected, proceed as follows:



- ▶ Press the **CHANGE PRESET** soft key



- ▶ Select the **LOCKED** column



- ▶ Press the **EDIT CURRENT FIELD** soft key

Preset protected without a password:




- ▶ Press the **LOCK / UNLOCK** soft key
- > The control cancels the write-protection.

Preset protected with a password:



- ▶ Press the **LOCK / UNLOCK PASSWORD** soft key

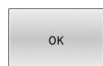

- ▶ Enter the password in the pop-up window
- ▶ Confirm with the **OK** soft key or with the **ENT** key
- > The control cancels the write-protection.



## Activating a preset

### Activating a preset in the Manual operation mode

#### NOTICE

##### Caution: Significant property damage!

Undefined fields in the preset table behave differently from fields defined with the value **0**: Fields defined with the value **0** overwrite the previous value when activated, whereas with undefined fields the previous value is kept.

- Before activating a preset, check whether all columns contain values.



##### Operating notes:

- When activating a preset from the preset table, the control resets any active datum shift, mirroring, rotation, or scaling factor.
- On the other hand, the **Tilt working plane** function (Cycle **19** or **PLANE**) remains active.



- Select the **Manual operation** mode



- Press the **PRESET MANAGEMENT** soft key



- Select the preset number that you want to activate



- Or, with the **GOTO** key, select the preset number that you want to activate



- Confirm with the **ENT** key



- Press the **ACTIVATE PRESET** soft key



- Confirm activation of the preset
- The control sets the display and the basic rotation.



- Exit the preset table

### Activating a preset in an NC program

Use Cycle **247** or the **PRESET SELECT** function in order to activate presets from the preset table during a program run.

In Cycle **247**, you can specify the number of the preset to be activated. With the **PRESET SELECT** function, you can specify the number of the preset or the entry in the **Doc** column that you want to activate.

**Further information:** User's Manual for **Programming of Machining Cycles**

## 5.6 Presetting without a 3-D touch probe

### Note

When presetting, you set the control display to the coordinates of a known workpiece position.



All manual probe functions are available with a 3-D touch probe.

**Further information:** "Presetting with a 3-D touch probe (option number 17)", Page 227



Refer to your machine manual!

The machine tool builder can disable presetting in individual axes.

### Preparation

- ▶ Clamp and align the workpiece
- ▶ Insert the zero tool with known radius into the spindle
- ▶ Ensure that the control is showing the actual positions

## Presetting with an end mill



- Select **Manual operation** mode



- Move the tool slowly until it touches (scratches) the workpiece surface



Setting a preset in an axis:




- Select the axis
- The control opens the **PRESETTING Z=** dialog window



- Alternative: Press the **SET PRESET** soft key
- Select the axis via soft key



- Zero tool in spindle axis: Set the display to a known workpiece position (here, 0) or enter the thickness  $d$  of the shim. In the tool axis: Consider the tool radius

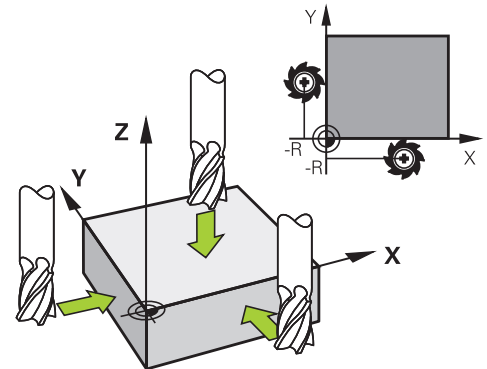

Repeat the process for the remaining axes.

If the tool in the tool axis has already been set, set the display of the tool axis to the length  $L$  of the tool or enter the sum  $Z=L+d$ .



### Operating notes:

- The control automatically saves the preset set with the axis keys in row 0 of the preset table.
- If the machine tool builder has locked an axis, then you cannot set a preset in that axis. The soft key for that axis is then not visible.
- The behavior of the control during presetting depends on the setting in the optional machine parameter **chkTiltingAxes** (no. 204601).

**Further information:** "Introduction", Page 201


## Using touch probe functions with mechanical probes or measuring dials

If you do not have an electronic 3-D touch probe on your machine, you can also use all the previously described manual touch probe functions (exception: calibration function) with mechanical probes or by simply touching the workpiece with the tool.

**Further information:** "Using a 3-D touch probe (option 17)", Page 201

In place of the electronic signal generated automatically by a 3-D touch probe during probing, you can manually initiate the trigger signal for capturing the **probing position** by pressing a key.

Proceed as follows:

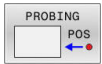

- ▶ Select any touch probe function by soft key
- ▶ Move the mechanical probe to the first position to be captured by the control.



- ▶ To capture the position: Press the **Actual-position-capture** soft key
- > The control saves the current position.
- ▶ Move the mechanical probe to the next position to be captured by the control.



- ▶ To capture the position: Press the **Actual-position-capture** soft key
- > The control saves the current position.
- ▶ If required, move to additional positions and capture as described previously
- ▶ **Preset:** In the menu window, enter the coordinates of the new preset, confirm with the **SET PRESET** soft key, or write the values to a table
- Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210
- Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- ▶ Terminate the probing function: Press the **END** key



If you try to set a preset in a locked axis, the control will issue either a warning or an error message, depending on what the machine tool builder has defined.

## 5.7 Using a 3-D touch probe (option 17)

### Introduction

The behavior of the control during preset setting depends on the setting in the optional machine parameter **chkTiltingAxes** (no. 204601):

- **chkTiltingAxes: NoCheck** The control does not check whether the current coordinates of the rotary axes (actual positions) agree with the tilt angles that you defined.
- **chkTiltingAxes: CheckIfTilted** With an active tilted working plane, the control checks during presetting in the X, Y, and Z axes whether the current coordinates of the rotary axes match the tilt angles that you defined (3-D ROT menu). If the positions do not match, the control opens the **Working plane is inconsistent** menu.
- **chkTiltingAxes: CheckAlways** With an active tilted working plane, the control checks during presetting in the X, Y, and Z axes whether the current coordinates of the rotary axes match. If the positions do not match, the control opens the **Working plane is inconsistent** menu.






Operating notes:

- If the checking function is off, the **PL** and **ROT** probing functions use a rotary axis position that is equal to 0 in their calculations.
- Always set a preset in all three principal axes. This clearly and correctly defines the preset. That way you also taken into account possible deviations resulting from the tilting of the axes.
- The control issues an error message if you do not use a 3-D touch probe for presetting and the positions do not match.

If the machine parameter has not been set, the control checks as if **chkTiltingAxes: CheckAlways** were set

### Behavior with tilted axes

If the positions do not match, the control opens the **Working plane is inconsistent** menu.

Soft key	Function
	In the 3-D ROT menu, the control sets <b>Manual Operation 3-D ROT</b> to <b>Active</b> . The linear axes move in a tilted working plane. <b>Manual Operation 3-D ROT</b> remains active until you set it to <b>Inactive</b> .
	The control ignores the tilted working plane. The preset defined applies only to this tilted condition.
	The control positions the rotary axes as specified in the 3-D ROT menu and sets <b>Manual Operation 3-D ROT</b> to <b>Active</b> . <b>Manual Operation 3-D ROT</b> remains active until you set it to <b>Inactive</b> .

### Aligning the rotary axes





#### NOTICE

##### Danger of collision!

The control does not check for collisions before aligning the rotary axes. Danger of collision if there is no pre-positioning movement.

- ▶ Move to a safe position before the alignment

To align the rotary axes, proceed as follows:

- ▶ Press the **ALIGN ROT. AXES** soft key  

- ▶ Define the feed rate, if required
- ▶ Specify tilting, if required
  - **NO SYM**  

  - **SYM +**
  - **SYM -**
- ▶ Select the positioning behavior  

- ▶ Press the **NC start** key  

- ▶ The control aligns the axes. The Tilt working plane function becomes active for this.



Tilting can only be selected if you have set **Manual Operation 3-D ROT** to **active**.

**Further information:** "Activating manual tilting", Page 239

## Overview



Refer to your machine manual!


 
 
 
 
 
 

The control must be specifically prepared by the machine tool builder for the use of a 3-D touch probe.

The touch probe cycles are available only with option number 17. If you are using a HEIDENHAIN touch probe, this option is available automatically.



HEIDENHAIN only gives warranty for the function of the probing cycles if HEIDENHAIN touch probes are used.

The following touch probe cycles are available in the **Manual operation** mode:

Soft key	Function	Page
	Calibrating the 3-D Touch Probe	212
	Measuring a 3-D basic rotation by probing a plane	223
	Measuring a basic rotation using a line	220
	Setting the preset on any axis	228
	Setting a corner as preset	229
	Setting a circle center as preset	230
	Setting the centerline as preset	233
	Touch probe system data management	See the User's Manual for Programming of Measuring Cycles for Workpieces and Tools



**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**

#### Traverse movements with a handwheel with display

With a handwheel with display, it is possible to transfer control to the handwheel during a manual touch probe cycle.

Proceed as follows:

- ▶ Start the manual touch probe cycle
- ▶ Position the touch probe at a position near the first touch point
- ▶ Probe the first touch point
- ▶ Activate the handwheel on the handwheel
- > The control shows the **Handwheel active** pop-up window.
- ▶ Position the touch probe at a position near the second touch point
- ▶ Deactivate the handwheel on the handwheel
- > The control closes the pop-up window.
- ▶ Probe the second touch point
- ▶ If necessary, set the preset
- ▶ End the probing function



If the handwheel is active, you cannot start the touch probe cycles.



## Suppressing touch probe monitoring

### Suppressing touch probe monitoring

If the control does not receive a stable signal from the touch probe, the **TCH PROBE MONITOR OFF** soft key is displayed.

Proceed as follows to deactivate touch-probe monitoring:



- ▶ Select **Manual operation** mode



- ▶ Press the **TCH PROBE MONITOR OFF** soft key
- ▶ The control disables touch-probe monitoring for 30 seconds.
- ▶ If required, move the touch probe so that the control receives a stable signal from it.

As long as touch-probe monitoring is switched off, the control displays the error message

**The touch probe monitor is deactivated for 30 seconds.** This error message automatically clears itself after 30 seconds.



If the touch probe sends a stable signal within the 30 seconds, then touch-probe monitoring reactivates itself automatically and the error message is cleared.

### NOTICE

 


 

 
#### Danger of collision!

While touch-probe monitoring is deactivated, the control will not perform collision checking. Thus, you must ensure that the touch probe can be positioned safely. There is a risk of collision if you choose the wrong direction of traverse!

- ▶ Carefully move the axes in the **Manual operation** mode

## Functions in touch probe cycles

Soft keys that are used to select the probing direction or a probing routine are displayed in the manual touch probe cycles. The soft keys displayed vary depending on the respective cycle:

Soft key	Function
	Select the probing direction
	Capture the actual position
	Probe hole (inside circle) automatically
	Probe stud (outside circle) automatically
	Probe a model circle (center point of several elements)
	Select a paraxial probing direction for probing of holes, studs and model circles

**Automatic probing routine for holes, studs, and circular patterns****NOTICE****Danger of collision!**

The control does not perform an automatic collision check with the stylus. During automatic probing procedures the control positions the touch probe to the probing positions automatically. There is a risk of collision if pre-positioning was not correct or if obstacles have been ignored.

- ▶ Program a suitable pre-position
- ▶ Use safety clearances to take obstacles into account


If you use a probing routine for automatic probing of a hole, stud, or a circular pattern, the control opens a form with the required entry fields.

**Input fields in the Measure stud and Measure hole forms**

Input field	Function
<b>Stud diameter? or Hole diameter</b>	Diameter of probe contact (optional for holes)
<b>Safety clearance?</b>	Distance to the probe contact in the plane
<b>Incr. clearance height?</b>	Positioning of touch probe in spindle axis direction (starting from the current position)
<b>Starting angle?</b>	Angle for the first probing operation (0° = positive direction of principal axis, i.e. in X+ for spindle axis Z). All other probe angles result from the number of touch points.
<b>Number of touch points?</b>	Number of probing operations (3 to 8)
<b>Angular length?</b>	Probing a full circle (360°) or a circle segment (angular length < 360°)

Automatic probing routine:


► Pre-position touch probe

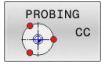

- Select the probing function: Press the **PROBING CC** soft key



- Hole should be probed automatically: Press the **HOLE** soft key

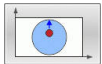

- Select paraxial probing direction



- Start probing function: Press the **NC start** key
- The control carries out all pre-positioning and probing processes automatically.

The control approaches the position at the feed rate **FMAX** defined in the touch probe table. The defined probing feed rate **F** is used for the actual probing operation.



Operating and programming notes:


- Before starting an automatic probing routine, you need to preposition the touch probe near the first touch point. Offset the touch probe by approximately the safety clearance opposite to the probing direction. The safety clearance is derived from the sum of the values in the touch-probe table and in the entry form.
- For inside circles with large diameters, the control can also position the touch probe on a circular arc at the feed rate **FMAX**. This requires that you enter a safety clearance for prepositioning and the hole diameter in the input form. Position the touch probe inside the hole at a position that is offset by approximately the safety clearance from the wall. Take the starting angle of the first probing process into account in pre-positioning; for example, at a starting angle of 0° the control will first probe in the positive direction of the reference axis.

## Selecting the probing cycle

- ▶ Select the **Manual operation** or **Electronic handwheel** mode of operation



- ▶ Select the probing functions: Press the **TOUCH PROBE** soft key

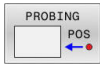

- ▶ Select the touch probe cycle by pressing the appropriate soft key, for example **PROBING POS**
- ▶ The control displays the associated menu.



### Operating notes:

- When you select a manual probing function, the control opens a form displaying all data required. The content of the forms varies depending on the respective function.
- You can also enter values in some of the fields. Use the arrow keys to switch to the desired input field. You can position the cursor only in fields that can be edited. Fields that cannot be edited are dimmed.

## Recording measured values from the touch probe cycles



Refer to your machine manual!

The control must be specially prepared by the machine tool builder for use of this function.

After executing the respective touch-probe cycle, the control writes the measured values to the TCHPRMAN.html file.

If you have not defined a path in the machine parameter **FN16DefaultPath** (no. 102202), the control will store the TCHPRMAN.html file in the **TNC:\** main directory.



### Operating notes:

- If you run several touch probes cycles in a row, the control stores the measured values below each other.

## Writing measured values from the touch probe cycles to a datum table



If you want to save measured values in the workpiece coordinate system, use the **ENTER IN DATUM TABLE** function. If you want to save measured values in the basic coordinate system, use the **ENTRY IN PRESET TABLE** function.

**Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211

With the **ENTER IN DATUM TABLE** soft key, the control can write the values measured during any touch-probe cycle to a datum table:

- ▶ Select any probing function
- ▶ Enter the desired coordinates for the datum in the designated input boxes (depends on the touch probe cycle being run)
- ▶ Enter the datum number in the **Number in table?** input field
- ▶ Press the **ENTER IN DATUM TABLE** soft key
- > The control saves the datum in the indicated datum table under the entered number.

## Writing measured values from the touch probe cycles to the preset table


**i** If you want to save measured values in the basic coordinate system, use the **ENTRY IN PRESET TABLE** function. If you want to save measured values in the workpiece coordinate system, use the **ENTER IN DATUM TABLE** function.

**Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210

With the **ENTRY IN PRESET TABLE** soft key, the control can write the values measured during any touch probe cycle to the preset table. The measured values are then stored with reference to the machine coordinate system (REF coordinates). The preset table has the name PRESET.PR, and is saved in the TNC:\table\ directory.

- ▶ Select any probe function
- ▶ Enter the desired coordinates for the preset in the designated input boxes (depends on the touch probe cycle being run)
- ▶ Enter the preset number in the **Number in table?** input field
- ▶ Press the **ENTRY IN PRESET TABLE** soft key
- The control opens the **Overwrite active preset?** menu.
- ▶ Press the **OVERWRITE PRESET** soft key
- The control saves the preset in the preset table under the entered number.
  - Preset number does not exist: The control does not save the line until the **CREATE LINE** soft key has been pressed (Create line in table?)
  - Preset number is protected: Press the **ENTRY IN LOCKED LINE** soft key to overwrite the active preset
  - Preset number is password-protected: Press the **ENTRY IN LOCKED LINE** soft key and enter the password to overwrite the active preset

**i** The control displays a note if a table row cannot be written to because of disabling. The probing function itself is not interrupted.

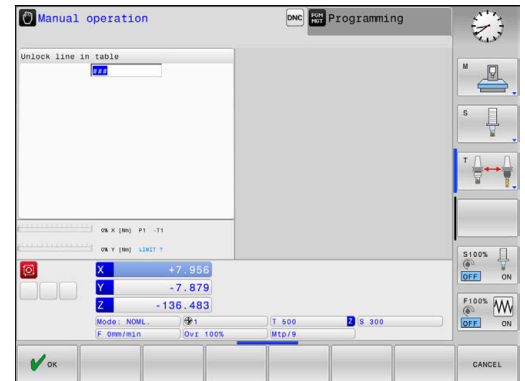

## 5.8 Calibrating 3-D touch probes (option 17)

### Introduction

In order to precisely specify the actual trigger point of a 3-D touch probe, you must first calibrate the touch probe, otherwise the control cannot provide precise measuring results.



#### Operating notes:

- Always calibrate the touch probe again in the following cases:
  - Initial configuration
  - Broken stylus
  - Stylus exchange
  - Change in the probe feed rate
  - Irregularities caused, for example, when the machine heats up
  - Change of active tool axis
- When you press the **OK** soft key after calibration, the calibration values are applied to the active touch probe. The updated tool data then become immediately effective and it is not necessary to repeat the tool call.

During calibration, the control finds the effective length of the stylus and the effective radius of the ball tip. To calibrate the 3-D touch probe, clamp a ring gauge or a stud of known height and known radius to the machine table.

The control provides calibration cycles for calibrating the length and the radius:

 

 
 


- ▶ Press the **TOUCH PROBE** soft key



- ▶ Display the calibration cycles: Press **CALIBRATE TS**
- ▶ Select the calibration cycle

### Calibration cycles

Soft key	Function	Page
	Calibrating the length	213
	Measure the radius and the center offset using a calibration ring	214
	Measure the radius and the center offset using a stud or a calibration pin	214
	Measure the radius and the center offset using a calibration sphere	214



## Calibrating the effective length




HEIDENHAIN only gives warranty for the function of the probing cycles if HEIDENHAIN touch probes are used.




The effective length of the touch probe is always referenced to the tool reference point. The tool reference point is often on the spindle nose (and face of the spindle). The machine manufacturer may also place the tool reference point at a different point.

- Set the preset in the spindle axis such that the following applies to the machine table:  $Z = 0$

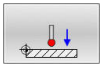

- Select the calibrating function for the touch probe length: Press the **TS calibration of tool length** soft key
- The control displays the current calibration data.
- **Datum for length?:** Enter the height of the ring gauge in the menu window
- Move the touch probe to a position just above the ring gauge
- To change the traverse direction (if necessary), press a soft key or an arrow key
- Probe surface: Press **NC Start** key
- Check results
- Press the **OK** soft key for the values to take effect
- Press the **CANCEL** soft key to terminate the calibrating function.
- The control logs the calibration process in the TCHPRMAN.html file.

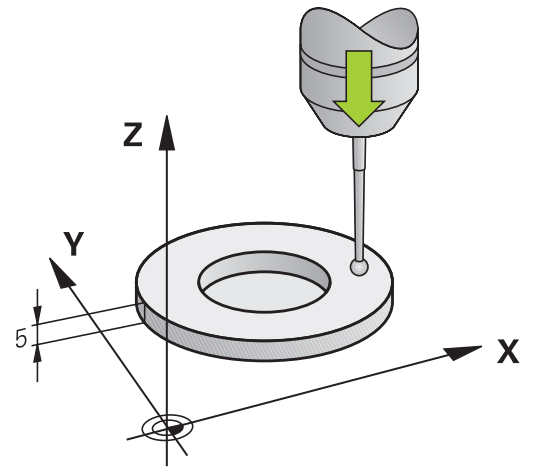

## Calibrating the effective radius and compensating center misalignment



HEIDENHAIN only gives warranty for the function of the probing cycles if HEIDENHAIN touch probes are used.


When calibrating the ball-tip radius, the control executes an automatic probing routine. In the first run the control finds the midpoint of the calibration ring or stud (approximate measurement) and positions the touch probe in the center. Then, in the actual calibration process (fine measurement), the radius of the ball tip is ascertained. If the touch probe allows probing from opposite orientations, the center offset is determined during another cycle. The property of whether or how your touch probe can be oriented is predefined for HEIDENHAIN touch probes. Other touch probes are configured by the machine tool builder.

After the touch probe is inserted, it normally needs to be aligned exactly with the spindle axis. The calibration function can determine the offset between touch probe axis and spindle axis by probing from opposite orientations (rotation by 180°) and can calculate and implement the necessary compensation.



The center offset can be determined only with a suitable touch probe.

If you want to calibrate using the outside of an object, you need to preposition the touch probe above the center of the calibration sphere or calibration pin. Ensure that the touch points can be approached without collision.

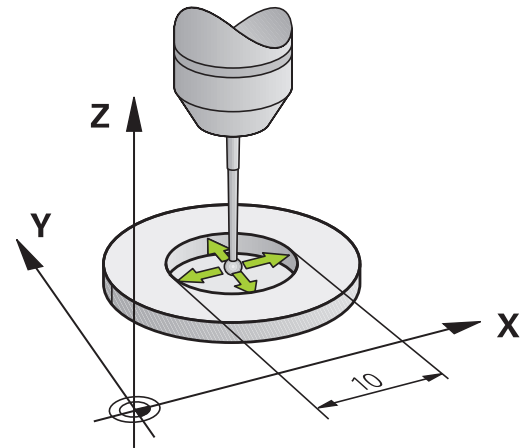

The calibration routine varies depending on how your touch probe can be oriented:

- No orientation possible, or orientation in only one direction: The control executes one approximate and one fine measurement, and then ascertains the effective ball tip radius (column R in tool.t).
- Orientation possible in two directions (e.g. HEIDENHAIN touch probes with cable): The control executes one approximate and one fine measurement, rotates the touch probe by 180°, and then executes another probing routine. The center offset (CAL\_OF in tchprobe.tp) is determined in addition to the radius by probing from opposite orientations.
- Any orientation possible (e.g. HEIDENHAIN touch probes with infrared transmission): The control executes one approximate and one fine measurement, rotates the touch probe by 180°, and then executes another probing routine. The center offset (CAL\_OF in tchprobe.tp) is determined in addition to the radius by probing from opposite orientations.

### Calibration using a calibration ring

For manual calibration using a calibration ring, proceed as follows:



- ▶ In the **Manual operation** mode, position the ball tip inside the bore of the ring gauge
- ▶ Select the calibrating function: Press the **Calibration of a TS in a ring** soft key
- > The control displays the current calibration data.
- ▶ Enter the diameter of the ring gauge
- ▶ Enter the start angle
- ▶ Enter the number of touch points
- ▶ Probe: Press the **NC Start** key
- > The 3-D touch probe probes all required touch points in an automatic probing routine and calculates the effective ball-tip radius. If probing from opposite orientations is possible, the control calculates the center offset.
- ▶ Check results
- ▶ Press the **OK** soft key for the values to take effect
- ▶ Press the **END** soft key to terminate the calibrating function.
- > The control logs the calibration process in the TCHPRMAN.html file.




Refer to your machine manual!

In order to be able to determine ball-tip center misalignment, the control needs to be specially prepared by the machine manufacturer.

### Calibration with a stud or calibration pin

For manual calibration with a stud or calibration pin, proceed as follows:

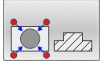

- ▶ In the **Manual operation** mode, position the ball tip above the center of the calibration pin
- ▶ Select the calibrating function: Press the **TS calibration on stud** soft key
- ▶ Enter the outside diameter of the stud
- ▶ Enter the safety clearance
- ▶ Enter the start angle
- ▶ Enter the number of touch points
- ▶ Probe: Press the **NC Start** key
- > The 3-D touch probe probes all required touch points in an automatic probing routine and calculates the effective ball-tip radius. If probing from opposite orientations is possible, the control calculates the center offset.
- ▶ Check results
- ▶ Press the **OK** soft key for the values to take effect
- ▶ Press the **END** soft key to terminate the calibrating function.
- > The control logs the calibration process in the TCHPRMAN.html file.




Refer to your machine manual!

In order to be able to determine ball-tip center misalignment, the control needs to be specially prepared by the machine manufacturer.

### Calibration using a calibration sphere

For manual calibration using a calibration sphere, proceed as follows:

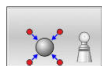

- ▶ In the **Manual operation** mode, position the ball tip above the center of the calibration sphere
- ▶ Select the calibrating function: Press the **Calibration of TS on a sphere** soft key
- ▶ Enter the outside diameter of the ball
- ▶ Enter the safety clearance
- ▶ Enter the start angle
- ▶ Enter the number of touch points
- ▶ Select Length measurement, if applicable
- ▶ If necessary, input the reference for the length
- ▶ Probe: Press the **NC Start** key
- ▶ The 3-D touch probe probes all required touch points in an automatic probing routine and calculates the effective ball-tip radius. If probing from opposite orientations is possible, the control calculates the center offset.
- ▶ Check results
- ▶ Press the **OK** soft key for the values to take effect
- ▶ Press the **END** soft key to terminate the calibrating function
- ▶ The control logs the calibration process in the TCHPRMAN.html file.



Refer to your machine manual!

In order to be able to determine ball-tip center misalignment, the control needs to be specially prepared by the machine manufacturer.

### Displaying calibration values

The control saves the effective length and effective radius of the touch probe in the tool table. The control saves the touch probe center offset to the touch probe table in the columns **CAL\_OF1** (principal axis) and **CAL\_OF2** (minor axis). You can display the values on the screen by pressing the **TCH PROBE TABLE** soft key.


During calibration, the control automatically creates the TCHPRMAN.html log file to which the calibration values are saved.



Ensure that the tool number in the tool table and the touch-probe number of the touch-probe table match. This is regardless of whether you want to use a touch-probe cycle in automatic mode or in **Manual operation** mode.



**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**

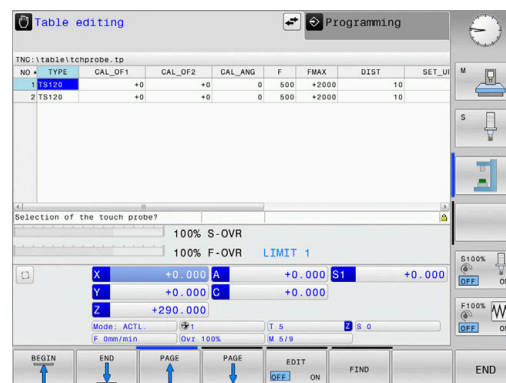

## 5.9 Compensating workpiece misalignment with 3-D touch probe (option 17)

### Introduction




Refer to your machine manual!

It depends on the machine whether you can compensate workpiece misalignment with an offset (angle for table rotation).



HEIDENHAIN only gives warranty for the function of the probing cycles if HEIDENHAIN touch probes are used.

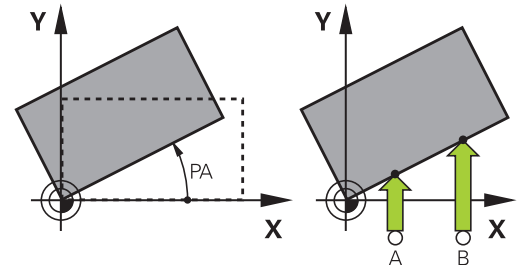

The control compensates workpiece misalignment either mathematically by computing a basic rotation (angle of basic rotation) or by an offset (angle for table rotation)

For this purpose, the control sets the rotation angle to the desired angle with respect to the reference axis in the working plane.

**Basic rotation:** The control interprets the measured angle as rotation around the tool direction, and saves the values in the columns SPA, SPB, or SPC of the preset table.

**Offset:** The control interprets the measured angle as a shift in each axis in the machine coordinate system, and saves the values in the columns A\_OFFS, B\_OFFS, or C\_OFFS of the preset table.

In order to identify the basic rotation or offset, probe two points on the side of the workpiece. The sequence in which you probe the points influences the calculated angle. The measured angle is measured from the first to the second touch point. You can also determine the basic rotation or offset using holes or studs. In this case, however, a consistent working plane is required. When calculating the basic rotation, the system uses the input coordinate system (I-CS).

**To determine the basic rotation in an actively tilted working plane, please remember:**

- If the current coordinates of the rotary axes and the defined tilt angles (3-D ROT menu) match, the working plane is consistent. Thus, the basic rotation is calculated in the input coordinate system (I-CS), based on the tool axis.
- If the current coordinates of the rotary axes and the defined tilt angles (3-D ROT menu) do not match, the working plane is inconsistent. Thus, the basic rotation is calculated in the workpiece coordinate system (W-CS), based on the tool axis.




Operating and programming notes:

- Select the probe direction perpendicular to the angle reference axis when measuring workpiece misalignment.
- To ensure that the basic rotation is calculated correctly during program run, program both coordinates of the working plane in the first positioning block.
- You can also use a basic rotation in conjunction with the **PLANE** function (except for **PLANE AXIAL**). In this case first activate the basic rotation and then the **PLANE** function.
- You can also activate a basic rotation or offset without probing a workpiece. To do so, enter a value in the corresponding input field and press the **SET BASIC ROTATION** or **SET TABLE ROTATION** soft key.
- The behavior of the control during presetting depends on the setting in the **chkTiltingAxes** machine parameter (no. 204601).

**Further information:** "Introduction", Page 201

## Measuring a basic rotation

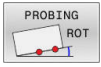

- ▶ Press the **Probe rotation** soft key
- > The control opens the **Probing of rotation** menu.
- ▶ The following input fields are displayed:
  - **Angle of basic rotation**
  - **Offset of rotary table**
  - **Number in table?**
- > The control displays any current basic rotation or offset in the input field.
- ▶ Position the touch probe at a position near the first touch point
- ▶ Select the probe direction or probing routine by soft key
- ▶ Press the **NC Start** key
- ▶ Position the touch probe at a position near the second touch point
- ▶ Press the **NC Start** key
- > The control determines the basic rotation and offset and displays them.
- ▶ Press the **SET BASIC ROTATION** soft key
- ▶ Press the **END** soft key

The control logs the probing process in TCHPRMAN.html.

## Saving the basic rotation in the preset table


- ▶ After the probing process, enter the preset number to which the control is to save the active basic rotation in the **Number in table?** input field
- ▶ Press the **BASIC ROT. IN PRESET TBL** soft key
- > If appropriate, the control opens the **Overwrite active preset?** menu.
- ▶ Press the **OVERWRITE PRESET** soft key
- > The control saves the basic rotation in the preset table.



## Compensation of workpiece misalignment by rotating the table

There are three possibilities for compensating workpiece misalignment by rotating the table:

- Aligning the rotary table
- Setting the table rotation
- Saving the table rotation in the preset table

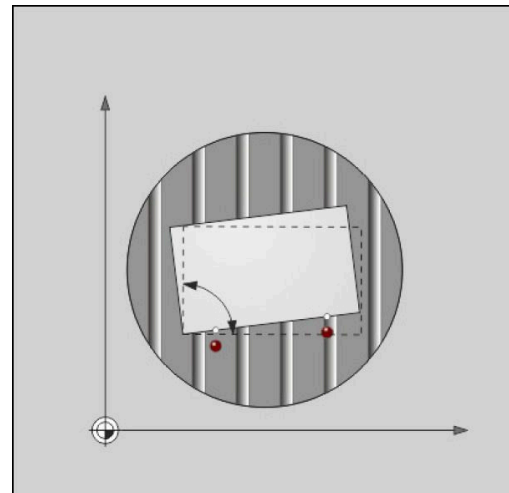

### Aligning the rotary table

You can compensate the ascertained misalignment by positioning the rotary table.



Pre-position all axes before rotating the table, in order to preclude collisions resulting from compensating movements. The control additionally outputs a warning before table rotation.

- ▶ Press the **ALIGN ROT. TABLE** soft key after the probing procedure
- > The control opens the warning.
- ▶ Clear with the **OK** soft key if needed
- ▶ Press the **NC Start** key
- > The control aligns the rotary table.

### Setting the table rotation

You can define a manual preset in the axis of the rotary table.

- ▶ Press the **SET TABLE ROTATION** soft key after the probing procedure
- > If a basic rotation is already set, the control opens the **Reset basic rotation?** menu.
- ▶ Press the **DELETE BASIC ROT.** soft key
- > The control deletes the basic rotation from the preset table, and inserts the offset.
- ▶ Alternative: Press **KEEP BASIC ROT.**
- > The control inserts the offset in the preset table, and the basic rotation also remains.

### Saving table rotation in the preset table

You can save the misalignment of the rotary table in any row of the preset table. The control stores the angle in the offset column of the rotary table, e.g. in the C\_OFFS column for a C axis.

- ▶ Press the **TABLE ROT. IN PRESET TBL** soft key after the probing procedure
- > If appropriate, the control opens the **Overwrite active preset?** menu.
- ▶ Press the **OVERWRITE PRESET** soft key
- > The control saves the offset in the preset table.

You may have to change the view in the preset table with the **BASE TRANSFORM./OFFSET** soft key for this column to be displayed.

### Showing basic rotation and offset

If you select the **PROBING ROT** function, the control displays the active angle of the basic rotation in the **Angle of basic rotation** input field and the active offset in the **Offset of rotary table** input field.

In addition, the control shows the basic rotation and the offset on the **STATUS POS.** tab of the **PROGRAM + STATUS** screen layout.

When the control moves the machine axis in accordance with the basic rotation, a symbol for the basic rotation is shown in the status display.

### Rescinding basic rotation or offset

- ▶ Select the probe function by pressing the **PROBING ROT** soft key
- ▶ Enter the **Angle of basic rotation: 0**
- ▶ Alternative: Enter the **Offset of rotary table: 0**
- ▶ Apply with the **SET BASIC ROTATION** soft key
- ▶ Alternative: Apply with the **SET TABLE ROTATION** soft key
- ▶ Terminate the probing function: Press the **END** soft key

## Determining a 3-D basic rotation

You can measure the inclined position of any tilted surface by probing three positions. The **Probe in plane** function enables you to measure this inclined position and save it as a 3-D basic rotation in the preset table.




Operating and programming notes:

- The sequence and position of the touch points determines how the control will calculate the orientation of the plane.
- With the first two points, you specify the direction of the reference axis. Define the second point in the positive direction of the desired reference axis. The position of the third point determines the direction of the minor axis and of the tool axis. Define the third point in the positive Y axis of the desired workpiece coordinate system.
  - 1st point is on the reference axis
  - 2nd point is on the reference axis, in a positive direction from the first point
  - 3rd point is on the minor axis, in a positive direction of the desired workpiece coordinate system


The optional entry of a reference angle enables you to define the nominal direction of the probed plane.

## Procedure

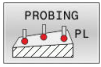


- ▶ Select the probing function: press the **PROBING PL** soft key
- ▶ The control displays the current 3-D basic rotation.
- ▶ Position the touch probe near the first touch point
- ▶ Select the probing direction or probing routine by soft key
- ▶ Start probing: press the **NC Start** key
- ▶ Position the touch probe near the second touch point
- ▶ Start probing: press the **NC Start** key
- ▶ Position the touch probe near the third touch point
- ▶ Start probing: press the **NC Start** key.
- ▶ The control measures the 3-D basic rotation and displays the values for SPA, SPB, and SPC in relation to the active coordinate system.
- ▶ If required, enter the reference angle

Activate 3-D basic rotation:

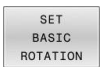


- ▶ Press the **SET BASIC ROTATION** soft key

Save the 3-D basic rotation to the preset table:

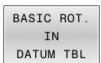


- ▶ Press the **BASIC ROT. IN PRESET TBL** soft key

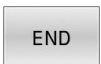

- ▶ Terminate the probing function: Press the **END** soft key

The control saves the 3-D basic rotation in the SPA, SPB, and SPC columns of the preset table.

## Displaying 3-D basic rotation

If a 3-D basic rotation is saved in the active preset, the control shows the  symbol for the 3-D basic rotation in the status display. The control moves the machine axes according to the 3-D basic rotation.

### Aligning the 3-D basic rotation

If your machine has two rotary axes and the probed 3-D basic rotation is activated, you can use the rotary axes to align the 3-D basic rotation.

#### NOTICE

##### Danger of collision!


The control does not check for collisions before aligning the rotary axes. Danger of collision if there is no pre-positioning movement.

- ▶ Move to a safe position before the alignment

Proceed as follows:



- ▶ Press the **ALIGN ROT. AXES** soft key
- > The control displays the calculated axis angles.
- ▶ Enter a feed rate

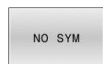

- ▶ Select a solution where necessary
- > The control activates the 3-D rotation and updates the axis-angle display.




- ▶ Select the positioning behavior



- ▶ Press the **NC start** key
- > The control aligns the axes. The Tilt working plane function becomes active for this.

After aligning the plane, you can align the reference axis with the **Probing rot** function.

### Canceling a 3-D basic rotation

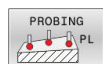


- ▶ Select the probing function: press the **PROBING PL** soft key
- ▶ Enter 0 for all angles
- ▶ Press the **SET BASIC ROTATION** soft key
- ▶ Terminate the probing function: Press the **END** soft key

## Comparison of offset and 3-D basic rotation

The following example shows how the two functions differ.

### Offset

Initial state

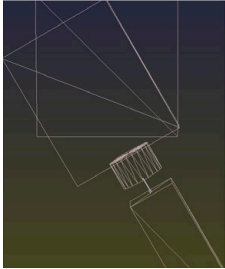


Position display:

- Actual position
- **B = 0**
- **C = 0**

Preset table:


- **SPB = 0**
- **B\_OFFS = -30**
- **C\_OFFS = +0**

Movement in +Z without tilting

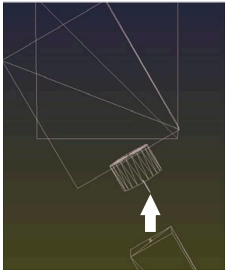

Movement in +Z with tilting


**PLANE SPATIAL** with **SPA+0 SPB+0 SPC+0**

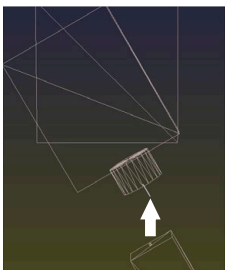

> The orientation **is not correct!**

### 3-D basic rotation

Initial state

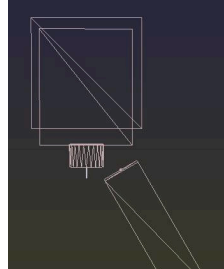


Position display:

- Actual position
- **B = 0**
- **C = 0**

Preset table:


- **SPB = -30**
- **B\_OFFS = +0**
- **C\_OFFS = +0**

Movement in +Z without tilting

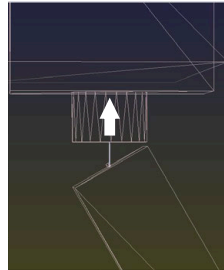

Movement in +Z with tilting

**PLANE SPATIAL** with **SPA+0 SPB+0 SPC+0**

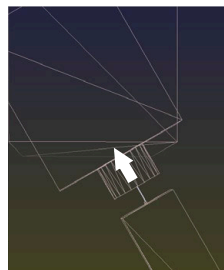


> The orientation is correct!  
> The next machining step will be **correct**.



HEIDENHAIN recommends to use the 3-D basic rotation because of its greater flexibility.

## 5.10 Presetting with a 3-D touch probe (option number 17)

### Overview

 
 
 
 



Refer to your machine manual!

The machine tool builder can disable presetting in individual axes.

If you try to set a preset in a locked axis, the control will issue either a warning or an error message, depending on what the machine tool builder has defined.

The following soft-key functions are available for setting a preset on an aligned workpiece:

Soft key	Function	Page
	Setting a preset in any axis	228
	Setting a corner as preset	229
	Setting a circle center as preset	230
	Setting the center line as preset	233




With an active datum shift, the determined value is referenced to the active preset (possibly a manual preset defined in the **Manual operation** mode). The datum shift is taken into account in the position display.


## Presetting on any axis



HEIDENHAIN only gives warranty for the function of the probing cycles if HEIDENHAIN touch probes are used.

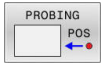

- ▶ Select the probing function: Press the **POSITION PROBING** soft key
- ▶ Move the touch probe to a position near the touch point
- ▶ Select the axis and probing direction, e.g. Probe in direction Z-
- ▶ Probe: Press the **NC Start** key
- ▶ **Preset:** Enter the nominal coordinate
- ▶ Apply with the **SET PRESET** soft key
- ▶ **Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210
- ▶ **Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- ▶ Terminate the probing function: Press the **END** soft key

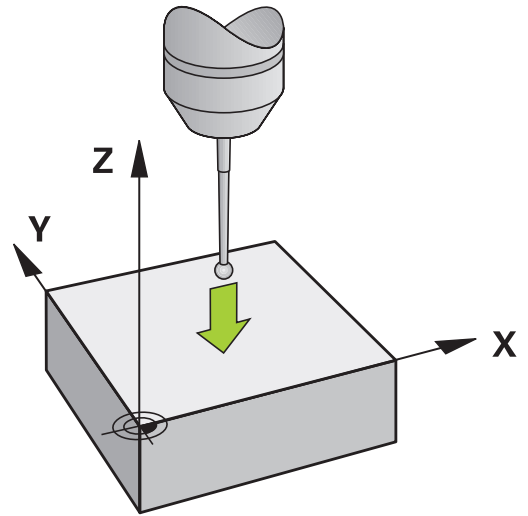



## Corner as preset




Refer to your machine manual!

It depends on the machine whether you can compensate workpiece misalignment with an offset (angle for table rotation).



HEIDENHAIN only gives warranty for the function of the probing cycles if HEIDENHAIN touch probes are used.

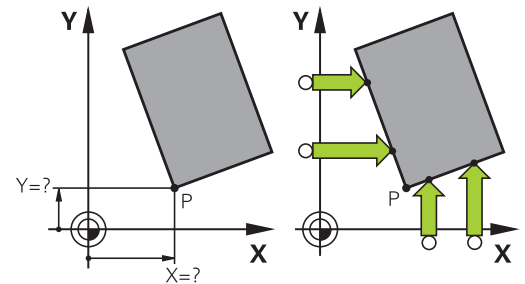

The manual "Corner as preset" probing function identifies the angle and intersection of two straight lines.



- ▶ Select the probing function: Press the **PROBING P** soft key
- ▶ Position the touch probe near the first touch point on the first workpiece edge
- ▶ Select the probe direction by soft key
- ▶ Probe: Press the **NC Start** key
- ▶ Position the touch probe near the second touch point on the same workpiece edge
- ▶ Probe: Press the **NC Start** key
- ▶ Position the touch probe near the first touch point on the second workpiece edge
- ▶ Select the probe direction by soft key
- ▶ Probe: Press the **NC Start** key
- ▶ Position the touch probe near the second touch point on the same workpiece edge
- ▶ Probe: Press the **NC Start** key
- ▶ **Preset:** Enter the X and Y coordinates of the preset in the menu window
- ▶ Apply with the **SET PRESET** soft key
- ▶ **Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210
- ▶ **Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- ▶ Terminate the probing function: Press the **END** soft key



You can determine the intersection of two straight lines using holes or studs and set it as a preset.

The **ROT 1** soft key activates the angle of the first straight line as basic rotation or as offset and the **ROT 2** soft key activates the angle or offset of the second straight line.

If you activate the basic rotation, the control automatically writes the positions and the basic rotation to the preset table.

If you activate the offset, the control automatically writes the positions and the offset or only the positions to the preset table.

### Circle center as preset

With this function, you can set the preset at the center of bore holes, circular pockets, cylinders, studs, circular islands, etc.

#### Inside circle:

The control probes the inside wall of a circle in all four coordinate axis directions.


For incomplete circles (circular arcs) you can choose the appropriate probing direction.



- ▶ Position the touch probe approximately in the center of the circle
- ▶ Select the touch probe function: Press the **PROBING CC** soft key
- ▶ Select the soft key for the desired probing direction
- ▶ Probe: Press the **NC Start** key. The touch probe probes the inside wall of the circle in the selected direction. Repeat this process. After the third probing process, you can have the control calculate the center (four touch points are recommended)
- ▶ Terminate the probing procedure and switch to the evaluation menu: Press the **EVALUATE** soft key
- ▶ **Preset:** Enter the X and the Y coordinates of the center of the circle in the menu window.
- ▶ Apply with the **SET PRESET** soft key
 

**Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210


**Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- ▶ Terminate the probing function: Press the **END** soft key

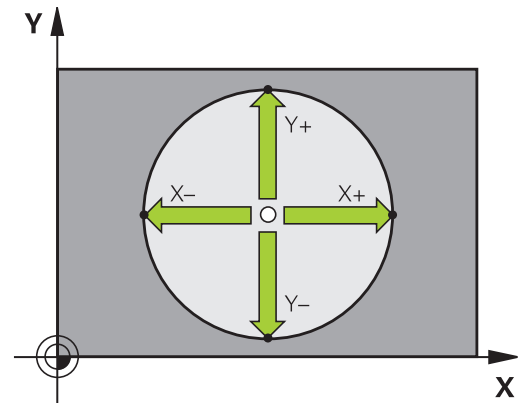

The control needs at least three touch points to calculate outside or inside circles, e.g. with circle segments. More precise results are obtained with four touch points. If possible, always pre-position the touch probe to the center.

**Outside circle:**

- ▶ Position the touch probe at a position near the first touch point outside of the circle
- ▶ Select the touch probe function: Press the **PROBING CC** soft key
- ▶ Select the soft key for the desired probing direction
- ▶ Probe: Press the **NC Start** key. The touch probe probes the inside wall of the circle in the selected direction. Repeat this process. After the third probing process, you can have the control calculate the center (four touch points are recommended)
- ▶ Terminate the probing procedure and switch to the evaluation menu: Press the **EVALUATE** soft key
- ▶ **Preset:** Enter the coordinates of the preset
- ▶ Apply with the **SET PRESET** soft key  
**Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210  
**Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- ▶ Terminate the probing function: Press the **END** soft key

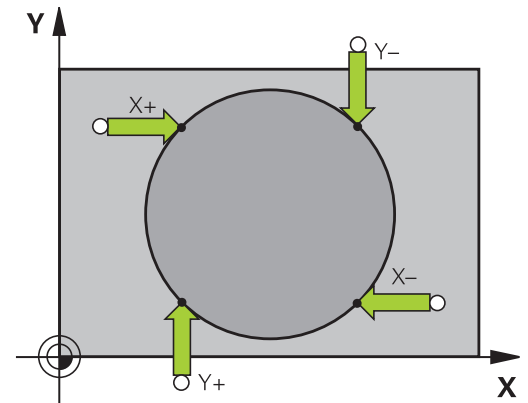

Once the probing routine is completed, the control displays the current coordinates of the circle center and the circle radius.

### Setting the preset using multiple holes or circular studs


The manual **Probing of circular pattern** probing function is part of the **Cir** probing function. Individual circles can be measured with paraxial probing operations.

A second soft-key row provides the **PROBING CC (probing of circular pattern)** soft key for using multiple holes or circular studs to set the preset. You can set the intersection of three or more elements to be probed as a preset.

### Setting the preset in the intersection of multiple holes or circular studs:

- Pre-position touch probe

Select the **Probing CC** probing function

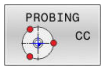


- Select the touch probe function: Press the **PROBING CC** soft key




- Press the **PROBING CC (Probing of circular pattern)** soft key

Probe a circular stud

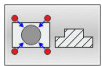

- Circular stud should be probed automatically: Press **Stud** soft key

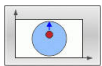

- Enter starting angle or select using soft key




- Start probing function: Press the **NC start** key

Probe the hole.



- Hole should be probed automatically: Press the **Hole** soft key

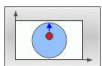


- Enter starting angle or select using soft key



- Start probing function: Press the **NC start** key
- Repeat the probing procedure for the remaining elements
- Terminate the probing procedure and switch to the evaluation menu: Press the **EVALUATE** soft key
- **Preset:** Enter the X and the Y coordinates of the center of the circle in the menu window.
- Apply with the **SET PRESET** soft key
- **Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210
- **Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- Terminate the probing function: Press the **END** soft key



## Setting a center line as preset

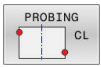

- ▶ Select the probing function: Press the **PROBING CL** soft key
- ▶ Position the touch probe at a position near the first touch point
- ▶ Select the probing direction by soft key
- ▶ Probe: Press the **NC Start** key
- ▶ Position the touch probe at a position near the second touch point
- ▶ Probe: Press the **NC Start** key
- ▶ **Preset:** Enter the coordinates of the preset in the menu window, confirm with the **SET PRESET** soft key, or write the value to a table  
**Further information:** "Writing measured values from the touch probe cycles to a datum table", Page 210  
**Further information:** "Writing measured values from the touch probe cycles to the preset table", Page 211
- ▶ Terminate the probing function: Press the **END** soft key



If you desire, then after the second touch point you can change the position of the centerline in the evaluation menu, and thus the axis for setting the preset. Use the soft keys to choose between principal axis, secondary axis, and tool axis. This way you can determine the positions once, and then store them in the principal axis as well as in the secondary axis.

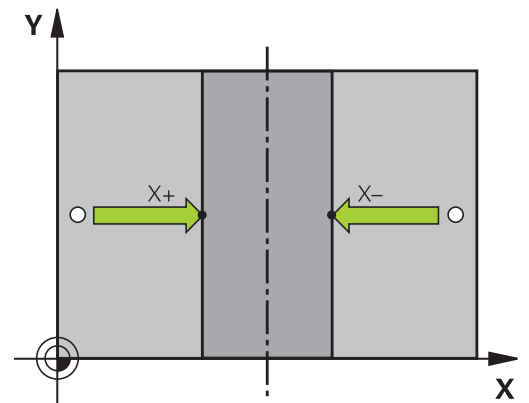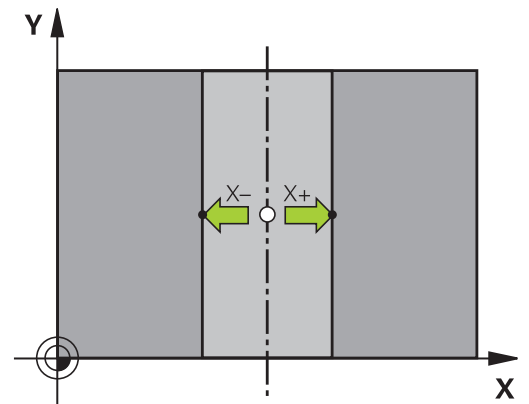

## Measuring workpieces with a 3-D touch probe


You can also use the touch probe in the **Manual operation** and **Electronic handwheel** operating modes to perform simple measurements on the workpiece. Numerous programmable touch-probe cycles are available for more complex measuring tasks.

**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**

With a 3-D touch probe you can determine:

- Position coordinates, and from them,
- Dimensions and angles on the workpiece

### Finding the coordinates of a position on an aligned workpiece

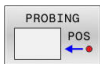

- ▶ Select the probing function: Press the **PROBING POS** soft key
- ▶ Move the touch probe to a position near the touch point
- ▶ Select the probing direction and the axis to which the coordinates relate: Use the corresponding soft keys to select
- ▶ Start the probing process: Press the **NC Start** key
- ▶ The control shows the coordinates of the touch point as preset.


### Finding the coordinates of a corner point on the working plane

Find the coordinates of the corner point.


**Further information:** "Corner as preset ", Page 229

The control displays the coordinates of the probed corner as preset.

### Measuring workpiece dimensions

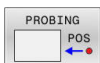

- ▶ Select the probing function: Press the **PROBING POS** soft key
- ▶ Position the touch probe at a position near the first touch point A
- ▶ Select the probing direction by soft key
- ▶ Probe: Press the **NC Start** key
- ▶ If you need the current preset later, write down the value that appears in the display
- ▶ Preset: Enter **0**.
- ▶ Cancel the dialog: Press the **END** key
- ▶ Select the probing function again: Press the **PROBING POS** soft key
- ▶ Position the touch probe at a position near the second touch point B
- ▶ Select the probe direction with the soft keys: Same axis but from the opposite direction
- ▶ Probe: Press the **NC Start** key
- ▶ The **Measured value** display shows the distance between the two points on the coordinate axis.

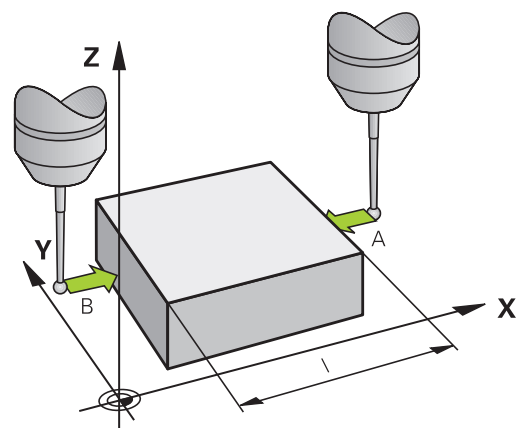

### Resetting to the preset that was active before the length measurement

- ▶ Select the probing function: Press the **PROBING POS** soft key
- ▶ Probe the first touch point again
- ▶ Set the preset to the value that you wrote down previously
- ▶ Cancel the dialog: Press the **END** key


### Measuring angles

You can use the 3-D touch probe to measure angles in the working plane. You can measure


- The angle between the angle reference axis and a workpiece edge; or
- the angle between two sides

The measured angle is displayed as a value of max. 90°.


### Finding the angle between the angle reference axis and a workpiece edge

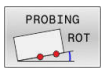


- ▶ Select the probe function by pressing the **PROBING ROT** soft key
- ▶ Rotation angle: If you wish to restore the current basic rotation later, note the value that appears under Rotation Angle
- ▶ Perform a basic rotation with the workpiece edge to be compared  
**Further information:** "Compensating workpiece misalignment with 3-D touch probe (option 17)", Page 218
- ▶ Press the **PROBING ROT** soft key to display the angle between the angle reference axis and the workpiece edge as the rotation angle
- ▶ Cancel the basic rotation, or restore the previous basic rotation
- ▶ Set the rotation angle to the value that you previously wrote down

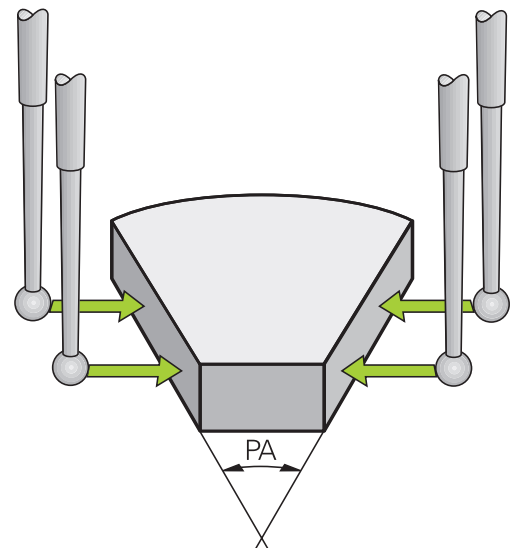

### Measuring the angle between two workpiece edges

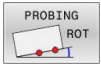

- ▶ Select the probe function by pressing the **PROBING ROT** soft key
- ▶ Rotation angle: If you wish to restore the current basic rotation later, note the value that appears under Rotation Angle
- ▶ Perform a basic rotation with the workpiece edge to be compared  
**Further information:** "Compensating workpiece misalignment with 3-D touch probe (option 17)", Page 218
- ▶ Probe the second edge in the same way as for a basic rotation, but do not set the rotation angle to 0
- ▶ Press the **ROTATION PROBING** soft key to display the angle PA between the workpiece edges as the rotation angle
- ▶ Cancel the basic rotation, or restore the previous basic rotation by setting the rotation angle to the value that you wrote down previously

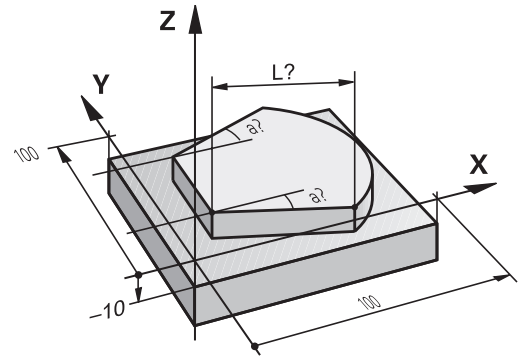



## 5.11 Tilting the working plane (option 8)

### Application, function



Refer to your machine manual!

The **Tilt working plane** functions are adapted to the control and the machine tool by the machine tool builder.


The machine tool builder also specifies whether the programmed angles are interpreted by the control as coordinates of the rotary axes (axis angles) or as angular components of a tilted plane (spatial angles).

The control supports the tilting functions on machine tools with swivel heads and/or tilting tables. Typical applications are, for example, oblique holes or contours in an oblique plane. The working plane is always tilted relative to the active datum. The program is written as usual for machining in a main plane, such as the X/Y plane, but is executed in a plane that is tilted relative to the main plane.

There are three functions available for tilting the working plane:

- Manual tilting with the **3-D ROT** soft key in the **Manual operation** and **Electronic handwheel** operating modes  
**Further information:** "Activating manual tilting", Page 239
- Tilting under program control, Cycle **19 WORKING PLANE** in the NC program  
**Further information:** User's Manual for **Programming of Machining Cycles**
- Tilting under program control, **PLANE** function in the NC program  
**Further information:** User's Manual for Klartext Programming or ISO Programming

The control functions for tilting the working plane are coordinate transformations. The working plane is always perpendicular to the direction of the tool axis.

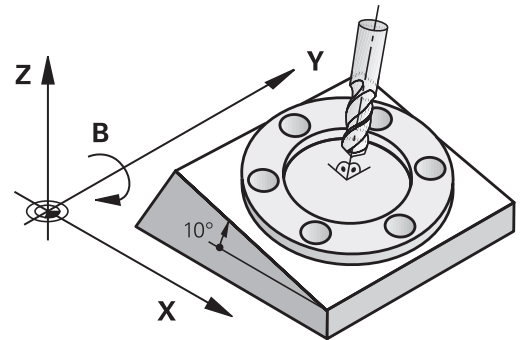

### Machine types

When tilting the working plane, the control differentiates between two machine types:

#### Machine with tilting table

- You must bring the workpiece into the desired position for machining by positioning the tilting table accordingly, for example with an L block.
- The position of the transformed tool axis **does not change** relative to the machine coordinate system. Thus if you rotate the table—and therefore the workpiece—by 90° for example, the coordinate system **does not rotate**. If you press the Z+ axis direction key in the **Manual operation** mode, the tool moves in Z+ direction.
- When calculating the active (transformed) coordinate system, the control considers only the mechanically influenced offsets of the particular tilting table (the translational components).

#### Machine with swivel head

- You must bring the tool into the desired position for machining by positioning the swivel head accordingly, for example with an L block
- The position of the tilted (transformed) tool axis changes relative to the machine coordinate system. Thus if you rotate the swivel head of your machine—and therefore the tool—in the B axis by +90° for example, the coordinate system also rotates. If you press the Z+ axis direction key in the **Manual operation** mode, the tool moves in the X+ direction of the machine coordinate system.
- When calculating the active coordinate system, the control considers both the mechanically influenced offsets of the particular swivel head (the translational components) as well as offsets caused by tilting of the tool (3-D tool length compensation).



The control only supports the **Tilt working plane** function in combination with spindle axis Z.

### Position display in a tilted system


The positions displayed in the status window (**ACTL.** and **NOML.**) are referenced to the tilted coordinate system.

In the machine parameter **CfgDisplayCoordSys** (no. 127501), the machine tool builder specifies the coordinate system in which the status display shows an active datum shift.

### Limitations on working with the tilting function

- The **Actual-position capture** function is not allowed if the Tilt working plane function is active
- PLC positioning (determined by the machine tool builder) is not possible.

## Activating manual tilting

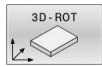

- ▶ Press the **3-D ROT** soft key
- ▶ The control opens the **Tilt the working plane** pop-up window.
- ▶ Use the arrow keys to position the cursor on the desired function



- **Manual Operation Tool Axis**
- **Manual Operation 3-D ROT**
- **Manual Operation Basic Rotation**



- ▶ Press the **ACTIVE** soft key




- ▶ If required, use the arrow keys to position the cursor on the desired rotary axis



- ▶ If applicable, press the **3-D ROT: AXIS ANGLE SPA. ANGLE** soft key
- ▶ The control now displays the spatial angle input fields.
- ▶ If required, enter the tilting angle



- ▶ Press the **END** key
- ▶ The input is complete.

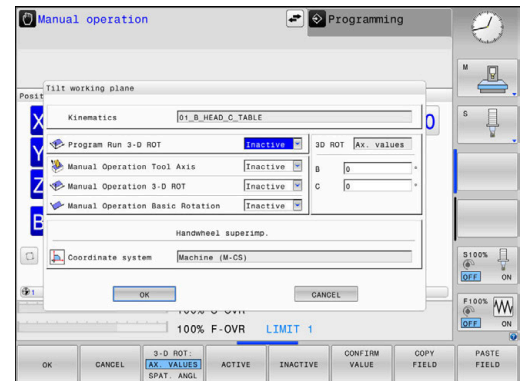


By setting **Manual Operation 3-D ROT** to **Active**, you can press the **3-D ROT: AXIS ANGLE SPA. ANGLE** soft key to toggle between axis values and spatial angles.

## Manual Operation Tool Axis



Refer to your machine manual!  
Your machine manufacturer enables this function.


If the Traverse in Tool Axis function is active, the control displays the  icon in the status display.

You can only move in the direction of the tool axis. The control locks all other axes.

The traverse is effective in the T-CS tool coordinate system.

**Further information:** "Tool coordinate system T-CS", Page 120

## Manual Operation 3-D ROT

If the 3-D ROT function is active, the control displays the  icon in the status display.


All axes move in a tilted working plane.

If a basic rotation or 3-D basic rotation has additionally been saved to the preset table, it will automatically be taken into account.

The axis movements are effective in the WPL-CS working plane coordinate system.

**Further information:** "Working plane coordinate system WPL-CS", Page 118

### Manual Operation Basic Rotation

If the basic rotation function is active, the control displays the  icon in the status display.

If a basic rotation or a 3-D basic rotation has already been saved to the preset table, the control additionally displays the corresponding icon.



If the **Manual Operation Basic Rotation** function is active, an active basic rotation or 3-D basic rotation will be taken into account during manual movement of the axes. The control displays two icons in the status display.

The axis movements are effective in the W-CS workpiece coordinate system.

**Further information:** "Workpiece coordinate system W-CS", Page 116

### Program Run 3-D ROT

If you set the **Tilt working plane** function to **Active** for the **Program run** mode, the tilt angle entered in the menu will be effective starting from the first NC block of the NC program to be run.

If you use Cycle **19 WORKING PLANE** or the **PLANE** function in the NC program, the angular values defined there become effective. Angle values entered in the menu will be set to 0.



The control uses the following **transformation types** for tilting:

- **COORD ROT**
  - if a **PLANE** function was previously executed with **COORD ROT**
  - after **PLANE RESET**
  - with corresponding configuration of the machine parameter **CfgRotWorkPlane** (no. 201200) by the machine tool builder
- **TABLE ROT**
  - if a **PLANE** function was previously executed with **TABLE ROT**
  - with corresponding configuration of the machine parameter **CfgRotWorkPlane** (no. 201200) by the machine tool builder



If tilting was active when the control was shut down, then the control will also perform movements in the tilted working plane when it is turned on again.

**Further information:** "Crossing the reference point in a tilted working plane", Page 167

### Deactivating manual tilting

To deactivate, set the desired function to **Inactive** in the **Tilt working plane** menu.

Even if the **3-D ROT** dialog in the **Manual operation** mode is set to **Active**, resetting the tilting (**PLANE RESET**) with an active basic transformation will still work correctly.

### Setting the tool-axis direction as the active machining direction




Refer to your machine manual!  
Your machine manufacturer enables this function.

Using this function in the **Manual operation** and **Electronic handwheel** operating modes, you can move the tool in the direction in which the tool axis is currently pointed using the axis-direction keys or the handwheel.

Use this function if

- You want to retract the tool in the direction of the tool axis during suspension of a 5-axis machining program
- You want to machine with an inclined tool using the handwheel or the axis direction keys in Manual Operation mode

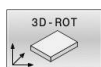

- ▶ To select manual tilting, press the **3-D ROT** soft key.



- ▶ Use the cursor keys to move the cursor to the **Manual Operation Tool Axis** menu item




- ▶ Press the **ACTIVE** soft key



- ▶ Press the **END** key


To deactivate, set the **Manual Operation Tool Axis** menu item in the Tilt working plane menu to **Inactive**.

The  icon appears in the status display when the Move in tool axis direction function is active.

### Setting a preset in a tilted coordinate system

After you have positioned the rotary axes, set the preset in the same manner as for a non-tilted system. The behavior of the control during presetting depends on the setting in the optional machine parameter **chkTiltingAxes** (no. 204601):

**Further information:** "Introduction", Page 201

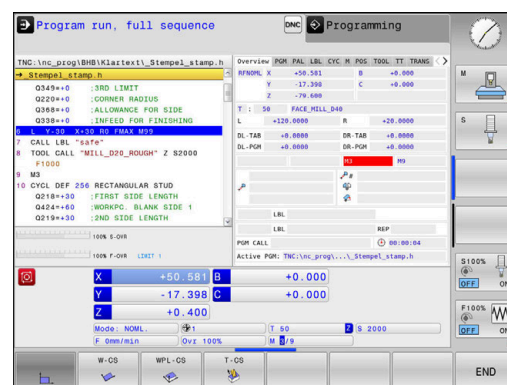



# 6

**Testing and  
running**

## 6.1 Graphics (option 20)

### Application

The control graphically simulates a machining operation in the following operating modes:

- **Manual operation**
- **Program run, single block**
- **Program run, full sequence**
- **Test Run**
- **Positioning w/ Manual Data Input**



In **Positioning w/ Manual Data Input** operating mode, the workpiece blank that is currently active in the **Program Run, Full Sequence/Single Block** operating mode is shown.

The graphic depicts the workpiece as if it were being machined with tool.

If a tool table is active, the control also takes the entries in columns **L**, **LCUTS**, **LU**, **RN**, **T-ANGLE**, and **R2** into consideration.

The control will not show a graphic if

- no NC program is selected
- a screen layout without graphics was selected
- the current NC program has no valid workpiece blank definition
- with blank form definition with a subprogram, the BLK FORM block was not yet run



The simulation of NC programs with 5-axis machining or tilted machining might run at reduced speed. In the **Graphic settings** group of the MOD menu, you can decrease the **Model quality** and thus increase the speed of simulation.

**Further information:** "Graphic settings", Page 346



If you are using a TNC 620 with touch control, you can replace some keystrokes with gestures.

**Further information:** "Operating the touchscreen", Page 461



**Graphics without Option 20 Advanced Graphic Features**

Without option 20, you will not have a model available in the following operating modes:

- **Manual operation**
- **Program run, single block**
- **Program run, full sequence**
- **Test Run**
- **Positioning w/ Manual Data Input**

The **PROGRAM + WORKPIECE** and **WORKPIECE** soft keys appear dimmed.

The line graphic in **Programming** operating mode also functions without option 20.

## View options

Display the **VIEW OPTIONS** as follows:

- ▶ Select the desired operating mode
- ▶ Press the **VIEW OPTIONS** soft key

 



 


The available soft keys depend on the following settings:

- The selected view  
You can select the view with the **VIEW** soft key.
- The selected model quality  
You can select the model quality in the **Graphic settings** group of the MOD menu.

The control provides the following **VIEW OPTIONS**:

Soft key	Function
	Show the workpiece
	Show the tool <b>Further information:</b> "Tool", Page 247
	Show the tool paths <b>Further information:</b> "Tool", Page 247
	Select the view <b>Further information:</b> "View", Page 248
	Reset the tool paths
	Reset the workpiece blank
	Show the workpiece blank frame
	Highlight the workpiece edges on 3-D model
	Show the STL file of the finished part <b>Further information:</b> User's Manual for <b>Klartext Programming</b> or <b>ISO Programming</b>
	Show the block numbers of the tool paths
	Show the end points of the tool paths

Soft key	Function
	Show the workpiece in color
	Remove the chips Parts of the workpiece material that are cut off by machining will be removed from the graphics.
	Reset the tool paths
	Rotate and zoom the workpiece <b>Further information:</b> "Rotating, zooming and moving a graphic", Page 250
	Shift the sectional plane in the projection in three planes <b>Further information:</b> "Shifting the sectional plane", Page 252



#### Operating notes:

- The **clearPathAtBlk** machine parameter (no. 124203) allows you to specify whether the tool paths are cleared with a new BLK FORM in **Test Run** operating mode.
- If points were output incorrectly by the postprocessor, machining marks may occur on the workpiece. To recognize these unwanted machining marks in time (prior to machining), you can test externally created NC programs for corresponding irregularities by displaying the tool paths.
- The control saves the state of the soft keys in non-volatile memory.

## Tool

### Displaying the tool

If the **L** and **LCUTS** columns are defined in the tool table, the tool is graphically displayed.



A realistic tool simulation may require additional definitions (e.g., in the columns **LU** and **RN** for tool neck surfaces).




**Further information:** "Entering tool data into the table", Page 133

The control displays the tool in various colors:

- Turquoise: tool length
- Red: length of cutting edge and tool is engaged
- Blue: length of cutting edge and tool is retracted


### Showing the tool paths

The control displays the following types of movement:

Soft key	Function
	Movements at rapid traverse and at the programmed feed rate
	Movements at the programmed feed rate
	No movements


 



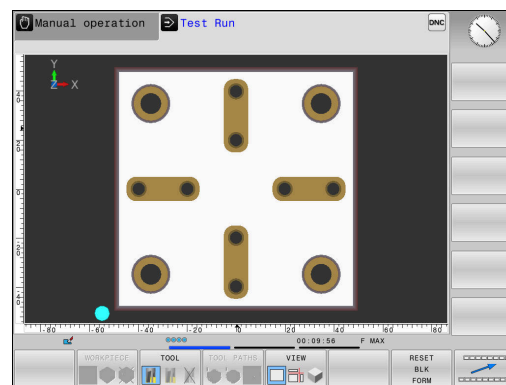
If you move at rapid traverse inside a workpiece, both the movement and the workpiece are shown in red at the respective location.

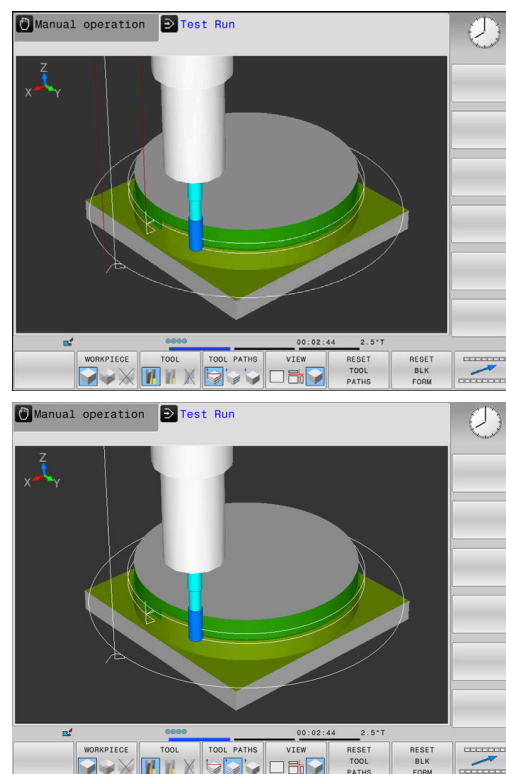

### View


The control provides the following views:

Soft key	Function
	Plan view
	Projection in three planes
	3-D view




### Projection in three planes

The simulation shows three sectional planes and a 3-D model, similar to a technical drawing.

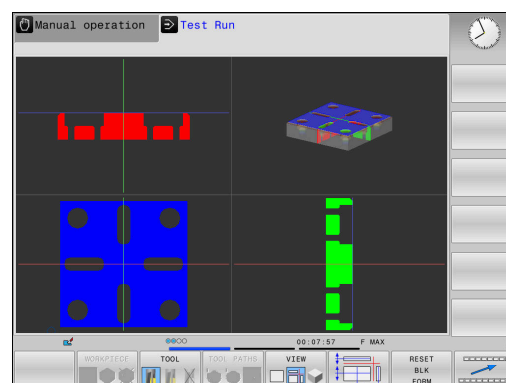


### 3-D view

The high-resolution 3-D view enables you to display the surface of the machined workpiece in greater detail. Using a simulated light source, the control creates realistic light and shadow conditions.

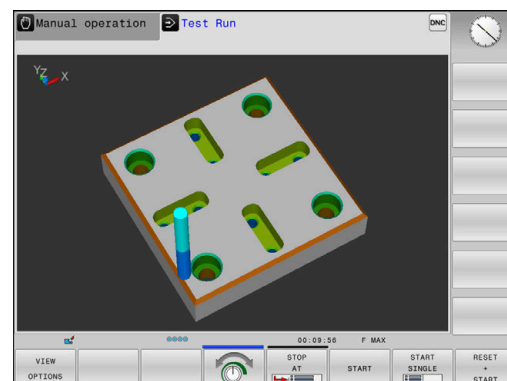

## Rotating, zooming and moving a graphic

Proceed as follows to rotate a graphic, for example:

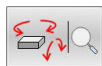


- ▶ Select functions for rotating and zooming
- The control displays the following soft keys.

Soft key		Function
		Rotate in 5° steps about the vertical axis
		Tilt in 5° steps about the horizontal axis
		Enlarge the graphic stepwise
		Reduce the graphic stepwise
		Reset the graphic to its original size and angle
		Move the graphic upward or downward
		Move the graphic to the left or right
		Reset the graphic to its original position and angle

You can also use the mouse to change the graphic display. The following functions are available:





- ▶ In order to rotate the model shown in three dimensions, hold down the right mouse button and move the mouse. If you simultaneously press the shift key, you can only rotate the model horizontally or vertically
- ▶ To shift the model shown: Hold the center mouse button or mouse wheel down and move the mouse. If you simultaneously press the shift key, you can only shift the model horizontally or vertically
- ▶ To zoom in on a certain area: Mark a zoom area by holding the left mouse button down.
- After you release the left mouse button, the control zooms in on the defined area.
- ▶ To rapidly magnify or reduce any area: Rotate the mouse wheel backwards or forwards
- ▶ To return to the standard display: Press the shift key and simultaneously double-click with the right mouse key. The rotation angle is maintained if you only double-click with the right mouse key

Setting the speed of the Test Run mode




The most recently set speed stays active until a power interruption. After the control has been started, the speed is set to MAX.


After you have started a program, the control displays the following soft keys with which you can set the simulation speed:

Soft key	Functions
	Test the NC program with the speed that will be used when actually running the program (programmed feed rates will be taken into account)
	Increase the simulation speed incrementally
	Decrease the simulation speed incrementally
	Test run at the maximum possible speed (default setting)

You can also set the simulation speed before you start a program:




- ▶ Select the function for setting the simulation speed



- ▶ Select the desired function by soft key, e.g. incrementally increasing the simulation speed

Repeating graphic simulation


A part program can be graphically simulated as often as desired. To do so you can reset the graphic to the workpiece blank.

Soft key	Function
	Show the unmachined workpiece blank

## Shifting the sectional plane

The default setting of the sectional plane is selected so that it lies in the working plane in the center of the workpiece blank and in the tool axis on the top surface of the workpiece blank.

Proceed as follows to move the sectional plane:

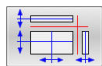

- ▶ Press the soft key for **shifting the sectional plane**
- ▶ The control displays the following soft keys:


Soft key	Function
	Shift the vertical sectional plane to the right or left
	Shift the vertical sectional plane forward or backward
	Shift the horizontal sectional plane upwards or downwards

The position of the sectional planes is visible during shifting. The shift remains active, even if you activate a new workpiece blank.

## Resetting sectional planes

The shifted sectional plane also remains active for a new workpiece blank. The sectional plan is automatically reset when the control is restarted.

Proceed as follows to move the sectional plane to the default position:

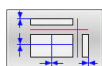

- ▶ Press the soft key for **resetting the sectional planes** soft key



## 6.2 Monitoring for collisions

### Application

Extended collision monitoring is available in **Test Run** operating mode.

The control issues a warning in the following events:

- Collisions between the tool holder and the workpiece
- Collisions between the tool and the workpiece
- The control also considers inactive steps of a stepped tool.
- During material removal at rapid traverse




Extended collision monitoring helps you reduce the risk of collision. However, the control cannot consider all possible constellations during operation.

To activate extended collision monitoring, proceed as follows:



- ▶ Set the soft key to **ON**
- ▶ The control performs extended collision monitoring during a test run.

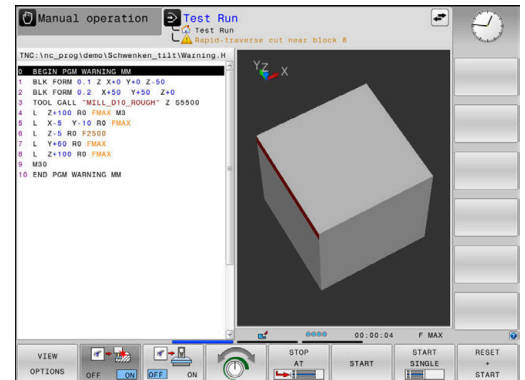

## 6.3 Measurement of machining time (option 20)

### Application

#### Machining time in the Test Run operating mode

The control calculates the duration of the tool movements and displays this as machining time in the test run. The control takes feed movements and dwell times into account.

The time determined by the control is only of limited value for calculating the machining time because it does not take any machine-dependent time intervals (e.g., for tool changes) into consideration.


 

Proceed as follows to select the stopwatch function:



- ▶ Select the stopwatch function



- ▶ Select the desired function by soft key, e.g. saving the displayed time

Soft key	Stopwatch functions
	Save the displayed time
	Display the sum of saved time and displayed time
	Clear the displayed time

#### Machining time in the machine operating modes

Time display from program start to program end. The timer stops whenever machining is interrupted.

## 6.4 Showing the workpiece blank in the working space (option 20)

### Application

In **Test Run** operating mode, you can graphically check the position of the workpiece blank and the preset in the working space of the machine. The graphic shows the preset that has been set in the NC program using Cycle **247**. If you have not defined a preset in the NC program, then the graphic shows the active preset on the machine.


A transparent cuboid represents the workpiece blank. Its dimensions are shown in the **BLK FORM** table. The control takes over the dimensions from the workpiece blank definition of the selected NC program.







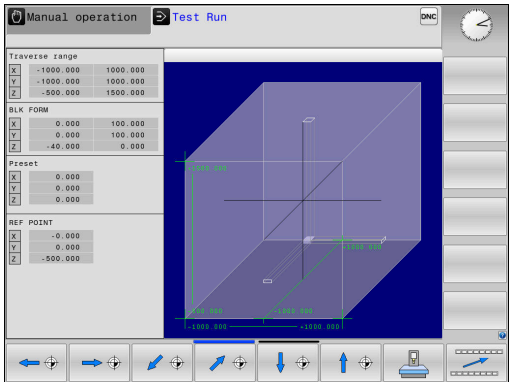


For a test run it normally does not matter where the workpiece blank is located within the working space. If you activate **BLANK IN WORK SPACE** working space monitoring, you must graphically shift the workpiece blank so that it lies within the working space. Use the soft keys shown in the table.


 

In addition, you can use the current machine status for the **Test Run** operating mode.

The current machine status includes the following:

- active machine kinematics
- active traverse ranges
- active machining modes
- active working spaces
- active preset



Soft key	Function
 	Shift the workpiece blank in positive or negative X direction
 	Shift the workpiece blank in positive or negative Y direction
 	Shift the workpiece blank in positive or negative Z direction
	Use the current machine status
	Display the current traverse range
	Select the traverse range The ranges of traverse are configured by the machine manufacturer.

Soft key	Function
	Switch on/off the monitoring function
	Display the machine preset
	Set the principal axis values of the active preset to 0 for the simulation



For blank in work space, the control depicts the **BLK FORM** only schematically.

- With **BLK FORM CYLINDER**, a cuboid is depicted as the workpiece blank
- With **BLK FORM ROTATION**, no workpiece blank is depicted

## 6.5 Measuring

### Application


In **Test Run** operating mode, you can use the **MEASURING** soft key to display the following information:

- Approximate coordinates as XYZ values
- Optional display
  - FMAX: If the control machines at the maximum feed rate.
- Tool number
- Tool name

Proceed as follows to select the measuring function:



- ▶ Set the **MEASURING** soft key to **ON**
- ▶ Position the mouse pointer on the respective position
- ▶ The control displays the positioning ball icon and the surface orientation with a black and white circle and a perpendicular line on it.
- ▶ The corresponding information is displayed in a blue text field.

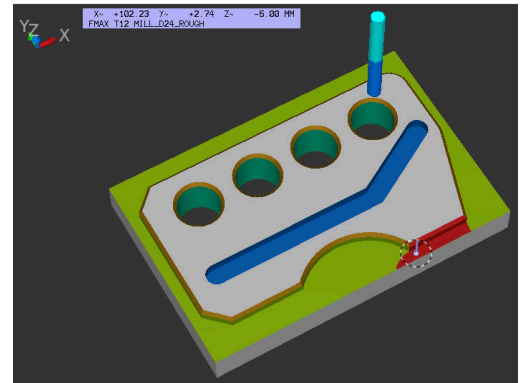

The **MEASURING** soft key is available in the following views:

- Plan view
- 3-D view

**Further information:** "View", Page 248

## 6.6 Optional program-run interruption

### Application



Refer to your machine manual!

The behavior of this function varies depending on the respective machine.

The control optionally interrupts program run at NC blocks in which an M1 has been programmed. If you use M1 in the **Program run** operating mode, the control does not switch off the spindle or the coolant.



- ▶ Set the **M01** soft key to **OFF**
- > The control does not interrupt the **Program run** or **Test Run** at NC blocks that contain an M1.



- ▶ Set the **M01** soft key to **ON**
- > The control interrupts the **Program run** or **Test Run** at NC blocks with M1.

## 6.7 Skipping NC blocks

You can have NC blocks skipped in the following operating modes:

- **Test Run**
- **Program run, full sequence**
- **Program run, single block**
- **Positioning w/ Manual Data Input**




Operating notes:

- This function does not work for **TOOL DEF** blocks.
- After a power interruption the control returns to the most recently selected setting.
- The setting of the **HIDE** soft key is only effective in the respective operating mode.

### Test Run and Program Run

#### Application

In **Test Run** or **Program Run, Full Sequence/Single Block** operating mode, the control can skip over NC blocks that you have preceded by a slash (/):

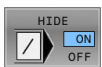

- ▶ Set the **HIDE** soft key to **ON**
- > The control skips the NC blocks.



- ▶ Set the **HIDE** soft key to **OFF**
- > The control runs or tests the NC blocks.

#### Procedure

You can optionally hide NC blocks.

To hide NC blocks in the **Programming** mode, proceed as follows:



- ▶ Select the desired NC block



- ▶ Press the **INSERT** soft key
- > The control inserts a slash (/).

To show NC blocks again in the **Programming** mode, proceed as follows:



- ▶ Select the hidden NC block



- ▶ Press the **REMOVE** soft key
- > The control removes the slash (/).

## Positioning w/ Manual Data Input

### Application



In order to skip NC blocks in the **Positioning w/ Manual Data Input** operating mode, you need an alphabetic keyboard.

In **Positioning w/ Manual Data Input** operating mode, you can have the control skip NC blocks that have been marked correspondingly. Proceed as follows:



- ▶ Set the **HIDE** soft key to **ON**
- > The control skips the NC blocks.



- ▶ Set the **HIDE** soft key to **OFF**
- > The control runs the NC blocks.

### Procedure

To hide NC blocks in the **Positioning w/ Manual Data Input** operating mode, proceed as follows:



- ▶ Select the desired NC block



- ▶ Press the **/** key on the alphabetic keyboard
- > The control inserts a slash (/).

To show NC blocks again in the **Positioning w/ Manual Data Input** operating mode, proceed as follows:



- ▶ Select the hidden NC block



- ▶ Press the **Backspace** key
- > The control removes the slash (/).



## 6.8 Exporting a finished part

### Application

In **Test Run** operating mode, the **EXPORT WORKPIECE** soft key allows you to export the current status of the motion simulation as a 3-D model in STL format.

The file size depends on the complexity of the geometry.



You can use the exported STL files as a workpiece blank in the NC program of a subsequent machining step, for example.



**Further information:** User's Manual for **Klartext Programming** or **ISO Programming**

To export a 3-D model, proceed as follows:

- Set the motion simulation to the desired status

EXPORT  
WORKPIECE

- Press the **EXPORT WORKPIECE** soft key
- The control opens a pop-up window.
- Enter the desired file name
- Select the desired target directory
- Confirm the data entered

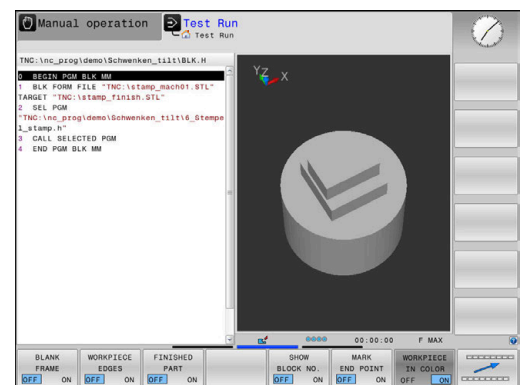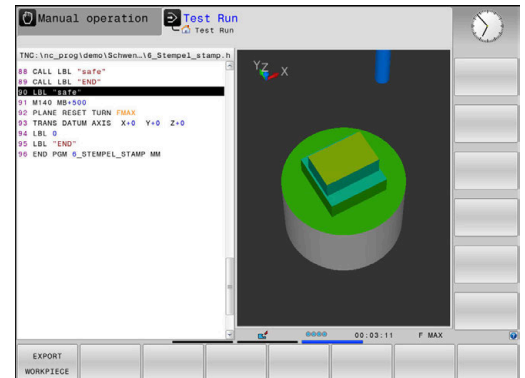

## 6.9 Test run

### Application

The simulation of NC programs and program sections in **Test Run** operating mode helps you to detect programming errors, as well as collisions and interruptions during program run, before the actual machining process. The motion simulation enables the visual inspection of both the machining result and the machine movements.

The control helps you detect the following problems:

- Programming errors
  - Geometrical incompatibilities
  - Missing data
  - Impossible jumps
  - Material removal at rapid traverse
- Machining errors
  - Usage of locked tools
  - Violation of the machine's working space
  - Collisions between the tool shank or tool holder and the workpiece

The following functions and information are available:

- Block-by-block simulation
- Cancellation of test at any NC block
- Hiding or skipping of NC blocks
- Determined machining time
- Additional status display
- Graphic display



The graphical representation functions and the quality of the represented model depend on the settings in the **Graphic settings** MOD function.

**Further information:** "Graphic settings", Page 346

**Keep the following in mind when performing a test run**

With cuboid workpiece blanks, the control starts a test run after a tool call at the following position:

- In the working plane in the center of the defined **BLK FORM**
- In the tool axis, 1 mm above the **MAX** point defined in the **BLK FORM**

With rotationally symmetrical workpiece blanks, the control starts a test run after a tool call at the following position:

- In the machining plane at the position  $X=0, Y=0$
- In the tool axis 1 mm above the defined workpiece blank

The **FN 27: TABWRITE** and **FUNCTION FILE** functions are only considered in the **Program run, single block** and **Program run, full sequence** operating modes.

**NOTICE****Danger of collision!**

In the **Test Run** operating mode, the control does not take all axis movements of the machine into consideration (e.g., PLC positioning movements as well as movements from tool-change macros and M functions). Thus, the test might be performed without errors, but later operation will deviate from these results. Danger of collision during machining!

- ▶ Test the NC program using the later machining position (**BLANK IN WORK SPACE**)
- ▶ Program a safe intermediate position after the tool change and before prepositioning
- ▶ Carefully test the NC program in the **Program run, single block** operating mode



Refer to your machine manual!

Your machine tool builder can also define a tool-change macro for the **Test Run** operating mode. This macro will simulate the exact behavior of the machine.

In doing so, the machine tool builder often changes the simulated tool change position.

## Test run execution



For the test run, you must activate a tool table (status S). Select a tool table via the file manager in the **Test Run** operating mode.

You can select any preset table (status S) for the test run.

Once you press the **RESET + START** soft key in the **Test Run** operating mode, the control automatically uses the active preset from the machine operating modes for simulation. This preset remains selected when starting the test run until you define another preset in the NC program. The control reads all other defined presets from the preset table selected for the test run.

With the **BLANK IN WORK SPACE** function, you can activate workspace monitoring for the test run.

**Further information:** "Showing the workpiece blank in the working space (option 20)", Page 255



- ▶ Operating mode: Press the **Test Run** key



- ▶ Call the file manager with the **PGM MGT** key and select the file you wish to test

### The control then displays the following soft keys:

Soft key	Function
	Reset the blank form, reset the previous tool data and test the entire NC program
	Test the entire NC program
	Test each NC block individually
	Executes the <b>Test Run</b> until NC block N
	Stop test run (this soft key only appears if you have started the test run)

You can interrupt and continue the test run at any time, even within machining cycles. In order to continue the test, the following actions must not be performed:

- Selecting another NC block with the arrow keys or the **GOTO** key
- Making changes to the NC program
- Selecting another NC program


## Executing a Test Run up to a certain NC block

With the **STOP AT** function, the control executes a **Test Run** up to the NC block with block number **N**.

To stop the **Test Run** at the desired NC block, proceed as follows:



- ▶ Press the **STOP AT** soft key
- ▶ **Stop at: N** = Enter the block number at which the simulation should stop
- ▶ **Program**: Enter the name of the NC program containing the NC block with the selected block number
- ▶ The control shows the name of the selected NC program.
- ▶ If the simulation is to be stopped in an NC program that has been called using **PGM CALL**, then enter this name
- ▶ **Repetitions** = If **N** is located in a program-section repeat, enter the number of repeats that you want to run.  
Default 1: The control stops before **N** is simulated

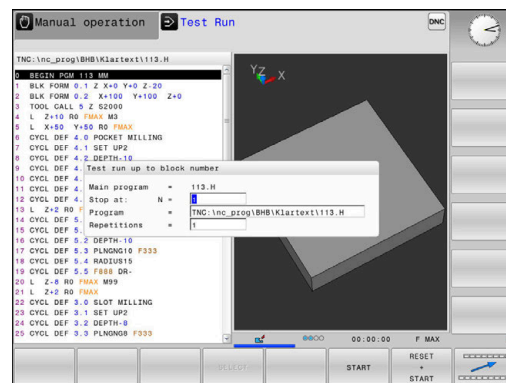

## Possibilities in stopped condition

If you interrupt the **Test Run** with the **STOP AT** function, you have the following possibilities in this stopped condition:

- Enable or disable **NC block skip**
- **Optional program stop** enable or disable
- Modify graphics resolution and model
- Modify the NC program in the **Programming** operating mode

If you modify the NC program in the **Programming** operating mode, the simulation behaves as follows:

- Modification before the interruption point: The simulation restarts at the beginning
- Modification after the interruption point: Positioning at the interruption point is possible with **GOTO**

## Using the GOTO key

### Jumping with the GOTO key

Use the **GOTO** key to jump to a specific location in the NC program, regardless of the active operating mode.

Proceed as follows:

- ▶ Press the **GOTO** key
- ▶ The control opens a pop-up window.
- ▶ Enter a number
- ▶ Select the jump statement by soft key, e.g. move down the number of lines entered



The control provides the following options:

Soft key	Function
	Move up the number of lines entered
	Move down the number of lines entered
	Jump to the block number entered



Use the **GOTO** function only during programming and testing of NC programs. Use the block scan function during program run.

**Further information:** "Any entry into the NC program: Block scan", Page 280

### Quick selection with the GOTO key

With the **GOTO** key, you can open the Smart Select window that makes it easy for you to select special functions or cycles.

Proceed as follows to select special functions:

- ▶ Press the **SPEC FCT** key
- ▶ Press the **GOTO** key
- ▶ The control displays a pop-up window showing a structural view of the special functions
- ▶ Select the desired function



**Further information:** User's Manual for **Programming of Machining Cycles**

### Opening the selection window with the GOTO key

When the control provides a selection menu, you can use the **GOTO** key to open the selection window. This allows you to view the available entries.

## Scrollbar

Screen content can be shifted with the mouse using the scrollbar at the right edge of the program window. In addition, the size and position of the scrollbar indicates program length and cursor position.

## 6.10 Program run


### Application

In the **Program run, full sequence** operating mode, the control executes an NC program continuously to its end or up to a program stop.

In the **Program run, single block** operating mode, the control executes each NC block individually after pressing the **NC Start** key. With point pattern cycles and **CYCL CALL PAT**, the control stops after each point. The workpiece blank definition will be interpreted as a separate NC block.

You can use the following control functions in the **Program run, single block** and **Program run, full sequence** operating modes:

- Interrupt program run
- Start the program run from a certain NC block
- Skip NC blocks
- Edit the tool table TOOL.T
- Edit the active datum table or compensation table
- Checking and changing Q parameters
- Superimpose handwheel positioning
- Functions for graphic simulation
- Additional status display

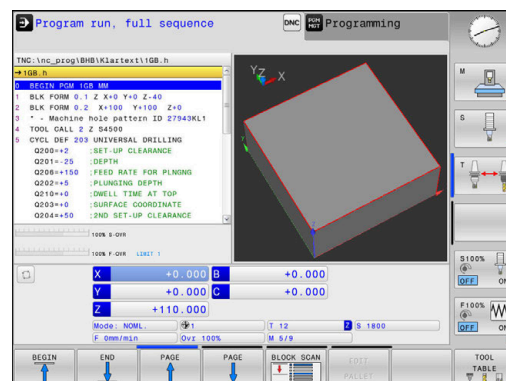

### Running an NC program

#### Preparation

- ▶ Clamp the workpiece to the machine table
- ▶ Set a preset
- ▶ Select the necessary tables and pallet files (status M)
- ▶ Select the NC program (status M)



#### Operating notes:

- You can change the feed rate and spindle speed using the potentiometers.
- You can reduce the feed rate using the **FMAX** soft key. This reduction affects all rapid traverse and feed movements, even after the control has been restarted.

#### Program Run, Full Sequence

- ▶ Start the NC program with the **NC start** key

#### Program Run, Single Block

- ▶ Start each NC block of the NC program individually with the **NC start** key



## Structuring NC programs

### Definition and applications

The control enables you to comment NC programs in structuring blocks. Structuring blocks are texts with up to 252 characters and are used as comments or headlines for the subsequent program lines.

With the aid of appropriate structuring blocks, you can organize long and complex NC programs in a clear and comprehensible manner.

This function is particularly convenient if you want to change the NC program later. Structuring blocks can be inserted into the NC program at any point.

Structure blocks can also be displayed in a separate window, and be edited or added to, as desired. Use the appropriate screen layout for this.

The control manages the inserted structure items in a separate file (extension: .SEC.DEF). This speeds navigation in the program structure window.

The **PROGRAM + SECTS** screen layout can be selected in the following operating modes:

- **Program run, single block**
- **Program run, full sequence**
- **Programming**

### Displaying the program structure window / Changing the active window




- ▶ Display structure window: For this screen layout press the **PROGRAM + SECTS** soft key



- ▶ Change the active window: Press the **CHANGE WINDOW** soft key

### Selecting blocks in the program structure window

If you are scrolling through the program structure window block by block, the control at the same time automatically moves the corresponding NC blocks in the program window. This way you can quickly skip large program sections.

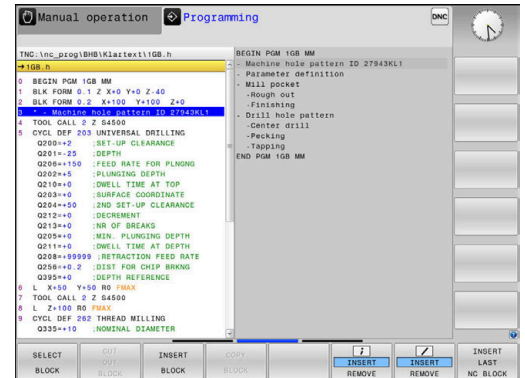

## Checking and changing Q parameters

### Procedure

You can check Q parameters in all operating modes, and also edit them.

- ▶ If needed, interrupt the program run (e.g., by pressing the **NC STOP** key and the **INTERNAL STOP** soft key), or stop the test run





- ▶ To call the Q parameter functions, press the **Q INFO** soft key or the **Q** key
- ▶ The control lists all of the parameters and their corresponding current values.
- ▶ Use the arrow keys or the **GOTO** key to select the desired parameter.
- ▶ If you want to change the value, then press the **EDIT CURRENT FIELD** soft key, enter the new value, and confirm with the **ENT** key
- ▶ If you want to leave the value unchanged, then press the **PRESENT VALUE** soft key or close the dialog with the **END** key



All of the parameters with displayed comments are used by the control within cycles or as transfer parameters.

If you want to check or edit local, global or string parameters, press the **SHOW PARAMETERS Q QL QR QS** soft key. The control then displays the specific parameter type. The functions previously described also apply.

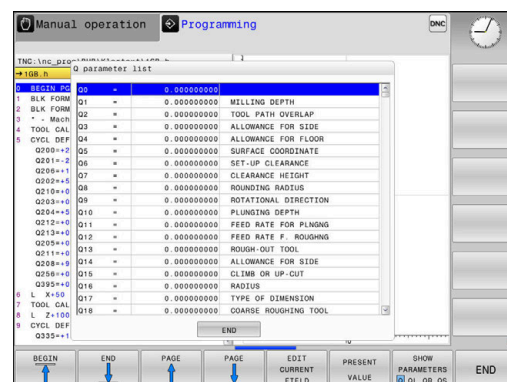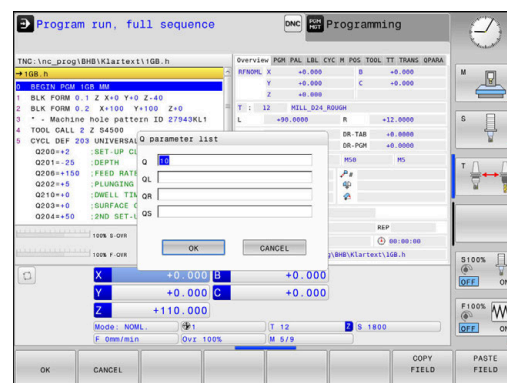

You can have Q parameters also displayed in the additional status display in all operating modes (except **Programming** mode).

- ▶ If needed, interrupt the program run (e.g., by pressing the **NC STOP** key and the **INTERNAL STOP** soft key), or stop the test run



- ▶ Display the soft key row for screen layout



- ▶ Select the layout option for the additional status display
- In the right half of the screen, the control shows the **Overview** status form.



- ▶ Press the **STATUS OF Q PARAM.** soft key



- ▶ Press the **Q PARAMETER LIST** soft key
- The control opens a pop-up window.
- ▶ For each parameter type (Q, QL, QR, QS), define the parameter numbers you wish to check. Separate single Q parameters with a comma, and connect sequential Q parameters with a hyphen, e.g. 1,3,200-208. The input range per parameter type is 132 characters



The display in the **QPARA** tab always contains eight decimal places. The result of **Q1 = COS 89.999** is shown by the control as 0.00001745, for example. Very large or very small values are displayed by the control in exponential notation. The result of **Q1 = COS 89.999 \* 0.001** is shown by the control as +1.74532925e-08, where e-08 corresponds to the factor of  $10^{-8}$ .

## Interrupting, stopping or aborting machining

There are several ways to stop a program run:

- Interrupt the program run with e.g. the miscellaneous function **M0**
- Interrupt the program run e.g. with the **NC stop** soft key
- Stop the program run (e.g., with the **NC stop** key in combination with the **INTERNAL STOP** soft key)
- Terminate the program run e.g. with the miscellaneous functions **M2** or **M30**

The control shows the current status of the program run in the status display.

**Further information:** "General status display", Page 67

In contrast to a stopped run, an interrupted, aborted (terminated) program run enables certain actions by the user, including the following:

- Select operating mode
- Check Q parameters and change these if necessary using the **Q INFO** function
- Change setting for the optional programmed interruption with **M1**
- Change setting for the programmed skipping of NC blocks with **/**



During major errors, the control automatically aborts the program run (e.g., during a cycle call with stationary spindle).

### Program-controlled interruptions

You can set interruptions directly in the NC program. The control interrupts the program run in the NC block containing one of the following inputs:

- Programmed stop **STOP** (with and without miscellaneous function)
- Programmed stop **M0**
- Conditional stop **M1**

### NOTICE

#### Danger of collision!

Certain manual interactions cause the control to lose program information affecting the mode and thereby to lose the so-called contextual reference. After the loss of the contextual reference, unexpected and undesired movements can occur. There is a danger of collision during subsequent machining operations!

- ▶ Do not perform the following interactions:
  - Cursor movement to another NC block
  - The jump command **GOTO** to another NC block
  - Editing an NC block
  - Modifying Q parameter values with the **Q INFO** soft key
  - Switching the operating modes
- ▶ Restore the contextual reference via repetition of the required NC blocks



Refer to your machine manual!

The miscellaneous function **M6** may also lead to a suspension of the program run. The machine manufacturer sets the functional scope of the miscellaneous functions.

### Manual program interruption

While an NC program is being executed in the **Program run, full sequence** operating mode, select the **Program run, single block** operating mode. The control interrupts the machining process at the end of the current machining step.

### Aborting program run



- ▶ Press the **NC Stop** key
- > The control does not finish the current NC block.
- > The control shows the icon for stopped status in the status display.
- > Actions such as a change of operating mode are not possible.
- > The program can be resumed with the **NC start** key.



- ▶ Press the **INTERNAL STOP** soft key



- > The control briefly shows the icon for program cancellation in the status display.



- > The control shows the icon for the exited inactive status in the status display.
- > Actions such as a change of operating mode are available again.

### Compensation during the program run

During the program run, you can access the programmed compensation tables and the active datum table. It is even possible to make changes to these tables.

The changes, however, only become effective after you have activated the corresponding compensation table again.

To access a table, proceed as follows:



- ▶ Press the **SELECT COMPENS. TABLES** soft key










- ▶ Press the soft key for the desired table (e.g., **DATUM TABLE**)

**Further information:** User's Manual for **Klartext Programming** or **ISO Programming**

## Moving the machine axes during an interruption

During program-run interruption, you can move the axes manually. If, at the time of the interruption, function **Tilt the working plane** (option 8) is active, then the **3-D ROT** soft key becomes available.

In the **3-D ROT** menu, you can choose between the following functions:

Soft key	Status display icon	Function
	No icon	You can move the axes in the machine coordinate system (M-CS). <b>Further information:</b> "Machine coordinate system M-CS", Page 113
		You can move the axes in the workpiece coordinate system (W-CS). <b>Further information:</b> "Workpiece coordinate system W-CS", Page 116
		You can move the axes in the working-plane coordinate system (WPL-CS). <b>Further information:</b> "Working plane coordinate system WPL-CS", Page 118
		You can move the axes in the tool coordinate system (T-CS). The control locks the other axes. <b>Further information:</b> "Tool coordinate system T-CS", Page 120



Refer to your machine manual!

Your machine tool builder enables the function for traversing in the tool-axis direction.

## NOTICE


### Danger of collision!

During a program interruption, you can move the axes manually (e.g., in order to retract from a hole when the working plane is tilted). There is a risk of collision if the **3-D ROT** setting is incorrect!

- It is better to use the **T-CS** function
- Use a low feed rate

## Modifying the preset during an interruption

If you modify the active preset during an interruption, resuming the program run is only possible with **GOTO** or mid-program startup at the interruption point.

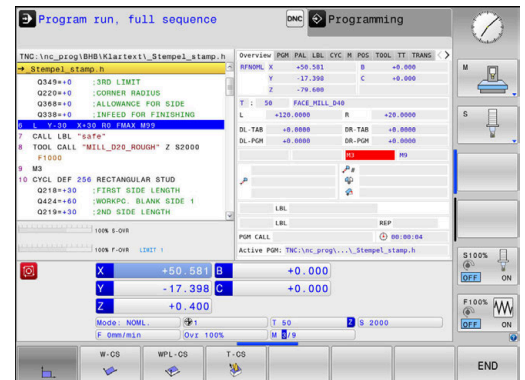

**Example: Retracting the spindle after tool breakage**

- ▶ Interrupt machining
- ▶ Enable the axis-direction keys: Press the **MANUAL TRAVERSE** soft key
- ▶ Move the machine axes with the axis direction keys



Refer to your machine manual!

On some machines, you may have to press the **NC start** key after the **MANUAL TRAVERSE** soft key to enable the axis-direction keys.

**Resuming program run after an interruption**

The control saves the following data during a program interruption:

- The last tool that was called
- Current coordinate transformations (e.g., datum shift, rotation, mirroring)
- The coordinates of the circle center that was last defined

The control uses the stored data for returning the tool to the contour after manual machine axis positioning during an interruption (**RESTORE POSITION** soft key).



Operating notes:

- The saved data remains active until it is reset (e.g., by selecting a program).
- If you interrupt an NC program using the **INTERNAL STOP** soft key, you have to start machining at the start of the program or by using the **BLOCK SCAN** function.
- For program interruptions within program-section repeats or subprograms, you have to use the **BLOCK SCAN** function for re-entering at the point of interruption.
- With machining cycles, mid-program startup is always executed at the start of the cycle. If you interrupt a program run during a machining cycle, the control repeats machining steps already carried out after a block scan.

**Resuming the program run with the NC Start key**

You can resume program run by pressing the **NC start** key if the NC program was stopped in one of the following ways:

- Press the **NC Stop** key
- Programmed interruption




Resuming program run after an error

With an erasable error message:

- ▶ Remove the cause of the error
- ▶ Clear the error message from the screen: Press the **CE** key
- ▶ Restart the program, or resume program run where it was interrupted

Retraction after a power interruption



Refer to your machine manual!  
Your machine tool builder configures and enables the **Retraction** mode of operation.

With the **Retraction** mode of operation you can disengage the tool from the workpiece after an interruption in power.


If you activated a feed-rate limit before a power failure, this is still active. You can deactivate the feed-rate limit using the **CANCEL THE FEED RATE LIMITATION** soft key.

The **Retraction** mode of operation is selectable in the following conditions:

- Power interrupted
- No control voltage for the relay
- Traversing the reference points

The **Retraction** operating mode offers the following modes of traverse:

Mode	Function
Machine axes	Movement of all axes in the machine coordinate system
Tilted system	Movement of all axes in the active coordinate system Effective parameters: Position of the tilting axes
Tool axis	Movements of the tool axis in the active coordinate system
Thread	Movements of the tool axis in the active coordinate system with compensating movement of the spindle Effective parameters: Thread pitch and direction of rotation



If the **Tilt the working plane** function (option 8) is enabled on your control, then the **Tilted system** traverse mode is also available.

The control selects the mode of traverse and the associated parameters automatically. If the traverse mode or the parameters have not been correctly preselected, you are unable to reset them manually.

## NOTICE

### Caution: Danger to the tool and workpiece!

A power failure during the machining operation can cause uncontrolled “coasting” or braking of the axes. In addition, if the tool was in effect prior to the power failure, then the axes cannot be referenced after the control has been restarted. For non-referenced axes, the control takes over the last saved axis values as the current position, which can deviate from the actual position. Thus, subsequent traverse movements do not correspond to the movements prior to the power failure. If the tool is still in effect during the traverse movements, then the tool and the workpiece can sustain damage through tension!

- ▶ Use a low feed rate
- ▶ Please keep in mind that the traverse range monitoring is not available for non-referenced axes

### Example

The power failed while a thread-cutting cycle was being performed in the tilted working plane. You have to retract the tap:

- ▶ Switch on the power supply for control and machine
- > The control starts the operating system. This process may take several minutes.
- > The control will then display the **Power interrupted** message in the screen header.



- ▶ Activate the **Retraction** mode: Press the **RETRACT** soft key
- > The control displays the message **Retraction selected**.



- ▶ Confirm the power interruption: Press the **CE** key
- > The control compiles the PLC program.



- ▶ Switch on the machine control voltage
- > The control checks the functioning of the EMERGENCY STOP circuit. If there is at least one non-referenced axis, you will have to compare the displayed position values with the actual axis values and confirm that they are correct. If required, follow the dialog.

- ▶ Check the preselected traverse mode: If required, select **THREAD**
- ▶ Check the preselected thread pitch: If required, enter the thread pitch
- ▶ Check the preselected direction of rotation: if needed, select the turning direction of the thread  
 Right-handed thread: the main spindle turns clockwise when moving into the workpiece, counter-clockwise when retracting from it; left-handed thread: main spindle turns counter-clockwise when moving into the workpiece and clockwise when retracting from it



- ▶ Activate retraction: Press the **RETRACT** soft key

- ▶ Retraction: Retract the tool with the axis direction keys or the electronic handwheel  
Axis key Z+: Retraction from the workpiece  
Axis key Z-: Moving into the workpiece



- ▶ Exit retraction: Return to the original soft-key level



- ▶ End **Retraction** mode: Press the **END RETRACTION** soft key
- ▶ The control checks whether the **Retraction** mode can be ended. If necessary, follow the dialog.
- ▶ Answer the confirmation prompt: If the tool was not correctly retracted, press the **NO** soft key. If the tool was correctly retracted, press the **YES** soft key.
- ▶ The control hides the **Retraction selected** dialog.
- ▶ Initialize the machine: if required, cross the datums
- ▶ Establish the desired machine condition: If required, reset the tilted working plane

## Any entry into the NC program: Block scan



Refer to your machine manual!

The **BLOCK SCAN** function must be enabled and configured by the machine tool builder.

The **BLOCK SCAN** function allows you to start an NC program at any desired NC block. The control factors workpiece machining up to this NC block into the calculations.

If the NC program was interrupted under the following conditions, the control saves the interruption point:


- **INTERNAL STOP** soft key
- Emergency stop
- Power failure

If, while restarting, the control finds a saved point of interruption, then it outputs a message. You can then execute a block scan directly to the point of interruption.

You have the following options for a block scan:

- Block scan in the main program, with repetitions if necessary
- Multi-level block scan in subprograms and touch probe cycles
- Block scan in a point table
- Block scan in pallet programs

At the start of the block scan, the control resets all data, as with a selection of the NC program. During the block scan, you can switch between **Program Run Full Sequence** and **Program Run Single Block**.

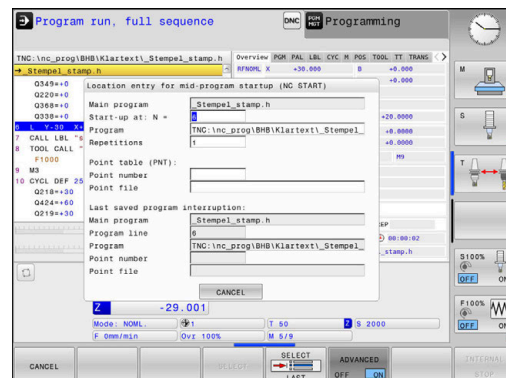

## NOTICE

**Danger of collision!**

The **BLOCK SCAN** function skips over the programmed touch probe cycles. This means that the result parameters contain no values or, possibly, incorrect values. If the subsequent machining operation uses these result parameters, then there is a risk of collision!

- Use the **BLOCK SCAN** function at multiple levels  
**Further information:** "Procedure for multi-level block scan",  
 Page 282




- Active stretch filter
- Touch probe cycles **0**, **1**, **3**, and **4** during the block scan search phase



### Procedure for simple block scan



The control only displays the dialogs required by the process in the pop-up window.

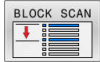

- ▶ Press the **BLOCK SCAN** soft key
- > The control shows a pop-up window with the active main program.
- ▶ **Start-up at: N =:** Enter the number of the NC block where you wish to enter the NC program
- ▶ **Program:** Check the name and path of the NC program containing the NC block, or enter with the **SELECT** soft key
- ▶ **Repetitions:** If the NC block is located within a program section repeat, enter the number of the repetition that should be run next.
- ▶ Press the **ADVANCED** soft key if needed

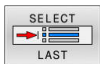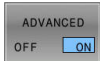

- ▶ If needed, press the **SELECT LAST BLOCK** soft key in order to select the last saved interruption
- ▶ Press the **NC Start** key
- > The control starts the block scan, calculates until the entered NC block, and shows the next dialog.

If you changed the machine status:



- ▶ Press the **NC Start** key
- > The control restores the machine status (e.g., TOOL CALL or M functions and shows the next dialog).

If you changed the axis positions:



- ▶ Press the **NC Start** key
- > The control approaches the specified positions in the specified sequence and shows the next dialog.  
Approach axes in individually selected sequence:

**Further information:** "Returning to the contour",  
Page 286



- ▶ Press the **NC Start** key
- > The control resumes execution of the NC program.

### Example of simple block scan



Even after an internal stop, the control shows the number of repetitions on the Overview tab of the status display.

After an internal stop, you would like to start in NC block 12 in the third machining operation of LBL 1.

Enter the following data in the pop-up window:

- **Start-up at: N =12**
- **Repetitions 3**

### Procedure for multi-level block scan


If you, for example, start in a subprogram that is called several times by the main program, then use the multi-level block scan. For this purpose, jump in the main program to the desired subprogram call. With the **CONTINUE BLOCK SCAN** function, you can jump further from this position.




Operating notes:

- The control only displays the dialogs required by the process in the pop-up window.
- You can also continue the **BLOCK SCAN** without restoring the machine status and the axis position of the first startup point. For this, press the **CONTINUE BLOCK SCAN** soft key before confirming the restoration with the **NC Start** key.


Block scan to the first start-up point:

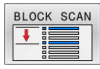

- ▶ Press the **BLOCK SCAN** soft key
- ▶ Enter the first NC block where you wish to start

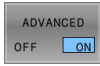

- ▶ Press the **ADVANCED** soft key if needed

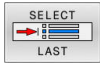

- ▶ If required, press the **SELECT LAST BLOCK** soft key in order to select the last saved interruption



- ▶ Press the **NC Start** key
- ▶ The control starts the block scan and calculates until the entered NC block.

If the control should restore the machine status of the entered NC block:



- ▶ Press the **NC Start** key
- ▶ The control restores the machine status (e.g., TOOL CALL, M functions).

If the control should restore the axis positions:



- ▶ Press the **NC Start** key
- ▶ The control moves in the specified sequence to the specified positions.

If the control should run the NC block:



- ▶ Select the **Program Run Single Block** operating mode if required



- ▶ Press the **NC Start** key
- ▶ The control runs the NC block.

Block scan to the next start-up point:



- ▶ Press the **CONTINUE BLOCK SCAN** soft key
- ▶ Enter the NC block where you wish to start

If you changed the machine status:



- ▶ Press the **NC Start** key

If you changed the axis positions:



- ▶ Press the **NC Start** key

If the control should run the NC block:



- ▶ Press the **NC Start** key

- ▶ Repeat these steps if required to jump to the next start-up point




- ▶ Press the **NC Start** key
- ▶ The control resumes execution of the NC program.

### Example of multi-level block scan

You run a main program with several subprogram calls in the NC program Sub.h. You work with a touch probe cycle in the main program. You use the result of the touch probe cycle later for positioning.

After an internal stop you wish to start up in NC block 8 in the second call of the subprogram. This subprogram call is in NC block 53 of the main program. The touch probe cycle is in NC block 28 of the main program (i.e., before the desired start-up point).

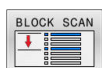

- ▶ Press the **BLOCK SCAN** soft key
- ▶ In the pop-up window enter the following data:
  - **Start-up at: N =28**
  - **Repetitions 1**




- ▶ Select the **Program Run Single Block** operating mode if required



- ▶ Press the **NC start** key until the control runs the touch probe cycle

> The control saves the result.

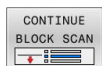


- ▶ Press the **CONTINUE BLOCK SCAN** soft key
- ▶ In the pop-up window enter the following data:
  - **Start-up at: N =53**
  - **Repetitions 1**



- ▶ Press the **NC start** key until the control runs the NC block

> The control jumps into the subprogram Sub.h.

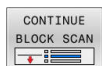

- ▶ Press the **CONTINUE BLOCK SCAN** soft key
- ▶ In the pop-up window enter the following data:
  - **Start-up at: N =8**
  - **Repetitions 1**





- ▶ Press the **NC start** key until the control runs the NC block
- > The control continues to run the subprogram and then returns to the main program.



### Block scan in a point table

If you start in a point table called by the main program, use the **ADVANCED** soft key.

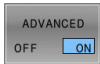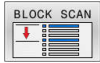

- ▶ Press the **BLOCK SCAN** soft key
- The control shows a pop-up window.
- ▶ Press the **ADVANCED** soft key
- The control expands the pop-up window.
- ▶ **Point number**: Enter the line number of the point table you start with
- ▶ **Point file**: Enter the name and path of the point table
- ▶ If required, press the **SELECT LAST BLOCK** soft key in order to select the last saved interruption
- ▶ Press the **NC Start** key

If you would like to use the block scan function to start in a point pattern, then proceed just as you would for starting in the point table. Enter the desired point number in the **Point number** input field. The first point in the point pattern has the point number **0**.

### Block scan in pallet programs


With the pallet management (option 22), you can also use the **BLOCK SCAN** function in conjunction with pallet tables.

If you interrupt the processing of pallet tables, the control always suggests the previously selected NC block of the interrupted NC program for the **BLOCK SCAN** function.



For **BLOCK SCAN** in pallet tables, you also define the **Pallet line** input field. This entry refers to the line **NR** in the pallet table. This input is always required as an NC program may be used several times in a pallet table.

The **BLOCK SCAN** always takes place in a workpiece-oriented manner, even if you have selected the machining method **TO** and **CTO**. After the **BLOCK SCAN**, the control continues working again in accordance with the selected machining method.

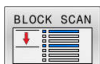

- ▶ Press the **BLOCK SCAN** soft key
- The control shows a pop-up window.
- ▶ **Pallet line**: Enter the line number of the pallet table
- ▶ Enter the **Repetitions** if the NC block is located within a program section repeat
- ▶ Press the **ADVANCED** soft key if required
- The control expands the pop-up window.
- ▶ Press the **SELECT LAST BLOCK** soft key to select the last saved interruption
- ▶ Press the **NC Start** key

## Returning to the contour

With the **RESTORE POSITION** function, the control moves the tool to the workpiece contour in the following situations:

- Return to the contour after the machine axes were moved during a program interruption that was not performed with the **INTERNAL STOP** function.
- Return to the contour after a block scan (e.g., after an interruption with **INTERNAL STOP**) **INTERNAL STOP**
- Depending on the machine, if the position of an axis has changed after the control loop has been opened during a program interruption

### Procedure

To approach the contour, proceed as follows:



- ▶ Press the **RESTORE POSITION** soft key
- ▶ Restore the machine status, if required

Approach the axes in the sequence shown by the control:



- ▶ Press the **NC Start** key

Approach the axes according to individually selected sequence:



- ▶ Press the **SELECT AXIS** soft key
- ▶ Press the soft key of the first axis
- ▶ Press the **NC Start** key




- ▶ Press the soft key of the second axis
- ▶ Press the **NC Start** key



- ▶ Repeat the process for all axes



If the tool is located in the tool axis below the starting point, then the control offers the tool axis as the first traverse direction.

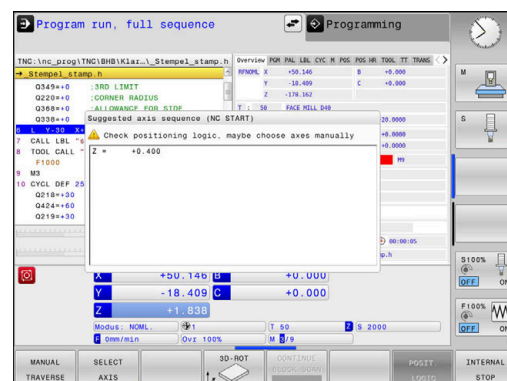

**Procedure for manual axes**


Manual axes are non-driven axes that need to be positioned by the machine operator.

If the axes to be returned to the contour include manual axes, the control does not display a sequence for approaching. The control automatically displays the soft keys of the available axes.

To return to the contour, proceed as follows:



- ▶ Press the soft key of the manual axis
- ▶ Position the manual axis to the value shown in the dialog
- > When a manual axis with encoder has reached the position, the control automatically removes the value from the dialog.

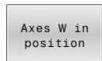

- ▶ Press the soft key of the manual axis again
- > The control saves the position.



When all manual axes available have been positioned, the control suggest a sequence for positioning the remaining axes.


## 6.11 Running CAM programs

If you create NC programs externally using a CAM system, you should pay attention to the recommendations detailed below. This will enable you to optimally use the powerful motion control functionality provided by the control and usually create better workpiece surfaces with shorter machining times. Despite high machining speeds, the control still achieves a very high contour accuracy. The basis for this is the HEROS 5 real-time operating system in conjunction with the **ADP** (Advanced Dynamic Prediction) function of the TNC 620. This enables the control to also efficiently process NC programs with high point densities.

### From 3-D model to NC program

Here is a simplified description of the process for creating an NC program from a CAD model:

- ▶ **CAD: Model creation**  
Construction departments prepare a 3-D model of the workpiece to be machined. Ideally the 3-D model is designed for the center of tolerance.
- ▶ **CAM: Path generation, tool compensation**  
The CAM programmer specifies the machining strategies for the areas of the workpiece to be machined. The CAM system uses the surfaces of the CAD model to calculate the paths of the tool movements. These tool paths consist of individual points calculated by the CAM system so that each surface to be machined is approximated as nearly as possible while considering chord errors and tolerances. This way, a machine-neutral NC program is created, known as a CLDATA file (cutter location data). A postprocessor generates a machine- and control-specific NC program, which can be processed by the CNC control. The postprocessor is adapted according to the machine tool and the control. The postprocessor is the link between the CAM system and the CNC control.
- ▶ **Control: Motion control, tolerance monitoring, velocity profile**  
The control uses the points defined in the NC program to calculate the movements of each machine axis as well as the required velocity profiles. Powerful filter functions then process and smooth the contour so that the control does not exceed the maximum permissible path deviation.
- ▶ **Mechatronics: Feed control, drive technology, machine tool**  
The motions and velocity profiles calculated by the control are realized as actual tool movements by the machine's drive system.

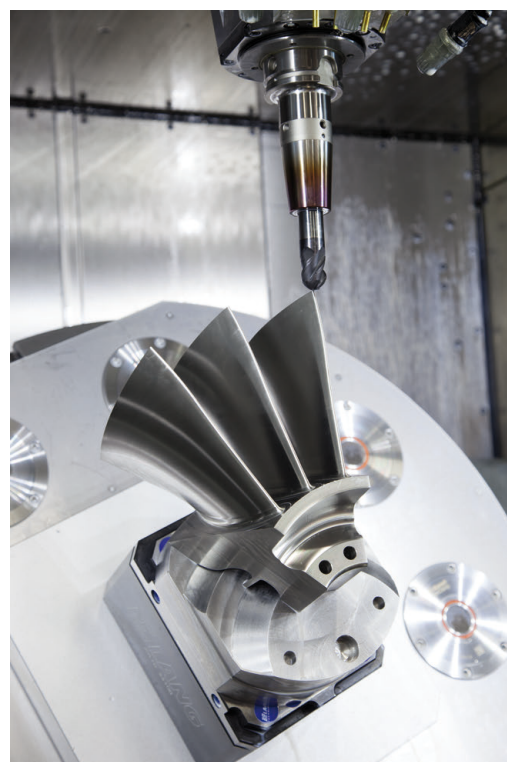

## Considerations required for post processor configuration

**Take the following points into account with post processor configuration:**

- Always set the data output for axis positions to at least four decimal places. This way you improve the quality of the NC data and avoid rounding errors, which can result in defects visible to the naked eye on the workpiece surface. Output of five decimal places may achieve improved surface quality for optical components as well as components with very large radii (i.e. small curvatures), for example molds for the automotive industry
- Always set the data output for the machining of surface normal vectors (LN blocks, only Klartext conversational programming) to exactly seven decimal places
- Avoid using successive incremental NC blocks because this may lead to the tolerances of the individual NC blocks being added together in the output
- Set the tolerance in Cycle **32** so that in standard behavior it is at least twice as large as the chord error defined in the CAM system. Also note the information describing the functioning of Cycle **32**
- If the chord error selected in the CAM program is too large, then, depending on the respective curvature of a contour, large distances between NC blocks can result, each with large changes of direction. During machining this leads to drops in the feed rate at the block transitions. Recurring and equal accelerations (i.e. force excitation), caused by feed-rate drops in the heterogeneous NC program, can lead to undesirable excitation of vibrations in the machine structure.
- You can also use arc blocks instead of linear blocks to connect the path points calculated by the CAM system. The control internally calculates circles more accurately than can be defined via the input format
- Do not output any intermediate points on exactly straight lines. Intermediate points that are not exactly on a straight line can result in defects visible to the naked eye on the workpiece surface
- There should be exactly one NC data point at curvature transitions (corners)
- Avoid sequences of many short block paths. Short paths between blocks are generated in the CAM system when there are large curvature transitions with very small chord errors in effect. Exactly straight lines do not require such short block paths, which are often forced by the continuous output of points from the CAM system
- Avoid a perfectly even distribution of points over surfaces with a uniform curvature, since this could result in patterns on the workpiece surface
- For 5-axis simultaneous programs: avoid the duplicated output of positions if they only differ in the tool's angle of inclination
- Avoid the output of the feed rate in every NC block. This would negatively influence the control's velocity profile

**Useful configurations for the machine tool operator:**

- In order to enable a realistic graphic simulation, use 3-D models in STL format as a workpiece blank and finished part
- In order to improve the structure of large NC programs, use the control's structuring function
- Use the control's commenting function in order to document NC programs
- Use the comprehensive cycles of the control available for the machining of holes and simple pocket geometries

**Further information:** User's Manual for **Programming of Machining Cycles**

- For fits, output the contours with **RL/RR** tool radius compensation. This makes it easy for the machine operator to make necessary compensations
- Separate feed rates for pre-positioning, machining, and downfeeds, and define them via Q parameters at the beginning of the program

**Example: Variable feed rate definitions**

1 Q50 = 7500	FEED RATE FOR POSITIONING
2 Q51 = 750	FEED RATE FOR PLUNGING
3 Q52 = 1350	FEED RATE FOR MILLING
...	
25 L Z+250 R0 FMAX	
26 L X+235 Y-25 FQ50	
27 L Z+35	
28 L Z+33.2571 FQ51	
29 L X+321.7562 Y-24.9573 Z+33.3978 FQ52	
30 L X+320.8251 Y-24.4338 Z+33.8311	
...	


## Please note the following for CAM programming

### Adapting chord errors



#### Programming notes:

- For finishing operations, do not set the chord error in the CAM system to a value greater than 5  $\mu\text{m}$ . In Cycle **32**, use an appropriate tolerance factor **T** of 1.3 to 3.
- For roughing operations, the total of the chord error and the tolerance **T** must be less than the defined machining oversize. In this way you can avoid contour damage.
- The specific values depend upon the dynamics of your machine.

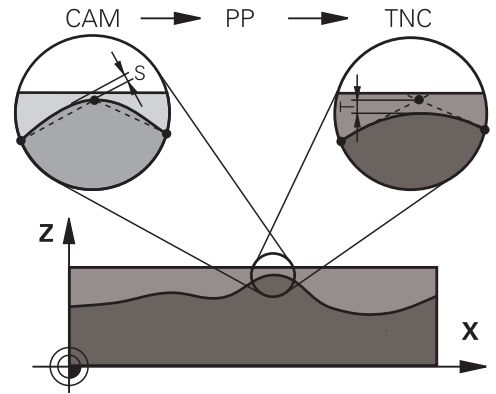

Adapt the chord error in the CAM program, depending on the machining:

#### ■ Roughing with preference for speed:

Use higher values for the chord error and the matching tolerance value in Cycle **32**. Both values depend on the oversize required on the contour. If a special cycle is available on your machine, use the roughing mode. In roughing mode the machine generally moves with high jerk values and high accelerations

- Normal tolerance in Cycle **32**: Between 0.05 mm and 0.3 mm
- Normal chord error in the CAM system: Between 0.004 mm and 0.030 mm

#### ■ Finishing with preference for high accuracy:

Use smaller values for the chord error and a matching low tolerance in Cycle **32**. The data density must be high enough for the control to detect transitions and corners exactly. If a special cycle is available on your machine, use the finishing mode. In finishing mode the machine generally moves with low jerk values and low accelerations

- Normal tolerance in Cycle **32**: Between 0.002 mm and 0.006 mm
- Normal chord error in the CAM system: Between 0.001 mm and 0.004 mm

#### ■ Finishing with preference for high surface quality:

Use small values for the chord error and a matching larger tolerance in Cycle **32**. The control is then able to better smooth the contour. If a special cycle is available on your machine, use the finishing mode. In finishing mode the machine generally moves with low jerk values and low accelerations

- Normal tolerance in Cycle **32**: Between 0.010 mm and 0.020 mm
- Normal chord error in the CAM system: Approx. 0.005 mm

### Further adaptations

Take the following points into account with CAM programming:

- For slow machining feed rates or contours with large radii, define the chord error to be only one-third to one-fifth of tolerance **T** in Cycle **32**. Additionally, define the maximum permissible point spacing to be between 0.25 mm and 0.5 mm. The geometry error or model error should also be specified to be very small (max. 1 µm).
- Even at higher machining feed rates, point spacings of greater than 2.5 mm are not recommended for curved contour areas
- For straight contour elements, one NC point at the beginning of a line and one NC point at the end suffice. Avoid the output of intermediate positions
- In programs with five axes moving simultaneously, avoid large changes in the ratio of path lengths in linear and rotational blocks. Otherwise large reductions in the feed rate could result at the tool reference point (TCP)
- The feed-rate limitation for compensating movements (e.g. via **M128 F...**) should be used only in exceptional cases. The feed-rate limitation for compensating movements can cause large reductions in the feed rate at the tool reference point (TCP).
- NC programs for 5-axis simultaneous machining with spherical cutters should preferably be output for the center of the sphere. The NC data are then generally more uniform. In Cycle **32**, you can additionally set a higher rotary axis tolerance **TA** (e.g., between 1° and 3°) for an even more constant feed-rate curve at the tool center point (TCP).
- For NC programs for 5-axis simultaneous machining with toroid cutters or spherical cutters, where the NC output is for the south pole of the sphere, choose a lower rotary axis tolerance. 0.1° is a typical value. However, the maximum permissible contour damage is the decisive factor for the rotational axis tolerance. This contour damage depends on the possible tool tilting, tool radius and contact depth of the tool.  
With 5-axis gear hobbing with an end mill you can calculate the maximum possible contour damage **T** directly from the cutter contact length **L** and permissible contour tolerance **TA**:  

$$T \sim K \times L \times TA \quad K = 0.0175 [1/^\circ]$$
 Example:  $L = 10 \text{ mm}$ ,  $TA = 0.1^\circ$ :  $T = 0.0175 \text{ mm}$



## Possibilities for intervention on the control

Cycle **32 TOLERANCE** is available for influencing the behavior of CAM programs directly on the control. Please note the information describing the functioning of Cycle **32**. Also note the interactions with the chord error defined in the CAM system.

**Further information:** User's Manual for **Programming of Machining Cycles**



Refer to your machine manual!

Some machine tool builders provide an additional cycle for adapting the behavior of the machine to the respective machining operation (e.g., Cycle **332** Tuning). Cycle **332** can be used to modify filter settings, acceleration settings, and jerk settings.

### Example

```
34 CYCL DEF 32.0 TOLERANCE
```

```
35 CYCL DEF 32.1 T0.05
```

```
36 CYCL DEF 32.2 HSC MODE:1 TA3
```

## ADP motion control



This function must be enabled and adapted by the machine tool builder.

An insufficient quality of data in NC programs created on CAM systems frequently causes inferior surface quality of the milled workpieces. The **ADP** (Advanced Dynamic Prediction) feature expands the conventional look-ahead of the permissible maximum feed rate profile and optimizes the motion control of the feed axes during milling. This enables clean surfaces with short machining times to be cut, even with a strongly fluctuating distribution of points in adjacent tool paths. This significantly reduces or eliminates the reworking complexity.





These are the most important benefits of ADP:

- Symmetrical feed-rate behavior on forward and backward paths with bidirectional milling
- Uniform feed rate curves with adjacent cutter paths
- Improved reaction to negative effects (e.g. short, step-like contours, coarse chord tolerances, heavily rounded block end-point coordinates) in NC programs generated by CAM systems
- Precise compliance to dynamic characteristics even in difficult conditions

## 6.12 Functions for program display

### Overview

In the **Program Run Single Block** and **Program Run Full Sequence** operating modes, the control displays the following soft keys for displaying the NC program in pages:

Soft key	Function
	Go back one screen in the NC program
	Go forward one screen in the NC program
	Select start of program
	Select end of program

## 6.13 Automatic program start

### Application



Refer to your machine manual!

The control must be specially prepared by the machine tool builder for use of the automatic program start function.

### **⚠ DANGER**

#### Caution: hazard to the user!


The **AUTOSTART** function automatically starts the machining operation. Open machines with unsecured work envelopes pose a huge danger for the machine operator.

- Use the **AUTOSTART** function exclusively on enclosed machines

In a Program Run operating mode, you can use the **AUTOSTART** soft key to define a specific time at which the NC program that is currently active in this operating mode is to be started:



- Display window for setting the starting time
- **Time (h:min:sec):** Time of day at which the NC program is to be started
- **Date (TT.MM.JJJJ):** Date at which the NC program is to be started
- To activate the start, press the **OK**

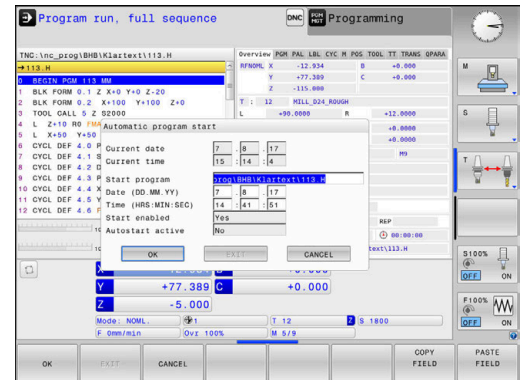

## 6.14 Positioning w/ Manual Data Input operating mode

The **Positioning w/ Manual Data Input** operating mode is particularly convenient for simple machining operations or for pre-positioning the tool. It enables you to write a short NC program, depending on machine parameter **programInputMode** (no. 101201), in Klartext format or in ISO format and execute it immediately. The NC program is stored in a file named \$MDI.

You can use the following functions for example:

- Cycles
- Radius compensation
- Program section repetitions
- Q parameters

The additional status display can be activated in the **Positioning w/ Manual Data Input** operating mode.

### NOTICE

#### Danger of collision!

Certain manual interactions cause the control to lose program information affecting the mode and thereby to lose the so-called contextual reference. After the loss of the contextual reference, unexpected and undesired movements can occur. There is a danger of collision during subsequent machining operations!

- ▶ Do not perform the following interactions:
  - Cursor movement to another NC block
  - The jump command **GOTO** to another NC block
  - Editing an NC block
  - Modifying Q parameter values with the **Q INFO** soft key
  - Switching the operating modes
- ▶ Restore the contextual reference via repetition of the required NC blocks

## Positioning with manual data input (MDI)



- ▶ Select **Positioning w/ Manual Data Input** operating mode

- ▶ Program the desired available function



- ▶ Press the **NC Start** key
- ▶ The control executes the highlighted NC block.

**Further information:** "Positioning w/ Manual Data Input operating mode", Page 296



Operating and programming notes:

- The following functions are not available in the **Positioning w/ Manual Data Input** operating mode:
  - FK free contour programming
  - Program call
    - **PGM CALL**
    - **SEL PGM**
    - **CALL SELECTED PGM**
  - Programming graphics
  - Program-run graphics
- Using the **SELECT BLOCK** and **CUT OUT BLOCK** soft keys etc. you can also conveniently and rapidly reuse program sections from other NC programs.
 


**Further information:** User's Manuals for Klartext Programming and ISO Programming
- You can control and modify Q parameters with the soft keys **Q PARAMETER LIST** and **Q INFO**.
 

**Further information:** "Checking and changing Q parameters", Page 270

**Example**

A hole with a depth of 20 mm is to be drilled into a single workpiece. After clamping and aligning the workpiece and setting the preset, you can program and execute the drilling operation with a few lines of programming.

First you pre-position the tool above the workpiece with straight-line blocks and position with a safety clearance of 5 mm above the hole. Then drill the hole with Cycle **200 DRILLING**.

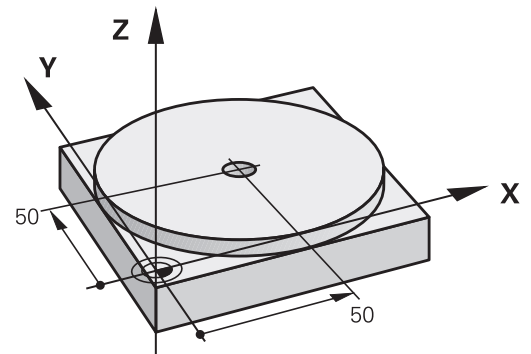

<b>0 BEGIN PGM \$MDI MM</b>	
<b>1 TOOL CALL 1 Z S2000</b>	Call the tool: tool axis Z, spindle speed 2000 rpm
<b>2 L Z+200 R0 FMAX</b>	Retract the tool (F MAX = rapid traverse)
<b>3 L X+50 Y+50 R0 FMAX M3</b>	Move the tool at F MAX to a position above the hole, spindle on
<b>4 CYCL DEF 200 DRILLING</b>	Define the cycle
<b>Q200=5 ;SET-UP CLEARANCE</b>	Set-up clearance of the tool above the hole
<b>Q201=-20 ;DEPTH</b>	Hole depth (algebraic sign=working direction)
<b>Q206=250 ;FEED RATE FOR PLNGNG</b>	Feed rate for drilling
<b>Q202=5 ;PLUNGING DEPTH</b>	Depth of each infeed before retraction
<b>Q210=0 ;DWELL TIME AT TOP</b>	Dwell time after every retraction in seconds
<b>Q203=-10 ;SURFACE COORDINATE</b>	Coordinate of the workpiece surface
<b>Q204=20 ;2ND SET-UP CLEARANCE</b>	Set-up clearance of the tool above the hole
<b>Q211=0.2 ;DWELL TIME AT DEPTH</b>	Dwell time in seconds at the hole bottom
<b>Q395=0 ;DEPTH REFERENCE</b>	Depth referenced to the tool tip or the cylindrical part of the tool
<b>5 CYCL CALL</b>	Call the cycle
<b>6 L Z+200 R0 FMAX M2</b>	Retract the tool
<b>7 END PGM \$MDI MM</b>	End of program

**Example: Remove workpiece misalignment on a machine with a rotary table**

- ▶ Use a 3-D touch probe to carry out a basic rotation  
**Further information:** "Compensating workpiece misalignment with 3-D touch probe (option 17)", Page 218
- ▶ Write down the rotation angle and cancel the basic rotation



- ▶ Select the operating mode: Press the **Positioning w/ Manual Data Input** key



- ▶ Select the rotary table axis, enter the rotation angle and feed rate you wrote down, e.g. **L C +2.561 F50**



- ▶ Conclude entry



- ▶ Press the **NC Start** button: The rotation of the table corrects the misalignment

**Saving NC programs from \$MDI**

The \$MDI file is intended for short NC programs that are only needed temporarily. Nevertheless, you can store an NC program, if necessary, by proceeding as follows:




- ▶ Operating mode: Press the **Programming** key



- ▶ Call the file manager: Press **PGM MGT** key.




- ▶ Move the highlight to the **\$MDI** file

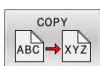

- ▶ Copy the file: Press the **COPY** soft key

**DESTINATION FILE =**

- ▶ Enter the name under which you want to save the current contents of the \$MDI file, e.g. **Hole**

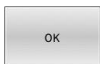

- ▶ Press the **OK** soft key.



- ▶ To exit the file manager, press the **END** soft key

## 6.15 Entering miscellaneous functions M and STOP

### Fundamentals

With the control's miscellaneous functions—also called M functions—you can affect:

- the program run, e.g. a program interruption
- the machine functions, such as switching spindle rotation and coolant supply on and off
- The path behavior of the tool

You can enter up to four M (miscellaneous) functions at the end of a positioning block or in a separate NC block. The control displays the following dialog question: **Miscellaneous function M ?**

You usually enter only the number of the miscellaneous function in the programming dialog. With some miscellaneous functions, the dialog is extended so that you can enter the required parameters for this function.

In the **Manual operation** and **Electronic handwheel** operating modes, the M functions are entered with the **M** soft key.

### Effectiveness of miscellaneous functions

Please note that some M functions become effective at the start of a positioning block, and others at the end, regardless of their position in the NC block.

Miscellaneous functions come into effect in the NC block in which they are called.

Some miscellaneous functions are effective only in the NC block in which they are programmed. Unless the miscellaneous function is only effective blockwise, you must either cancel it in a subsequent NC block with a separate M function, or it is automatically canceled by the control at the end of the program.



If multiple functions were programmed in a single NC block, the execution sequence is as follows:

- M functions taking effect at the start of the block are executed before those taking effect at the end of the block
- If all M functions are effective at the start or end of the block, execution takes place in the sequence as programmed

### Entering a miscellaneous function in a STOP block

If you program a **STOP** block, the program run or test run is interrupted at the block, e.g. for a tool inspection. You can also enter an M (miscellaneous) function in a **STOP** block:

STOP

- ▶ To program an interruption of program run, press the **STOP** key
- ▶ Enter a miscellaneous function **M** if required

### Example

87 STOP




## 6.16 Miscellaneous functions for program run inspection, spindle and coolant

### Overview



Refer to your machine manual!

The machine manufacturer can influence the behavior of the miscellaneous functions described below.


M	Effect	Effective at block	Start	End
<b>M0</b>	Program STOP Spindle STOP			■
<b>M1</b>	Optional program STOP Spindle STOP if necessary Coolant OFF if necessary (function defined by the machine tool builder)			■
<b>M2</b>	STOP program run Spindle STOP Coolant off Return jump to block 1 Clear status display Functional scope depends on machine parameter <b>resetAt</b> (no. 100901)			■
<b>M3</b>	Spindle ON clockwise		■	
<b>M4</b>	Spindle ON counterclockwise		■	
<b>M5</b>	Spindle STOP			■
<b>M6</b>	Tool change Spindle STOP Program STOP			■
<div>  <p>Since this function varies depending on the machine tool builder, HEIDENHAIN recommends that you use the <b>TOOL CALL</b> function for tool changes.</p> </div>				
<b>M8</b>	Coolant ON		■	
<b>M9</b>	Coolant OFF			■
<b>M13</b>	Spindle ON clockwise Coolant ON		■	
<b>M14</b>	Spindle ON counterclockwise Coolant ON		■	
<b>M30</b>	Same as M2			■

## 6.17 Miscellaneous functions for coordinate entries

### Programming machine-referenced coordinates: M91/M92

#### Scale datum

On the scale, a reference mark indicates the position of the scale datum.

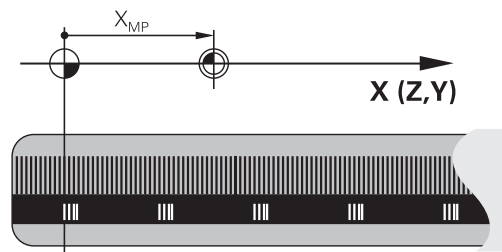

#### Machine datum

The machine datum is required for the following tasks:

- Define the axis traverse limits (software limit switches)
- Approach machine-referenced positions (such as tool change positions)
- Set a workpiece preset

The distance in each axis from the scale datum to the machine datum is defined by the machine tool builder in a machine parameter.

#### Standard behavior

The control references the coordinates to the workpiece datum.

**Further information:** "Presetting without a 3-D touch probe", Page 198

#### Behavior with M91 – Machine datum

If you want the coordinates in a positioning block to be referenced to the machine datum, enter M91 into these NC blocks.



If you program incremental coordinates in an M91 block, enter them with respect to the last programmed M91 position. If no M91 position is programmed in the active NC block, then enter the coordinates with respect to the current tool position.

The coordinate values on the control's screen are referenced to the machine datum. Switch the display of coordinates in the status display to REF.

**Further information:** "Status displays", Page 67

**Behavior with M92 – Additional machine reference point**

Refer to your machine manual!

In addition to the machine datum, the machine tool builder can also define an additional machine-based position as a machine reference point (machine preset). For each axis, the machine tool builder defines the distance between the machine preset and the machine datum.

If you want the coordinates in positioning blocks to be based on the machine preset, enter M92 into these NC blocks.



Radius compensation remains the same in blocks that are programmed with **M91** or **M92**. The tool length will **not** be taken into account.

**Effect**

M91 and M92 are effective only in the blocks in which M91 and M92 have been programmed.


M91 and M92 take effect at the start of block.

**Workpiece preset**

If you want the coordinates to always be referenced to the machine datum, you can inhibit presetting for one or more axes.

If preset setting is disabled for all axes, the control no longer displays the **SET PRESET** soft key in **Manual operation** mode.

The figure shows coordinate systems with the machine and workpiece datum.

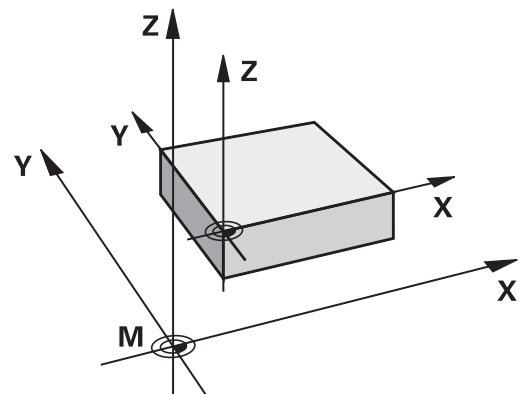**M91/M92 in the Test Run mode**

In order to be able to graphically simulate M91/M92 movements, you need to activate working space monitoring and display the workpiece blank referenced to the defined preset.

**Further information:** "Showing the workpiece blank in the working space (option 20)", Page 255

## Moving to positions in a non-tilted input coordinate system with a tilted working plane: M130

### Standard behavior with a tilted working plane

The control references the coordinates in the positioning blocks to the tilted working plane coordinate system.

**Further information:** "Working plane coordinate system WPL-CS", Page 118

### Behavior with M130

Despite an active tilted working plane, the control references the coordinates in straight line blocks to the non-tilted input coordinate system.

**M130** ignores only the **Tilt the working plane** function, but takes into account active transformations before and after tilting. This means that, when calculating the position, the control considers the axis angles of the rotary axes that are not in their zero position.

**Further information:** "Input coordinate system I-CS", Page 119

### NOTICE

#### Danger of collision!

The function **M130** is only effective blockwise. The control executes the subsequent machining operations in the tilted working plane coordinate system again. Danger of collision during machining!

- Check the sequence and positions using a graphic simulation

### Programming notes

- The function **M130** is allowed only if the **Tilt the working plane** function is active.
- If the function **M130** is combined with a cycle call, the control will interrupt machining with an error message.

### Effect

**M130** functions blockwise in straight-line blocks without tool radius compensation.

## 6.18 Miscellaneous functions for path behavior

### Superimposing handwheel positioning during program run: M118 (option 21)

#### Standard behavior



Refer to your machine manual!  
Your machine tool builder must have prepared the control for this function.

In the Program Run operating modes, the control moves the tool as defined in the NC program.

#### Behavior with M118

**M118** permits manual corrections by handwheel during the program run. For this purpose, you program **M118** and enter an axis-specific value (linear or rotary axis).

#### Input

If you enter **M118** in a positioning block, the control continues the dialog for this block by prompting you for the axis-specific values. Use the orange axis keys or the alphabetic keyboard for entering the coordinates.

#### Effect

To cancel handwheel positioning, program **M118** once again without coordinate input or end the NC program with **M30** / **M2**.



If the program aborts, handwheel positioning will also be canceled.

**M118** becomes effective at the start of the block.

#### Example

You want to be able to use the handwheel during program run to move the tool in the working plane X/Y by  $\pm 1$  mm and in the rotary axis B by  $\pm 5^\circ$  from the programmed value:

```
L X+0 Y+38.5 RL F125 M118 X1 Y1 B5
```



When programmed in an NC program, **M118** is always effective in the machine coordinate system.  
The **POS HR** tab of the additional status display shows the **Max. val.** defined in **M118**.  
The function **Handwheel superimposed** is also effective in the **Positioning w/ Manual Data Input** operating mode!

## Deleting basic rotation: M143

### Standard behavior

The basic rotation remains in effect until it is reset or is overwritten with a new value.

### Behavior with M143

The control deletes a basic rotation from the NC program.



The function **M143** is not permitted with mid-program startup.

### Effect

**M143** is effective only from the NC block in which it is programmed.

**M143** becomes effective at the start of the block.



**M143** clears the entries from the **SPA**, **SPB** and **SPC** columns in the preset table. When the corresponding line is reactivated, the basic rotation is **0** in all columns.

## Automatically retracting the tool from the contour at an NC stop: M148

### Standard behavior

In case of an NC stop, the control stops all traverse movements. The tool stops moving at the point of interruption.

### Behavior with M148



Refer to your machine manual!

This function must be configured and enabled by your machine tool builder.

In the **CfgLiftOff** (no. 201400) machine parameter, the machine tool builder defines the path the control is to traverse for a **LIFTOFF** command. You can also use the **CfgLiftOff** machine parameter to deactivate the function.

Set the **Y** parameter in the **LIFTOFF** column of the tool table for the active tool. The control then retracts the tool from the contour by 2 mm max. in the direction of the tool axis.

**Further information:** "Entering tool data into the table", Page 133

**LIFTOFF** takes effect in the following situations:

- An NC stop triggered by you
- An NC stop triggered by the software, e.g. if an error occurred in the drive system
- When a power interruption occurs

### Effect

**M148** remains in effect until deactivated with **M149**.

**M148** becomes effective at the start of the block, **M149** at the end of the block.





# 7

## **Special functions**

## 7.1 Active Chatter Control (ACC) (option 145)

### Application



This function must be enabled and adapted by the machine tool builder.

Strong forces come into play during roughing (power milling). Depending on the tool spindle speed, the resonances in the machine tool and the chip volume (metal-removal rate during milling), the machine can sometimes begin to **chatter**. This chattering places heavy strain on the machine, and causes ugly marks on the workpiece surface. The tool, too, is subject to heavy and irregular wear from chattering. In extreme cases it can result in tool breakage.

In order to reduce a machine's tendency to chatter, HEIDENHAIN offers an effective control function known as Active Chatter Control (**ACC**). The use of this control function is particularly advantageous during heavy machining. ACC makes substantially higher metal removal rates possible. Depending on the type of machine, the metal-removal rate can often be increased by more than 25 %. You reduce the mechanical load on the machine and increase the life of your tools at the same time.




ACC was developed especially for roughing and heavy machining and is particularly effective in this area. You need to conduct appropriate tests to see whether ACC will also be advantageous on your machine and with your tool.

## Activating ACC

To activate ACC, proceed as follows:

- In the TOOL.T tool table, set column **ACC** to **Y**
- Specify the number of cutting edges for your tool in column **CUT** of the TOOL.T tool table
- Switch on the spindle
- The tooth meshing frequency must be between 20 and 150 Hz

If ACC is active, the control shows the  icon in the position display.


To activate/deactivate ACC temporarily for the machine mode, proceed as follows:



- ▶ Operating mode: Press the **Program run, full sequence, Program run, single block** or **Positioning w/ Manual Data Input** key



- ▶ Shift the soft-key row

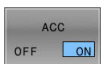

- ▶ Activate ACC: Set the soft key to **ON**
- > The control displays the ACC icon in the position display.

**Further information:** "Status displays", Page 67



- ▶ To deactivate ACC: Set the soft key to **OFF**

## 7.2 Defining a counter

### Application



Refer to your machine manual!  
Your machine manufacturer enables this function.

The **FUNCTION COUNT** function allows you to control a simple counter from within the NC program. For example, this function allows you to count the number of manufactured workpieces.


Proceed as follows for the definition:



- Show the soft key row with special functions



- Press the **PROGRAM FUNCTIONS** soft key

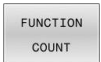

- Press the **FUNCTION COUNT** soft key

### NOTICE

#### Caution: Data may be lost!

Only one counter can be managed by the control. If you execute an NC program that resets the counter, any counter progress of another NC program will be deleted.

- Please check prior to machining whether a counter is active.
- If necessary, note down the counter value and enter it again via the MOD menu after execution.



You can use Cycle **225** to engrave the current counter value into the workpiece.

**Further information:** User's Manual for **Programming of Machining Cycles**

#### Effect in the operating mode Test Run

You can simulate the counter in the **Test Run** operating mode. Only the count you have defined directly in the NC program is effective. The count in the MOD menu remains unaffected.

#### Effect in the operating modes Program Run Single Block and Program Run Full Sequence

The count from the MOD menu is only effective in the **Program Run Single Block** and **Program Run Full Sequence** operating modes.

The count is retained even after a restart of the control.

## Defining FUNCTION COUNT

The **FUNCTION COUNT** function provides the following possibilities:

Soft key	Function
FUNCTION COUNT INC	Increase count by 1
FUNCTION COUNT RESET	Reset counter
FUNCTION COUNT TARGET	Set the nominal count (target value) to the desired value Input value: 0–9999
FUNCTION COUNT SET	Set the counter to the desired value Input value: 0–9999
FUNCTION COUNT ADD	Increment the counter by the desired value Input value: 0–9999
FUNCTION COUNT REPEAT	Repeat the NC program starting from this label if more parts are to be machined.

### Example

<b>5 FUNCTION COUNT RESET</b>	Reset the counter value
<b>6 FUNCTION COUNT TARGET10</b>	Enter the target number of parts to be machined
<b>7 LBL 11</b>	Enter the jump label
<b>8 L ...</b>	Machining
<b>51 FUNCTION COUNT INC</b>	Increment the counter value
<b>52 FUNCTION COUNT REPEAT LBL 11</b>	Repeat the machining operations if more parts are to be machined
<b>53 M30</b>	
<b>54 END PGM</b>	



# 8

**Pallets**

## 8.1 Pallet management (option number 22)

### Application



Refer to your machine manual!


Pallet table management is a machine-dependent function. The standard functional range is described below.

Pallet tables (.p) are mainly used in machining centers with pallet changers. The pallet tables call the different pallets (PAL), fixtures (FIX) optionally, and the associated NC programs (PGM). The pallet tables activate all defined presets and datum tables.

Without a pallet changer you can use pallet tables to process NC programs with different presets in sequence with just one press of **NC Start**.



The file name of a pallet table must always begin with a letter.

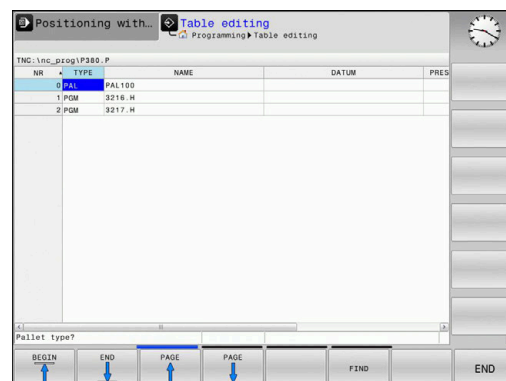

### Columns of the pallet table

The machine tool builder defines a pallet table prototype that opens automatically when you create a pallet table.

The prototype can include the following columns:

Column	Meaning	Field type
<b>NR</b>	The control creates the entry automatically. The entry is required for the input field <b>Line number</b> of the <b>BLOCK SCAN</b> function.	Mandatory field
<b>TYPE</b>	The control differentiates between the following entries <ul style="list-style-type: none"> <li>■ <b>PAL</b> Pallet</li> <li>■ <b>FIX</b> Fixture</li> <li>■ <b>PGM</b> NC program</li> </ul> Select the entries using the <b>ENT</b> key and the arrow keys or by soft key.	Mandatory field
<b>NAME</b>	File name The machine tool builder specifies the names for pallets and fixtures, if applicable, whereas you define program names. You must specify the complete path if the NC program is not saved in the directory of the pallet table.	Mandatory field
<b>DATUM</b>	Datum You must specify the complete path if the datum table is not saved in the folder of the pallet table. You activate datums from a datum table in the NC program using Cycle <b>7</b> .	Optional field This entry is only required if a datum table is used.
<b>PRESET</b>	Workpiece preset Enter the preset number of the workpiece.	Optional field



Column	Meaning	Field type
<b>LOCATION</b>	Location of the pallet The entry <b>MA</b> indicates that there is a pallet or fixture in the working space of the machine and can be machined. Press the <b>ENT</b> key to enter <b>MA</b> . Press the <b>NO ENT</b> key to remove the entry and thus suppress machining.	Optional field If the column exists, the entry is mandatory.
<b>LOCK</b>	Line locked Using an <b>*</b> you can exclude the line of the pallet table from processing. Press the <b>ENT</b> key to identify the line with the entry <b>*</b> . Press the <b>NO ENT</b> key to cancel the lock. You can lock the execution for individual NC programs, fixtures or entire pallets. Unlocked lines (e.g. PGM) in a locked pallet are also not executed.	Optional field
<b>PALPRES</b>	Number of the pallet preset	Optional field This entry is only required if pallet presets are used.
<b>W-STATUS</b>	Execution status	Optional field This entry is only required for tool-oriented machining.
<b>METHOD</b>	Machining method	Optional field This entry is only required for tool-oriented machining.
<b>CTID</b>	ID for mid-program startup	Optional field This entry is only required for tool-oriented machining.
<b>SP-X, SP-Y, SP-Z</b>	Clearance height in the linear axes X, Y, and Z	Optional field
<b>SP-A, SP-B, SP-C</b>	Clearance height in the rotary axes A, B, and C	Optional field
<b>SP-U, SP-V, SP-W</b>	Clearance height in the parallel axes U, V, and W	Optional field
<b>DOC</b>	Comment	Optional field





 

 












You can remove the **LOCATION** column if you are only using pallet tables in which the control is to machine all lines.

   **Further information:** "Inserting or deleting columns", Page 319

### Editing a pallet table

When you create a new pallet table, it is empty at first. Using the soft keys, you can insert and edit lines.

Soft key	Editing function
	Select the table start
	Select the table end
	Select the previous page in the table
	Select the next page in the table
	Insert as last line in the table
	Delete the last line in the table
	Add several lines at end of table
	Copy the current value
	Insert the copied value
	Select beginning of line
	Select end of line
	Find text or value
	Sort or hide table columns
	Edit the current field
	Sort by column contents
	Miscellaneous functions, e.g. saving
	Open file path selection

## Selecting a pallet table

Proceed as follows to select a pallet table or create a new pallet table:



- ▶ Switch to the **Programming** operating mode or a program run operating mode



- ▶ Press the **PGM MGT** key

If no pallet tables are shown:



- ▶ Press the **SELECT TYPE** soft key
- ▶ Press the **SHOW ALL** soft key
- ▶ Select a pallet table with the arrow keys, or enter a name for a new pallet table (.p)



- ▶ Press the **ENT** key



You can select either a list view or form view using the **Screen Layout** key.

## Inserting or deleting columns




This function is not enabled until the code number **555343** is entered.

Depending on the configuration, a newly created pallet table may not contain all columns. For tool-oriented machining, for example, you need columns that you have to insert first.

To insert a column in an empty pallet table, proceed as follows:

- ▶ Open the pallet table

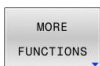

- ▶ Press the **MORE FUNCTIONS** soft key



- ▶ Press the **EDIT FORMAT** soft key
- ▶ The control opens a pop-up window displaying the available columns
- ▶ Using the arrow keys, select the desired column.
- ▶ Press the **INSERT COLUMN** soft key



- ▶ Press the **ENT** key

You can remove the column with the **DELETE COLUMN** soft key.

## Executing a pallet table



A machine parameter defines whether the control is to execute the pallet table blockwise or continuously.

To execute a pallet table, proceed as follows:



- ▶ Switch to **Program run, full sequence** or **Program run, single block** operating mode



- ▶ Press the **PGM MGT** key

If no pallet tables are shown:



- ▶ Press the **SELECT TYPE** soft key
- ▶ Press the **SHOW ALL** soft key
- ▶ Select a pallet table with the arrow keys
- ▶ Press the **ENT** key



- ▶ Select the screen layout, if necessary



- ▶ Execute with the **NC Start** key

Proceed as follows to check the NC program content before execution:

- ▶ Select pallet table
- ▶ With the arrow keys, select the NC program you would like to check



- ▶ Press the **OPEN THE PROGRAM** soft key
- ▶ The control displays the selected NC program on the screen.



- ▶ Scroll through the NC program with the arrow keys





- ▶ Press the **END PGM PAL** soft key
- ▶ The control returns to the pallet table.



A machine parameter defines how the control is to react after an error.

### Screen layout when executing the pallet table

If you want to see the NC program content and the content of the pallet table at the same time, select the screen layout **PALLET + PROGRAM**. During execution, the control then shows NC program blocks to the left and the pallet to the right.

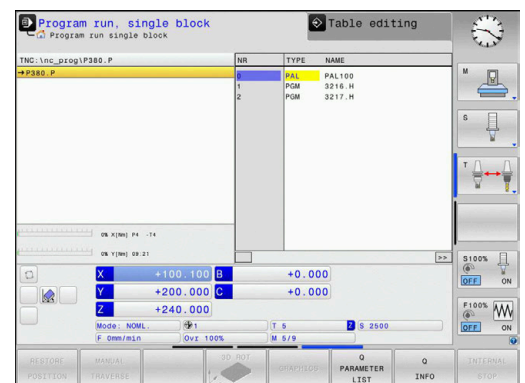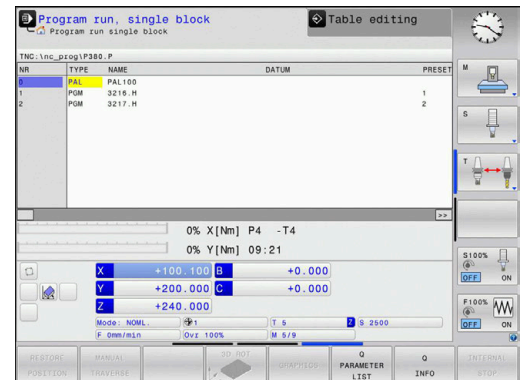

### Editing pallet tables

If the pallet table is active in the **Program run, full sequence** or **Program run, single block** operating mode, the soft keys for modifying the table in the **Programming** operating mode are inactive.

You can modify this table with the **EDIT PALLET** soft key in the **Program run, single block** or **Program run, full sequence** operating mode.

### Block scan in a pallet table

With the pallet management you can also use the **BLOCK SCAN** function in conjunction with pallet tables.

If you interrupt the execution of a pallet table, the control always suggests the previously selected NC block of the interrupted NC program for the **BLOCK SCAN** function.

**Further information:** "Block scan in pallet programs", Page 285

## 8.2 Pallet preset management

### Fundamentals



Refer to your machine manual!

This function must be enabled and adapted by the machine tool builder.

Changes to the pallet preset table must always be made in agreement with your machine tool builder!

The pallet preset table is available to you in addition to the workpiece preset table (**preset.pr**). The workpiece presets refer to an activated pallet preset.

The control shows the active pallet preset in the status display on the PAL tab.

### Application

Pallet presets are an easy way to compensate e.g. mechanical differences between individual pallets.

You can also completely align the coordinate system to the pallet by e.g. positioning the pallet preset in the center of a clamping tower.

### Using pallet presets

If you want to use pallet presets, insert the **PALPRES** column in the pallet table.

Enter the preset number from the pallet preset table into this column. Usually, you always want to change the pallet preset when you insert a new pallet, i.e. in the PAL type lines of the pallet table.

### NOTICE

#### Danger of collision!

Despite a basic rotation due to the active pallet preset, the control does not show a symbol in the status display. There is a danger of collision during all subsequent axis movements!

- ▶ If necessary, check the active pallet preset in the **PAL** tab
- ▶ Check the traverse movements of the machine
- ▶ Use pallet presets only in conjunction with pallets

## 8.3 Tool-oriented machining

### Fundamentals of tool-oriented machining

#### Application



Refer to your machine manual!

Tool-oriented machining is a machine-dependent function. The standard functional range is described below.

Tool-oriented machining allows you to machine several workpieces together even on a machine without pallet changer, which reduces tool-change times.

#### Limitation

#### NOTICE

##### Danger of collision!

Not all pallet tables and NC programs are suitable for tool-oriented machining. With tool-oriented machining, the control no longer executes the NC programs continuously, but divides them at the tool calls. The division of the NC programs allows functions that were not reset to be effective across programs (machine states). This leads to a danger of collision during machining!

- ▶ Consider the stated limitations
- ▶ Adapt pallet tables and NC programs to the tool-oriented machining
  - Reprogram the program information after each tool in every NC program (e.g. **M3** or **M4**).
  - Reset special functions and miscellaneous functions before each tool in every NC program (e. g., **Tilt the working plane** or **M138**)
- ▶ Carefully test the pallet table and associated NC programs in the **Program run, single block** operating mode

The following functions are not permitted:

- FUNCTION TCPM, M128
- M144
- M101
- M118
- Changing the pallet preset

The following functions require special attention, particularly for mid-program startup:

- Changing the machine statuses with a miscellaneous function (e.g. M13)
- Writing to the configuration (e.g. WRITE KINEMATICS)
- Traverse range switchover
- Cycle **32**
- Tilting the working plane

### Pallet table columns for tool-oriented machining

Unless the machine tool builder has made a different configuration, you need the following additional columns for tool-oriented machining:

Column	Meaning
<b>W-STATUS</b>	<p>The machining status defines the machining progress. Enter BLANK for an unmachined (raw) workpiece. The control changes this entry automatically during machining.</p> <p>The control differentiates between the following entries</p> <ul style="list-style-type: none"> <li>■ BLANK / no entry: Workpiece blank, requires machining</li> <li>■ INCOMPLETE: Partly machined, requires further machining</li> <li>■ ENDED: Machined completely, no further machining required</li> <li>■ EMPTY: Empty space, no machining required</li> <li>■ SKIP: Skip machining</li> </ul>
<b>METHOD</b>	<p>Indicates the machining method</p> <p>Tool-oriented machining is also possible with a combination of pallet fixtures, but not for multiple pallets.</p> <p>The control differentiates between the following entries</p> <ul style="list-style-type: none"> <li>■ WPO: Workpiece oriented (standard)</li> <li>■ TO: Tool oriented (first workpiece)</li> <li>■ CTO: Tool oriented (further workpieces)</li> </ul>
<b>CTID</b>	<p>The control automatically generates the ID number for mid-program startup with block scan.</p> <p>If you delete or change the entry, mid-program startup is no longer possible.</p>
<b>SP-X, SP-Y, SP-Z, SP-A, SP-B, SP-C, SP-U, SP-V, SP-W</b>	<p>The entry for the clearance height in the existing axes is optional.</p> <p>You can enter safety positions for the axes. The control only approaches these positions if the machine tool builder processes them in the NC macros.</p>



## Sequence of tool-oriented machining

### Requirements

Requirements for tool-oriented machining:

- The machine manufacturer must define a tool-change macro for tool-oriented machining
- The tool-oriented machining methods TO and CTO have to be defined in the pallet table
- The NC programs are using the same tools to at least some extent
- The W-STATUS of the NC programs permits further machining

### Sequence

- 1 The entry TO or CTO tells the control that the tool-oriented machining is valid beyond these lines of the pallet table
- 2 The control executes the NC program with the entry TO up to the TOOL CALL
- 3 The W-STATUS changes from BLANK to INCOMPLETE and the control enters a value into the CTID field
- 4 The control executes all other NC programs with the entry CTO up to the TOOL CALL
- 5 The control uses the next tool for the following machining steps if one of the following situations applies:
  - The next line in the table contains the entry PAL
  - The next line in the table contains the entry TO or WPO
  - There are lines in the table that do not yet contain the entry ENDED or EMPTY
- 6 The control updates the entry in the CTID field with each machining operation
- 7 If all table lines of the group contain the entry ENDED, the control processes the next few lines in the pallet table

### Resetting the machining status

If you want to start machining again, change the W-STATUS to BLANK or remove the previous input.

If you change the status in the PAL line, all FIX and PGM lines below this line are automatically changed, too.

## Mid-program startup with block scan

You can also return to a pallet table after an interruption. The control can show the line and the NC block at which the interruption occurred.

The block scan in the pallet table is tool oriented.

After a block scan, the control can resume tool-oriented machining if the tool-oriented machining method TO and CTO is defined in the following lines.

### Keep the following in mind for mid-program startup

- The entry in the CTID field remains there for two weeks. After this time, mid-programs startup is no longer possible.
- Do not change or delete the entry in the CTID field.
- The data from the CTID field become invalid after a software update.
- The control saves the preset numbers for mid-program startup. If you change this preset, machining is shifted, too.
- Mid-program startup is no longer possible after editing an NC program within tool-oriented machining.

The following functions require special attention, particularly for mid-program startup:

- Changing the machine statuses with a miscellaneous function (e.g. M13)
- Writing to the configuration (e.g. WRITE KINEMATICS)
- Traverse range switchover
- Cycle **32** Tolerance
- Tilting the working plane

## 8.4 Batch Process Manager (option 154)

### Application



Refer to your machine manual!  
Your machine tool builder configures and enables the **Batch Process Manager** function.

The **Batch Process Manager** enables you to plan production orders on a machine tool.

You save the planned NC programs in a job list. You use the **Batch Process Manager** to open the job list.

The following information is displayed:

- Whether the NC program is free of errors
- Run time of the NC programs
- Availability of the tools
- Times at which manual interventions at the machine are necessary



The tool usage test function has to be enabled and switched on to ensure you get all information!  
**Further information:** "Tool usage test", Page 144

### Fundamentals

The **Batch Process Manager** is available in the following operating modes:


- **Programming**
- **Program run, single block**
- **Program run, full sequence**

In the **Programming** operating mode, you can create and edit the job list.

The job list is executed in the **Program run, single block** and **Program run, full sequence** operating modes. Changes are possible only to a limited extent.

## Screen display

When you open the **Batch Process Manager** in the **Programming** operating mode, the following screen layout is displayed:

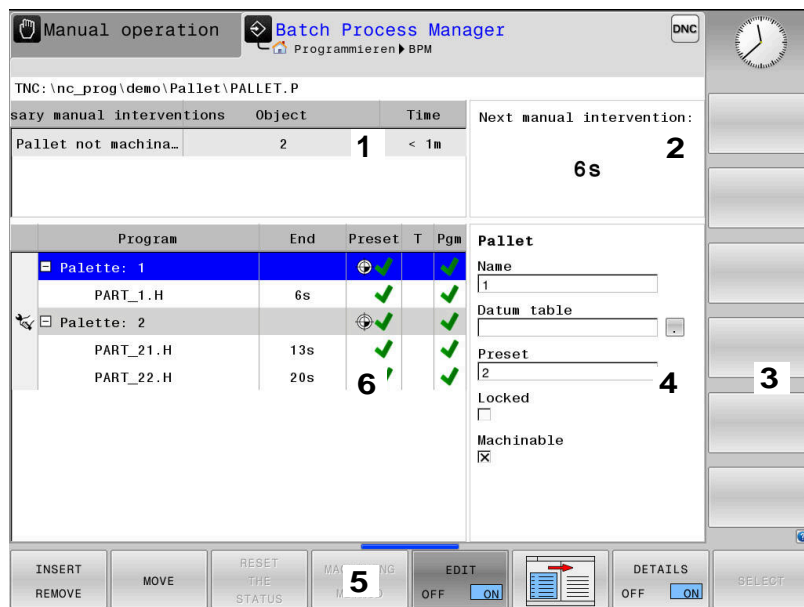





- 1 Displays all required manual interventions
- 2 Displays the next manual intervention
- 3 Shows any current soft keys provided by the machine tool builder
- 4 Shows the editable entries in the line highlighted in blue
- 5 Displays the current soft keys
- 6 Displays the job list

## Columns in the job list

Column	Meaning
No column name	Status of the <b>Pallet</b> , <b>Clamping</b> , or <b>Program</b>
<b>Program</b>	Name or path of the <b>Pallet</b> , <b>Clamping</b> , or <b>Program</b>
<b>Duration</b>	Run time in seconds This column is only shown if you have a 19-inch screen.
<b>End</b>	End of the run time <ul style="list-style-type: none"> <li>■ Time in <b>Programming</b> mode</li> <li>■ Actual time in <b>Program run, single block</b> and <b>Program run, full sequence</b> modes</li> </ul>
<b>Preset</b>	Status of the workpiece preset
<b>T</b>	Status of the inserted tools
<b>Pgm</b>	Status of the NC program
<b>Sts</b>	Machining status


The status of the **Pallet**, **Clamping**, and **Program** is shown by means of icons in the first column.

The icons have the following meanings:

Icon	Meaning
	The <b>Pallet</b> , <b>Clamping</b> , or <b>Program</b> is locked
	The <b>Pallet</b> or <b>Clamping</b> is not enabled for machining
	This line is currently being executed in <b>Program run, single block</b> or <b>Program run, full sequence</b> mode and cannot be edited
	In this line, the program was interrupted manually







In the **Program** column, the machining method is indicated by means of icons.

The icons have the following meanings:

Icon	Meaning
No icon	Workpiece-oriented machining
	Tool-oriented machining <ul style="list-style-type: none"> <li>■ Start</li> <li>■ End</li> </ul>

The status is shown by means of icons in the **Preset**, **T**, and **Pgm** columns.

The icons have the following meanings:

Icon	Meaning
	Test completed
	Test failed (e.g., because of expired tool life)
	Test not yet completed
	Incorrect program structure (e.g., pallet does not contain any subprograms)
	Workpiece preset is defined
	Check input You can assign a workpiece preset either to the pallet or to all NC subprograms.




 


#### Operating notes:

- In **Programming** operating mode, the **T** column is always empty because the control first checks the status in the **Program run, single block** and **Program run, full sequence** operating modes.
- If the tool usage test function is not enabled or is not switched on for your machine, then no icon is shown in the **Pgm** column

**Further information:** "Tool usage test", Page 144

In the **Sts** columns, the machining status is indicated by icons.

The icons have the following meanings:

Icon	Meaning
	Workpiece blank, machining required
	Partially machined, requires further machining
	Completely machined, no further machining required
	Skip machining



#### Operating notes:

- The machining status is automatically adjusted during machining
- The **Sts** column is shown in the **Batch Process Manager** only if the pallet table contains the **W STATUS** column

**Further information:** "Tool-oriented machining", Page 323

## Opening the Batch Process Manager






 


Refer to your machine manual!

In machine parameter **standardEditor** (no. 102902), your machine tool builder specifies the standard editor used by the control.



Programming operating mode

If the control does not open the pallet table (.p) in the Batch Process Manager as a job list, proceed as follows:

- ▶ Select the desired job list
  -  ▶ Shift the soft-key row
-  ▶ Press the **MORE FUNCTIONS** soft key
-  ▶ Press the **SELECT EDITOR** soft key
  - ▶ The control opens the **Select editor** pop-up window.
-  ▶ Select **BPM-EDITOR**
-  ▶ Confirm with the **ENT** key
- 
  - ▶ Alternative: Press the **OK** soft key
  - ▶ The control opens the job list in the **Batch Process Manager**.


Program run, single block and Program run, full sequence operating modes

If the control does not open the pallet table (.p) in the Batch Process Manager as a job list, proceed as follows:


 

 
 
-  ▶ Press the **Screen layout** key
- 
  - ▶ Press the **BPM** key
  - ▶ The control opens the job list in the **Batch Process Manager**.

 






 

 

Soft keys

The following soft keys are available:



Refer to your machine manual!  
The machine tool builder can configure his own soft keys.

Soft key	Function
	Collapse or expand tree structure
	Edit opened job list
	Shows the soft keys <b>INSERT BEFORE</b> , <b>INSERT AFTER</b> , and <b>REMOVE</b>
	Move line
	Select line

Soft key	Function
	Cancel marking
	Insert a new <b>Pallet, Clamping,</b> or <b>Program</b> before the cursor position
	Insert a new <b>Pallet, Clamping,</b> or <b>Program</b> after the cursor position
	Delete line or block
	Switch active windows
	Select possible entries from a pop-up window
	Reset the machining status to workpiece blank
	Select workpiece-oriented or tool-oriented machining
	Collapse or expand necessary manual interventions
	Open Extended Tool Management
	Interrupt machining



#### Operating notes:

- The **TOOL MANAGEMENT** and **INTERNAL STOP** soft keys are available only in the **Program run, single block** and **Program run, full sequence** operating modes.
- If the pallet table contains the **W STATUS** column, the **RESET THE STATUS** soft key is available.
- If the pallet table contains the **W STATUS, METHOD,** and **CTID** columns, the **MACHINING METHOD** soft key is available.

**Further information:** "Tool-oriented machining", Page 323



## Creating a job list

You can only create a new job list in the file manager.



The file name of a job list must always begin with a letter.



- ▶ Press the **Programming** key



- ▶ Press the **PGM MGT** key
- > The control opens the file manager.



- ▶ Press the **NEW FILE** soft key



- ▶ Enter the file name with extension (.p)
- ▶ Confirm with the **ENT** key
- > The control opens an empty job list in the **Batch Process Manager**.




- ▶ Press the **INSERT REMOVE** soft key



- ▶ Press the **INSERT AFTER** soft key
- > The control displays the various types on the right-hand side.
- ▶ Select the desired type
  - **Pallet**
  - **Clamping**
  - **Program**
- > The control inserts an empty line in the job list.
- > The control shows the selected type on the right-hand side.
- ▶ Define the entries
  - **Name:** Enter the name directly or select one by means of the pop-up window, if there is one
  - **Datum table:** Enter the datum directly, where applicable, or select one by means of the pop-up window
  - **Preset:** Enter the workpiece preset directly, where applicable
  - **Locked:** The selected line is excluded from machining
  - **Machinable:** The selected line is enabled for machining
- ▶ Confirm your entries by pressing the **ENT** key.



- ▶ Repeat the steps if required
- ▶ Press the **EDIT** soft key

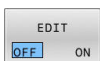

## Editing a job list

You can edit a job list in the **Programming**, **Program run, single block**, and **Program run, full sequence** operating modes.




Operating notes:

- If a job list is selected in the **Program run, single block** or **Program run, full sequence** operating mode, it is not possible to edit the job list in the **Programming** operating mode.
- The possibilities of changing a job list during machining are limited, because the control defines a protected area.
- NC programs in the protected area are shown in light gray.

Proceed as follows to edit a line in the job list in the **Batch Process Manager**:

- ▶ Open the desired job list

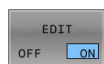

- ▶ Press the **EDIT** soft key



- ▶ Place the cursor on the desired line (e.g., **Pallet**)
- > The control displays the selected line in blue.
- > The control displays the editable entries on the right-hand side.



- ▶ Press the **CHANGE WINDOW** soft key if required
- > The control switches the active window.
- ▶ The following entries can be changed:
  - **Name**
  - **Datum table**
  - **Preset**
  - **Locked**
  - **Machinable**



- ▶ Confirm the edited entries by pressing the **ENT** key.
- > The control adopts the changes.
- ▶ Press the **EDIT** soft key



Proceed as follows to move a line in the job list in the **Batch Process Manager**:

- ▶ Open the desired job list




- ▶ Press the **EDIT** soft key



- ▶ Place the cursor on the desired line (e.g., **Program**)
- > The control displays the selected line in blue.



- ▶ Press the **MOVE** soft key

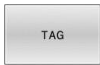

- ▶ Press the **TAG** soft key
- > The control highlights the line in which the cursor is positioned.




- ▶ Place the cursor on the desired position.
- > When the cursor is placed at a suitable position, the control shows the **INSERT BEFORE** and **INSERT AFTER** soft keys.



- ▶ Press the **INSERT BEFORE** soft key
- > The control inserts the line at the new position.



- ▶ Press the **GO BACK** soft key

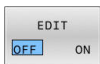

- ▶ Press the **EDIT** soft key



# 9

**MOD functions**


## 9.1 MOD function

The MOD functions provide additional input possibilities and displays. In addition, you can enter code numbers to enable access to protected areas.

### Selecting MOD functions

To open the MOD menu, proceed as follows:

- ▶ Press the **MOD** key
- ▶ The control opens a pop-up window displaying the available MOD functions.

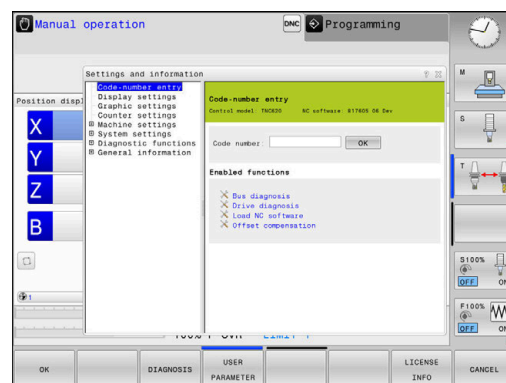

### Changing the settings

Navigation in the MOD menu is possible with the mouse and the alphabetic keyboard alike.

- ▶ Use the tab key to switch from the input area in the right window to the group and function selections in the left window
- ▶ Select the desired MOD function
- ▶ Switch to the input field with the tab key or ENT key
- ▶ Enter the required value for the function and confirm with **OK** or make a selection and confirm with **Apply**



If there are multiple possible settings available, then you can show the selection box by pressing the **GOTO** key. Select the desired setting with the **ENT** key. If you do not wish to change the setting, close the window with the **END** key.

### Exiting MOD functions

To exit the MOD menu, proceed as follows:

- ▶ Press the **END** soft key or the **END** key
- ▶ The control closes the pop-up window.

## Overview of MOD functions

The following groups with subordinate areas and functions are available independently of the selected operating mode:

### Code-number entry

- Code number

### Display settings

- Position display
- Measuring unit (mm/inch) for position display
- Program entry for MDI
- Show time of day
- Show the info line

### Graphic settings

- Model type
- Model quality

### Counter settings

- Momentary count
- Target value for counter

### Machine settings

- Kinematics
- Traverse limits
- Tool-usage file
- External access
- Set up wireless handwheel
- Set up touch probes

### System settings


- Set the system time
- Define the network connection
- Network: IP configuration

### Diagnostic functions

- Bus diagnosis
- TNCdiag
- Drive diagnosis
- Hardware configuration
- HEROS information

### General information

- Version information
- Info about machine manufacturer
- Machine information
- License information
- Machine times

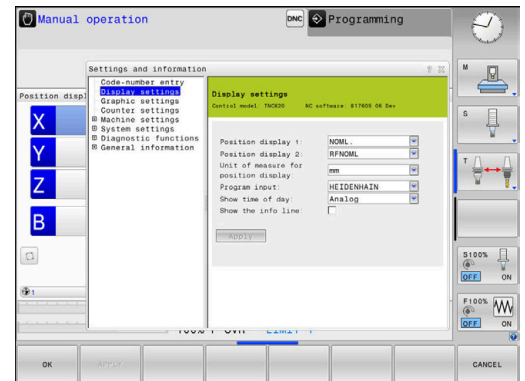

The **Info about machine manufacturer** area is available after the machine tool builder has defined the machine parameter **CfgOemInfo** (no. 131700).

The **Machine information** area is available after the machine operator has defined the machine parameter **CfgMachineInfo** (no. 131600, options 56 to 61).

## 9.2 Display software numbers

### Application

In the **Version information** MOD area of the **General information** group, the control displays the following information on the software:

- **Control model:** Designation of the control (managed by HEIDENHAIN)
- **NC-SW:** Number of the NC software (managed by HEIDENHAIN)
- **NCK:** Number of the NC software (managed by HEIDENHAIN)
- **PLC-SW:** Number or name of the PLC software (managed by the machine tool builder)



## 9.3 Entering the code number

### Application

The control requires a code number for the following functions:

Function	Code number
Select user parameters	123
Configuration of Ethernet interface	NET123
Enabling of special functions during Q-parameter programming	555343

The control shows in the code number dialog whether CAPS LOCK is active.

### Functions provided to the machine tool builder by the code number dialog

The two soft keys **OFFSET ADJUST** and **UPDATE DATA** are shown in the MOD menu of the control.

The **OFFSET ADJUST** soft key enables automatic determination and subsequent saving of an offset voltage required for analog axes.



Refer to your machine manual!  
This function may only be used by trained personnel!

The **UPDATE DATA** soft key enables the machine tool builder to install software updates on the control.

### NOTICE

#### Caution: Data may be lost!

Not following the instructions when installing updates can cause a loss of data.

- ▶ Always follow the instructions when installing software updates!
- ▶ Refer to your machine manual.

## 9.4 Loading the machine configuration

### Application

#### NOTICE

**Caution: Data may be lost!**

The **RESTORE** function irrevocably overwrites the current machine configuration with the backup files. The control does not perform an automatic backup before the **RESTORE** function is executed. The current files are thus permanently lost.

- ▶ Perform a backup of the current machine configuration prior to the **RESTORE** function
- ▶ Use the function only in consultation with the machine tool builder

Your machine tool builder can provide you with a backup including a machine configuration. After entering the **RESTORE** keyword, you can restore the backup on your machine or programming station.

To restore a backup, proceed as follows:

- ▶ Select the **Code-number entry** MOD function
- ▶ Enter the **RESTORE** keyword
- ▶ Press the **OK** soft key
- ▶ Select the backup file in the control's file manager (e.g., BKUP-2013-12-12\_.zip)
- > The control opens the pop-up window for the backup.
- ▶ Press Emergency Stop
- ▶ Press the **OK** soft key
- > The control starts restoring the backup.

## 9.5 Selecting the position display


### Application



In the **Display settings** group, you can influence the display of the coordinates for **Manual operation** mode as well as for the **Program run, full sequence** and **Program run, single block** operating modes:

The figure on the right shows the different tool positions:

- Initial position
- Target position of the tool
- Workpiece datum
- Machine datum

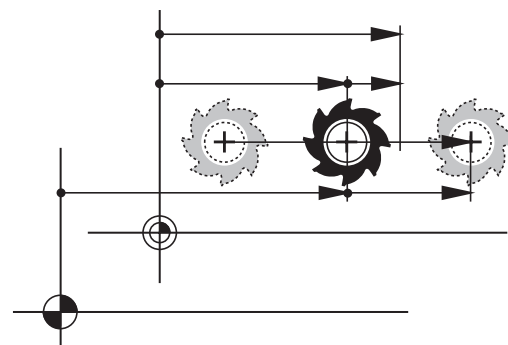You can select the following coordinates for the control's position displays:



Display	Function
NOML	Nominal position: The value currently commanded by the control
	<div>            The NOML and ACTL displays differ solely with regard to following error.         </div>
ACTL	Actual position; current tool position
	<div>            Refer to your machine manual!            Your machine tool builder defines whether the ACTL and NOML display deviates from the programmed position by the DL oversize of the tool call.         </div>
REF ACTL	Reference position; actual position relative to the machine datum
REF NOML	Reference position; nominal position relative to the machine datum
LAG	Servo lag; difference between nominal and actual positions
ACTDST	Distance remaining to the programmed position in the input coordinate system; difference between actual and target positions Examples with Cycle <b>11</b> : <ul style="list-style-type: none"> <li>▶ Scaling factor 0.2</li> <li>▶ L IX+10</li> <li>&gt; The ACTDST display shows 10 mm.</li> <li>&gt; The scaling factor does not have any influence.</li> </ul> Examples with Cycle <b>11</b> and tilted working plane: <ul style="list-style-type: none"> <li>▶ Tilt A by 45°</li> <li>▶ Scaling factor 0.2</li> <li>▶ L IX+10</li> <li>&gt; The ACTDST display shows 10 mm.</li> <li>&gt; The scaling factor and the tilt do not have any influence.</li> </ul>

Display	Function
REFDST	<p>Distance remaining to the programmed position in the machine coordinate system; difference between actual and target positions</p> <p>Examples with Cycle <b>11</b>:</p> <ul style="list-style-type: none"> <li>▶ Scaling factor 0.2</li> <li>▶ L IX+10</li> <li>&gt; The REFDST display shows 2 mm.</li> <li>&gt; The scaling factor has an effect on the distance and thus on the display.</li> </ul> <p>Examples with Cycle <b>11</b> and tilted working plane:</p> <ul style="list-style-type: none"> <li>▶ Tilt A by 45°</li> <li>▶ Scaling factor 0.2</li> <li>▶ L IX+10</li> <li>&gt; The REFDST display shows 1.4 mm in the X and Z axes.</li> <li>&gt; The scaling factor and the tilt have an effect on the distance and thus on the display.</li> </ul>
M118	<p>Traverse paths that were executed with handwheel superimpositioning function (<b>M118</b>)</p>

With the **Position display 1** MOD function, you can select the position display in the status display.

With the **Position display 2** MOD function, you can select the position display in the additional status display.

## 9.6 Setting the unit of measure

### Application

Use the **Unit of measure for position display** MOD function in the **Display settings** group to set the coordinate display to mm or inches.

- Metric system: e.g.  $X = 15.789$  (mm), the value is displayed to 3 decimal places
- Inch system: e.g.  $X = 0.6216$  (inches), value is displayed to 4 decimal places

If the display in inches is active, the control also displays the feed rate in inches/min. In an inch-based program, you must multiply the feed rate by 10.

## 9.7 Graphic settings

Use the **Simulation parameters** MOD function in the **Graphic settings** group to select the model type and model quality operating mode.




To define the graphic settings, proceed as follows:

- ▶ Select the **Graphic settings** group in the MOD menu
- ▶ Select the **Model type**
- ▶ Select the **Model quality**
- ▶ Press the **APPLY** soft key
- ▶ Press the **OK** soft key.
- > The control saves the selected settings.





In the **Test Run** operating mode, the control displays the icons of the active graphic settings.

In the **Simulation parameters** MOD function, the following settings are available:

### Model type

Icon	Choice	Properties	Application
	3-D	Very true to detail, heavy time and processor consumption	Milling with undercuts,
	2.5 D	Fast	Milling without undercuts
	No model	Very fast	Line graphics
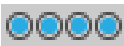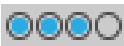
### Model quality

Icon	Choice	Properties
	Very high	<ul style="list-style-type: none"> <li>■ High data transfer rate</li> <li>■ Accurate display of the tool geometry</li> <li>■ Block end points and block numbers can be displayed</li> </ul>
	High	<ul style="list-style-type: none"> <li>■ High data transfer rate</li> <li>■ Accurate display of the tool geometry</li> </ul>
	Medium	<ul style="list-style-type: none"> <li>■ Medium data transfer rate</li> <li>■ Approximation of the tool geometry</li> </ul>
	Low	<ul style="list-style-type: none"> <li>■ Low data transfer rate</li> <li>■ Less accurate approximation of the tool geometry</li> </ul>

**Aspects to be observed with the Graphic settings**

Besides the MOD settings, the NC program has a great influence on the simulation result. Setting the highest model quality and using a 5-axis simultaneous program with many very short NC blocks might slow down the simulation.

Setting a low model quality, in turn, may lead to a distorted simulation result because very short NC blocks become invisible due to the low resolution.

HEIDENHAIN recommends the following settings:

- Fast visualization of a 3-axis program or test of an NC program for feasibility
  - **Model type:** 2.5-D
  - **Model quality:** medium
- Test of the NC program by means of the graphic simulation
  - **Model type:** 3-D
  - **Model quality:** very high

## 9.8 Setting the counter

 


The **Counter** MOD function in the **Counter settings** group allows you to change the current counter reading (actual value) and the target value (nominal value).

To define the counter, proceed as follows:

- ▶ Select the **Counter settings** group in the MOD menu
- ▶ Define the **Momentary count**
- ▶ Define the **PGM for counter**
- ▶ Press the **APPLY** soft key
- ▶ Press the **OK** soft key
- > The control saves the selected settings.

The control applies the defined values to the status display.

The following soft keys are available in the **Counter** MOD functions:

Soft key	Function
	Reset count
	Increase count
	Lower count

You can also enter the values directly with a connected mouse.

**Further information:** "Defining a counter", Page 312



## 9.9 Changing the machine settings

### Selecting the kinematics



Refer to your machine manual!

The **Kinematics** function will be configured and enabled by your machine tool builder.

### NOTICE

#### Danger of collision!

All stored kinematics can also be selected as active machine kinematics. By this means, all manual movements and machining operations are executed using the selected kinematics. All subsequent axis movements pose a risk of collision!

- ▶ Use the **Kinematics** function exclusively in the **Test Run** operating mode
- ▶ Use the **Kinematics** function for selecting the active machine kinematics only if required

The **Kinematics** MOD function in the **Machine settings** group allows you to select different kinematics as machine kinematics for the test run. You can use this function to test NC programs whose kinematics does not match the active machine kinematics.

The various kinematics must be defined and enabled by the machine tool builder. When you select a kinematics for the test run, the machine kinematics remains unaffected.

To change the kinematics, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Select the **Kinematics** function
- ▶ Select the desired kinematics for the **SIM** channel
- ▶ Press the **APPLY** soft key
- ▶ Press the **OK** soft key
- > The control saves the selected kinematics for the **Test Run** operating mode.



Ensure that you have selected the correct kinematics in the Test Run operating mode for checking your workpiece.

## Entering traverse limits



Refer to your machine manual!  
Your machine tool builder configures and enables the **Traverse limits** function.


The **Traverse limits** MOD function in the **Machine settings** group enables you to limit the actually usable traverse path within the maximum range of traverse. Thus, you can define traverse limits on each axis (e.g., to protect an indexing head from collision).

To define traverse limits, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Select the **Traverse limits** function
- ▶ Define a value in the **Lower limit** or **Upper limit** column

or

- ▶ Apply the current position by pressing the **ACTUAL POSITION CAPTURE** soft key
- ▶ Press the **APPLY** soft key
- > The control validates the defined values.
- ▶ Press the **OK** soft key
- > The control saves the defined traverse limits.

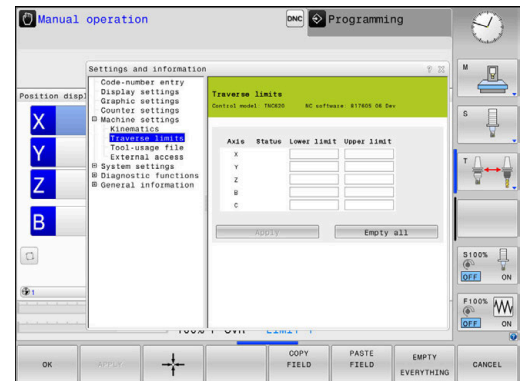

Operating notes:

- The protection zone becomes active automatically as soon as you have set a valid traverse limit in an axis. The settings are kept even after the control has been restarted.
- The only way to deactivate the traverse limits is to delete all values or to press the **EMPTY EVERYTHING** soft key.

**Software limit switch with modulo axes**

If you set software limit switches for modulo axes, make sure to comply with the following basic conditions:

- The lower limit is greater than  $-360^\circ$  and less than  $+360^\circ$
- The upper limit is not negative and less than  $+360^\circ$
- The lower limit is not greater than the upper limit
- The difference between the upper and the lower limit is less than  $360^\circ$

If these conditions are not met, you will not be able to move the modulo axis. The TNC 620 displays an error message.

If modulo limit switches are active, a movement is allowed if the target position or an equivalent position is within the allowed range. Equivalent positions are positions that differ from the target positions by an offset of  $n \cdot 360^\circ$  (where  $n$  is any integer). The direction of motion is derived automatically because there is always only one equivalent position that the axis can move to—with the exception described below.

**Example:**

For the modulo axis C, the limit switches have been set to  $-80^\circ$  and  $+80^\circ$ . The axis is at  $0^\circ$ . If you program **L C+320** now, the C axis will move to  $-40^\circ$ .

If an axis is positioned outside the limit switch range, it can only be moved towards the nearer limit switch.

**Example:**

The limit switches have been set to  $-90^\circ$  and  $+90^\circ$ . The C axis is at  $-100^\circ$ .

In this case, the C axis must move in the positive direction with its next movement so that moving by **L C+15** works, while **L C-15** would result in a limit switch violation.

**Exception:**

The axis is positioned exactly in the middle of the forbidden range. Thus, the distance to both limit switches is the same. In this case, the movement can go to either direction. This results in the special situation that the axis can move to two equivalent positions if the target position is within the allowed range. In this case, the axis will be moved to the nearer equivalent position, i.e. the shorter path is used. If both equivalent positions are equidistant (i.e.,  $180^\circ$  away), the control selects the direction of motion according to the programmed value.

**Example:**

The limit switches have been set to  $C-90^\circ$ ,  $C+90^\circ$  and the axis is at  $180^\circ$ .

If you program **L C+0**, the C axis will move to 0. The same is true when programming **L C-360**, etc. However, if you program **L C +360** (or **L C+720**, etc.), then the C axis will move to  $360^\circ$ .

## Generating a tool usage file



Refer to your machine manual!

The tool usage test function must be enabled by your machine tool builder.

Using the **Tool-usage file** MOD function in the **Machine settings** group, you can define whether the control never, once, or always creates a tool usage file. The settings for the test run and the program run operating modes must be defined separately.

To change the settings in the tool usage file, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Select the **Tool-usage file** function
- ▶ Select the setting for **Program Run, Full Sequence/Single Block**
- ▶ Select the setting for **Test Run**
- ▶ Press the **APPLY** soft key
- ▶ Press the **OK** soft key
- > The control saves the defined settings.

## Permitting or restricting external access



Refer to your machine manual!

The machine tool builder can configure the external access options.

Depending on the machine, you can grant or restrict access for an external diagnostics or commissioning software application using the **TNCOPT** soft key.


The **External access** MOD function in the **Machine settings** group allows you to permit or block access to the control. Once you have restricted external access, it is no longer possible to connect to the control and to exchange data over a network or over a serial connection (e.g., with the **TNCremo** software).

To block external access, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Select the **External access** function
- ▶ Set the **EXTERNAL ACCESS ON/OFF** soft key to **OFF**
- ▶ Press the **OK** soft key
- > The control saves the settings.



Once the control is accessed externally, the following icon appears:

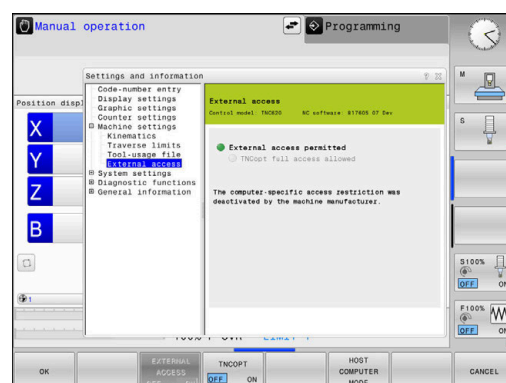

Computer-specific access control

If your machine tool builder has set up computer-specific access control (machine parameter **CfgAccessControl** no. 123400), you can permit access for up to 32 connections authorized by you.

To establish a new connection, proceed as follows:


- ▶ Press the **ADD NEW** soft key
- > The control opens an input window for you to enter the connection data.

Access settings

Host name	Host name of the external computer
Host IP	Network address of the external computer
Description	Additional information (text is shown in the overview list)
<b>Type:</b>	
Ethernet	Network connection
Com 1	Serial interface 1
COM 2	Serial interface 2

Access rights:


Inquire	For external access, the control opens a query dialog
Deny	Do not permit network access
Permit	Permit network access without query




When user administration is active, the control automatically disables the LSV2 connections of the serial interfaces (COM1 and COM2) for security purposes.

If you assign the **Inquire** access right to a connection, and if access is gained from this address, then the control opens a pop-up window. You must permit or deny external access in the pop-up window:

External access	Permission
Yes	Permit once
Always	Permit continuously
Never	Deny continuously
No	Deny once



In the overview list, an active connection is shown with a green symbol.  
Connections without access rights are shown gray in the overview list.

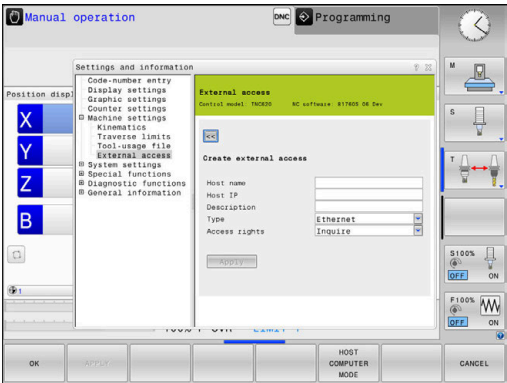

### Host computer operation



Refer to your machine manual!

This function must be enabled and adapted by the machine tool builder.

With the **HOST COMPUTER MODE** soft key you transfer the command to an external host computer in order to transfer data to the control, for example.

The requirements to be met for starting host computer mode include the following:

- Dialogs, such as **GOTO** or **Block scan** are closed
- No program run is active
- Handwheel is inactive

To start host computer operation, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Select the **External access** function
- ▶ Press the **HOST COMPUTER MODE** soft key
- > The control shows an empty screen with the **Host computer is active** pop-up window.



Your machine tool builder can specify that the host computer mode can automatically be activated externally.

To terminate host computer operation, proceed as follows:

- ▶ Press the **HOST COMPUTER MODE** soft key again
- > The control closes the pop-up window.

## 9.10 Setting up touch probes

### Introduction

The control allows you to set up and manage multiple touch probes. Depending on the type of touch probe, you have the following options for setting it up:

- TT tool touch probe with radio transmission: Setup via MOD function
- TT tool touch probe with cable or infrared transmission: Setup via MOD function or entry in machine parameters
- TS 3-D touch probe with radio transmission: Setup via MOD function
- 3-D TS touch probe with cable or infrared transmission: Setup via MOD function, tool management, or touch probe table

**Further information:** User's Manual for **Programming of Measuring Cycles for Workpieces and Tools**

The **Set up touch probes** MOD function in the **Machine settings** group enables you to set up touch probes.

To open the **Set up touch probes** MOD function, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Select the **Set up touch probes** function
- > The control opens a pop-up window for device configuration on the third desktop.

### Setting up a touch probe with radio transmission



Refer to your machine manual!

In order for the control to recognize the touch probe with radio transmission, you will require an **SE 661** transceiver with EnDat interface.

In the **Set up touch probes** MOD function, the left-hand side of the screen shows the touch probes that have already been configured. If not all of the columns are visible, you can shift the view with the scroll bar or move the dividing line between the left and right sides of the screen using the mouse.

To set up a new wireless touch probe, proceed as follows:

- ▶ Place the cursor on the row of the **SE 661**
- ▶ Select the radio channel



- ▶ Press the **CONNECT NEW TCH PROBE** soft key
- > The control displays the next steps in the dialog
- ▶ Follow the instructions in the dialog:
  - Remove the battery from the touch probe
  - Insert the battery into the touch probe
- > The control connects to the touch probe and creates a new row in the table

## Setting up a touch probe from within the MOD function

You can set up a 3-D touch probe with cable or with infrared transmission either in the touch probe table, in tool management, or in the **Set up touch probes** MOD function.

You can also define tool touch probes via the machine parameter **CfgTT** (No. 122700).

In the **Set up touch probes** MOD function, the left-hand side of the screen shows the touch probes that have already been configured. If not all of the columns are visible, you can shift the view with the scroll bar or move the dividing line between the left and right sides of the screen using the mouse.

### Setting up a 3-D touch probe

To set up a new touch probe, proceed as follows:



- ▶ Press the **CREATE TS ENTRY** soft key
- > The control creates a new row in the table.
- ▶ If necessary, highlight the row with the cursor
- ▶ Enter the touch probe data on the right side
- > The control saves the entered data in the touch probe table.

### Setting up a tool touch probe

To set up a tool touch probe, proceed as follows:



- ▶ Press the **CREATE TT ENTRY** soft key
- > The control opens a pop-up window.
- ▶ Enter a unique name for the touch probe
- ▶ Press the **OK** soft key
- > The control creates a new row in the table.
- ▶ If necessary, highlight the row with the cursor
- ▶ Enter the touch probe data on the right side
- > The control saves the entered data in the machine parameters.



## Touch probe with radio transmission configuration

In the **Set up touch probes** MOD function, the control displays information on each touch probe at the right-hand side of the screen. Some of this information is also visible and configurable for infrared touch probes.

Tab	TS 3-D touch probe	TT tool touch probe
Work data	Data from the touch probe table	Data from the machine parameters
Project information	Connection data and diagnostics functions	Connection data and diagnostics functions

You can change the data from the touch probe table by selecting the row with the cursor and overwriting the current value.

You can change the machine parameters only after first entering the code number.




### Changing properties

To change the characteristics of a touch probe, proceed as follows:

- ▶ Place the cursor on the row for the touch probe
- ▶ Select the “Properties” tab
- > The control shows the properties of the selected touch probe.
- ▶ Change the properties as desired per soft key

You have the following options depending on the row on which the cursor is located:

Soft key	Function
SELECT DEFLECTION	Select the probe signal
SELECT CHANNEL	Select the radio channel Select the channel with the best radio transmission and pay attention to overlaps with other machines or wireless handwheels.
CHANGE CHANNEL	Change the radio channel
REMOVE TCH. PROBE	Delete the touch probe data The control deletes the entry from the MOD function and the touch probe table or from the machine parameters.
EXCHANGE TCH. PROBE	Save a new touch probe in the current row The control automatically overwrites the serial number of the replaced touch probe with the new number.

Soft key	Function
	Select the SE transceiver
	Select the strength of the infrared signal You only need to change the signal strength if there is interference.
	Select the strength of the radio signal You only need to change the signal strength if there is interference.

The **Switching on/off** connection setting is preset based on the type of touch probe. Under **Deflection**, you can select how the touch probe is to transmit the signal when probing.

Deflection	Meaning
IR	Infrared probe signal
Radio	Radio probe signal
Radio + IR	The control selects the probe signal

You can activate the touch probe per soft key in the “Properties” tab (e.g., in order to test the radio connection)




If you activate the touch probe's radio connection manually per soft key, then the signal remains unchanged even after a tool change. You must deactivate the radio connection manually again.

### Current radio touch probe data

The control displays the following information in the “Current radio touch probe data” area:

Display	Meaning
NO.	Number in the touch probe table
Model	Type of touch probe
Status	Touch probe active or inactive
Signal strength	Display of the signal strength in the bar graphic The control shows the currently best-known connection as a complete bar
Deflection	Stylus deflected or not deflected
Collision	Collision or no collision recognized
Battery status	Display of the battery quality If the charge is less than the displayed bar, then the control outputs a warning.

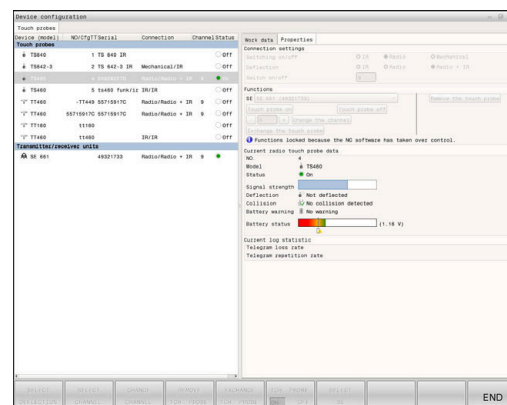

## 9.11 Configuring the HR 550FS radio handwheel

### Application



This setup dialog is managed by the HEROS operating system.

After you have changed the conversational language on your control, you need to restart the control to enable the new language.

To configure the HR 550FS wireless handwheel, use the **SET UP WIRELESS HANDWHEEL** soft key. The following functions are available:

- Assigning the handwheel to a specific handwheel holder
- Setting the transmission channel
- Analyzing the frequency spectrum for determining the optimum transmission channel
- Selecting transmitter power
- Statistical information on the transmission quality



Any changes or modifications that were not expressly approved by the party responsible for conformity could void your authority to operate the device.

This device complies with Part 15 of the FCC Rules and the RSS standard(s) of Industry Canada for license-exempt equipment.

Operation is subject to the following conditions:


- 1 The device must not cause any harmful interference.
- 2 The device must be tolerant to any interferences it receives, including interference that might impair its operation.

### Assigning the handwheel to a specific handwheel holder

To assign a handwheel to a specific handwheel holder, the handwheel holder must be connected to the control hardware.

To assign a handwheel to a specific handwheel holder, proceed as follows:

- ▶ Place the handwheel in the handwheel holder
- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Press the **SET UP WIRELESS HANDWHEEL** soft key
- The control opens a pop-up window.
- ▶ Select the **Connect HW** button
- The control saves the serial number of the inserted wireless handwheel and displays it in the configuration window to the left of the **Connect HW** button.
- ▶ Select the **END** button
- The control saves the configuration.


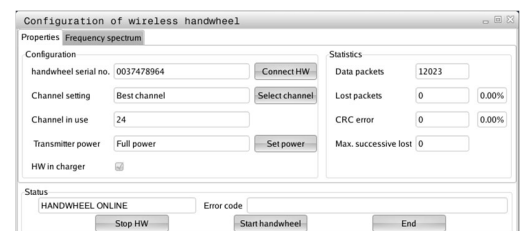


## Setting the transmission channel

If the wireless handwheel is started automatically, then the control tries to select the transmission channel that provides the best transmission signal.

To manually set the radio channel, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Press the **SET UP WIRELESS HANDWHEEL** soft key
- > The control opens a pop-up window.
- ▶ Select the **Frequency spectrum** tab
- ▶ Select the **Stop HW** button
- > The control stops the connection to the wireless handwheel and determines the current frequency spectrum for all 16 available channels.
- ▶ Note the number of the channel with the least amount of radio traffic (smallest bar)
- ▶ Select the **Start handwheel** button
- > The control restores the connection to the wireless handwheel.
- ▶ Select the **Properties** tab
- ▶ Select the **Select channel** button
- > The controls shows all available channel numbers
- ▶ Select the number of the channel with the least amount of radio traffic
- ▶ Select the **END** button
- > The control saves the configuration.

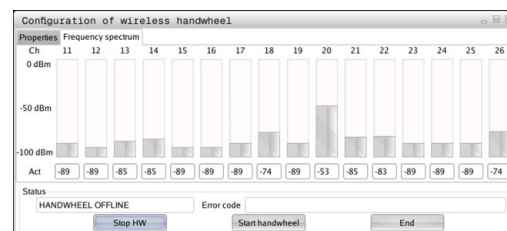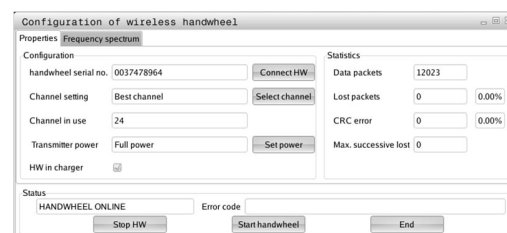


## Selecting the transmitter power



A reduction in transmission power decreases the range of the wireless handwheel.

To set the transmitter power of the handwheel, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Press the **SET UP WIRELESS HANDWHEEL** soft key
- > The control opens a pop-up window.
- ▶ Select the **Set power** button
- > The control displays the three available power settings.
- ▶ Select the desired transmitter power setting
- ▶ Select the **END** button
- > The control saves the configuration.

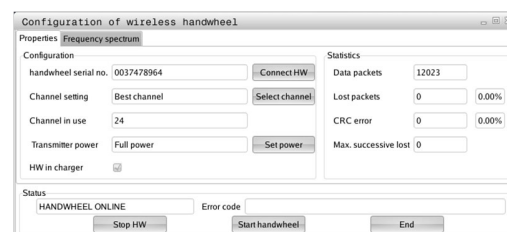

## Statistical data

To display the statistics data, proceed as follows:

- ▶ Select the **Machine settings** group in the MOD menu
- ▶ Press the **SET UP WIRELESS HANDWHEEL** soft key
- > The control opens a pop-up window.

Under **Statistics**, the control displays information about the transmission quality.


If the reception quality is poor so that a proper and safe stop of the axes cannot be ensured anymore, an emergency-stop reaction of the wireless handwheel is triggered.

A high value under **Max. successive lost** is an indication of a limited quality of reception. If the control repeatedly displays values greater than 2 during normal operation of the wireless handwheel within the desired range of use, there is a high risk of undesired disconnection.

If this occurs, try to improve the transmission quality by selecting a different channel or by increasing the transmitter power.

**Further information:** "Setting the transmission channel", Page 360

**Further information:** "Selecting the transmitter power", Page 360

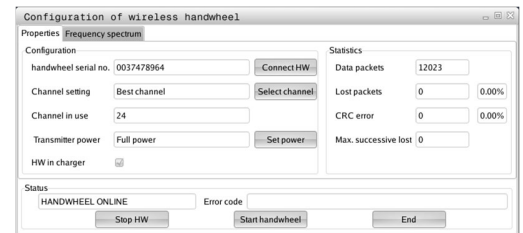

## 9.12 Changing the system settings

### Set the system time

With the **Set the system time** MOD function in the **System settings** group, you can set the time zone, date, and time manually or by means of an NTP server synchronization.

To set the system time manually, proceed as follows:

- ▶ Select the **System settings** group in the MOD menu
- ▶ Press the **SET DATE/ TIME** soft key
- > The control opens a pop-up window.
- ▶ In the **Time zone** area, select the desired time zone
- ▶ Press the **NTP off** soft key if required
- > The control enables the **Set the time manually** check box.
- ▶ Change the date and time, if required
- ▶ Press the **OK** soft key
- > The control saves the settings.

To set the system time using a NTP server, proceed as follows:

- ▶ Select the **System settings** group in the MOD menu
- ▶ Press the **SET DATE/ TIME** soft key
- > The control opens a pop-up window.
- ▶ In the **Time zone** area, select the desired time zone
- ▶ Press the **NTP on** soft key, if required
- > The control enables the **Synchronize the time over NTP server** check box.
- ▶ Enter the host name or the URL of an NTP server
- ▶ Press the **Add** soft key
- ▶ Press the **OK** soft key
- > The control saves the settings.

## 9.13 Diagnostic functions

### Bus diagnosis



This function is protected by a code number.  
Only use this function after consultation with your machine tool builder.

The **Diagnostic functions** group of the **Bus diagnosis** MOD area allows the machine tool builder to retrieve the bus system data.

### TNCdiag



Only use this function after consultation with your machine tool builder.

The control displays status and diagnostic information of HEIDENHAIN components in the **Diagnostic functions** group of the **TNCdiag** MOD area.



For more information, please refer to the **TNCdiag** documentation.

### Drive diagnosis



Only use this function after consultation with your machine tool builder.

In the **Diagnostic functions** group of the **Drive diagnosis** MOD area, the **DriveDiag** diagnosis tool is displayed.

With **DriveDiag**, the machine tool builder can retrieve information about the hardware, software, and drive system in use.

### Hardware configuration



Only use this function after consultation with your machine tool builder.

In the **Diagnostic functions** group of the **Hardware configuration** MOD area, the control displays the nominal and actual hardware configurations in the **HwViewer**.

If the control detects a hardware change, it automatically opens the error window. The soft keys displayed there allow you to open the **HwViewer**.

The changed hardware component is color-highlighted.

### HeROS information

In the **Diagnostic functions** group of the **HeROS information** MOD area, the control displays details on the operating system.

Besides the information on the control type and the software version, this MOD area also shows the current CPU and memory usage values.

## 9.14 Displaying operating times

### Application


In the **General information** group of the **MACHINE TIMES** MOD area, the control displays the following operating times:

Operating time	Meaning
<b>Control on</b>	Operating time of the control since being put into service
<b>Machine on</b>	Operating time of the machine tool since being put into service
<b>Program run</b>	Duration of controlled operation since being put into service



Refer to your machine manual!

The machine tool builder can provide further operating time displays.

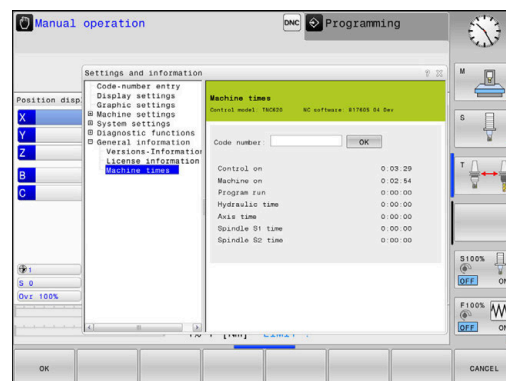



# 10

**HEROS functions**

## 10.1 Remote Desktop Manager (option 133)

### Introduction

The Remote Desktop Manager enables you to display external computer units on the control screen that are connected via Ethernet, and to operate them via the control. You can also start programs specifically under HEROS or display web pages of an external server.

HEIDENHAIN offers you the IPC 6641 as a Windows computer. With the IPC 6641 Windows computer, you can start and operate Windows-based applications directly from within the control.

The following connection options are available:

- **Windows Terminal Service (RemoteFX):** Displays the desktop of a remote Windows computer on the control
- **VNC:** Connection to an external computer. Displays the desktop of a remote Windows, Apple, or Unix computer on the control
- **Switch-off/restart of a computer:** Configure automatic shutdown of a Windows computer
- **World Wide Web:** Available only to authorized specialists
- **SSH:** Available only to authorized specialists
- **XDMCP:** Available only to authorized specialists
- **User-defined connection:** Available only to authorized specialists



HEIDENHAIN assures a functioning connection between HEROS 5 and the IPC 6641. No guarantee is given for other combinations and connections.



If you are using a TNC 620 with touch control, you can replace some keystrokes with gestures.

**Further information:** "Operating the touchscreen", Page 461

## Configuring a connection: Windows Terminal Service (RemoteFX)

### Configuring an external computer



You do not need additional software for your external computer to connect to the Windows Terminal Service.

Proceed as follows to configure the external computer, e.g. in the Windows 7 operating system:






- ▶ Press the Windows Start button and select **Control Panel** on the Start menu.
- ▶ Select **System and Security**
- ▶ Select **System**
- ▶ Select **Remote settings**
- ▶ Under **Remote Assistance**, enable **Allow Remote Assistance connections to this computer**
- ▶ Under **Remote Desktop**, select **Allow connections from computers running any version of Remote Desktop**
- ▶ Press **OK** to confirm your settings

### Configuring the control

Proceed as follows to configure the control:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select **Remote Desktop Manager**
- > The control opens the **Remote Desktop Manager**.
- ▶ Press **New connection**
- ▶ Press **Windows Terminal Service (RemoteFX)**
- > The control opens the **Selection of server operating sys.** pop-up window.
- ▶ Select the desired operating system
  - Win XP
  - Win 7
  - Win 8.X
  - Win 10
  - Other Windows version
- ▶ Press **OK**
- > The control opens the **Edit the connection** pop-up window.
- ▶ Define the connection settings

Setting	Meaning	Input
Connection name	<p>Name of the connection in the Remote Desktop Manager</p> <div> <p><b>i</b> You can use the following characters in the name of the connection:</p> <p>A B C D E F G H I J K L M N O P Q R S T U V W X Y Z a b c d e f g h i j k l m n o p q r s t u v w x y z 0 1 2 3 4 5 6 7 8 9 _</p> <p>When you edit an existing connection, the control will automatically delete all impermissible characters from the name.</p> </div>	Required
Restarting after end of connection	<p>Behavior after disconnection:</p> <ul style="list-style-type: none"> <li>■ Always restart</li> <li>■ Never restart</li> <li>■ Always after an error</li> <li>■ Ask after an error</li> </ul>	Required
Automatic starting upon login	Connection is automatically established during control startup	Required
Add to favorites	<p>Connection icon in the task bar:</p> <ul style="list-style-type: none"> <li>► Single click with the left mouse button</li> <li>&gt; The control switches to the desktop of the connection.</li> <li>► Single click with the right mouse button</li> <li>&gt; The control displays the connection menu.</li> </ul>	Required
Move to the following workspace	<p>Number of the desktop for the connection, desktops 0 and 1 being reserved for the NC software</p> <p>Default setting: Third desktop</p>	Required
Release USB mass memory	Permit access to connected USB mass memory devices	Required
Private connection	Connection can only be seen and used by its creator	Required
Computer	<p>Host name or IP address of the external computer</p> <p>HEIDENHAIN recommends the following setting for the IPC (6641):</p> <p><b>IPC6641.machine.net</b></p> <p>The host name <b>IPC6641</b> must be assigned to the IPC in the Windows operating system for this setting.</p> <div> <p><b>i</b> The <b>.machine.net</b> code is very important in this context. When <b>.machine.net</b> is specified, the control automatically searches the Ethernet interface <b>X116</b>, and not the interface <b>X26</b>—this reduces the time needed for access.</p> </div>	Required
User name	Name of the user	Required
Password	User password	Required
Windows domain	Domain of the external computer	Optional
Full-screen mode or User-defined window size	Size of the connection window	Required

Setting	Meaning	Input
<b>Multimedia enhancements</b>	<p>Enables hardware acceleration when playing videos Certain formats, e.g. MP4 files, require the paid Fluendo Codec Pack</p> <div>  Any additional software will be installed by your machine tool builder. </div>	Optional
<b>Touchscreen input</b>	Enables operation of multitouch systems and applications	Optional
<b>Encryption</b>	<p>Sets the encryption that is appropriate for the selected Windows system</p> <div>  If you activate the <b>Encryption</b> function, you need to remove the <b>-sec-tls -sec-nla</b> entries from the <b>Additional options</b> input field. If problems occur, try to set up a connection with the encryption function deactivated. The Windows log files are required for analysis. </div>	Required
<b>Color depth</b>	Setting for the display of the external system on the control	Required
<b>Locally effective keys</b>	<p>Shortcuts for automatically switching to the next active connection and workspace or desktop Default setting:</p> <ul style="list-style-type: none"> <li>■ <b>Super_R</b> corresponds to the right DIADUR key and switches between the active connections</li> <li>■ <b>F12</b> switches between the workspaces or desktops</li> </ul> <div>  Touchscreens no longer include an <b>F12</b> key. Here, the vacant key between <b>PGM MGT</b> and <b>ERR</b> is used to switch the workspaces or desktops. </div> <p>It is possible to adjust the default settings or to make additional entries</p>	Required
<b>Max. connection time (seconds)</b>	<p>Waiting time for connection If this timeout is exceeded, the connection could not be established</p>	Required
<b>Additional options</b>	<p>Available only to authorized specialists Additional command lines with transfer parameters</p> <div>  If you activate the <b>Encryption</b> function, you need to remove the <b>-sec-tls -sec-nla</b> entries from the <b>Additional options</b> input field. </div>	Required
<b>Pass USB devices through</b>	<p>Passing the USB devices (e.g. 3-D mouse for operating CAD programs) connected to the control through to the Windows computer This requires installation of the Eltima EveUSB software on the Windows computer.</p> <div>  All USB devices that have been passed through are not available on the control while the connection to the Windows computer is active. </div>	Optional

For integrating the IPC 6641, HEIDENHAIN recommends the use of a RemoteFX connection.

When using a RemoteFX connection, the screen of the external computer is not mirrored, as with VNC. Instead, a separate desktop is opened. The desktop that is active on the external computer when establishing the connection is then locked and the user is logged off. This prevents two users from accessing the control simultaneously.

## Configuring a connection: VNC

### Configuring an external computer



You need an additional VNC server for your external computer when trying to connect to VNC.  
Install and configure the VNC server, e.g. the TightVNC server, before configuring the control.

### Configuring the control

To configure the control, proceed as follows:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select **Remote Desktop Manager**
- > The control opens the **Remote Desktop Manager**.
- ▶ Press **New connection**
- ▶ Press **VNC**
- > The control opens the **Edit the connection** pop-up window.
- ▶ Define the connection settings

Setting	Meaning	Input
<b>Connection name:</b>	Name of the connection in the Remote Desktop Manager	Required
	<div> <p>You can use the following characters in the name of the connection: A B C D E F G H I J K L M N O P Q R S T U V W X Y Z a b c d e f g h i j k l m n o p q r s t u v w x y z 0 1 2 3 4 5 6 7 8 9 _ When you edit an existing connection, the control will automatically delete all impermissible characters from the name.</p> </div>	
<b>Restarting after end of connection:</b>	Behavior after disconnection: <ul style="list-style-type: none"> <li>■ Always restart</li> <li>■ Never restart</li> <li>■ Always after an error</li> <li>■ Ask after an error</li> </ul>	Required
<b>Automatic starting upon login</b>	Connection is automatically established during control startup	Required
<b>Add to favorites</b>	Connection icon in the task bar: <ul style="list-style-type: none"> <li>▶ Single click with the left mouse button</li> <li>&gt; The control switches to the desktop of the connection.</li> <li>▶ Single click with the right mouse button</li> <li>&gt; The control displays the connection menu.</li> </ul>	Required
<b>Move to the following workspace</b>	Number of the desktop for the connection, desktops 0 and 1 being reserved for the NC software Default setting: Third desktop	Required
<b>Release USB mass memory</b>	Permit access to connected USB mass memory devices	Required
<b>Private connection</b>	Connection can only be seen and used by its creator	Required

Setting	Meaning	Input
<b>Calculator</b>	Host name or IP address of the external computer. In the recommended configuration of the IPC 6641, the IP address 192.168.254.3 is used.	Required
<b>User name:</b>	Name of the user to be logged on	Required
<b>Password</b>	Password for connecting to the VNC server	Required
<b>Full-screen mode or User-defined window size:</b>	Size of the connection window	Required
<b>Permit further connections (share)</b>	Additionally grant other VNC connections access to the VNC server	Required
<b>View only</b>	In display mode, the external computer cannot be operated	Required
Entries in the <b>Advanced options</b> area	Available only to authorized specialists	Optional

With VNC, the screen of the external computer is mirrored directly. The active desktop at the external computer is not locked automatically.

With a VNC connection, it is also possible to completely shut down the external computer via the Windows menu. As the computer cannot be rebooted via a connection, it must actually be switched off and on again.

### Shutting down or restarting an external computer

#### NOTICE

##### Caution: Data may be lost!


If you do not shut down the external computer properly, data may be irreversibly damaged or deleted.

- Configure the automatic shutdown of the Windows computer

To configure the control, proceed as follows:

- Press the **DIADUR** key to open the HEROS menu
- Select **Remote Desktop Manager**
- > The control opens the **Remote Desktop Manager**.
- Press **New connection**
- Press **Switch-off/restart of a computer**
- > The control opens the **Edit the connection** pop-up window.
- Define the connection settings



Setting	Meaning	Input
Connection name:	<p>Name of the connection in the Remote Desktop Manager</p> <div>  <p>You can use the following characters in the name of the connection:  A B C D E F G H I J K L M N O P Q R S T U V W X Y Z  a b c d e f g h i j k l m n o p q r s t u v w x y z 0 1 2 3 4  5 6 7 8 9 _</p> <p>When you edit an existing connection, the control will automatically delete all impermissible characters from the name.</p> </div>	Required
Restarting after end of connection:	Not necessary with this connection	–
Automatic starting upon login	Not necessary with this connection	–
Add to favorites	<p>Connection icon in the task bar:</p> <ul style="list-style-type: none"> <li>▶ Single click with the left mouse button</li> <li>&gt; The control switches to the desktop of the connection.</li> <li>▶ Single click with the right mouse button</li> <li>&gt; The control displays the connection menu.</li> </ul>	Required
Move to the following workspace	Not active with this connection	–
Release USB mass memory	Not advisable with this connection	–
Private connection	Connection can only be seen and used by its creator	Required
Calculator	Host name or IP address of the external computer. In the recommended configuration of the IPC 6641, the IP address 192.168.254.3 is used.	Required
User name	User name to be used for establishing the connection	Required
Password	Password for connecting to the VNC server	Required
Windows domain:	Domain of the target computer, if required	Optional
Max. waiting time (seconds):	<p>A shutdown of the control causes the Windows computer to shut down as well.</p> <p>Before the control displays the message <b>Now you can switch off.</b>, it waits for <b>&lt;Timeout&gt;</b> seconds. While waiting, the control checks whether the Windows computer is still accessible (port 445).</p> <p>If the Windows computer is switched off before the <b>&lt;Timeout&gt;</b> seconds have expired, the control will wait no longer.</p>	Required
Additional waiting time:	<p>Waiting time after the Windows computer has stopped being accessible.</p> <p>Windows applications may delay the shutdown of the computer after port 445 has been closed.</p>	Required
Force	<p>Close all programs on the Windows computer, even if dialogs are still open.</p> <p>If <b>Force</b> is not selected, Windows waits up to 20 seconds. This delays the shutdown process or the Windows computer is switched off before Windows has shut down.</p>	Required

Setting	Meaning	Input
<b>Restart</b>	Reboot the Windows computer	Required
<b>Run during restart</b>	Reboot the Windows computer when the control reboots. Effective only if the control is rebooted using the shutdown icon at the bottom right in the taskbar or if it is rebooted as a result of a change in the system settings (e.g. network settings).	Required
<b>Run during switch-off</b>	The Windows computer is switched off when the control shuts down (no reboot). This is the standard scenario. Even the <b>END</b> key will then no longer trigger a reboot.	Required
Entries in the <b>Advanced options</b> area	Available only to authorized specialists	Optional

## Starting and stopping the connection

Once a connection has been configured, this connection is shown as an icon in the Remote Desktop Manager window. When you highlight a connection, the **Start the connection** and **Terminate the connection** menu items become selectable.

If the desktop of the external connection or the external computer is active, all inputs from the mouse and the alphabetic keyboard are transmitted there.

When the HEROS 5 operating system is shut down, the control automatically terminates all connections. Please note, however, that only the connection is terminated, whereas the external computer or the external system is not shut down automatically.

**Further information:** "Shutting down or restarting an external computer", Page 372

Proceed as follows to switch between the third desktop and the control interface:

- Use the right DIADUR key on the alphabetic keyboard
- Use the taskbar
- Use the operating mode key

## Exporting and importing connections

The **Export the connections** and **Import connections** functions allow you to save and restore the connections of the **Remote Desktop Manager**.



To create and edit public connections when user administration is active, you need the HEROS.SetShares role. Users without this role are able to start and terminate public connections, but can only import, create, and edit private connections.

To export a connection, proceed as follows:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select **Remote Desktop Manager**
- > The control opens the **Remote Desktop Manager**.
- ▶ Select the desired connection
- ▶ Select the right arrow symbol in the menu bar
- > The control opens a drop-down menu.
- ▶ Select **Export the connections**
- > The control opens a pop-up window.
- ▶ Define the name of the saved file
- ▶ Select the target file
- ▶ Select **Save**
- > The control saves the connection data under the name defined in the pop-up window

To Import a connection, proceed as follows:

- ▶ Open the **Remote Desktop Manager**
- ▶ Select the right arrow symbol in the menu bar
- > The control opens a drop-down menu.
- ▶ Select **Import connections**
- > The control opens a pop-up window.
- ▶ Select file
- ▶ Select **Open**
- > The control creates the connection under the name that was defined originally in the **Remote Desktop Manager**.

## Private connections

Every user can create private connections by means of the user administration. A private connection can only be seen and used by the user who created it.





- If you create private connections before user administration was activated, these connections are no longer available when user administration is active.  
Change private connections to public connections or export the connections before activating user administration.
- To create and edit public connections, you need the HEROS.SetShares right. Users without this right are able to start and terminate public connections, but can only import, create, and edit private connections.

**Further information:** "Definition of roles",  
Page 434

To create a private connection, proceed as follows:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select **Remote Desktop Manager**
- > The control opens the **Remote Desktop Manager**.
- ▶ Select **New connection**
- ▶ Select the desired connection, e.g. **Switch-off/restart of a computer**
- > The control opens the **Edit the connection** pop-up window.
- ▶ Define the connection settings
- ▶ Select **Private connection**
- ▶ Press **Ok**
- > The control creates a private connection.

The control indicates private connections with a symbol:

Symbol	Meaning
	Public connection
	Private connection

You can save the connections individually with the **Export the connections** functions.

**Further information:** "Exporting and importing connections",  
Page 375


When user administration is active, the control saves the private connections in the user's **HOME:** directory. If you create a backup with the **NC/PLC Backup** HEROS function, the control also saves the private connections. You can choose whether the control is to save the **HOME:** directory for the current user or for all users.

10.2 Additional tools for ITCs

The following additional tools allow you to apply various settings for the touch screens on connected ITCs.


ITCs are industrial PCs without their own memory media, and therefore they do not have their own operating system. This feature is what makes ITCs different from IPCs.

ITCs are frequently used with large machinery, e.g. as a clone of the actual control system.



Refer to your machine manual!  
The machine manufacturer defines and configures the display and function of the connected ITCs and IPCs.

Additional tool	Application
ITC Calibration	4-point calibration
ITC Gestures	Configuration of gesture control
ITC touchscreen configuration	Selection of touch sensitivity



The additional tools for the ITCs are only provided by the control in the taskbar with connected ITCs.

ITC Calibration

Using the additional tool **ITC Calibration**, you align the position for the mouse cursor displayed with the actual movement position of your finger.

Calibration using the additional **ITC Calibration** tool is recommended in the following cases:


- After replacing the touchscreen
- When changing the touch screen position (parallel axis error due to amended viewing angle)

Calibration involves the following steps:

- ▶ Start the tool in control using the task bar
- > The ITC opens the calibration screen with four touch points in the corners of the screen
- ▶ Touch the four touch points shown one after the other
- > The ITC closes the calibration screen once calibration has been successfully completed

ITC Gestures

Using the additional **ITC Gestures** tool, the machine manufacturer configures the gesture control on the touch screen.



Refer to your machine manual!  
This function may only be used with the permission of your machine manufacturer.

### ITC touchscreen configuration

Using the additional **ITC Touchscreen Configuration** tool, you can select the touch sensitivity of the touch screen.

The ITC gives you the following options:

- **Normal Sensitivity (Cfg 0)**
- **High Sensitivity (Cfg 1)**
- **Low Sensitivity (Cfg 2)**

Use the **Normal Sensitivity (Cfg 0)** setting as standard. If you find it difficult to operate the equipment while wearing gloves in this setting, select the **High Sensitivity (Cfg 1)** setting.



If the ITC touch screen is not splash-proof, select the **Low Sensitivity (Cfg 2)** setting. This stops the ITC interpreting drops of water as touches.

Configuration involves the following steps:

- ▶ Start the tool in control using the task bar
- > The ITC opens a pop-up window with three options
- ▶ Select Touch Sensitivity
- ▶ Press the **OK** button
- > The ITC closes the pop-up window

### 10.3 Window manager



Refer to your machine manual!

The machine tool builder determines the scope of function and behavior of the window manager.

The control features the Xfce window manager. Xfce is a standard application for UNIX-based operating systems, and is used to manage graphical user interfaces. The following functions are possible with the window manager:

- Display a task bar for switching between various applications (user interfaces)
- Manage an additional desktop, on which special applications from your machine manufacturer can run
- Control the focus between NC software applications and those of the machine manufacturer
- You can change the size and position of pop-up windows. It is also possible to close, minimize and restore pop-up windows



The control shows a star in the upper left of the screen if an application of the window manager or the window manager itself has caused an error. In this case, switch to the window manager and correct the problem. If required, refer to your machine manual.

## Overview of taskbar

In the task bar you can choose different workspaces by mouse click.

The control provides the following workspaces:

- Workspace 1: Active operating mode
- Workspace 2: Active programming mode
- Workspace 3: CAD-Viewer or applications of the machine tool builder (optionally available)
- Workspace 4: Display and remote control of external computer units (option 133) or applications of the machine tool builder (optionally available)

In addition, you can also select other applications from the task bar which you have started in parallel to the control software, e.g. the **TNCguide**.




You can randomly move all open applications to the right of the green HEIDENHAIN symbol between the workspaces by pressing and holding the left mouse button.

Click the green HEIDENHAIN symbol to open a menu in which you can get information, make settings or start applications.

The following functions are available:

- **About HeROS**: Open information about the operating system of the control
- **NC Control**: Start and stop the control software (for diagnostic purposes only)
- **Web Browser**: Start the web browser
- **Touchscreen Configuration**: Adjust the screen properties (only for touch operation)  
**Further information**: "Touchscreen configuration", Page 476
- **Touchscreen Cleaning**: Lock the screen (only for touch operation)  
**Further information**: "Touchscreen cleaning", Page 476
- **Remote Desktop Manager** (option 133): Display and remote control of external computer units  
**Further information**: "Remote Desktop Manager (option 133)", Page 366
- **Switch-off**: Shut down the control  
**Further information**: "Switching or logging out users", Page 446

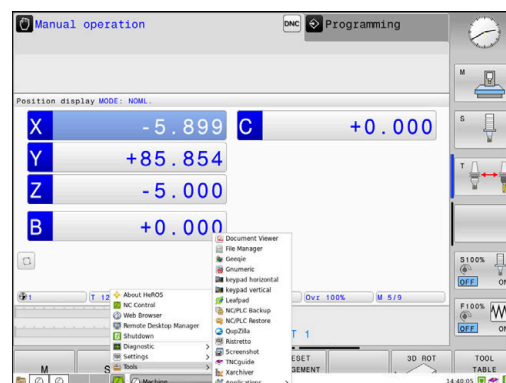



- **Diagnostic:** Diagnostic applications
  - **GSmartControl:** Available only to authorized specialists
  - **HE Logging:** Define settings for internal diagnostic files
  - **HE Menu:** Available only to authorized specialists
  - **perf2:** Check processor load and process load
  - **Portscan:** Test active connections  
**Further information:** "Portscan", Page 384
  - **Portscan OEM:** Available only to authorized specialists
  - **RemoteService:** Start and stop remote maintenance  
**Further information:** "Remote Service", Page 385
  - **Terminal:** Enter and execute console commands
  - **TNCdiag:** Evaluates status and diagnostic information of HEIDENHAIN components with a focus on the drive motors, and presents it graphically



If you want to use **TNCdiag**, contact your machine tool builder.

- **Settings:** Operating system settings
  - **Current User:** Show the current user  
**Further information:** "Current User", Page 450
  - **Date/Time:** Set date and time
  - **Firewall:** Configure the firewall  
**Further information:** "Firewall", Page 398
  - **HePacketManager:** Available only to authorized specialists
  - **HePacketManager Custom:** Available only to authorized specialists
  - **Language/Keyboards:** Select system dialog language and keyboard version—the control overwrites the setting of the system dialog language when starting with the language setting of the machine parameter **CfgDisplayLanguage** (no. 101300)
  - **Network:** Define network settings
  - **OEM function users:** Edit machine tool builder function user  
**Further information:** "HEIDENHAIN function users", Page 433
  - **OPC UA / PKI Admin:** Settings for OPC UA  
**Further information:** "HEIDENHAIN OPC UA NC Server (options 56 to 61)", Page 453
  - **Printer:** Configure and manage printer  
**Further information:** "Printer", Page 387
  - **Screensaver:** Setting the screensaver  
**Further information:** "Screensaver with lockout", Page 446
  - **SELinux:** Define safety software for Linux-based operating systems
  - **Shares:** Connect and manage external network drives
  - **State Reporting Interface** (option 137): Activate the **SRI** and clear the status data  
**Further information:** "State Reporting Interface (option 137)", Page 389
  - **UserAdmin:** Configure user administration  
**Further information:** "Configuring the user administration", Page 419
  - **VNC:** Define the setting for external software accessing the control, e.g., for maintenance procedures (Virtual Network Computing)  
**Further information:** "VNC", Page 392
  - **WindowManagerConfig:** Available only to authorized specialists

- **Tools:** File applications
  - **Diffuse Merge Tool:** Compare and merge text files
  - **Document Viewer:** Display and print files (e.g., PDF files)
  - **File Manager:** Available only to authorized specialists
  - **Geeqie:** Open, manage, and print graphics
  - **Gnumeric:** Open, edit, and print tables
  - **Keypad:** Open virtual keyboard
  - **Leafpad:** Open and edit text files
  - **NC/PLC Backup:** Create backup file  
**Further information:** "Backup and restore", Page 395
  - **NC/PLC Restore:** Restore backup file  
**Further information:** "Backup and restore", Page 395
  - **QupZilla:** Alternative web browser for touch operation
  - **Ristretto:** Open graphics
  - **Screenshot:** Create screenshots
  - **TNCguide:** Call up help system
  - **Xarchiver:** Extract or compress directories
  - **Applications:** Supplementary applications
    - **Orage Calender:** Open calendar
    - **Real VNC viewer:** Define the setting for external software accessing the control for e.g. maintenance work (Virtual Network Computing)



The applications available under tools can be started directly by selecting the corresponding file type in the file management of the control  
**Further information:** "Additional tools for management of external file types", Page 90

## Portscan

The PortScan function allows the cyclic or manual searching for all open, incoming TCP and UDP listen ports on the system. All ports found are compared with whitelists. If the control finds a non-listed port it shows a corresponding pop-up window.

The HEROS **Diagnostic** menu contains the **Portscan** and **Portscan OEM** applications for this purpose. **Portscan OEM** is only executable after entering the machine manufacturer password.

The **Portscan** function searches for all open, incoming TCP and UDP ports on the system and compares them to four whitelists stored in the system:

- System-internal whitelists **/etc/sysconfig/portscan-whitelist.cfg** and **/mnt/sys/etc/sysconfig/portscan-whitelist.cfg**
- Whitelist for ports for machine manufacturer-specific functions, e.g. for Python applications, external applications: **/mnt/plc/etc/sysconfig/portscan-whitelist.cfg**
- Whitelist for ports with customer-specific functions: **/mnt/tnc/etc/sysconfig/portscan-whitelist.cfg**

For each entry, the whitelist specifies the type of port (TCP/UDP), the port number, the providing program, and optional comments. If the automatic port scan function is active, only ports listed in the whitelists can be open. Non-listed ports trigger a notification window.

The result of the scan is saved to a log file (LOG:/portscan/scanlog and LOG:/portscan/scanlogevil) and, if new ports are found that are not listed in one of the whitelists, these are displayed.

### Manually starting Portscan

Proceed as follows to manually start the Portscan:

- ▶ Open the task bar at the bottom edge of the screen  
**Further information:** "Window manager", Page 379
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Diagnostic** menu item
- ▶ Select the **Portscan** menu item
- > The control opens the **HEROS Portscan** pop-up window.
- ▶ Press the **Start** button

### Cyclically starting Portscan

Proceed as follows to automatically start the Portscan cyclically:

- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Diagnostic** menu item
- ▶ Select the **Portscan** menu item
- > The control opens the **HEROS Portscan** pop-up window.
- ▶ Press the **Automatic update on** key
- ▶ Set the time interval with the slider

Remote Service

In conjunction with the remote service setup tool, TeleService from HEIDENHAIN offers the possibility to establish encrypted end-to-end connections between a service computer and a machine.

To enable the HEIDENHAIN control to communicate with the HEIDENHAIN server, the control needs to be connected to the Internet.


**Further information:** "General network settings", Page 407


In its basic state the firewall of the control blocks all incoming and outgoing connections. Therefore, the firewall settings must be adjusted or the firewall must be deactivated for the duration of the service session.


Setting up the control

Proceed as follows to deactivate the firewall:

- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Settings** menu item
- ▶ Select the **Firewall** menu item
- ▶ The control opens the **Firewall settings** dialog.
- ▶ Deactivate the firewall by removing the **Active** option in the **Firewall** tab.
- ▶ Press the **Apply** button to save the settings
- ▶ Press the **OK** button
- ▶ The firewall is disabled.

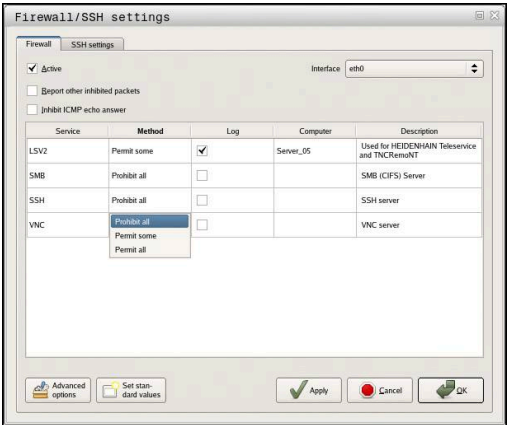

 Remember to activate the firewall again at the end of the service session.



**Alternative procedure for deactivating the firewall**

The remote diagnosis via the TeleService PC software uses the **LSV2** service and this service must therefore be permitted in the firewall settings.

The following deviations from the firewall default settings are required:

- ▶ Set the method to **Permit some** for the **LSV2** service
- ▶ Enter the name of the service computer in the **Computer** column

The access security is ensured through the network settings. The network security is the responsibility of the machine tool builder or the respective network administrator.

Automatic installation of a session certificate

With an NC software installation a temporary certificate is automatically installed on the control. An installation, also in the form of an update, may only be carried out by a service technician from the machine tool builder.

### Manual installation of a session certificate

A new certificate must be installed if no valid session certificate is installed on the control. Contact the responsible service technician to determine which certificate you need. He will then provide you with a valid certificate file if necessary.


Proceed as follows to install the certificate on the control:

- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Settings** menu item
- ▶ Select the **Network** menu item
- > The control opens the **Network settings** dialog.
- ▶ Select the **Internet** tab. The settings in the **Telemaintenance** field are configured by the machine tool builder.
- ▶ Press the **Add** button
- ▶ Select the file in the selection menu
- ▶ Press the **Open** button
- > The certificate is opened.
- ▶ Press the **OK** soft key.
- ▶ It may be necessary to restart the control to load the settings

### Starting the service session

To start a service session, proceed as follows:

- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Diagnostic** menu item
- ▶ Select the **RemoteService** menu item
- ▶ Enter the **Session key** of the machine tool builder

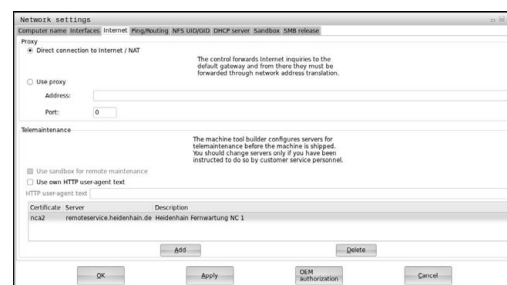

## Printer









The **Printer** function in the HEROS menu enables you to add and manage printers.

### Displaying the printer settings

Proceed as follows to access the printer settings:

- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Settings** menu item
- ▶ Select the **Printer** menu item
- > The control opens the **Heross Printer Manager** pop-up window.

The name of the printer is displayed in the input field.

Soft key	Function	Meaning
	<b>DATA RECS.</b>	Creates the printer named in the input field
	<b>CHANGE</b>	Modifies the properties of the selected printer
	<b>COPY</b>	Creates the printer named in the input field with the attributes of the selected printer This can be useful if printing both portrait and landscape formats on the same printer
	<b>DELETE</b>	Deletes the selected printer
	<b>UP</b>	Selects the desired printer
	<b>DOWN</b>	
	<b>STATUS</b>	Displays status information of the selected printer
	<b>PRINT A TEST PAGE</b>	Prints a test page on the selected printer

For each printer, the following attributes can be set:

Setting	Meaning
Name of the printer	The printer name can be changed here.
Connection	Here, you can select the connection type <ul style="list-style-type: none"> <li>■ USB: The USB connection can be assigned here. The name is displayed automatically.</li> <li>■ Network: Enter the network name or the IP address of the target printer here. In addition, specify the port of the network printer here (default: 9100)</li> <li>■ Printer not connected</li> </ul>
Timeout	Defines the delay to printing after the last change has been made to the file to be printed in PRINTER:. This can be useful if the file to be printed is populated with data by using FN functions, e.g. during probing.
Standard printer	Select to define the standard printer in case several printers are available. Is defined automatically when creating the first printer.
Settings for printing of text	These settings are applicable when printing text documents: <ul style="list-style-type: none"> <li>■ Paper size</li> <li>■ Number of copies</li> <li>■ Job name</li> <li>■ Font size</li> <li>■ Header</li> <li>■ Print options (black and white, color, duplex)</li> </ul>
Orientation	Portrait, landscape for all printable files
Expert options	Available only to authorized specialists

Print options:

- Copying of the file to be printed in PRINTER:  
The file to be printed is automatically forwarded to the standard printer and deleted from the directory after the print job has been executed
- Using the FN 16: F-PRINT function

List of printable files:

- Text files
- Graphic files
- PDF files



The connected printer must be PostScript-enabled.



## State Reporting Interface (option 137)

### Introduction

With production lot sizes becoming ever smaller and products becoming increasingly customized, systems for production data acquisition are becoming increasingly important.

The operating resource data—as one of the most important parts of production data acquisition—describe the states of an operating resource along the time scale. For machine tools, the idle times and run times as well as information about pending faults are recorded. An evaluation per workpiece can also be made when the active NC programs are additionally taken into account.

One of the most common applications of production data acquisition is the determination of equipment effectiveness. The term Overall Equipment Effectiveness (OEE) is a measure of the value added of equipment. It provides information about the productivity of equipment as well as its losses at a glance.

With the **State Reporting Interface (SRI)**, HEIDENHAIN offers a simple and reliable interface for acquiring the operating states of your machine.

In contrast to other interfaces, **SRI** also provides historical production data. Even if your company network is down for several hours, your valuable operating data will not be lost.



A buffer memory that contains 2x 10 000 entries is available for storing the historical operating states. Each entry corresponds to a status change.

## Configuring the control

Adjusting the firewall settings:

The **State Reporting Interface** uses **TCP Port 19090** to transfer the acquired operating states.

Accesses to the SRI from the company network (X26 connection) must be permitted in the firewall settings.

- Allow **SRI**

**Further information:** "Firewall", Page 398




If the **SRI** is accessed locally via an IPC connected to the machine network (X116), eth0 (X26) can also remain locked.

In the control's factory default setting, the **SRI** is deactivated.

Activating the **State Reporting Interface**:

- Open the task bar at the bottom edge of the screen
- Press the green HEIDENHAIN button to open the **HEROS menu**
- Select the **Settings** menu item
- Select the **State Reporting Interface** menu item
- Activate the **State Reporting Interface** in the **SRI** pop-up window

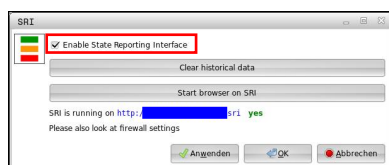

**Further information:** "Overview of taskbar", Page 380



To clear all previous operating states, use the **Clear historical data** button.

### Acquiring operating states

The **State Reporting Interface** uses the **Hypertext Transfer Protocol (HTTP)** to transfer the operating states.

With the following **URLs (Uniform Resource Locator)**, you can access the operating states of your control using any web browser.

- **http://<hostname>:19090/sri** for accessing all pieces of information (max. 20 000 entries)
- **http://<hostname>:19090/sri?lineno=<line>** for accessing the most recent pieces of information

Configuring **URL**:

- Replace the **<hostname>** by your control's network name
- Replace **<line>** by the first line to be retrieved
- The control transmits the requested data.

```
<html>
  <head></head>
  <body>
    <pre style="word-wrap: break-word; white-space: pre-wrap;">
      State Reporting Interface: 1.0.6
      HOST:      XXX
      HARDWARE: MC64XX 0.1
      SOFTWARE: 340590 10
      1 ; 2018-07-04 ; 09:52:22 ; TNC:\nc_prog\TS.h ; SUSPEND
      2 ; 2018-07-04 ; 09:52:28 ; TNC:\nc_prog\demo\Start_demo.h ; SUSPEND
      3 ; 2018-07-04 ; 09:52:30 ; TNC:\nc_prog\demo\Start_demo.h ; OPERATE
      4 ; 2018-07-04 ; 09:52:35 ; TNC:\nc_prog\demo\Start_demo.h ; ALARM
      5 ; 2018-07-04 ; 09:52:40 ; TNC:\nc_prog\demo\Start_demo.h ; SUSPEND
      6 ; 2018-07-04 ; 09:52:49 ; TNC:\nc_prog\demo\Start_demo.h ; SUSPEND
      7 ; 2018-07-04 ; 09:53:14 ; TNC:\nc_prog\demo\Start_demo.h ; SUSPEND
      8 ; 2018-07-04 ; 09:53:19 ; TNC:\nc_prog\demo\Start_demo.h ; OPERATE
      9 ; 2018-07-04 ; 09:53:24 ; TNC:\nc_prog\demo\Start_demo.h ; ALARM
    </pre>
  </body>
</html>
```

You will find the operating states in the **<body>** of the HTML file as **CSV** contents (**Comma Separated Values**).

CSV contents:

- Header

Designation	Meaning
<b>State Reporting Interface:</b>	Version of the interface. The version number should be taken into account in the evaluation of the data to ensure downward compatibility in your application.
<b>SOFTWARE:</b>	Software of the connected control.
<b>HOST:</b>	Full network name of the connected control.
<b>HARDWARE:</b>	Hardware of the connected control.

## ■ Operating data

Contents	Meaning
1	Consecutive number
2	
...	
2018-07-04	Date (yyyy-mm-dd)
09:52:22	Time (hh:mm:ss)
TNC:\nc_prog\TS.h	Selected or active NC program
States	Status:
■ <b>OPERATE</b>	■ Program run is active
■ <b>SUSPEND</b>	■ Program run stopped without error
■ <b>ALARM</b>	■ Program stopped due to an error

## VNC

Use the **VNC** function to configure the behavior of the various VNC clients. This includes, for example, operation via soft keys, mouse, and the alphabetic keyboard.

The control provides the following options:


- List of permitted clients (IP address or name)
- Password for the connection
- Additional server options
- Additional settings for assigning the focus



Refer to your machine manual!

For multiple clients or operating units, the focus assignment procedure depends on the design and the operating situation of the machine.

This function must be adapted by your machine manufacturer.

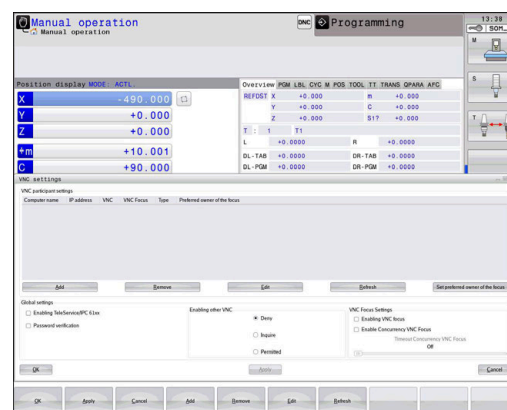

### Opening the VNC settings

Proceed as follows to open the VNC settings:


 
 
- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Settings** menu item
- ▶ Select the **VNC** menu item
- > The control opens the **VNC Settings** pop-up window.

The control provides the following options:

- Add: Add new VNC viewer/client
- Remove: Deletes the selected client. Only possible with manually entered clients.
- Edit: Edit the configuration of the selected client
- Update: Updates the display. Required with connection attempts during which the dialog is open.

### VNC settings

Dialog	Option	Meaning
VNC participant settings	<b>Computer name:</b>	IP address or computer name
	<b>VNC:</b>	Connection of the client to the VNC viewer
	<b>VNC Focus</b>	The client participates in the focus assignment
	<b>Type</b>	<ul style="list-style-type: none"> <li>■ Manual Manually entered client</li> <li>■ Denied This client is not permitted to connect</li> <li>■ Enable TeleService and IPC Client via TeleService connection</li> <li>■ DHCP Other computer that obtains an IP address from this computer</li> </ul>
Firewall warning		<p>Warnings and information about if the VNC protocol has not been authorized for all VNC clients due to firewall settings on the control.</p> <p><b>Further information:</b> "Firewall", Page 398.</p>
Global settings	<b>Enable TeleService and IPC</b>	Connection is always permitted
	<b>Password verification</b>	The client must enter a password for verification. If this option is active the password must be entered when the connection is established.

Dialog	Option	Meaning
Enabling other VNC	<b>Deny</b>	Access generally denied to all other VNC clients.
	<b>Inquire</b>	During connection attempts a corresponding dialog is opened.
	<b>Permitted</b>	Access is generally granted to all other VNC clients.
VNC Focus Settings	<b>Enabling VNC focus</b>	Enable focus assignment for this system. Otherwise there is no central focus assignment. In the default setting, the focus is actively reassigned by the owner of the focus by clicking the focus symbol. This means that the owner of the focus must first release the focus by clicking the focus symbol before any other client can retrieve the focus.
	<b>Enabling concurrency VNC focus</b>	In the default setting, the focus is actively reassigned by the owner of the focus by clicking the focus symbol. This means that the owner of the focus must first release the focus by clicking the focus symbol before any other client can retrieve the focus. If concurrency focus is selected, any client can retrieve the focus at any time without having to wait for the current owner of the focus to release it.
	<b>Timeout Concurrency VNC Focus</b>	Time period within which the current owner of the focus can object to the focus being withdrawn or can prevent the reassignment of the focus. If a client requests the focus, a dialog in which the reassignment of focus can be refused appears on all clients' screens.
Focus symbol		Current status of VNC focus on the respective client: Focus is owned by other client. Mouse and alphabetic keyboard are disabled.
		Current status of VNC focus on respective client: Focus is owned by current client. Entries can be made.
		Current status of VNC focus on the respective client: Request by the owner of the focus to give the focus to another client. Mouse and alphabetic keyboard are disabled until the focus is assigned unambiguously.

If **Enable concurrency VNC focus** is selected, a pop-up window appears. This dialog makes it possible to refuse that the focus be given to the requesting client. If this does not occur, the focus changes to the requesting client after the set time limit.

## Backup and restore

With the **NC/PLC Backup** and **NC/PLC Restore** functions you can back up and restore individual folders or the complete **TNC** drive. You can save the backup files locally, on a network drive, or to USB storage devices.

The backup program generates a **\*. tncbck** file that can also be processed by the PC tool TNCbackup (part of TNCremo). The Restore program can restore these files as well as those from existing TNCbackup programs. If you select a **\*. tncbck** file in the File Manager of the control, the **NC/PLC Restore** program will be launched automatically.

Backup and restore is subdivided into several steps. Navigate between these steps with the **FORWARD** and **BACK** soft keys. Specific actions for steps are selectively displayed as soft keys.

### Open NC/PLC Backup or NC/PLC Restore

Proceed as follows to open the functions:

- ▶ Open the task bar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the **HEROS menu**
- ▶ Select the **Tools** menu item
- ▶ Open the **NC/PLC Backup** or **NC/PLC Restore** menu item
- > The control opens the pop-up window.

### Backing up data

To back up data from the control, proceed as follows:

- ▶ Select **NC/PLC Backup**
- ▶ Select type
  - Back up the **TNC** partition
  - Back up the directory tree: Select the directory for backup in the file management
  - Backup machine configuration (for machine tool builders only)
  - Complete backup (for machine tool builders only)
  - Comment: Freely configurable comment for the backup
- ▶ Select the next step with the **FORWARD** soft key
- ▶ Stop the control if required with the **STOP NC SOFTWARE** soft key
- ▶ Define the exclusion rules
  - User preset rules
  - Write own rules to the table
- ▶ Select the next step with the **FORWARD** soft key
- > The control generates a list of files for backing up.
- ▶ Check the list. Deselect files if necessary.
- ▶ Select the next step with the **FORWARD** soft key
- ▶ Enter the name of the backup file
- ▶ Select the storage path
- ▶ Select the next step with the **FORWARD** soft key
- > The control generates the backup file.
- ▶ Confirm with the **OK** soft key
- > The control concludes the backup process and restarts the NC software.



**Restore data****NOTICE****Caution: Data may be lost!**

When you restore data (Restore function), any existing data will be overwritten without a confirmation prompt. Existing data is not automatically backed up by the control before running the restore process. Power failures or other problems can interfere with the data restore process. As a consequence, data may be irreversibly damaged or deleted.

- ▶ Before starting the data restore process, make a backup of the existing data

To restore the data proceed as follows:




- ▶ Select **NC/PLC Restore**
- ▶ Select the archive to be restored
- ▶ Select the next step with the **FORWARD** soft key
- > The control generates a list of files for restoring.
- ▶ Check the list. Deselect files if necessary.
- ▶ Select the next step with the **FORWARD** soft key
- ▶ Stop the control if required with the **STOP NC SOFTWARE** soft key
- ▶ Extract the archive
- > The control restores the files.
- ▶ Confirm with the **OK** soft key
- > The control restarts the NC software.

## 10.4 Firewall

### Application

You can set up a firewall for the primary network interface of the control. It can be configured so that incoming network traffic is blocked and/or a message is displayed, depending on the sender and the service. The firewall cannot be started for the secondary network interface of the control.

Once the firewall has been activated, a symbol appears at the lower right in the taskbar. The symbol changes depending on the safety level that the firewall was activated with, and informs about the level of the safety settings:

Icon	Meaning
	Firewall protection does not yet exist although it has been activated according to the configuration. This can happen, for example, if PC names for which there are no equivalent IP addresses as yet were used in the configuration.
	Firewall active with medium security level
	Firewall active with high safety level. (all services except for SSH are blocked)



Have your network specialist check and, if necessary, change the standard settings.

### Configuring the firewall




Make your firewall settings as follows:

- ▶ Use the mouse to open the taskbar at the bottom edge of the screen
- ▶ Press the green HEIDENHAIN button to open the HEROS menu
- ▶ Select the **Settings** menu item.
- ▶ Select the **Firewall** menu item.

HEIDENHAIN recommends activating the firewall with the prepared default settings:

- ▶ Select the **active** option to enable the firewall
- ▶ Press the **Set standard values** button to activate the default settings recommended by HEIDENHAIN.
- ▶ Confirm the changes with **Apply**.
- ▶ Close the dialog with **OK**.

## Firewall settings

Option	Meaning
Active	Switching the firewall on and off
Interface	<p>Selection of the <b>eth0</b> interface usually corresponds to X26 of the MC main computer. <b>eth1</b> corresponds to X116. You can check this in the network settings on the Interfaces tab. For main computer units with two Ethernet interfaces, the DHCP server for the machine network is active for the second (non-primary) interface by default. With this setting the firewall cannot be activated for <b>eth1</b> because the firewall and DHCP server mutually exclude each other.</p> <div>  To configure the sandbox, you use the optional interface brsb0.  <b>Further information:</b> "Sandbox tab", Page 413 </div>
Report other inhibited packets	Firewall active with high safety level. (all services except for SSH are blocked)
Inhibit ICMP echo answer	If this option is set, the control no longer responds to a PING request
Service	<p>This column contains the short names of the services that are configured with this dialog. For the configuration it is not important here whether the services themselves have been started</p> <ul style="list-style-type: none"> <li>■ <b>DNC</b> designates the service the DNC server provides via the RPC protocol for external applications that were developed with the RemoTools SDK (port 19003)</li> </ul> <div>  For more detailed information, consult the RemoTools SDK manual. </div> <ul style="list-style-type: none"> <li>■ <b>LDAPS</b> includes the server on which the user data and the user administration configuration are saved.</li> <li>■ <b>LSV2</b> includes the functionality for <b>TNCremo</b>, Teleservice, and other HEIDENHAIN PC Tools (port 19000)</li> </ul> <div>  When user administration is active, the control automatically disables the LSV2 connections of the serial interfaces (COM1 and COM2) for security purposes. </div> <ul style="list-style-type: none"> <li>■ <b>OPCUA</b> designates the service provided by the HEIDENHAIN OPC UA NC Server (port 4840)</li> <li>■ <b>SMB</b> only refers to incoming SMB connections, i.e. if a Windows share is created on the NC. Outgoing SMB connections (i.e. if a Windows share is connected on the NC) cannot be prevented.</li> <li>■ <b>SRI</b> refers to the connections that are used in conjunction with the acquisition of operating states through the <b>State Reporting Interface</b> option.</li> <li>■ <b>SSH</b> stands for the Secure Shell protocol (port 22). As of HEROS 504, LSV2 can be executed securely via this SSH protocol while user administration is active.  <b>Further information:</b> "User authentication from external applications", Page 439</li> <li>■ <b>VNC</b> protocol means access to the screen contents. If this service is blocked, the screen content can no longer be accessed, not even with the TeleService programs from HEIDENHAIN (e.g., screenshot). If this service is blocked, the VNC configuration dialog shows a warning from HEROS that VNC is disabled in the firewall.</li> </ul>

Option	Meaning
Method	Use <b>Method</b> to configure whether the service is inaccessible for all ( <b>Prohibit all</b> ), accessible for all ( <b>Permit all</b> ) or only accessible for individuals ( <b>Permit some</b> ). If you set <b>Permit some</b> , you must also specify the computer (under Computer) that you wish to grant access to the respective service. If you do not specify any computer under <b>Computer</b> , the setting <b>Prohibit all</b> will automatically become active when the configuration is saved.
Log	When <b>Log</b> is activated, a <b>red</b> message is output if a network packet for this service has been blocked. A (blue) message is output if a network packet for this service was accepted
Calculator	If the setting <b>Permit some</b> is selected under <b>Method</b> , the relevant computers can be specified here. The computers can be entered with their IP addresses or host names separated by commas. If a host name is used, the system checks upon closing or saving of the dialog whether the host name can be translated into an IP address. If this is not the case, an error message is displayed and the dialog does not terminate. If a valid host name is specified, this host name is translated into an IP address each time the control is started. If a computer that was entered with its name changes its IP address, you may have to restart the control or formally change the firewall configuration to ensure that the control uses the new IP address for a host name in the firewall.
Advanced options	These settings are only intended for your network specialists
Set standard values	Resets the settings to the default values recommended by HEIDENHAIN

## 10.5 Setting up data interfaces

### Serial interfaces on the TNC 620


The TNC 620 automatically uses the LSV2 transmission protocol for serial data transfer. The LSV2 protocol is prescribed and cannot be modified apart from setting the baud rate (machine parameter **baudRateLsv2**, no. 106606). You can also define another type of data transfer (interface). The settings described below are therefore effective only for the respective newly defined interface.



When user administration is active, the control automatically disables the LSV2 connections of the serial interfaces (COM1 and COM2) for security purposes.

### Application

To set up a data interface, press the **MOD** key. Enter the code number 123. In the **CfgSerialInterface** (no. 106700) machine parameter, you can enter the following settings:

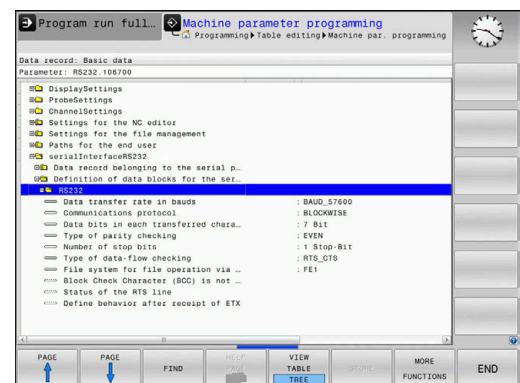

### Setting the RS-232 interface

Open the RS232 folder. The control then displays the following settings:

#### Set BAUD RATE (baud rate no. 106701)

You can set the BAUD RATE (data transfer speed) from 110 to 115 200 baud.

## Set protocol (protocol no. 106702)

The data transfer protocol controls the data flow of a serial transmission (comparable to MP5030 of the iTNC 530).



Operating notes:

- The **BLOCKWISE** setting designates a type of data transfer in which the data is transferred grouped in blocks.
- The **BLOCKWISE** setting does **not** correspond to the data reception in blocks nor to the simultaneous execution of older contouring controls in blocks. This function is no longer available for current controls.

Data transmission protocol	Selection
Standard data transmission (transmission line-by-line)	STANDARD
Packet-based data transfer	BLOCKWISE
Transmission without protocol (only character-by-character)	RAW_DATA

## Set data bits (dataBits no. 106703)

By setting the data bits you define whether a character is transmitted with 7 or 8 data bits.

## Check parity (parity no. 106704)

The parity bit helps the receiver to detect transmission errors. The parity bit can be formed in three different ways:

- No parity (NONE): There is no error detection
- Even parity (EVEN): Here there is an error if the receiver finds that it has received an odd number of set bits
- Odd parity (ODD): Here there is an error if the receiver finds that it has received an even number of set bits

## Set stop bits (stopBits no. 106705)

The start bit and one or two stop bits enable the receiver to synchronize each transmitted character during serial data transmission.

### Set handshake (flowControl no. 106706)

By handshaking, two devices control data transfer between them. A distinction is made between software handshaking and hardware handshaking.

- No data flow checking (NONE): Handshaking is not active
- Hardware handshaking (RTS\_CTS): Transmission stop is active through RTS
- Software handshaking (XON\_XOFF): Transmission stop is active through DC3 (XOFF)

### File system for file operation (fileSystem no. 106707)

In **fileSystem** you define the file system for the serial interface. This machine parameter is not required if you don't need a special file system.

- EXT: Minimum file system for printers or non-HEIDENHAIN transmission software. It corresponds to the EXT1 and EXT2 operating modes on older HEIDENHAIN controls.
- FE1: Communication with the TNCserver PC software or an external floppy disk unit.

### Block check character (bccAvoidCtrlChar no. 106708)

With Block Check Character (optional) no control character, you determine whether the checksum can correspond to a control character.

- TRUE: The checksum does not correspond to a control character
- FALSE: The checksum can correspond to a control character

### Condition of RTS line (rtsLow no. 106709)

With the state of the RTS line (optional), you can define whether the **LOW** level is active in idle state.

- TRUE: Level is **LOW** in idle state
- FALSE: Level is not **LOW** in idle state

### Define behavior after receipt of ETX (noEotAfterEtx no. 106710)

With define behavior after reception of ETX (optional) you determine whether the EOT character is sent after the ETX character was received.

- TRUE: The EOT character is not sent
- FALSE: The EOT character is sent

## Settings for the transmission of data using PC software TNCserver

Apply the following settings in machine parameter **RS232** (no. 106700):

Parameters	Selection
Data transfer rate in baud	Has to match the setting in TNCserver
Data transmission protocol	BLOCKWISE
Data bits in each transferred character	7 bits
Type of parity checking	EVEN
Number of stop bits	1 stop bit
Specify type of handshake:	RTS_CTS
File system for file operations	FE1

## Setting the operating mode of the external device (fileSystem)



The **load all programs**, **load offered program**, and **load directory** functions are not available in the **FE2** and **FEX** operating modes.

Icon	External device	Operating mode
	PC with <b>TNCremo</b> software	LSV2
	HEIDENHAIN floppy disk units	FE1
	Non-HEIDENHAIN devices such as printers, scanners, punchers, PC without <b>TNCremo</b>	FEX



## Software for data transfer

For data transfer to or from the control, you should use the **TNCremo** software. With **TNCremo**, data transfer is possible with all HEIDENHAIN controls via the serial interface or the Ethernet interface.



When user administration is active, the control automatically disables the LSV2 connections of the serial interfaces (COM1 and COM2) for security purposes.



You can download the current version of the **TNCremo** software from the HEIDENHAIN homepage.

System requirements for TNCremo:

- Operating system
  - Windows 7
  - Windows 8
  - Windows 8.1
  - Windows 10
- 2 GB RAM
- 5 MB of free disk space
- An available serial interface or connection to the TCP/IP network

### Installation under Windows

- ▶ Open the file manager (Explorer) and start the SETUP.EXE installer
- ▶ Follow the setup program instructions

### Starting TNCremo under Windows

- ▶ Click <Start>, <All Programs>, <HEIDENHAIN>, <**TNCremo**>
- ▶ Alternatively, double-click the TNCremo icon on your desktop

## Data transfer between the control and TNCremo

Check whether the control is connected to the correct serial port on your PC or to the network.

Once you have started the **TNCremo** software, you will see a list of all files that are stored in the active directory in the upper section of the main window **1**. Using <File>, <Change directory>, you can select any drive or another directory on your PC.


If you want to control data transfer from the PC, establish the connection with your PC in the following manner:

- ▶ Select <File>, <Setup connection>. **TNCremo** now receives the file and directory structure from the control and displays this in the lower part of the main window **2**
- ▶ To transfer a file from the control to the PC, select the file in the control window per mouse click and move the highlighted file into the PC window while holding down the mouse button **1**
- ▶ To transfer a file from the PC to the control, select the file in the PC window per mouse click and move the highlighted file into the control window while holding down the mouse button **2**

If you want to control data transfer from the control, establish the connection with your PC in the following manner:

- ▶ Select <Extras>, <TNCserver>. **TNCremo** then starts in server mode and can receive data from the control or send data to the control
- ▶ You can now call the file management functions on the control by pressing the **PGM MGT** key in order to transfer the desired files

**Further information:** "Data transfer to or from an external data carrier", Page 87

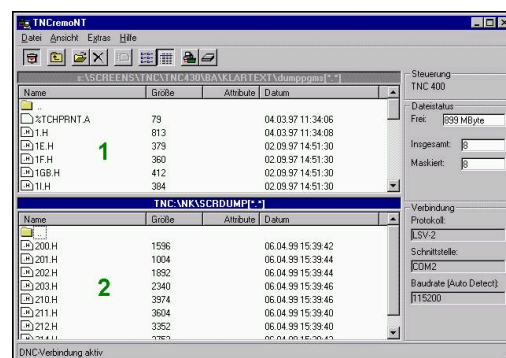

If you have exported a tool table from the control, then the tool types are converted to tool type numbers.

**Further information:** "Available tool types", Page 152

## Ending TNCremo

Select <File>, <Exit>



You can open the context-sensitive help function of the **TNCremo** software by pressing the **F1** key.

## 10.6 Ethernet interface

### Introduction

The control is provided with an Ethernet interface as a standard feature so that you can integrate it into your network as a client.

The control transfers data via the Ethernet interface using the following protocols:

- The **SMB** protocol (Server Message Block)—previously **cifs**—for Windows operating systems
- The **TCP/IP** protocol family (Transmission Control Protocol/Internet Protocol) and with support from the **NFS** (Network File System)



- Protect your data and your control by running your machines in a secure network.
- To avoid security gaps, prefer the current versions of the SMB and NFS protocols.


### Connection possibilities

You can connect the Ethernet interface of the control directly to a PC or to your network via the RJ45 connection X26. The connection is electrically isolated from the control electronics.

You need a Twisted Pair cable to connect the control to your network.



- The maximum cable length permissible between the control and a node depends on the quality grade of the cable, the sheathing, and the type of network.

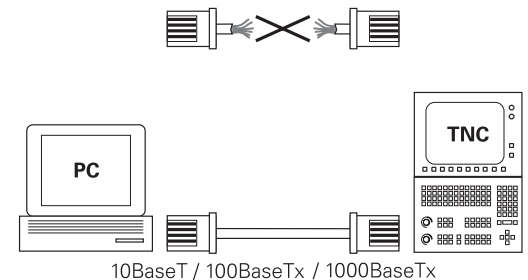

### General network settings



- Have a network specialist configure the control.

To open the general network settings, proceed as follows:

MOD

- ▶ Press the **MOD** key

PGM  
MGT

- ▶ Enter code number **NET123**
- ▶ Press the **PGM MGT** key

NET

- ▶ Press the **NET** soft key

CONFIGURE  
NETWORK

- ▶ Press the **CONFIGURE NETWORK** soft key
- ▶ The control opens the **Network settings** window.

## Computer name tab



This setup dialog is managed by the HEROS operating system. After you have changed the conversational language on your control, you need to restart the control to enable the language.

Setting	Meaning
<b>Primary interface</b>	Name of the Ethernet interface to be integrated in your company network. Only active if a second, optional Ethernet interface is available on the control hardware
<b>Computer name</b>	Name displayed for the control in your company network
<b>Host file</b>	<b>Only required for special applications:</b> Name of a file in which the assignments of IP addresses to computer names are defined



## Interfaces tab

Setting	Meaning
<b>Interface list</b>	List of the active Ethernet interfaces. Select one of the listed interfaces (by mouse or cursor keys) <ul style="list-style-type: none"> <li>■ <b>Activate</b> button: Activate the selected interface (X appears in the <b>Active</b> column)</li> <li>■ <b>Deactivate</b> button: Deactivate the selected interface (- appears in the <b>Active</b> column)</li> <li>■ <b>Configuration</b> button: Open the configuration menu</li> </ul>
<b>Allow IP forwarding</b>	<b>This function must be inactive by default.</b> Only activate this function after instruction by our Service department for diagnostic purposes. If external access to the second, optional Ethernet interface is necessary, this function needs to be activated.

Access the configuration menu as follows:

- Click the **Configuration** button

Setting	Meaning
<b>Status</b>	<ul style="list-style-type: none"> <li>■ <b>Interface active:</b> Connection status of the selected Ethernet interface</li> <li>■ <b>Name:</b> Name of the selected interface</li> <li>■ <b>Plug connection:</b> Number of the plug connection of the selected interface on the logic unit of the control</li> </ul>

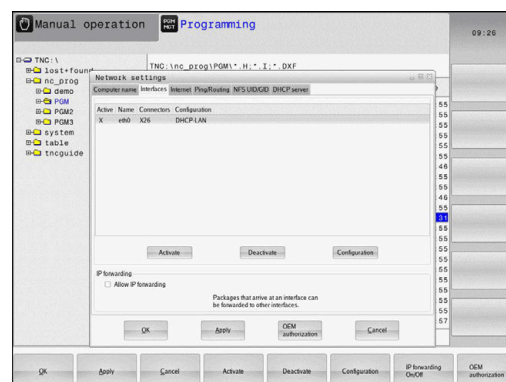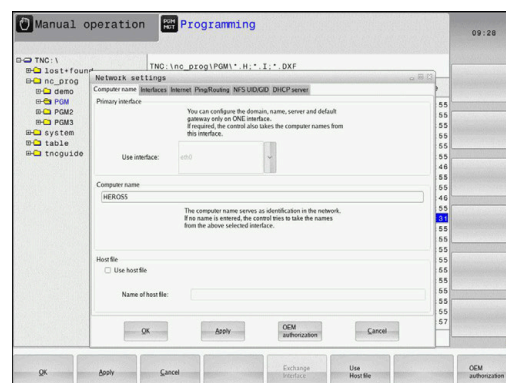

Setting	Meaning
<b>Profile</b>	<p>Here you can create or select a profile in which all settings shown in this window are stored. HEIDENHAIN provides two standard profiles:</p> <ul style="list-style-type: none"> <li>■ <b>DHCP-LAN:</b> Settings for the standard Ethernet interface; should work in a standard company network</li> <li>■ <b>MachineNet:</b> Settings for the second, optional Ethernet interface; for configuration of the machine network</li> </ul> <p>Press the corresponding buttons to save, load, and delete profiles</p>
<b>IP address</b>	<ul style="list-style-type: none"> <li>■ <b>Automatically procure IP address</b> option: The control is to procure the IP address from the DHCP server</li> <li>■ <b>Set the IP address manually</b> option: Manually define the IP address and subnet mask. Input: Four numerical values separated by periods (e.g., <b>160.1.180.20</b> or <b>255.255.0.0</b>)</li> </ul>
<b>Domain Name Server (DNS)</b>	<ul style="list-style-type: none"> <li>■ <b>Automatically procure DNS</b> option: The control is to automatically procure the IP address of the domain name server</li> <li>■ <b>Manually configure the DNS</b> option: Manually enter the IP addresses of the servers and the domain name</li> </ul>
<b>Default gateway</b>	<ul style="list-style-type: none"> <li>■ <b>Automatically procure default gateway</b> option: The control is to automatically procure the default gateway</li> <li>■ <b>Manually configure the default gateway</b> option: Manually enter the IP addresses of the default gateway</li> </ul>
<p>► Apply the changes with the <b>OK</b> button, or discard them with the <b>Cancel</b> button</p>	



## Internet tab

Setting	Meaning
Proxy	<ul style="list-style-type: none"> <li>■ <b>Direct connection to Internet / NAT:</b> The control forwards Internet inquiries to the default gateway and from there they must be forwarded through network address translation (e.g., if a direct connection to a modem is available)</li> <li>■ <b>Use proxy:</b> Define the <b>Address</b> and <b>Port</b> of the Internet router in your network; ask your network administrator for information</li> </ul>


Telemaintenance	The machine manufacturer configures the server for telemaintenance here. Changes must always be made in agreement with your machine tool builder
-----------------	--

## Ping/Routing tab

Setting	Meaning
Ping	<p>In the <b>Address:</b> input field, enter the IP number for which you want to check a network connection. Input: Four numerical values separated by periods (e.g., <b>160.1.180.20</b>). As an alternative, you can enter the name of the computer whose connection you want to check</p> <ul style="list-style-type: none"> <li>■ <b>Start</b> button: Start the test; the control shows the status information in the Ping field</li> <li>■ <b>Stop</b> button: Conclude the test</li> </ul>
Routing	<p>For network specialists: Status information of the operating system for the current routing</p> <ul style="list-style-type: none"> <li>■ <b>Update</b> button: Refresh the routing information</li> </ul>

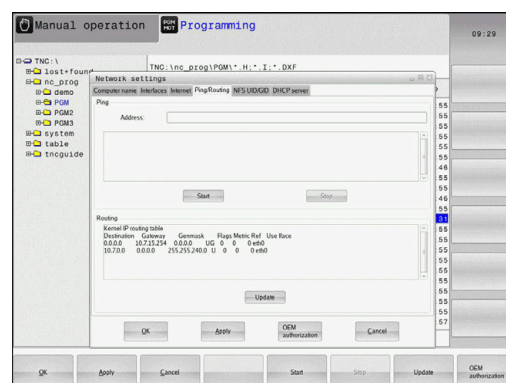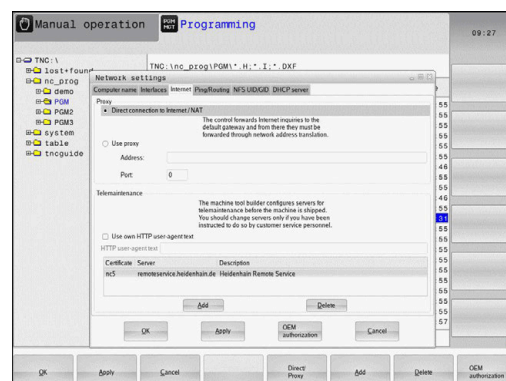


NFS UID/GID tab



If user administration is active, the control will not display this tab. You will find the user-specific settings in user administration.


On the **NFS UID/GID** tab, you define the user and group identifications.

Setting	Meaning
Set UID/GID for NFS shares	<ul style="list-style-type: none"><li>■ <b>User ID:</b> Definition of which user identification the end user uses to access files in the network. Ask your network specialist for the proper value</li><li>■ <b>Group ID:</b> Definition of the group identification with which you access files in the network. Ask your network specialist for the proper value</li></ul>

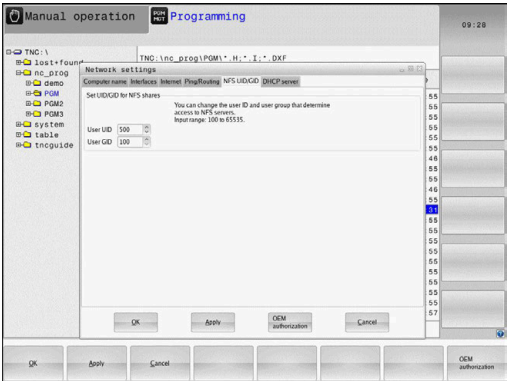

## DHCP Server tab

Setting	Meaning
	<ul style="list-style-type: none"> <li>■ <b>IP addresses from:</b> Define the IP address as of which the control is to derive the pool of dynamic IP addresses. The control transfers the values that appear dimmed from the static IP address of the defined Ethernet interface; these values cannot be edited.</li> <li>■ <b>IP addresses to:</b> Define the IP address up to which the control is to derive the pool of dynamic IP addresses.</li> <li>■ <b>Lease Time (hours):</b> Time within which the dynamic IP address is to remain reserved for a client. If a client logs on within this time, the control reassigns the same dynamic IP address.</li> <li>■ <b>Domain name:</b> Here you can define a name for the machine network if required. This is necessary if the same names are assigned in the machine network and in the external network, for example.</li> <li>■ <b>Forward DNS to external:</b> If <b>IP forwarding</b> is active (Interfaces tab) and the option is active, you can specify that the name resolution for devices in the machine network can also be used by the external network.</li> <li>■ <b>Forward DNS from external:</b> If <b>IP forwarding</b> is active (Interfaces tab) and this option is active, you can specify that the control is to forward DNS requests from devices within the machine network to the name server of the external network as well if the DNS server of the MC cannot answer the request..</li> <li>■ <b>Status</b> button: Call an overview of the devices that are provided with a dynamic IP address in the machine network. You can also select settings for these devices</li> <li>■ <b>Advanced options</b> button: Additional settings for the DNS/DHCP server.</li> <li>■ <b>Set standard values</b> button: Set factory default settings.</li> </ul>

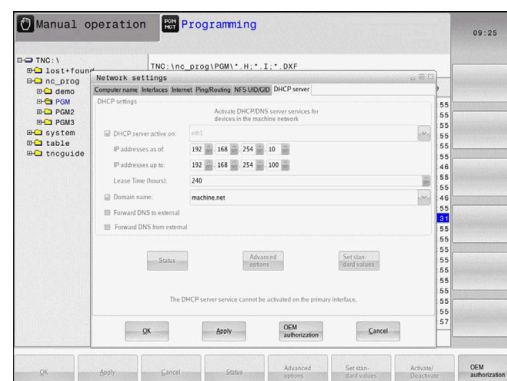



### Sandbox tab

On the **Sandbox** tab, you configure the sandbox feature.

With the sandbox feature, the control enables you to execute applications in an environment that is isolated from the rest of the control. By isolating the data accesses, applications that run within a sandbox container have no access to files outside the virtual environment. This can be used, for example, to run a browser with access to the Internet.



Configure and use the sandbox on your control. For safety and security reasons, always open the browser in the sandbox.

Activate the sandbox as follows:

- ▶ Activate the Sandbox option (by selecting it)
- > The control activates the default settings for the sandbox.
- > When the default settings are active, the control offers you to start the browser from within the sandbox.

The sandbox can share a network connection (e.g., eth0) with the control. You can use the **Configure** button to configure separate network settings for the sandbox.



You can define firewall settings for the sandbox using the **brsb0** interface.

**Further information:** "Firewall", Page 398

With the aid of the network settings, this enables you to allow only the sandbox to access the Internet. The control is only allowed to access its local Intranet or machine network. In this case, the browser is only allowed to access the Internet if the browser runs within the sandbox.

The sandbox is automatically given its own computer name. The computer name of the control is therefore suffixed with **\_sandbox**.

## Settings for network drives



Have a network specialist configure the control.

You can connect network drives to the control. If the control is connected to a network and the file shares are connected, the control displays additional drives in the directory window of the file management


You can define any number of network drives, but only seven can be connected at a time

To open the settings for network drives, proceed as follows:

- ▶ Press the **PGM MGT** key
- ▶ Press the **NET** soft key
- ▶ Press the **DEFINE NETWORK CONNECTN.** soft key
- ▶ The control opens the **Mount Setup** window.

In the **Network drive** area, the control shows a list of all defined network drives, as well as the status of each drive.

In the **Status Log** area, the control shows status information and error messages.

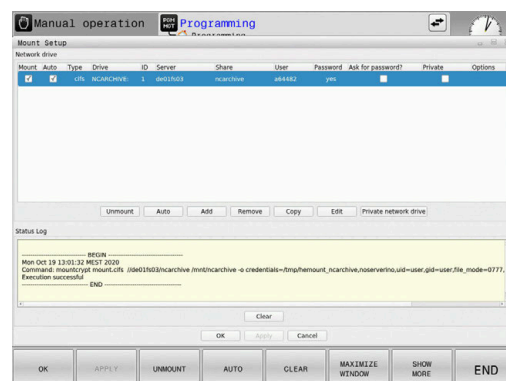

Soft key	Button	Meaning
	<b>Mount</b>	Connect a network drive The control ticks the check box in the <b>Mount</b> column when there is an active connection.
	<b>Unmount</b>	Disconnect a network drive
	<b>Auto</b>	Automatically connect the network drive whenever the control is switched on The control ticks the check box in the <b>Auto</b> column when there is an automatic connection.
	<b>Add</b>	Define a new network drive
	<b>Unmount</b>	Delete an existing network drive
	<b>Copy</b>	Copy a network drive
	<b>Edit</b>	Edit a network drive
	<b>Clear</b>	Delete the contents of the <b>Status Log</b> area
	<b>Private network drive</b>	User-specific network drive when user administration is active The control ticks the check box in the <b>Privat</b> column when there is a user-specific connection.


## Adding a network drive


### Prerequisites for connecting a network drive:


- There is a connection to the network
- The control and the server are in the same network
- The access data and the drive path are known.

To add a network drive, proceed as follows:

- Select **Add**
- The control opens the **Mount assistant** window.
- Define the settings on the individual tabs
- Select **Forward** after every tab
- On the **Check** tab, check the settings and select **Apply**
- The control saves the network drive.

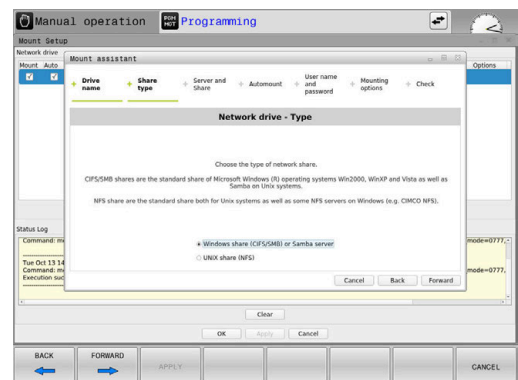

Tab	Settings
Drive name	<ul style="list-style-type: none"> <li>■ <b>Drive name:</b> Name of the network drive in the file management</li> <li>■ <b>Private network drive:</b> When user administration is active, the connection is only visible to the user who created it</li> </ul> <div>  <p>To create and edit public connections, you need the HEROS.SetShares right. Users without this right are able to start and terminate public connections, but can only create and edit private connections.</p> <p><b>Further information:</b> "Definition of roles", Page 434</p> </div>
Share type	<p>Transfer protocol:</p> <ul style="list-style-type: none"> <li>■ <b>Windows share (CIFS/SMB) or Samba server</b></li> <li>■ <b>UNIX share (NFS)</b></li> </ul>
Server and Share	<ul style="list-style-type: none"> <li>■ <b>Server name:</b> or IP address of the network drive</li> <li>■ <b>Share name:</b> Directory accessed by the control</li> </ul>
Automount	<p><b>Connect automatically (not possible with "Ask for password?" option):</b> The control connects the network drive automatically during start-up.</p>
User name and password (only with Windows share)	<ul style="list-style-type: none"> <li>■ <b>Single Sign On:</b> When user administration is active, the control automatically connects an encrypted network drive when the user is logging in.</li> <li>■ <b>Windows user name:</b></li> <li>■ <b>Ask for password? (Not possible with "Automount" option):</b> Select whether a password is required during connection</li> <li>■ <b>Password</b></li> <li>■ <b>Password verification</b></li> </ul>

Tab	Settings
Mounting options	<p data-bbox="311 376 820 412"><b>Parameters for mount option "-o":</b> Auxiliary parameters for the connection</p> <div data-bbox="311 443 820 474"> <p data-bbox="319 459 371 506"> To avoid security gaps, prefer the current versions of the SMB and NFS protocols.</p> <p data-bbox="421 443 815 474">If the network drive requires an older protocol version, you can change the protocol version with the <b>vers=</b> auxiliary parameter. Contact your network specialist.</p> </div>
Check	The control displays the defined settings.

## 10.7 SELinux security software

**SELinux** is an extension for Linux-based operating systems. SELinux is an additional security software package based on Mandatory Access Control (MAC) and protects the system against the running of unauthorized processes or functions and therefore protects against viruses and other malware.

MAC means that every action must be explicitly permitted, otherwise it will not be executed by the control. The software is intended as protection in addition to the normal access restriction in Linux. Certain processes and actions can only be executed if the standard functions and access control of SELinux permit it.



The SELinux installation of the control has been prepared to permit running only programs installed with the HEIDENHAIN NC software. Other programs cannot be run with the standard installation.

The access control of SELinux under HEROS 5 is regulated as follows:

- The control executes only applications that are installed with the HEIDENHAIN NC software
- Files in connection with the security of the software (SELinux system files, HEROS 5 boot files, etc.), may only be modified by programs that have been selected explicitly.
- New files generated by other programs must never be executed
- USB data carriers cannot be deselected
- There are only two processes that are permitted to execute new files:
  - Starting a software update: A software update from HEIDENHAIN can replace or change system files
  - Starting the SELinux configuration: The configuration of SELinux is usually password-protected by your machine manufacturer; refer here to the relevant machine manual



HEIDENHAIN recommends activating SELinux because it provides additional protection against attacks from outside.

## 10.8 User administration

### Introduction



Refer to your machine manual!

Some user administration areas are configured by the machine tool builder.


If you want to use the user administration feature on a control without HEIDENHAIN keyboard, you need to connect an external alphabetic keyboard to the control.

User administration is inactive in the control's factory default setting. This status is called **legacy mode**. In **legacy mode**, the control's behavior is identical to that of older software versions without user administration.

It is not mandatory that you use the user administration feature, but it is essential for the implementation of an IT security system.

User administration supports you in the following fields of security, based on the requirements of the IEC 62443 series of standards:

- Application security
- Network security
- Platform security

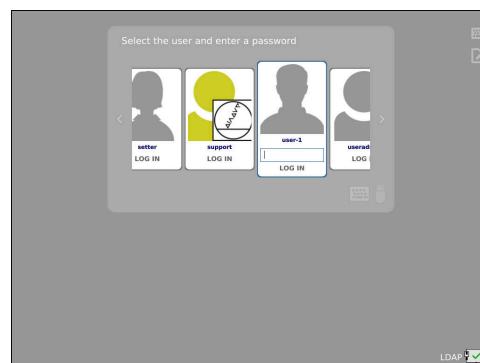

User administration enables you to define users with different access rights.

**The following options are available for saving your user data:**

- **Local LDAP database**
  - Using the user administration feature on one single control
  - Setting up a central LDAP server for more than one control
  - Exporting an LDAP server configuration file if the exported database is to be used by more than one control

**Further information:** "Local LDAP database", Page 424

- **LDAP on remote computer**

- Importing an LDAP server configuration file

**Further information:** "LDAP on remote computer", Page 424

- **Connection to Windows domain**

- Integrating the user administration feature on more than one control
  - Using different roles on different controls

**Further information:** "Connection to a Windows domain", Page 425



Parallel operation of Windows users and users from an LDAP database is possible.

## Configuring the user administration



If you used the **Remote Desktop Manager** to establish private connections before user administration was activated, these connections are no longer available after the activation of user administration.

Save your private connections before activating user administration.

**Further information:** "Remote Desktop Manager (option 133)", Page 366

User administration is inactive in the control's factory default setting. This status is called **legacy mode**.

User administration needs to be configured before you can use it.

Perform the following steps for configuration:

- 1 Calling and activating user administration
- 2 Creating a **useradmin** user
- 3 Setting up a database
- 4 Creating further users

**Further information:** "Creating further users", Page 428

### Calling user administration

Call user administration as follows:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select the **Settings** menu item
- ▶ Select the **UserAdmin** menu item
- > The control opens the **User management** window.




You can exit the **User management** window after each configuration step.

If you exit the **User management** window directly after having activated user administration, the control will prompt you for a restart once.

### Activating user administration

Activate user administration as follows:

- ▶ Call the user administration
- ▶ Press the **User administration active** soft key
- > The control shows the message **Password for user 'useradmin' missing.**

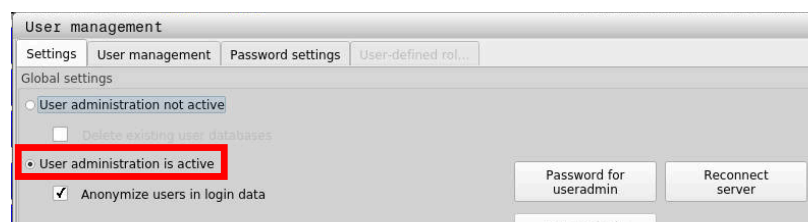

The purpose of the **Anonymize users in login data** function is data privacy; this function is active by default. While this function is active, user data in all log files of the control will be anonymized.

### NOTICE

#### Caution: Unwanted data transfer is possible!

If you deactivate the **Anonymize users in login data** function, the system will show personalized user data in all control log files.

If servicing becomes necessary or if the log files need to be transmitted for another reason, the contracting party will be able to view this user data. In this case it is your responsibility to ensure that all required data protection provisions have been made at your company.

- ▶ Retain or reactivate the active status of the **Anonymize users in login data** function



### Deactivating user administration

If you deactivate user administration, the control saves all configured users. Thus they will be available again when user administration is reactivated.

If you want to delete the configured users upon deactivation, you need to set this explicitly when deactivating user administration.

User administration can only be deactivated by the following function users:

- **useradmin**
- **OEM**
- **SYS**

**Further information:** "HEIDENHAIN function users", Page 433

Deactivate user administration as follows:

- ▶ Log in as the appropriate function user
- ▶ Call the user administration
- ▶ Select **User administration inactive**
- ▶ If necessary, check **Delete existing user databases** to delete any configured users and user-specific directories



- ▶ Press the **APPLY** soft key



- ▶ Press the **END** soft key
- > The control opens the **System reboot required** window.
- ▶ Select **Yes**
- > The control triggers a restart.

### Creating a useradmin function user

After user administration has been activated, create the **useradmin** function user.

The **useradmin** user is comparable to the local administrator of a Windows system.

Create the **useradmin** user as follows:

- ▶ Select **Password for useradmin**
- > The control opens the **Password for user 'useradmin'** pop-up window.
- ▶ Set the password for the **useradmin** user
- ▶ Select **Set new password**
- > The control shows the message **Settings and password for 'useradmin' were changed.**



For reasons of security, passwords should comply with the following criteria:

- Eight characters minimum
- Letters, numbers, and special characters
- Avoid using whole words or a sequence of characters (e.g., Anna or 123)

If you want to use special characters, pay attention to the keyboard layout. HEROS assumes a US keyboard, the NC software assumes a HEIDENHAIN keyboard. External keyboards can be freely configured.

The **useradmin** account provides the following functions:

- Creating databases
- Assigning the password data
- Activating the LDAP database
- Exporting LDAP server configuration files
- Importing LDAP server configuration files
- Emergency access if the user database was destroyed
- Retroactive change of the database connection
- Deactivating the user administration




The **useradmin** user automatically receives the **HEROS.Admin** role. This allows him to manage users in the user administration, provided that he knows the LDAP database password. The **useradmin** user is a function user who has been predefined by HEIDENHAIN. You can neither add roles to function users, nor delete their roles.

HEIDENHAIN recommends permitting more than one person to access an account with the **HEROS.Admin** role. This ensures that necessary changes to user administration can also be made in the administrator's absence.

### Setting up a database

Set up the database as follows:

- ▶ Select the database for saving the user data
- ▶ Set up a database
- ▶ Press the **APPLY** soft key
- ▶ Press the **END** soft key
- > The control opens the **System reboot required** window.
- ▶ Press **Yes** to restart the system
- > The control restarts.

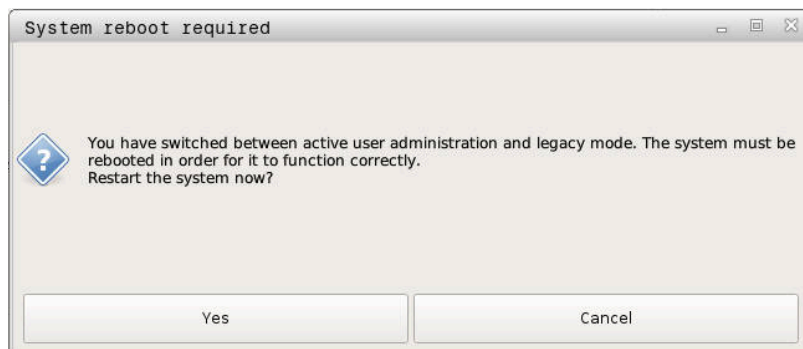

## Local LDAP database

Before you can use the **Local LDAP database** function, the following requirements must be met:

- The user administration is active
- The **useradmin** user has been configured

Proceed as follows to set up a **Local LDAP database**:

- ▶ Call the user administration
- ▶ Select the **LDAP user database** function
- > The control enables the dimmed area for editing the LDAP user database.
- ▶ Select the **Local LDAP database** function
- ▶ Select the **Configuration** function
- > The control opens the **Configure local LDAP database** window.
- ▶ Enter the name of the **LDAP domain**
- ▶ Enter the password
- ▶ Repeat the password
- ▶ Press the **OK** soft key
- > The control closes the **Configure local LDAP database** window.



Before you can start editing the user administration, the control prompts you to enter the password of your local LDAP database.

Passwords must not be trivial and must be known only to the administrators.

**Further information:** "Creating further users", Page 428



If the host name or domain name of the control changes, you need to reconfigure the local LDAP databases.

## LDAP on remote computer

### Requirements

Before you can use the **LDAP on remote computer** function, the following requirements must be met:

- User administration is active
- The **useradmin** user has been configured
- An LDAP database has been set up in the company network
- A server configuration file of an existing LDAP database must be stored on the control or on a PC in the network
- The PC with the existing configuration file is running.
- The PC with the existing configuration file is accessible in the network

### Providing a server configuration file


Provide a server configuration file for an LDAP database as follows:

- ▶ Call the user administration
- ▶ Select the **LDAP user database** function
- > The control enables the dimmed area for editing the LDAP user database.
- ▶ Select the **Local LDAP database** function
- ▶ Select the **Export server configuration** function
- > The control opens the **Export LDAP configuration file window**.
- ▶ Enter the name for the server configuration file into the name field
- ▶ Save the file to the desired folder
- > The server configuration file was exported successfully.

### Using the LDAP database on another computer

To use the **LDAP on remote computer** function, proceed as follows:

- ▶ Call the user administration
- ▶ Select the **LDAP user database** function
- > The control enables the dimmed area for editing the LDAP user database.
- ▶ Select the **LDAP on remote computer** function
- ▶ Select the **Import server configuration** function
- > The control opens the **Import LDAP configuration file window**.
- ▶ Select the existing configuration file
- ▶ Select **FILE**
- ▶ Press the **APPLY** soft key
- > The configuration file was imported.

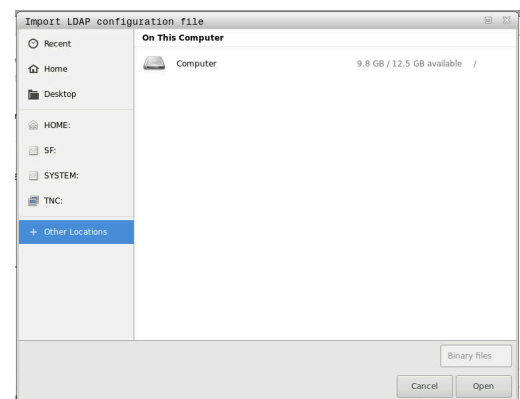

## Connection to a Windows domain

### Prerequisites

Before you can use the **Connection to Windows domain** function, the following requirements must be met:

- User administration is active
- The **useradmin** user has been configured
- There is a Windows Active Domain Controller in the network
- You have access to the password of the domain controller
- You have access to the user interface of the domain controller or you are supported by an IT administrator
- The domain controller is accessible in the network

### Setting up the Connection to Windows domain function

Set up the **Connection to Windows domain** function as follows:

- ▶ Call the user administration
- ▶ Select the **Connection to Windows domain** function
- ▶ Select the **Find domain** function



Use the **Configuration** function to define various settings of your connection:

- Use the **Map SIDs to Unix UIDs** check box to select whether Windows SIDs are automatically mapped to Unix UIDs
- Use the **Use LDAPs** check box to select LDAP or secure LDAPs. For LDAPs, define whether or not the secure connection verifies a certificate
- Define a special group of Windows users to whom you want to restrict the connection to this control
- Modify the organizational unit in which the HEROS role names are stored
- Change the prefix in order to manage users from different workshops, for example. Each prefix given to a HEROS role name can be changed (e.g., HEROS hall 1 and HEROS hall 2)
- Modify the separator within the HEROS role names

- ▶ Press the **APPLY** soft key
- > The control opens the **Connect to domain** window.



With the **Organizational unit for computer account:** function, you can specify in which of the already existing organizational units you want to create the access, e.g.

- ou = controls
- cn = computers

The values you enter must match the conditions of the domain. The terms are not exchangeable.

- ▶ Enter the user name of the domain controller
- ▶ Enter the password of the domain controller
- > The control connects to the Windows domain found.
- > The control checks whether all of the required roles have been created in the domain as groups.



If not all of the required roles have been created in the domain as groups, the control issues a warning.

If the control issues a warning, proceed in one of the two following ways:

- ▶ Press the **Add role definition** soft key


- Select the **Add** function

You can enter the roles directly into the domain in this case.

- Press **Export**

With this function, you can export the roles to a file in .ldif format.

- > All of the required roles have been created in the domain as groups.

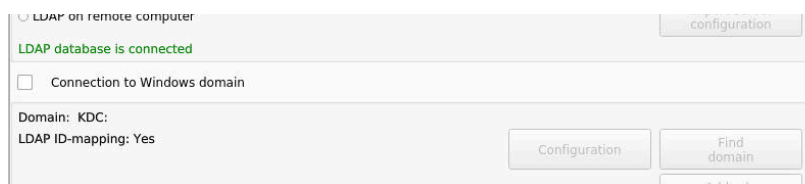

### Creating groups

There are the following ways to create groups corresponding to the different roles:


- Automatically when entering the Windows domain by specifying a user with administrator rights
- By importing an import file in .ldif format to the Windows server

The Windows administrator must add the users manually to the roles (security groups) on the domain controller.

Two suggestions describing how the groups can be structured by the Windows administrator are given by below.


### Example 1

The user is a direct or indirect member of the respective group:

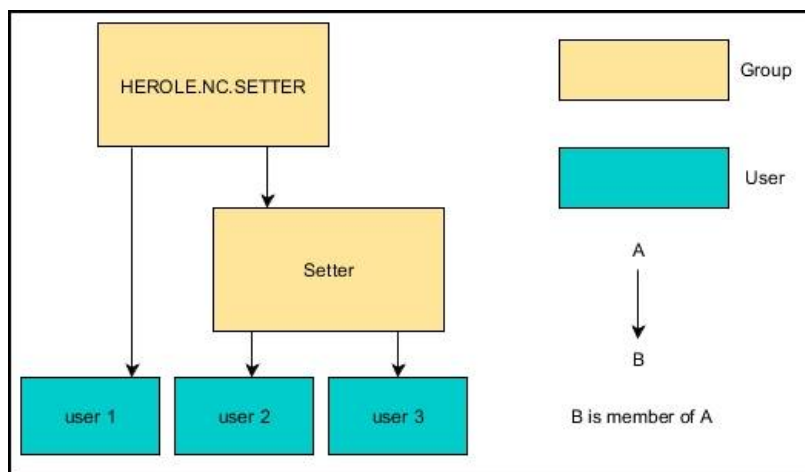

### Example 2

Users from various sectors (workshops) are members of groups with different prefixes:

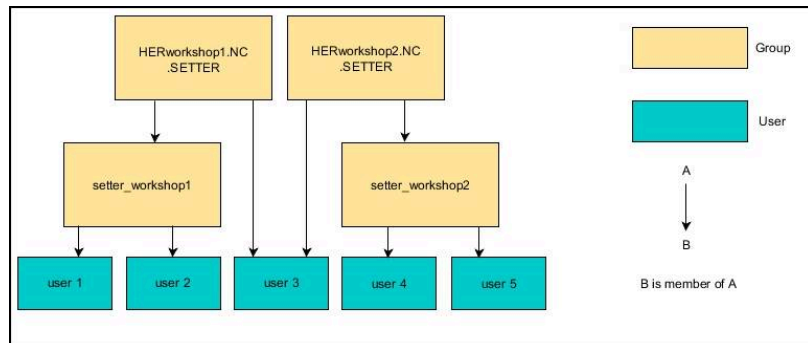

### Creating further users

Before you can create further users, the following requirements must be met:

- User administration has been configured
- LDAP database has been selected and configured



The **User management** tab is only effective for the following databases:

- **Local LDAP database**
- **LDAP on remote computer**

If **Connection to Windows domain** is used, you need to configure the users in the Windows domain.


**Further information:** "Connection to a Windows domain", Page 425

### Opening the User management tab

To manage users, proceed as follows:

- ▶ Call the user administration
- ▶ Select the **User management** tab
- ▶ Press the **EDIT ON** soft key
- The control prompts you to enter the password of the user database, if applicable.
- After you have entered the password, the control opens the **User management** menu.

You can edit the existing users or create new users.

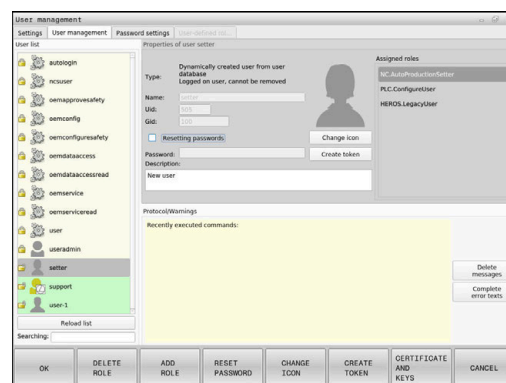



### Create new user

To create a new user, proceed as follows:

- ▶ Press the **Create new user** soft key
- The control opens a window for creating a user.
- ▶ Enter the user name
- ▶ Enter the password for the user



The user must change the password when logging in for the first time.

**Further information:** "Login to user administration", Page 443

- ▶ Create a user description, if desired
  - ▶ Press the **Add role** soft key
  - ▶ In the selection window, select the roles corresponding to the user
- Further information:** "Definition of roles", Page 434
- ▶ Press the **Add** soft key



Two additional soft keys are available in the menu:

#### ■ Add external login

Adds **Remote.HEROS.Admin** in place of **HEROS.Admin**, for example.

This role is only enabled for remote logon to the system.

#### ■ Add local login

Adds **Local.HEROS.Admin** in place of **HEROS.Admin**, for example.


This role is only enabled for local logon at the control's screen.

- ▶ Press the **CLOSE** soft key
- The control closes the window for creating a user.
- Press the **OK** soft key
- ▶ Press the **APPLY** soft key
- The control adopts the changes.
- ▶ Press the **END** soft key
- The control closes the user administration.



If you have not restarted your control after configuring the database, the control prompts you to restart for the changes to take effect.

**Further information:** "Configuring the user administration", Page 419

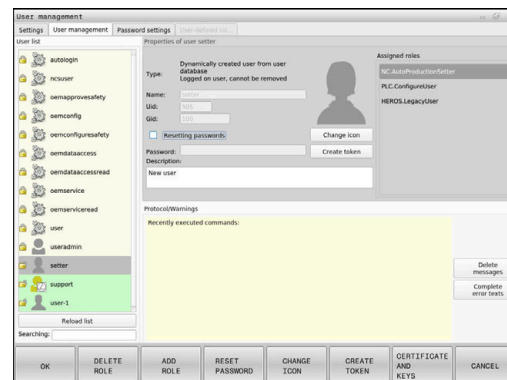

### Adding profile images

You can optionally also assign images to the users. The **Default user icons**: from HEIDENHAIN are available for this purpose. You can also load your own images in JPEG or PNG format to the control. Then you can use these image files as profile images.

To define profile images, proceed as follows:

- ▶ Log on the user with **HEROS.Admin** role, e.g. **useradmin**

**Further information:** "Login to user administration", Page 443

- ▶ Call the user administration
- ▶ Select the **User management** tab
- ▶ Press the **Edit user** soft key
- ▶ Press the **Change icon** soft key
- ▶ Select the desired image in the menu
- ▶ Press the **Choose icon** soft key
- ▶ Press the **OK** soft key
- ▶ Press the **APPLY** soft key
- ▶ The control adopts the changes.



You can also directly add profile images when creating the users.

## Password settings in user administration

### Password settings tab

Users with the **HEROS.Admin** role can specify exact requirements for user passwords on the **Password settings** tab.

**Further information:** "Privileges", Page 437



If you do not comply with the requirements defined here when creating your password, the control will issue an error message.

Open the **Password settings** tab as follows:

- ▶ Log on as a user with **HEROS.Admin** role
- ▶ Call the user administration
- ▶ Select the **Password settings** tab
- ▶ Press the **EDIT ON** soft key
- ▶ The control opens the **Enter password of LDAP database** window.
- ▶ Enter password
- ▶ The control releases the **Password settings** tab for editing.


### Defining password settings

The control allows you to configure user password requirements by setting various parameters.

The screenshot displays the 'Password settings' tab within a user administration interface. The interface includes a navigation bar at the top with options like 'Settings', 'User management', and 'Password settings'. Below this, there are several configuration sections: 'Validity period of password' with a dropdown menu, 'Warning before expiration' with a date selector, and 'Password quality' with multiple input fields and checkboxes. The 'Password quality' section includes fields for 'Minimum password length', 'Minimum number of character classes (upper/lower, digits, special)', 'Maximum number of repeated characters', 'Maximum length of character sequences', 'Dictionary check (number of matching characters)', and 'Minimum number of characters changed compared to previous password'. At the bottom, there are navigation buttons: 'BACK', 'EDIT ON', 'APPLY', and 'END'.

Edit the parameters as follows:

- ▶ Open the **Password settings** tab
- ▶ Select the desired parameter
- > The control highlights the selected parameter in blue.
- ▶ Set the desired parameter using the slider.
- > The control shows the selected parameter in the display field.

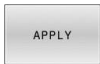

- ▶ Press the **APPLY** soft key
- > The control applies the change.

The following parameters are available:

#### **Password lifetime**

- **Validity period of password:**  
Here, you can indicate how long the password can be used.
- **Warning before expiration:**  
From the defined time, a warning will be issued that the password will soon expire.

#### **Password quality**


- **Minimum password length:**  
Here, you can indicate the minimum password length.
- **Minimal number of character classes (upper/lower, digits, special):**  
Here, you can indicate the minimum number of different character classes required in the password.
- **Maximum number of repeated characters:**  
Here, you can indicate the maximum number of identical successive characters in the password.
- **Maximum length of character sequences:**  
Here, you can indicate the maximum length of the character sequences to be used in the password, e.g. 123.
- **Dictionary check (number of matching characters):**  
Here, you can enable a check whether the password contains known words and specify the allowed number of meaningful characters.
- **Minimum number of characters changed compared to previous password:**  
Here, you can specify how many characters in the new password must be different from the previous one.

## Access rights

The user administration is based on the Unix rights management. Access to the control is controlled by means of rights.

The user administration differentiates between the following terms:

- User
- Roles
- Rights

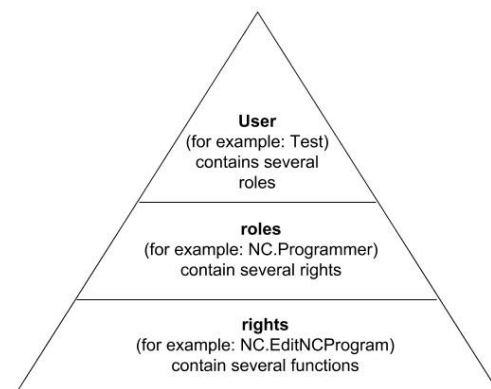

## User

A user can be pre-defined in the control or he can be defined by the end user.

The user administration offers the following types of users:

- Function users predefined by HEIDENHAIN  
**Further information:** "HEIDENHAIN function users",  
 Page 433
- Function users defined by the machine tool builder
- Self-defined users

A user contains all the roles that have been assigned to him.



Your machine tool builder defines function users who are required for specific tasks such as machine maintenance.

Depending on the task assigned, you can use one of the pre-defined function users or you have to create a new user.

The access rights of HEIDENHAIN function users are already pre-defined in the control's factory default setting.

## Roles

Roles consist of a combination of rights that cover certain functions provided by the control.

- **Operating system roles:**
- **NC operator roles:**
- **Machine tool builder (PLC) roles:**

All of these roles are pre-defined in the control.

You can assign more than one role to a user.

## Rights

Rights consist of a combination of functions that cover a task area of the control, e.g. editing the tool table.

- HEROS rights
- NC rights
- PLC rights (machine tool builder)

If more than one role is assigned to a user, he will be granted all rights contained in these roles.



Ensure that every user is assigned all access rights he needs. The access rights result from the actions a user performs on the control.

## HEIDENHAIN function users

HEIDENHAIN function users are pre-defined users that are automatically created upon activation of user administration. Function users cannot be changed.

HEIDENHAIN provides four different function users in the control's factory default setting.

### ■ **oem**

The **oem** function user is intended for the machine tool builder. With **oem**, you can access the PLC partition of the control.

### ■ **Function user defined by the machine tool builder**




Refer to your machine manual!

The users defined by the machine tool builder can differ from those pre-defined by HEIDENHAIN.

The machine tool builder's function users can already be active in **legacy mode** and replace code numbers.

By entering code numbers or passwords that replace code numbers, you can temporarily enable rights of **oem** function users.

**Further information:** "Current User", Page 450

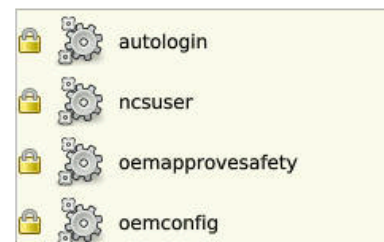

### ■ **sys**

With the **sys** function user, you can access the system partition of the control. This function user is reserved for use by the JH service personnel.

### ■ **user**

In **legacy mode**, the **user** function user is automatically logged on to the system during control startup. When user administration is active, the **user** function user has no effect. The logged-on user of the type **user** cannot be changed in **legacy mode**.

### ■ **useradmin**

The **useradmin** function user is automatically created upon activation of user administration. With **useradmin**, you can configure and edit user administration.

## Definition of roles

HEIDENHAIN combines several rights for individual task areas to roles. Different pre-defined roles that you can use to assign rights to your users are available. The tables below describe the individual rights of the different roles.



Every user should have at least one role from the operating system area and at least one role from the programming area.

You can enable a role either for local login or for remote login. With local login, the user directly logs on to the control at the control's screen. A remote login (DNC) is a connection via SSH.

You can therefore also make the rights of a user dependent on the access used to operate the control.

If a role is only enabled for local login, **Local.** is added to the role name, e.g. **Local.HEROS.Admin** instead of **HEROS.Admin**.

If a role is only enabled for remote login, **Remote.** is added to the role name, e.g. **Remote.HEROS.Admin** instead of **HEROS.Admin**.

Advantages of classification in roles:

- Simplified administration
- Different rights are compatible between different software versions of the control and different machine manufacturers.



Various applications require access to certain interfaces. Where required, the administrator also needs to set up rights to access the required interfaces as well as rights to access certain functions and additional programs. These rights are granted by the **Operating system roles**.



The following contents can change in the following software versions of the control:

- HEROS role names
- Unix groups
- Basic ID number

## Operating system roles:

Role	Privileges		
	HEROS role name	UNIX group	Basic ID number
HEROS.RestrictedUser	Role for a user with minimum rights on the operating system.		
	■ HEROS.MountShares	■ mnt	■ 332
	■ HEROS.Printer	■ lp	■ 9
HEROS.NormalUser	Role for a normal user with limited rights on the operating system.		
	This role grants the rights of the <b>RestrictedUser</b> role, as well as the following rights:		
	■ HEROS.SetShares	■ mntcfg	■ 331
HEROS.LegacyUser	■ HEROS.ControlFunctions	■ ctrlfct	■ 337
	With the <b>legacy user</b> role, the behavior regarding the operating system of the control is identical to that of older software versions without user administration. The user administration remains active.		
	This role grants the rights of the <b>NormalUser</b> role, as well as the following rights:		
HEROS.LegacyUserNoC-ctrlfct	■ HEROS.BackupUsers	■ userbck	■ 334
	■ HEROS.PrinterAdmin	■ lpadmin	■ 16
	■ HEROS.SWUpdate	■ swupdate	■ 338
HEROS.Admin	■ HEROS.SetNetwork	■ netadmin	■ 333
	■ HEROS.SetTimezone	■ tz	■ 330
	■ HEROS.VMSharedFolders	■ vboxsf	■ 1000
HEROS.LegacyUserNoC-ctrlfct	This role determines the rights for remote log-in when user administration is disabled, e.g. via SSH. The control assigns this role automatically.		
	This role grants the rights of the <b>LegacyUser</b> role, with the exception of the following right:		
	■ HEROS.ControlFunctions	■ ctrlfct	■ 337
HEROS.Admin	The configuration of the network and the configuration of the user administration are some of the rights granted by this role.		
	This role grants the rights of the <b>LegacyUser</b> role, as well as the following rights:		
	■ HEROS.UserAdmin	■ useradmin	■ 336

## NC operator roles:

Role	Privileges		
	HEROS role name	UNIX group	Basic ID number
<b>NC.Operator</b>	This role allows you to run NC programs.		
	■ NC.OPModeProgramRun	■ NCOpPgmRun	■ 302
<b>NC.Programmer</b>	This role grants the rights of NC programming.		
	This role grants the rights of the <b>Operator</b> role, as well as the following rights:		
	■ NC.EditNCProgram	■ NCEdNCProg	■ 305
	■ NC.EditPalletTable	■ NCEdPal	■ 309
	■ NC.EditPresetTable	■ NCEdPreset	■ 308
	■ NC.EditToolTable	■ NCEdTool	■ 306
	■ NC.OPModeMDi	■ NCOpMDI	■ 301
	■ NC.OPModeManual	■ NCOpManual	■ 300
<b>NC.Setter</b>	This role allows you to edit the pocket table.		
	This role grants the rights of the <b>Programmer</b> role, as well as the following rights:		
	■ NC.ApproveFsAxis	■ NCApproveFsAxis	■ 319
	■ NC.EditPocketTable	■ NCEdPocket	■ 307
	■ NC.SetupDrive	■ NCSetupDrv	■ 315
	■ NC.SetupProgramRun	■ NCSetupPgRun	■ 303
<b>NC.AutoProductionSetter</b>	This role allows you to execute all NC functions, including programming a scheduled NC program start.		
	This role grants the rights of the <b>Setter</b> role, as well as the following rights:		
	■ NC.ScheduleProgramRun	■ NCSchedulePgRun	■ 304
<b>NC.LegacyUser</b>	With the <b>legacy user</b> role, the control's behavior regarding NC programming is identical to that of older software versions without user administration. User administration remains active. The <b>legacy user</b> has the same rights as the <b>AutoProductionSetter</b> .		
<b>NC.AdvancedEdit</b>	This role allows you to use special functions of the NC and table editors.		
	■ Special functions of Q parameter programming and editing the table header Replacement for code number <b>555343</b>		
	■ NC.EditNCProgramAdv	■ NCEditNCPgmAdv	■ 327
	■ NC.EditTableAdv	■ NCEditTableAdv	■ 328
<b>NC.RemoteOperator</b>	This role allows you to start NC programs from an external application.		
	■ NC.RemoteProgramRun	■ NCRemotePgmRun	■ 329



**Machine tool builder (PLC) roles:**

Role	Privileges		
	HEROS role name	UNIX group	Basic ID number
<b>PLC.ConfigureUser</b>	This role grants the rights on code number <b>123</b> .		
	■ NC.ConfigUserAdv	■ NCConfigUserAdv	■ 316
	■ NC.SetupDrive	■ NCSetupDrv	■ 315
<b>PLC.ServiceRead</b>	This role allows read-only access during servicing. This role can be used to display various types of diagnostic information		
	■ NC.Data.AccessServiceRead	■ NCDAServiceRead	■ 324



Refer to your machine manual!

The machine tool builder can adapt the PLC roles.

When the **Machine tool builder (PLC) roles:** are adapted by the machine tool builder, the following contents may change:

- The names of the roles
- The number of roles
- The functionality of the roles

**Privileges**

The table below lists all of the individual rights.

**Rights:**

HEROS role name	Description
HEROS.Printer	Data output to network printers
HEROS.PrinterAdmin	Configuration of network printers
NC.OPModeManual	Operating the machine in the <b>Manual Operation</b> and <b>Electronic handwheel</b> operating modes.
NC.OPModeMDi	Working in the <b>Positioning w/ Manual Data Input</b> operating mode.
NC.OPModeProgramRun	Execution of NC programs in the <b>Program Run Full Sequence</b> or <b>Program run, single block</b> operating mode.
NC.SetupProgramRun	Probing in the <b>Manual Operation</b> and <b>Electronic handwheel</b> operating modes Using the <b>AFC</b> and <b>ACC</b> functions.
NC.ScheduleProgramRun	Programming a scheduled NC program start
NC.EditNCProgram	Editing NC programs
NC.EditToolTable	Editing the tool table
NC.EditPocketTable	Editing the pocket table
NC.EditPresetTable	Editing the preset table
NC.EditPalletTable	Editing pallet tables
NC.SetupDrive	Adjustment of drives by the end user
NC.ApproveFsAxis	Confirming test position of safe axes
NC.EditNCProgramAdv	Additional NC functions
NC.EditTableAdv	Additional table programming functions (e.g., editing of the table head)

HEROS role name	Description
HEROS.SetTimezone	Adjustment of time and date, time zone, and time synchronization via NTP and HEROS menu
HEROS.SetShares	Configuration of public network drives mounted on the control
HEROS.MountShares	Connecting and disconnecting network shares with the control
HEROS.SetNetwork	Configuration of network and relevant settings for data security
HEROS.BackupUsers	Data backup on the control—for all users configured on the control
HEROS.BackupMachine	Backup and restoring data of the entire machine configuration
HEROS.UserAdmin	Configuration of user administration on the control This includes creating, deleting and configuring local users
HEROS.ControlFunctions	Control function of the operating system <ul style="list-style-type: none"> <li>■ Auxiliary functions, such as starting and stopping NC software</li> <li>■ Telemaintenance</li> <li>■ Advanced diagnostic functions, such as log data</li> </ul>
HEROS.SWUpdate	Installation of software updates for the control
HEROS.VMSharedFolders	Access to shared folders of a virtual machine Only relevant when running a programming station within a virtual machine
NC.RemoteProgramRun	NC program start from an external application, e.g. via the DNC interface
NC.ConfigUserAdv	Configuration access to the contents that have been enabled through code number <b>123</b>
NC.Data.AccessServiceRead	Read-only access to the PLC partition during servicing

## Enabling Autologin

When the **Autologin** function is enabled, during startup the control automatically activates a user defined by you, without the need to enter a password.

As opposed to the **Legacy-Mode**, this enables you to restrict a user's rights without entering a password.

For further authorizations, the control still requires an authentication to be entered.

In order to enable **Autologin**, the following requirements must be met:

- User administration has been configured
- The user for **Autologin** has been defined

Proceed as follows to enable the **Autologin** function:

- ▶ Call the user administration
- ▶ Select the **Settings** tab
- ▶ Press the **Global settings** soft key
- ▶ Tick the check box for **Enable autologin**
- > The control opens a window for selecting the user.
- ▶ Select the user
- ▶ Enter the user's password
- ▶ Press the **OK** soft key

## User authentication from external applications

### Introduction

If user administration is active, external applications also need to authenticate a user so that the suitable rights can be assigned.

If LSV2 connections are used, the connection is routed via an SSH tunnel. This method assigns the remote user to a user set up on the control, granting the remote user this user's rights.



Besides, the encryption used with the SSH tunnel protects the communication from attackers.



For OPC UA connections, a stored user certificate is used for authentication.

**Further information:** "HEIDENHAIN OPC UA NC Server (options 56 to 61)", Page 453

### Concept of transmission through an SSH tunnel


Prerequisites:

- TCP/IP network
- The remote computer acts as SSH client
- The control acts as SSH server
- Key pair consisting of
  - Private key
  - Public key

An SSH connection is always set up between an SSH client and an SSH server.

A key pair is used to protect the connection. This key pair is generated on the client. The key pair consists of a private key and a public key. The private key remains with the client. During setup, the public key is transferred to the server and assigned to a certain user.

The client tries to connect to the server using the pre-defined user name. The server can use the public key to verify that the requester of the connection holds the associated private key. If yes, the server accepts the SSH connection and assigns it to the user that has been used for the login. Communication can then be "tunneled" through this SSH connection.

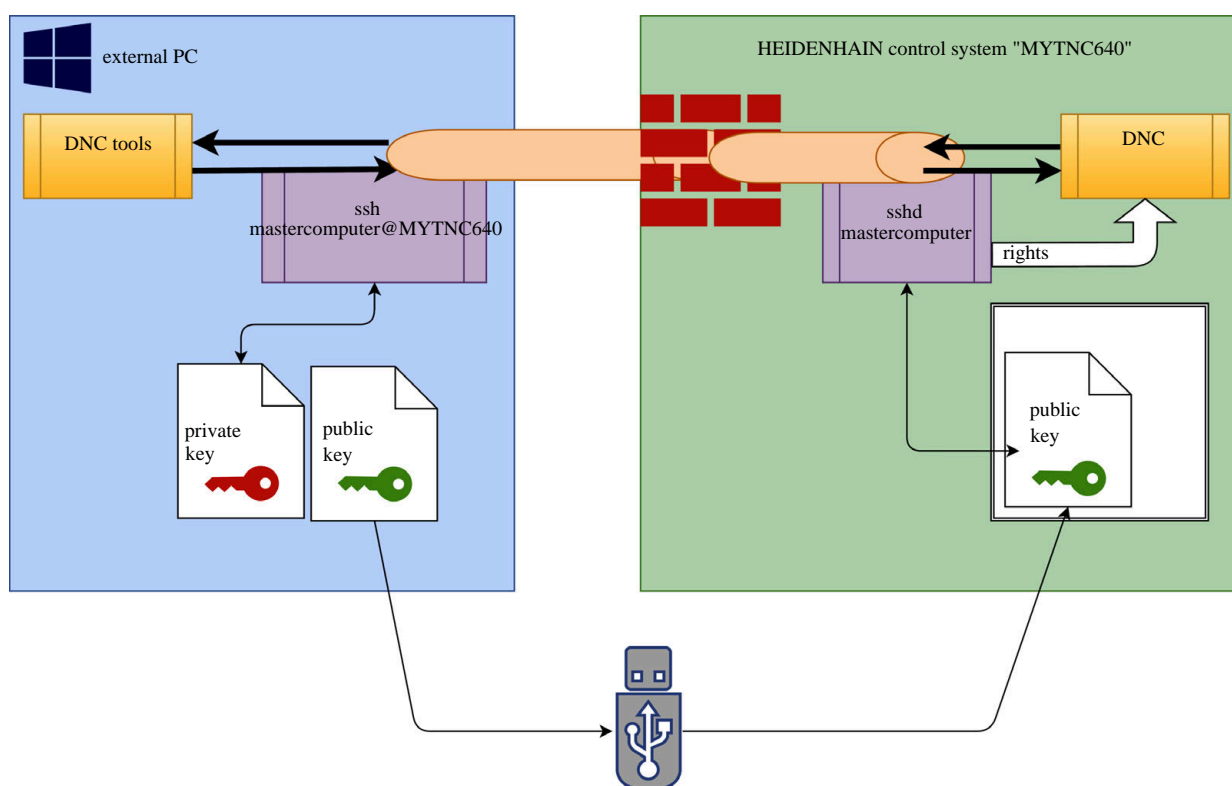

**Use in external applications**

When user administration is active, the control automatically disables the LSV2 connections of the serial interfaces (COM1 and COM2) for security purposes.

**Further information:** "Serial interfaces on the TNC 620", Page 401

The PC tools available from HEIDENHAIN, such as TNCremo with version **v3.3** or higher, provide all functions for setting up, building up, and managing secure connections through an SSH tunnel.

When the connection is set up, the required key pair is generated in TNCremo and the public key is transferred to the control.



Once the connection configurations created in TNCremo have been set up, they can be shared among all PC tools for building up a connection.

This also applies to applications that are using the HEIDENHAIN DNC component from RemoTools SDK for communication. There is no need to adapt existing customer applications.



In order to expand the connection configuration using the associated **CreateConnections** tool, you need to update to **HEIDENHAIN DNC v1.7.1**. A modification of the application source code is not required.

### Setting up and removing a secure connection

Set up a secure connection for the logged-on user as follows:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select the **Settings** menu item
- ▶ Select the **Current User** menu item
- ▶ Press the **Certificate and keys** soft key
- ▶ Select the **Allow password authentication** function
- ▶ Press the **Store and restart server now** soft key
- ▶ Use **TNCremo** to set up the secure connection (TCP secure).



For details, refer to the integrated help system of TNCremo.

- > The public key has been stored on the control by TNCremo.



In order to ensure maximum security, deactivate the **Allow password authentication** function after the public key has been stored.

- ▶ Deselect the **Allow password authentication** function
- ▶ Press the **Store and restart server now** soft key
- > The control has adopted your changes.



In addition to using the PC tools for setup with password authentication, you can also import the public key into the control by using a USB stick or a network drive.

Proceed as follows to delete a key in the control so that a user can no longer use the secure connection:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select the **Settings** menu item
- ▶ Select the **Current User** menu item
- ▶ Press the **Certificate and keys** soft key
- ▶ Select the key to be deleted
- ▶ Press the **Delete SSH key** soft key
- > The control deletes the selected key.

### Disabling insecure connections in the firewall

The DNC protocols LSV2 and RPC should be blocked in the firewall to ensure that the use of secure connections provides a real IT security advantage for the control.

This requires that the following parties change to secure connections:

- Machine tool builders with all external applications (e.g., pick-and-place robots)



If the additional application is connected via **machine network X116**, there is no need to switch to an encrypted connection.

- Users with custom external applications

If you have ensured that the connections of all parties are secure, the LSV2 and RPC DNC protocols can be blocked in the firewall.

To sort the protocols in the firewall, proceed as follows:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select the **Settings** menu item
- ▶ Select the **Firewall** menu item
- ▶ Select the **Prohibit all** method for **DNC** and **LSV2**
- ▶ Select the **Apply** function
- > The control saves your changes.
- ▶ Close the window with **OK**


### Login to user administration

The control displays the Login dialog in the following cases:

- After the **User logout** function has been executed
- After the **Switch user** function has been executed
- After the screen has been locked by the screensaver
- Immediately after control startup if user administration is active and **Autologin** is not enabled

The login dialog provides the following options:

- Users who logged in at least once
- **Other** user

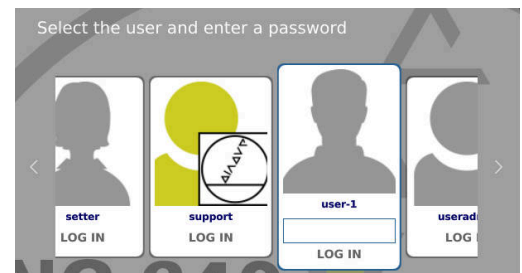

### Logging in a user for the first time

To log in as a user for the first time, you need to use the **Other** input field.

Log on as a user with the **Other** option for the first time as follows:

- ▶ Select **Other** in the login dialog
- > The control enlarges the user icon you selected.
- ▶ Enter the user name
- ▶ Enter the user's password
- > The control opens a window with the **Password expired** message. **Change the password now.**
- ▶ Enter the current password
- ▶ Enter a new password
- ▶ Repeat the new password
- > The control uses the new user to log you in.
- > The user is shown in the login dialog.

### Logging in a known user with password

To log in as a user who is displayed in the login dialog, proceed as follows:

- ▶ Select the respective user in the login dialog
- > The control enlarges the user icon you selected.
- ▶ Enter the user password
- > The control uses the selected user to log you in.



The control shows in the Login dialog whether CAPS LOCK is active.

### Logging in a user with token

To log in as a user with a token, proceed as follows:

- ▶ Hold the token close to the reader
- ▶ Enter PIN, if required
- > The control uses the selected user to log you in.
- ▶ Remove the token from the reader



### Password requirements



For reasons of security, passwords should comply with the following criteria:

- Eight characters minimum
- Letters, numbers, and special characters
- Avoid using whole words or a sequence of characters (e.g., Anna or 123)

Keep in mind that an administrator can define the requirements to be met by a password. The password requirements include:

- Minimum length
- Minimum number of different types of characters
  - Capital letters
  - Small letters
  - Numbers
  - Special characters
- Maximum length of character strings (e.g., 54321 = string of five characters)
- The number of characters must match the dictionary check
- Minimum number of characters changed compared to previous password

If the new password does not meet the requirements, an error message will be issued. This means that you have to enter a different password.



Administrators can specify the expiration of passwords. If you do not change your password within the valid period, you will no longer be able to log on as that user. In this case, an administrator needs to reset the user password before you can log on again.

- ▶ Change your password at regular intervals

**Further information:** "Changing the current user's password", Page 451

- ▶ Take note of the password change warnings

## Switching or logging out users

Use the **Switch-off** HEROS menu item or the icon of the same name at bottom right in the menu bar to open the **Switch off and restart** window.

The control provides the following options:

- **Switch-off:**
  - The control stops and ends all additional programs and functions
  - The system is shut down
  - The control is switched off
- **Restart:**
  - The control stops and ends all additional programs and functions
  - The system is restarted
- **Log out:**
  - The control ends all additional programs
  - The user is logged out
  - The login window appears



To continue, you need to log in a new user and enter his password.


The NC program continues running under the previously logged-on user.

- **Switch user:**
  - The login window appears
  - The user is not logged out



You can close the login window with **Cancel** without entering a password.

All additional programs and the NC programs started by the logged-on user continue running.

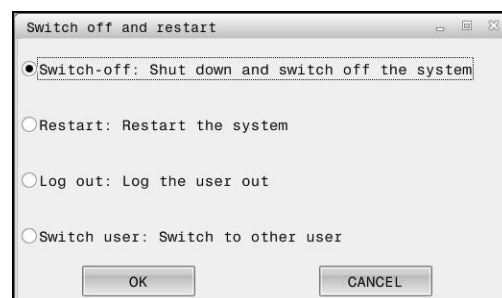


## Screensaver with lockout

You can use the screensaver to lock the control. NC programs that have already been started continue running during this period.



You need to enter a password to unlock the screensaver again.

**Further information:** "Login to user administration", Page 443

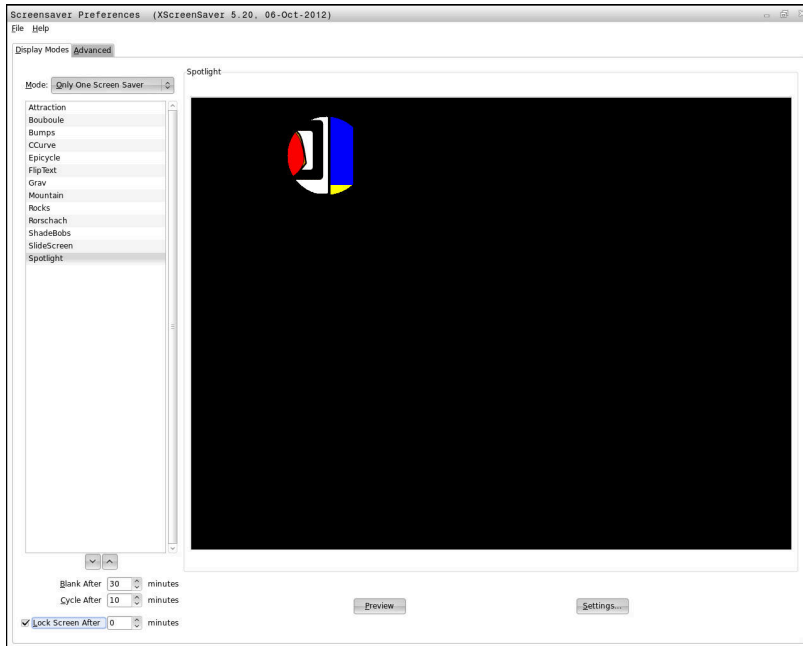


Proceed as follows to access the screensaver settings in the HEROS menu:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select the **Settings** menu item
- ▶ Select the **Screensaver** menu item

The screensaver provides the following options:

- Use the **Blank After** setting to define after how many minutes the screensaver should turn on.
- Use the **Lock Screen After** setting to activate the lock with password protection.
- The time value behind **Lock screen after** defines the delay after which the lock will take effect after the screensaver has been turned on. A value of **0** means that the lock becomes effective immediately after the screensaver has been turned on.

When the lock is active and you use one of the input devices (e.g. the mouse), the screensaver disappears and the lock screen appears.

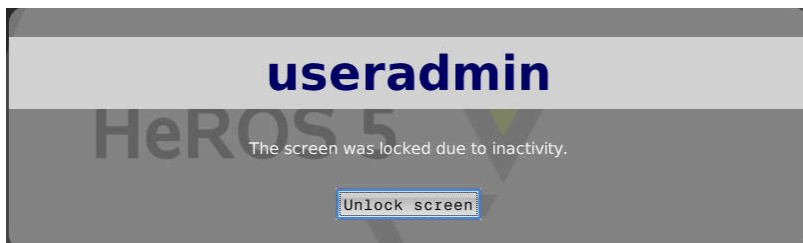


Use **Unlock screen** or **Enter** to open the login window again.

## HOME directory

When user administration is active, a private **HOME:** directory, to which you can save your private programs and files, is available to every user.

The **HOME:** directory can be viewed by any logged-on user.

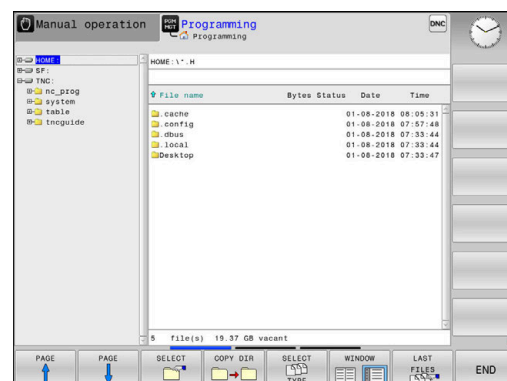


## 'public' directory

### public directory

Upon the first activation of user administration, the **public** directory below the TNC partition will be connected.

The **public** directory can be accessed by any user.

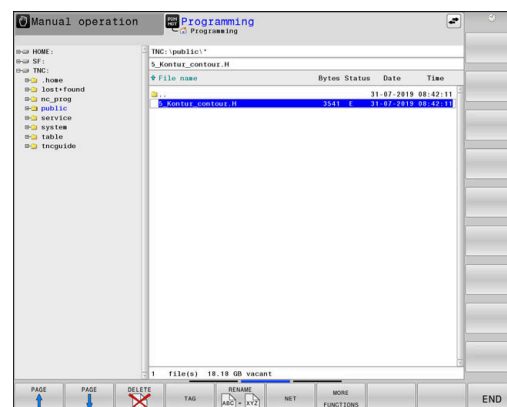


## Setting advanced file access rights

In order to control the use of individual files in the **public** directory, HEIDENHAIN provides the **ADVANCED ACCESS RIGHTS** function that allows you to restrict access on a file level.

To call the **ADVANCED ACCESS RIGHTS** function, proceed as follows:

- ▶ Select the **Programming** operating mode
- ▶ Press the **PGM-MGT** key
- ▶ Switch to horizontal soft-key row 2
- ▶ Press the **MORE FUNCTIONS** soft key
- ▶ Switch to horizontal soft-key row 2
- ▶ Press the **ADVANCED ACCESS RIGHTS** soft key
- ▶ The control opens the **Set advanced access rights** window.

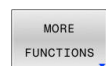

### Setting file access rights

If you transfer files to the **public** directory or create files there, the control considers the logged-in user as the file owner. The owner can control access to his own files.



Access rights can only be defined for files located in the **public** directory.

For all files stored on the TNC partition instead of the **public** directory, the **user** function user will automatically be assigned as the owner.

You can specify the access rights for the following users:

- **Owner:**  
The person who owns the file
- **Group:**  
A selected Linux group or users with a specific HEIDENHAIN access right
- **Other:**  
All users not belonging to the previously selected Linux group or not having the specified HEIDENHAIN access right.

You can set access rights as follows:

- **Read**  
The file can be viewed
- **Write**  
The file can be edited
- **Run**  
The file can be executed

Using the soft keys in the **Set advanced access rights** window, you can select or deselect all access rights for the users:



- ▶ Select or deselect all access rights for **Owner:**



- ▶ Select or deselect all access rights for **Group:**



- ▶ Select or deselect all access rights for **Other:**

Erweiterte Zugriffsrechte einstellen

Name: 5\_Kontur\_contour.H

Besitzer: useradmin  
☒ Lesen ☒ Schreiben ☒ Ausführen

Gruppe: user  
☒ Lesen ☐ Schreiben ☒ Ausführen

Andere:  
☒ Lesen ☐ Schreiben ☒ Ausführen

OK CANCEL

Proceed as follows to select the access rights for a group:

- ▶ Call the **ADVANCED ACCESS RIGHTS** function
- ▶ Select the desired group in the drop-down menu
- ▶ Select or deselect the access rights as required
- > Any changes made are highlighted in red.
- ▶ Select **Ok**
- > The changes made to access rights are applied.

## Current User

With **Current User**, you can view the group rights of the currently logged-on user in the **HEROS** menu.



In legacy mode, the **user** function user is automatically logged on to the system during control startup. When user administration is active, the **user** function user has no effect.

**Further information:** "HEIDENHAIN function users", Page 433

Calling the **Current User**:

- ▶ Press the **DIADUR** key to open the HEROS menu
- ▶ Select the **Settings** menu item
- ▶ Select the **Current User** menu icon

## Temporarily changing the current user's rights

The user administration allows you to temporarily increase the current user's rights by adding the rights of a user you selected.

Proceed as follows to temporarily increase a user's rights:

- ▶ Call **Current User**
- ▶ Press the **Add rights** soft key
- ▶ Select the user
- ▶ Enter the user's user name
- ▶ Enter the selected user's password
- > The control temporarily increases the logged-on user's rights by adding the rights of the user specified in **Add rights**.



You can temporarily enable the rights of **oem** function users. For this purpose, enter the appropriate code number or the password defined by the machine tool builder.

You have the following options to remove the rights that have temporarily been added:

- Enter the code number **0**
- User logout
- Press the **Remove added rights** soft key

Select the **Remove added rights** soft key as follows:

- ▶ Call **Current User**
- ▶ Select the **Added rights** tab
- ▶ Press the **Remove added rights** soft key

### Changing the current user's password

In the **Current User** menu item, you can change the current user's password.

Proceed as follows to change the current user's password:

- ▶ Call **Current User**
- ▶ Select the **Change password** tab
- ▶ Enter the old password
- ▶ Press the **Verify old password** soft key
- > The control checks whether you have correctly entered your old password.
- > If the password is correct, the fields **New password** and **Repeat password** are enabled.
- ▶ Enter the new password
- ▶ Repeat the new password
- ▶ Press the **Set new password** soft key
- > The control compares the requirements defined for passwords by the administrator to the password you entered.

**Further information:** "Login to user administration", Page 443

- > The message **Password was changed successfully** appears.

### Defining login with token

The control also permits login with a token. This ensures secure login without the user having to enter a password.



Refer to your machine manual!

The machine manufacturer must prepare the machine for use with a token. For example, an appropriate reader must be mounted on the machine.

In the **Current User** menu item, you can define login with a token for the current user.

Create a token as follows:

- ▶ Call **Current User**
- ▶ Select **Create token**
- ▶ Select the type of token with **Switch type**, if required
- ▶ Enter the user's password
- ▶ Enter PIN, if required
- ▶ Hold the token close to the reader
- ▶ Select **Reload list**
- ▶ Choose a token from the list

- ▶ Select **Start writing**
- ▶ Enter PIN, if defined
- > The control starts the write process.
- ▶ Hold the token close to the reader until the end of the write process.
- > When writing is complete, the control shows a message.

With **Delete token** you can delete the created token and use password entry again.

## Dialog for requesting additional rights

If you do not have the rights required for a specific HEROS menu item, the control opens the window for requesting additional rights:


In this window, you can temporarily obtain more rights by adding another user's rights.

In the **Users that have this right:** field, the control lists all existing users that have the right to use this function.



If **Connection to Windows domain** is used, only users that were recently logged on are shown in the selection menu.

To attain the rights of users that are not shown, enter their user data. The control will then recognize those users that are contained in the user database.

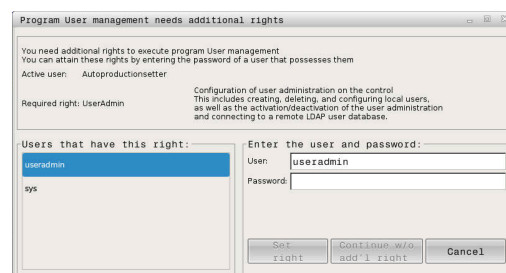

## Obtaining more rights

Temporarily add another user's rights to your rights as follows:

- ▶ Select the user whose rights you need
- ▶ Enter the user's name
- ▶ Enter the user's password
- ▶ Press the **Set right** soft key
- > The control adds the entered user's rights to your rights.

**Further information:** "Current User", Page 450



## 10.9 HEIDENHAIN OPC UA NC Server (options 56 to 61)

### Introduction

**Open Platform Communications Unified Architecture** (OPC UA) refers to a collection of specifications. These specifications are used to standardize machine-to-machine communication (M2M) in the field of industrial automation. OPC UA enables the data exchange—across operating systems—between products from different manufacturers, e.g. between a HEIDENHAIN control system and third-party software. Thus, OPC UA has become the data exchange standard for a secure, reliable, manufacturer/platform-independent industrial communication over the last years.

For OPC UA-based communication, the HEIDENHAIN control features the **HEIDENHAIN OPC UA NC Server**. For each OPC UA client to be connected, you need one of the six available software options (56 - 61).

Both standard and custom software can be used with the **HEIDENHAIN OPC UA NC Server**. Compared to other established interfaces, significantly less development effort is required for OPC UA connection, thanks to the uniform communication technology.

The **HEIDENHAIN OPC UA NC Server** allows you to access the data and functions of the HEIDENHAIN NC information model exposed in the server address space. The following OPC UA functions are supported:

- Reading and writing variables
- Subscribing to value changes
- Executing methods
- Subscribing to events
- File system access to the **TNC**: directory
- File system access to the **PLC**: directory (a corresponding permission is required)

**Further information:** "Application development", Page 456

### IT Security

In 2016, the German Federal Office for Information Security (BSI) published a security analysis related to OPC UA. The specification analysis performed by the BSI revealed that OPC UA provides a high level of security, when compared to most other industrial protocols.

HEIDENHAIN follows the BSI recommendations and provides SignAndEncrypt, which exclusively features up-to-date IT security profiles. For this purpose, OPC UA-based industrial applications and the **HEIDENHAIN OPC UA NC Server** exchange certificates for authentication. In addition, any transferred data is encrypted. This effectively prevents messages between the communication partners from being intercepted or altered.

Among others, the HEROS **Connection Assistant** function supports you when setting up the certificates.

**Further information:** "Setting up the connection", Page 454

## Machine configuration

Using the **HEIDENHAIN OPC UA NC Server**, OPC UA client applications can query general machine information, such as the year of construction of the machine or its location.

The following machine parameters are available for the digital identification of your machine:

- For users: **CfgMachineInfo** (no. 131700)
- For the machine tool builder: **CfgOemInfo** (no. 131600)



If the machine parameters contain entries, the **Info about machine manufacturer** and **Machine information** are available in the **MOD** dialog of the **General information** group.

## Setting up the connection

### Easy configuration with the Connection Assistant

For quick and easy setup of an OPC UA client application, you can use the HEROS **Connection Assistant** function. This assistant guides through the steps that are required to connect an OPC UA client application to the control.

The assistant features the following steps:

- Export **OPC UA NC Server** certificates
- Import the certificates of the OPC UA client application
- Assign each of the available **OPC UA NC Server** software options to an OPC UA client application
- Import user certificates
- Assign user certificates to users
- Configure the firewall



The **Connection Assistant** also helps you create test or sample certificates for users and the OPC UA client application. Do not use the user and client application certificates created at the control for other purposes than development at the programming station.



If at least one of the options 56 to 61 is active, then, when booting for the first time, the control creates the server certificate as part of a self-generated certificate chain.

The client application or the manufacturer of the application creates the client certificate.

The user certificate is linked to the user account. Please contact your IT department.

### Complex configuration with separate HEROS functions

Besides the simple setup with the **Connection Assistant**, the control provides separate HEROS functions for complex configurations:

- **PKI Admin**

The **HEIDENHAIN OPC UA NC Server** is one of the applications whose **Public Key Infrastructure (PKI)** can be configured with the HEROS **PKI Admin** function. After launching the HEROS **PKI Admin** function and selecting the **OPC UA NC Server** application, you can use the extended functionality.

**Further information:** "PKI Admin", Page 458

- **Current User and UserAdmin**

Each user of an OPC UA client application uses a certificate for authentication. For linking the certificates with users, the HEROS **Current User** or **UserAdmin** functions are available.

**Further information:** "User administration", Page 418

- **OPC UA NC Server**

The HEROS **OPC UA NC Server** function includes a dialog named **License Settings** for managing the assignment of the active software options 56 to 61.



Before a certificate will be available for activation in the selection area of the **License Settings** dialog, you must import the corresponding certificate of a OPC UA client application with the HEROS **PKI Admin** function or the **Connection Assistant**.

- **Firewall**

Make sure to configure your firewall accordingly so that the connection of OPC UA applications to the **OPC UA NC Server** will not be blocked.

**Further information:** "Firewall", Page 398

## Application development

OPC UA is a manufacturer/platform-independent, open communication standard. For this reason, an OPC UA client SDK is not included in the **HEIDENHAIN OPC UA NC Server**.

### HEIDENHAIN information model

A separate **Companion Specification** document is available that describes the information model supported by the **HEIDENHAIN OPC UA NC Server**.



#### OPC UA NC Server information model

The specification for the **HEIDENHAIN OPC UA NC Server** is described in the interface documentation titled **Information Model**. This document is available only in English.

ID: 1309365-xx



The **OPC UA NC Server Information Model** interface documentation is provided at:

- **HEIDENHAIN homepage**

### Technical notes

In order to establish a connection, the OPC UA client must support the **security policy** and authentication method used by the **HEIDENHAIN OPC UA NC Server**.

The **HEIDENHAIN OPC UA NC Server** has the following end point configuration:

- **Security Mode: SignAndEncrypt**
- **Algorithm: Basic256Sha256**
- **User Authentication: X509 certificates**



The end point configuration including the URL, which depends on the server host name, is displayed on the last page of the **Connection Assistant**.

The so-called user certificate can be assigned to a user in user administration.

## Access to directories

The **HEIDENHAIN OPC UA NC Server** enables read and write access to the **TNC:** and **PLC:** directories.



During access, the permissions of the user to which the certificate used is linked are active. The directories and files displayed, as well as the access options, vary depending on the permissions.

If user administration is active, the private data of others users cannot be accessed.

**Further information:** "User administration", Page 418

The following actions are permitted:

- Creation and deletion of folders
- Reading, editing, copying, moving, creating, and deletion of files.

While the NC software is running, the files referenced in the following machine parameters are locked for write access:

- Tables referenced by the machine tool builder in the machine parameter **CfgTablePath** (no. 102500)
- Files referenced by the machine tool builder in the machine parameter **dataFiles** (no. 106303, branch **CfgConfigData** no. 106300)

The **HEIDENHAIN OPC UA NC Server** enables access to the control even if the NC software is switched off. You can, for example, transfer automatically created service files at any time as long as the operating system is active.

### NOTICE

#### Caution: potential damage to property!

The control does not automatically back up the files before editing or deletion. Files that are missing cannot be restored. The removal or editing of system-relevant files, such as the tool table, can negatively affect the control functions.

- System-relevant files must be edited only by authorized specialists

## PKI Admin

The **HEIDENHAIN OPC UA NC Server** requires three different types of certificates. The server and the client need two of them, the so-called application instance certificates, in order to establish a secure connection. The third certificate (user certificate) is required for authorization and for starting a session with specific user permissions.



If at least one of the options 56 to 61 is active, then, when booting for the first time, the control creates the server certificate as part of a self-generated certificate chain.

The client application or the manufacturer of the application creates the client certificate.

The user certificate is linked to the user account. Please contact your IT department.

The control automatically generates a two-level certificate chain (**Chain of Trust**) for the server. This certificate chain consists of a self-signed root certificate (including a **revocation list**) and a certificate for the server that is created on the basis of the root certificate.

The client certificate must be added on the **Trusted** tab.

All other certificates should be added on the **Issuers** tab for verification of the entire certificate chain.

### User certificate

The control uses the HEROS functions **Current User** or **UserAdmin** for administration of the user certificate. When you initiate a session, the rights of the associated internal user are active.

To assign a user certificate to a user, proceed as follows:

- ▶ Open the **Current User** HEROS function
- ▶ Select **SSH keys and certificates**
- ▶ Press the **Import certificate** soft key
- > The control opens a pop-up window.
- ▶ Select the certificate
- ▶ Select **Open**
- > The control imports the certificate.
- ▶ Press the **Use for OPC-UA** soft key

**Self-generated certificates**

You can also create and import all of the required certificates yourself.

Self-generated certificates must fulfill the following requirements:

- General requirements
  - File format: \*.der
  - Signature with hash SHA256
  - Valid run time
- Client certificates
  - Host name of the client
  - Application URI of the client
- Server certificates
  - Host name of the control
  - Application URI of the server according to the following structure:  
urn:<hostname>/HEIDENHAIN/OpcUa/NC/Server

## 10.10 Changing the HEROS conversational language

The HEROS conversational language is internally based on the NC conversational language. Therefore the HEROS menu and the control cannot permanently be set to two different conversational languages.

When you change the NC conversational language, the HEROS conversational language will only reflect this change after a restart of the control.



With the optional machine parameter **applyCfgLanguage** (no. 101305), you define the behavior of the control if the NC conversational language and in the HEROS conversational language do not match.

The following link provides information on how to change the NC conversational language:

**Further information:** "List of user parameter", Page 480

### Changing the language layout of the keyboard

You can change the language layout of the keyboard for HEROS applications.

Proceed as follows to change the language layout of the keyboard for HEROS applications:

- ▶ Select the HEROS menu icon
- ▶ Select **Settings**
- ▶ Select **Language/Keyboards**
- > The control opens the **helocale** window.
- ▶ Select the **Keyboards** tab
- ▶ Select the desired keyboard layout
- ▶ Press **Apply**
- ▶ Press **OK**
- ▶ Press **Apply**
- > The changes are applied.



# 11

**Operating the  
touchscreen**

## 11.1 Display unit and operation

### Touchscreen



Refer to your machine manual!

This function must be enabled and adapted by the machine tool builder.

The touchscreen is distinguished by a black frame and the lack of soft-key selection keys.

The TNC 620 has its operating panel integrated in the 19" screen.

#### 1 Header

When the control is on, the screen displays the selected operating modes in the header.

#### 2 Soft-key row for the machine tool builder

#### 3 Soft-key row

The control shows further functions in a soft-key row. The active soft-key row is shown as a blue bar.

#### 4 Integrated operating panel

#### 5 Setting the screen layout

#### 6 Switchover between machine operating modes, programming modes, and a third desktop



### Operability of touchscreens regarding electrostatic discharge

Touchscreens from HEIDENHAIN work based on a capacitive method of touch detection. This makes them sensitive to the user's electrostatic discharge.

Users can discharge static electricity from their body by touching grounded metal objects. If problems with electrostatic discharge continue to occur, we recommend that users wear ESD shoes and ESD clothing.

Please also refer to the information provided by your machine tool builder.

## Operating panel

### Integrated operating panel

The operating panel is integrated in the screen. The content of the operating panel changes depending on the current operating mode.

- 1 Area for showing the following:
  - Alphabetic keyboard
  - HEROS menu
  - Potentiometer for the speed of simulation (only in the **Test Run** operating mode)
- 2 Machine operating modes
- 3 Programming modes
 

The control shows the active operating mode, to which the screen is switched, with a green background.

The control shows the operating mode in the background through a small white triangle.
- 4
  - File management
  - Calculator
  - MOD function
  - HELP function
  - Show error messages
- 5 Rapid access menu
 

Depending on the operating mode, you'll find the most important functions here at a glance.
- 6 Initiating the programming dialogs (only in the **Programming** and **Positioning w/ Manual Data Input** operating modes)
- 7 Numerical input and axis selection
- 8 Navigation
- 9 Arrows and the jump statement **GOTO**
- 10 Task bar


**Further information:** "Icons of the taskbar", Page 475

In addition, the machine tool builder supplies a machine operating panel.




Refer to your machine manual!

External keys, e.g. **NC START** or **NC STOP**, are described in your machine manual.

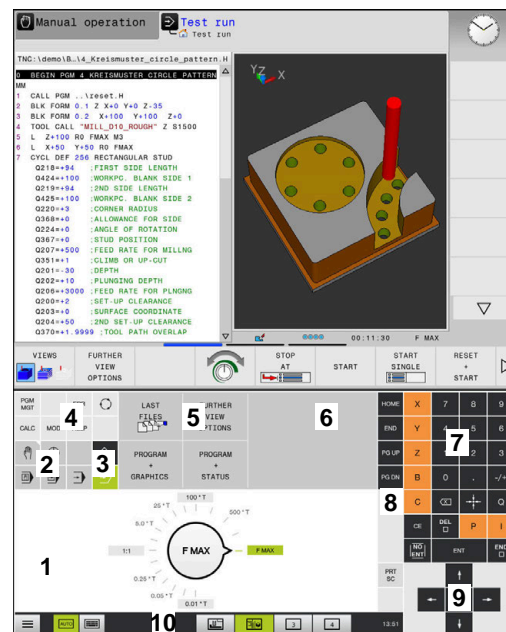

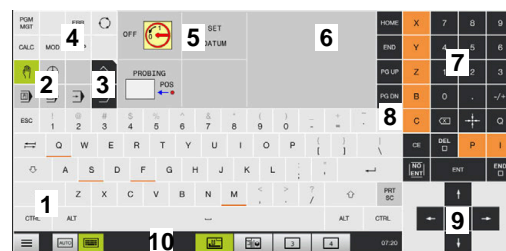


Operating panel of the Test Run mode



Operating panel in the Manual Operation mode

**Basic operation**







The following keys, for example, can easily be replaced by hand gestures:




Key	Function	Gesture
	Switch between operating modes	Tap on the operating mode in the header
	Shift the soft-key row	Swipe horizontally over the soft-key row
	Soft-key selection keys	Tap on the function in the touchscreen

## 11.2 Gestures

### Overview of possible gestures




The screen of the control is multi-touch capable. That means that it can distinguish various gestures, including with two or more fingers at once.

Symbol	Gesture	Meaning
	Tap	A brief touch by a finger on the screen
	Double tap	Two brief touches on the screen
	Long press	Continuous contact of fingertip on the screen <div><div></div><div>If you do not stop holding, the control will automatically cancel the holding gesture after approximately ten seconds. Permanent actuation is thus not possible.</div></div>
	Swipe	Flowing motion over the screen
	Drag	A combination of long-press and then swipe, moving a finger over the screen when the starting point is clearly defined

Symbol	Gesture	Meaning
	Two-finger drag	A combination of long-press and then swipe, moving two fingers in parallel over the screen when the starting point is clearly defined
	Spread	Two fingers long-press and move away from each other
	Pinch	Two fingers move toward each other

### Navigating in the table and NC programs

You can navigate in an NC program or a table as follows:

Symbol	Gesture	Function
	Tap	Mark the NC block or table line Stop scrolling
	Double tap	Activate the table line
	Swipe	Scroll through the NC program or table






## Operating the simulation

The control offers touch operation with the following graphics:

- Programming graphics in the **Programming** operating mode.
- 3-D view in the **Test Run** operating mode.
- 3-D view in the **Program Run Single Block** operating mode.
- 3-D view in the **Program Run Full Sequence** operating mode.
- Kinematics view


### Rotating, zooming, or moving a graphic

The control supports the following gestures:

Symbol	Gesture	Function
	Double tap	Set the graphic to its original size
	Drag	Rotate the graphic (only 3-D graphics)
	Two-finger drag	Move graphics
	Spread	Magnify the graphic
	Pinch	Reduce the graphic



### Measuring a graphic

If you have activated measurement in the **Test Run** operating mode, the following additional function is available:

Symbol	Gesture	Function
	Tap	Select the measuring point

### Using the HEROS menu

You can use the **HEROS menu** menu as follows:




Symbol	Gesture	Function
	Tap	Select the application
	Long press	Open the application



Operating the CAD viewer




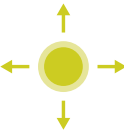
The control also supports touch operation for working with the **CAD-Viewer**. You have various gestures available depending on the operating mode.




To be able to use all applications, first use the icon to select the desired function:

Icon	Function
	Default setting
	<b>Add</b> Works in the selection mode like a pressed <b>Shift</b> key
	<b>Remove</b> Works in the selection mode like a pressed <b>CTRL</b> key

Layer setting mode and specifying the workpiece preset



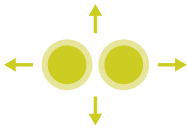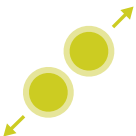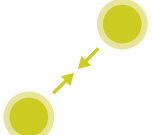


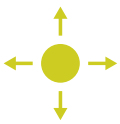
The control supports the following gestures:




Symbol	Gesture	Function
	Tap on an element	Show element information Specify the workpiece preset
	Double-tap on the background	Set the graphic or 3-D model to its original size
	Activate <b>Add</b> and double-tap on the background	Reset the graphic or 3-D model to its original size and angle
	Drag	Rotate the graphic or 3-D model (only in the Layer Setting mode)

Symbol	Gesture	Function
	Two-finger drag	Move a graphic or 3-D model
	Spread	Enlarge a graphic or 3-D model
	Pinch	Reduce a graphic or 3-D model

Selecting a contour


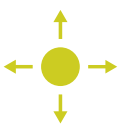



The control supports the following gestures:

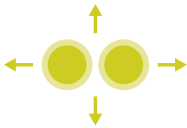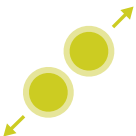
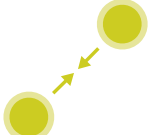
Symbol	Gesture	Function
	Tap on an element	Select element
	Tap on an element in the list-view window	Select or deselect an element
	Activate <b>Add</b> and tap on an element	Part, shorten, or lengthen an element
	Activate <b>Remove</b> and tap on an element	Deselect an element
	Double-tap on the background	Reset the graphic to its original size
	Swipe over an element	Show a preview of selected elements Show element information

Symbol	Gesture	Function
	Two-finger drag	Move graphics
	Spread	Magnify the graphic
	Pinch	Reduce the graphic

Selecting machining positions

The control supports the following gestures:

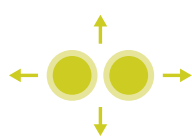Symbol	Gesture	Function
	Tap on an element	Select element Select an intersection
	Double-tap on the background	Reset the graphic to its original size
	Swipe over an element	Show a preview of selected elements Show element information
	Activate <b>Add</b> and drag	Spread a fast selection area
	Activate <b>Remove</b> and drag	Spread an area for deselection of elements
	Two-finger drag	Move graphics

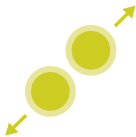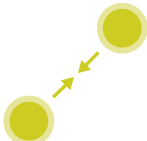Symbol	Gesture	Function
	Spread	Magnify the graphic
	Pinch	Reduce the graphic

### Saving elements and switching to the NC program

When you tap on the appropriate icons, the controls saves the selected elements.








You can switch back to the **Programming** operating mode in the following ways:

- Press the **Programming** key  
The control switches to the **Programming** mode of operation.
- Close the **CAD-Viewer**  
The control automatically switches to the **Programming** operating mode.
- Use the task bar to leave the **CAD-Viewer** open on the third desktop  
The third desktop stays active in the background

11.3 Functions in the taskbar

Icons of the taskbar

The taskbar provides you with the following icons:

 


Icon	Function
	Open the HEROS menu
	Automatically show and hide the alphabetic keyboard
	Always show the alphabetic keyboard
	Workspace 1: Select the active machine mode
	Workspace 2: Select the active programming mode
	Workspace 3: Select the CAD viewer, DXF converter or applications of the machine tool builder (optionally available)
	Workspace 4: Select the display and remote control of external computer units (option 133) or applications of the machine tool builder (optionally available)


Functions in the HEROS menu

Using the **Menu** icon on the taskbar, you can open the HEROS menu through which you can find information, make settings, or start applications.

**Further information:** "Overview of taskbar", Page 380

When the HEROS menu is open, the following icons are available:

Icon	Function
	Return to main menu
	Show active applications
	Show all applications



If you have set the view to active applications, you can close specific applications as in a task manager.



## Touchscreen configuration

With the **Touchscreen Configuration** function you can define the properties of the screen.

### Adjusting sensitivity

Proceed as follows to adjust the sensitivity:

- ▶ Open the HEROS menu by selecting the **menu** icon
- ▶ Select the **Touchscreen Configuration** menu item
- > The control opens a pop-up window.
- ▶ Select the sensitivity
- ▶ Confirm with **OK**

### Display of the touch points

Proceed as follows to show or hide the touch points:

- ▶ Press the **DIADUR** key to open the JH menu
- ▶ Select the **Touchscreen Configuration** menu item
- > The control opens a pop-up window.
- ▶ Select the **Show Touch Points** display
  - **Disable Touchfingers** to hide the touch points
  - **Enable Single Touchfinger** to show the touch point
  - **Enable Full Touchfingers** to show the touch points of all fingers involved
- ▶ Confirm with **OK**

## Touchscreen cleaning

With the **Touchscreen Cleaning** function you can lock the screen in order to clean it.

### Activating the cleaning mode

Proceed as follows to activate the cleaning mode:

- ▶ Open the HEROS menu by selecting the **menu** icon
- ▶ Select the **Touchscreen Cleaning** menu item
- > The control locks the screen for 90 seconds.
- ▶ Clean the screen

If you would like to stop the cleaning mode:

- ▶ Pull the displayed sliders apart at the same time



# 12

**Tables and  
overviews**

## 12.1 Machine-specific user parameters

### Application

The parameter values are entered in the **configuration editor**.



Refer to your machine manual!

- The machine tool builder can make additional machine-specific parameters available as user parameters, so that you can configure the functions that are available.
- The machine tool builder can adapt the structure and contents of the user parameters. The display on your machine may be different.

The machine parameters are grouped as parameter objects in a tree structure in the configuration editor. Each parameter object has a name (e.g. **Settings for screen displays**) that gives information about the parameters it contains.

### Calling the configuration editor

Proceed as follows:



- ▶ Press the **MOD** key






 
 


- ▶ Select the **Code-number entry** function, if necessary
- ▶ Enter the code number **123**






- ▶ Confirm with the **ENT** key
- > The control displays the list of available parameters in the tree view.

### Depiction of the parameters

The icon at the beginning of each line in the parameter tree shows additional information about this line. The icons have the following meanings:

-  Branch exists but is closed
-  Branch is open
-  Empty object, cannot be opened
-  Initialized machine parameter
-  Uninitialized (optional) machine parameter
-  Can be read but not edited
-  Can neither be read nor edited

The folder icon indicates the object type:

-  Key (group name)
-  List
-  Entity (parameter object)



The icons of parameters and objects that are not yet active appear dimmed. These can be activated with the **MORE FUNCTIONS** and **INSERT** soft keys.

### Changing the parameters

Proceed as follows:

- ▶ Find the desired parameter
- ▶ Edit the value

END

- ▶ Press the **END** soft key to close the configuration editor

STORE

- ▶ Press the **SAVE** soft key to save the changes



The control saves a change list of the last 20 changes to the configuration data. To undo changes, select the corresponding line and press the **MORE FUNCTIONS** and **CANCEL CHANGE** soft keys.

### Changing the display of the parameters

If you are in the configuration editor for the user parameters, you can change the display of the existing parameters. In the default setting, the parameters are displayed with short, explanatory texts.

Proceed as follows in order to have the actual system names of the parameters be shown:



► Press the **Screen layout** key



► Press the **SHOW SYSTEM NAME** soft key

Follow the same procedure to return to the standard display.

### Displaying help texts

The **HELP** key enables you to call a help text for each parameter object or attribute.

If the help text does not fit on one page (1/2 is then displayed at the upper right, for example), press the **HELP PAGE** soft key to scroll to the second page.

The control displays other information (e.g. unit of measurement, initial value, selection list) in addition to the help text. If the selected machine parameter matches a parameter in the previous control model, the corresponding MP number is displayed.

### List of user parameter



Refer to your machine manual!

- The machine tool builder can make additional machine-specific parameters available as user parameters, so that you can configure the functions that are available.
- The machine tool builder can adapt the structure and contents of the user parameters. The display on your machine may be different.

---

## Parameter settings

---

### DisplaySettings

Settings for screen display

Display sequence and rules for axes

[0] to [7]: depends on the available axes

Key name of an object in CfgAxis

**Key name of the axis to be displayed**

Axis designation

**Axis designation to be used in place of the key name**

Display rule for the axis

**ShowAlways**

**IfKinem**

**IfKinemAxis**

**IfNotKinemAxis**

**Never**

Display sequence and rules for axes in the REF display

[0] to [7]: depends on the available axes

**See display sequence and rules for axes**

Type of position display in the position window

**NOML**

**ACTL**

**REF ACTL**

**REF NOML**

**LAG**

**ACTDST**

**REFDST**

**M118**

Type of position display in the status display

**NOML**

**ACTL**

**REF ACTL**

**REF NOML**

**LAG**

**ACTDST**

**REFDST**

**M118**

Definition of decimal separator for position display

**. point**

**, comma**

Display of the feed rate in the Manual Operation and El. Handwheel modes of operation

**at axis key: Display the feed rate only if axis-direction key is pressed**

---

**Parameter settings**


---

**always minimum: Always display the feed rate**

Display of spindle position in the position display

**during closed loop: Display spindle position only if spindle is in position feedback control**

**during closed loop and M5: Display spindle position if spindle is in position feedback control and with M5**

**during closed loop or M5 or tapping: Display spindle position if spindle is in position feedback control, with M5 and in spindle jog operation**

Lock the PRESET MANAGEMENT soft key

**TRUE: Access to the preset table is locked**

**FALSE: The preset table can be accessed by soft key**

Font size for program display

**FONT\_APPLICATION\_SMALL**

**FONT\_APPLICATION\_MEDIUM**

Sequence of icons in the display

[0] to [19]: depends on the activated options

**e.g., S\_PULSE**

Settings for display behavior: depends on the machine tool builder

**Entered by the machine tool builder**

Display setting for unchecked axes

**ValuesRedColor: Red coloring of unchecked axes**

**SymbolNearAxisName: Caution symbol next to the axis letter**

---

Parameter settings

DisplaySettings

Display step for the individual axes

List of all available axes

Display step for position display in mm or degrees

- 0.1
- 0.05
- 0.01
- 0.005
- 0.001
- 0.0005
- 0.0001
- 0.00005
- 0.00001

Display step for position display in inches

- 0.005
- 0.001
- 0.0005
- 0.0001
- 0.00005
- 0.00001

DisplaySettings

Definition of the unit of measure valid for the display

Unit of measure for display in the user interface

- metric: Use the metric system**
- inch: Use the inch system**

DisplaySettings

Format of the NC programs and cycle display

Program entry in HEIDENHAIN Klartext conversational programming language or in DIN/ISO

- HEIDENHAIN: Klartext conversational programming language for entering the program in Positioning with Manual Data Input operating mode**
- ISO: DIN/ISO for entering the program in Positioning with Manual Data Input operating mode**

---

## Parameter settings

---

### DisplaySettings

Definition of the NC and PLC conversational languages

NC conversational language

**ENGLISH**

**GERMAN**

**CZECH**

**FRENCH**

**ITALIAN**

**SPANISH**

**PORTUGUESE**

**SWEDISH**

**DANISH**

**FINNISH**

**DUTCH**

**POLISH**

**HUNGARIAN**

**RUSSIAN**

**CHINESE**

**CHINESE\_TRAD**

**SLOVENIAN**

**KOREAN**

**NORWEGIAN**

**ROMANIAN**

**SLOVAK**

**TURKISH**

Load the language of the NC control

**FALSE: Upon startup of the control, the language of the HEROS operating system is used**

**TRUE: Upon startup of the control, the language from the machine parameters is used**

PLC conversational language

**See NC conversational language**

PLC error message language

**See NC conversational language**

Language for online help

**See NC conversational language**

---



---

## Parameter settings

---

### DisplaySettings

Behavior during control start-up

Acknowledge the "Power interrupted" message

**TRUE: Start-up of the control is not continued until the message has been acknowledged**

**FALSE: The Power interrupted message does not appear**

---

### DisplaySettings

Display mode for time of day

Selection of display mode

**Analog**

**Digital**

**Logo**

**Analog and logo**

**Digital and logo**

**Analog on logo**

**Digital on logo**

---

### DisplaySettings

Link row on/off

Display settings for link row

**OFF: Switch off the information line in the operating-mode line**

**ON: Switch on the information line in the operating-mode line**

---

### DisplaySettings

Settings for 3-D simulation graphics

Model type of the 3-D simulation graphics

**3-D: Model depiction for complex machining operations with undercuts (compute-intensive)**

**2.5-D: Model depiction for 3-axis operations**

**No Model: Model depiction is deactivated**

Model quality of the 3-D simulation graphics

**very high: High resolution; the block end points can be depicted**

**high: High resolution**

**medium: Medium resolution**

**low: Low resolution**

Reset tool paths in new BLK form

**ON: With new BLK form in Test Run, the tool paths are reset**

**OFF: With new BLK form in Test Run, the tool paths are not reset**

Write graphics journal files after restart

**OFF: Do not generate journal data**

**ON: Generate journal data after a restart for diagnostic purposes**

---

---

## Parameter settings

---

### DisplaySettings

#### Position display settings

##### Position display with TOOL CALL DL

**As Tool Length: The programmed oversize DL is considered to be the change in tool length for display of the workpiece-based position**

**As Workpiece Oversize: The programmed oversize DL is considered to be the workpiece oversize for display of the workpiece-based position**

---

### DisplaySettings

#### Table editor setting

##### Behavior when deleting tools from the pocket table

**DISABLED: Deletion of tool is not possible**

**WITH\_WARNING: Tool deletion is possible, but must be confirmed**

**WITHOUT\_WARNING: Tool deletion is possible without warning**

##### Behavior when deleting a tool's index entries

**ALWAYS\_ALLOWED: Deletion of index entries is always possible**

**TOOL\_RULES: The behavior depends on the setting of the parameter "Behavior when deleting tools from the pocket table"**

##### Show the RESET COLUMN T soft key

**TRUE: The soft key is displayed. All tools can be deleted from the tool memory by the user**

**FALSE: The soft key is not displayed**

---

### DisplaySettings

#### Setting the coordinate systems for the display

##### Coordinate system for the datum shift

**WorkplaneSystem: Datum is displayed in the system of the tilted plane, WPL-CS**

**WorkpieceSystem: Datum is displayed in the workpiece coordinate system, W-CS**

---

---

**Parameter settings**


---

## ProbeSettings

Configuration of the tool calibration

TT140\_1

M function for spindle orientation

**–1: Spindle orientation directly by NC****0: Function inactive****1 to 999: Number of the M function for spindle orientation**

Probing routine

**MultiDirections: Probing from multiple directions****SingleDirection: Probing from one direction**

Probing direction for tool radius measurement: Depends on the tool axis

**X\_Positive, Y\_Positive, X\_Negative, Y\_Negative, Z\_Positive, Z\_Negative**

Distance from lower edge of tool to upper edge of stylus

**0.001 to 99.9999 [mm]**

Rapid traverse in probing cycle

**10 to 300 000 [mm/min]**

Probing feed rate during tool measurement

**1 to 30 000 [mm/min]**

Calculation of the probing feed rate

**ConstantTolerance: Calculation of the probing feed rate with constant tolerance****VariableTolerance: Calculation of the probing feed rate with variable tolerance****ConstantFeed: Constant probing feed rate**

Speed determination method

**Automatic: Automatically determine the speed****MinSpindleSpeed: Use the minimum spindle speed**

Max. permissible surface cutting speed at the tooth edge (circumference of the milling cutter)

**1 to 129 [m/min]**

Maximum permissible speed for tool measurement

**0 to 1000 [rpm]:**

First maximum permissible measurement error during tool measurement

**0.001 to 0.999 [mm]**

Second maximum permissible measurement error during tool measurement

**0.001 to 0.999 [mm]**

NC stop during tool check

**True: When the breakage tolerance is exceeded, the NC program is stopped**

---

**Parameter settings**


---

**False: The NC program is not stopped**

NC stop during tool measurement

**True: When the breakage tolerance is exceeded, the NC program is stopped**

**False: The NC program is not stopped**

Change the tool table during tool check and tool measurement

**AdaptOnMeasure: The table is changed after tool measurement**

**AdaptOnBoth: The table is changed after tool check and tool measurement**

**AdaptNever: The table is not changed after tool check and tool measurement**

---

**ProbeSettings**

Configuration of a round stylus

TT140\_1

Coordinates of the stylus center

**[0]: X coordinate of the stylus center with respect to the machine datum [mm]**

**[1]: Y coordinate of the stylus center with respect to the machine datum [mm]**

**[2]: Z coordinate of the stylus center with respect to the machine datum [mm]**

Set-up clearance above the stylus for pre-positioning

**0.001 to 99 999.9999 [mm]**

Safety zone around the stylus for pre-positioning: Set-up clearance in the plane perpendicular to the tool axis

**0.001 to 99 999.9999 [mm]**

---

**ProbeSettings**

Configuration of a rectangular stylus

TT140\_1

Coordinates of the stylus center

**[0]: X coordinate of the stylus center with respect to the machine datum [mm]**

**[1]: Y coordinate of the stylus center with respect to the machine datum [mm]**

**[2]: Z coordinate of the stylus center with respect to the machine datum [mm]**

Set-up clearance above the stylus for pre-positioning

**0.001 to 99 999.9999 [mm]**

Safety zone around the stylus for pre-positioning: Set-up clearance in the plane perpendicular to the tool axis

**0.001 to 99 999.9999 [mm]**

---

---

**Parameter settings**


---

## ChannelSettings

## CH\_NC

## Active kinematics

Kinematics to be activated

**List of machine kinematics**

The kinematics to be activated during control start-up

**List of machine kinematics**

Specify the behavior of the NC program

Reset the machining time when program starts

**True: Machining time is reset****False: Machining time is not reset**

PLC signal for the number of the pending fixed cycle

**Depends on the machine tool builder**

## Geometrical tolerances

Permissible deviation of circle radius between circle end point and circle starting point

**0.0001 to 0.016 [mm]**

Permissible error in successive threads: Permissible deviation of the dynamically smoothed contour from the programmed thread contour

**0.0001 to 999.9999 [mm]**

Reserve for retraction movements: Distance to limit switch or collision object with M140 MB MAX

**0.0001 to 10 [mm]**

## Configuration of machining cycles

Overlap factor for pocket milling: Path overlap for Cycle 4 POCKET MILLING and Cycle 5 CIRCULAR POCKET

**0.001 to 1.414**

Traverse after machining a contour pocket

**PosBeforeMachining: Tool moves to the same position as before the cycle was machined****ToolAxClearanceHeight: Position the tool axis to clearance height**Display the **Spindle ?** error message if M3/M4 is not active**On: Issue error message****Off: No error message**Display the **Enter depth as negative****On: Issue error message****Off: No error message**

---

**Parameter settings**


---

Behavior when moving to wall of slot in the cylinder surface

**LineNormal: Approach on a straight line**

**CircleTangential: Approach**

M function for spindle orientation in machining cycles

**-1: Spindle orientation directly by NC**

**0: Function inactive**

**1 to 999: Number of the M function for spindle orientation**

Do not show the error message **Plunging type is not possible**

**On: Error message is not displayed**

**Off: Error message is displayed**

Behavior of M7 and M8 with Cycles 202 and 204

**TRUE: At the end of Cycles 202 and 204, the status of M7 and M8 is restored to that before the cycle call**

**FALSE: At the end of Cycles 202 and 204, the status of M7 and M8 is not restored automatically**

Do not show the **Residual material** warning

**On: Warning is not displayed**

**Off: Warning is displayed**

Geometry filter for filtering out linear elements

Type of stretch filter

**Off: No filter active**

**ShortCut: Omit individual points on a polygon**

**Average: The geometry filter smooths corners**

Maximum distance of the filtered to the unfiltered contour: The filtered points lie within this tolerance to the resulting path

**0 to 10 [mm]**

Maximum length of the distance resulting from filtering: Length along which the geometry filter is effective

**0 to 1000 [mm]**

Special spindle parameters

Potentiometer for feed rate during thread cutting

**SpindlePotentiometer: During thread cutting, the potentiometer is effective for the spindle-speed override. The potentiometer for the feed-rate override is disabled**

**FeedPotentiometer: During thread cutting, the potentiometer is effective for the feed-rate override. The potentiometer for the spindle-speed override is not active**

Waiting time at reversal point in thread base: The spindle stops for this time at the bottom of the thread before starting again in the opposite direction of rotation

**-999999999 to 999999999 [s]**

---

**Parameter settings**

---

Advanced switching time of spindle: The spindle is stopped for this period of time before reaching the bottom of the thread.

**–999999999 to 999999999 [s]**

Limitation of spindle speed with Cycles 17, 207, and 18

**TRUE: With small thread depths, the spindle speed is limited so that it runs at constant speed approx. 1/3 of the time**

**FALSE: No limitation of the spindle speed**

---

---

## Parameter settings

---

Settings for the NC editor

Generate backup files

**TRUE: Generate backup file after editing NC programs**

**FALSE: Do not generate backup file after editing NC programs**

Behavior of the cursor after deletion of lines

**TRUE: Cursor is placed on the preceding line after deletion (behavior of iTNC)**

**FALSE: Cursor is placed on the following line after deletion**

Behavior of the cursor on the first or last line

**TRUE: Cursor jumps from end to beginning of program**

**FALSE: Cursor is not allowed to jump from end to beginning of program**

Line break on blocks with more than one line

**ALL: Always display all lines**

**ACT: Only display the lines of the active block completely**

**NO: Only display all lines when block is edited**

Activate help graphics when entering cycle data

**TRUE: Always display help graphics during input**

**FALSE: Only display help graphics when the CYCLE HELP soft key is set to ON. The CYCLE HELP OFF/ON soft key is displayed in Programming operating mode after pressing the "Screen layout" key**

Behavior of the soft-key row after entering a cycle

**TRUE: The cycle soft-key row remains active after a cycle definition**

**FALSE: The cycle soft-key row is hidden after a cycle definition**

Confirmation request when deleting a block

**TRUE: Display confirmation request when deleting an NC block**

**FALSE: Do not display confirmation request when deleting an NC block**

Line number up to which a test of the NC program is to be run: Program length for which the geometry is to be checked

**100 to 50000**

ISO programming: Increments for creation of ISO blocks in the program

**0 to 250**

Specify programmable axes

**TRUE: Use the specified axis configuration**

**FALSE: Use the default axis configuration XYZABCUVW**

Behavior of paraxial positioning blocks

**TRUE: Paraxial positioning blocks enabled**

**FALSE: Paraxial positioning blocks disabled**



---

**Parameter settings**

---

Line number up to which identical syntax elements are searched for: Search for selected elements with up or down cursor keys

**500 to 50000**

Behavior of PARAXMODE function with UVW axes

**FALSE: PARAXMODE function enabled**

**TRUE: PARAXMODE function disabled**

---

**File management settings**

Display of dependent files

**MANUAL: Dependent files are displayed**

**AUTOMATIC: Dependent files are not displayed**

---

**Settings for tool usage file**

Timeout for creation of tool-usage files

**1 to 500 [min]**

Create tool-usage file for NC program

**NotAutoCreate: Do not create a tool usage list when a program is selected**

**OnProgSelectionIfNotExist: When a program is selected, create a list if does not yet exist**

**OnProgSelectionIfNecessary: When a program is selected, create a list if it does not yet exist or is obsolete**

**OnProgSelectionAndModify: When a program is selected, create a list if it does not yet exist, is obsolete, or the program is changed**

Create a pallet usage file

**NotAutoCreate: Do not create a tool usage list when a pallet is selected**

**OnProgSelectionIfNotExist: When a pallet is selected, a list is created if it does not yet exist**

**OnProgSelectionIfNecessary: When a pallet is selected, a list is created if it does not yet exist or is obsolete**

**OnProgSelectionAndModify: When a pallet is selected, a list is created if it does not yet exist, is obsolete, or the program is changed**

---

**Paths for the end user**

List of drives or directories: These machine parameters are effective only for a Windows programming station

**Drives or directories entered here are shown in the control's file manager**

FN 16 output path for execution

**Path for FN 16 output when no path is defined in the NC program**

FN 16 output path for the Programming and Test Run operating modes

**Path for FN 16 output when no path is defined in the NC program**

---

**Serial Interface RS232**

**Further information:** "Setting up data interfaces", Page 401

---

---

**Parameter settings**

---

monitoring (component monitoring)

Monitoring settings for the user

Perform configured error reaction

**TRUE: Error reaction is performed**

**FALSE: Error reaction is not performed**

Display warning for the component monitor

**TRUE: Warnings are displayed**

**FALSE: Warnings are not displayed**

---

General machine information provided by the operator: Information retrievable via an interface

**Custom name (nickname) of the machine**

**Inventory number, or**

**Photo or image of the machine**

**Machine location**

**Department or division**

**Responsible for the machine**

**Contact e-mail address**

**Contact telephone number**

## 12.2 Pin layout and cables for data interfaces

### RS-232-C/V.24 interface for HEIDENHAIN devices



The interface complies with the requirements of EN 50178 for **Low voltage electrical separation**.

When using the 25-pin adapter block:

Control		Conn. cable 365725-xx			Adapter block 310085-01		Conn. cable 274545-xx		
Male	Assign-ment	Female	Color	Female	Male	Female	Male	Color	Female
1	Do not assign	1		1	1	1	1	White/ Brown	1
2	RXD	2	Yellow	3	3	3	3	Yellow	2
3	TXD	3	Green	2	2	2	2	Green	3
4	DTR	4	Brown	20	20	20	20	Brown	8
5	Signal GND	5	Red	7	7	7	7	Red	7
6	DSR	6	Blue	6	6	6	6		6
7	RTS	7	Gray	4	4	4	4	Gray	5
8	CTR	8	Pink	5	5	5	5	Pink	4
9	Do not assign	9					8	Violet	20
Hsg.	External shield	Hsg.	External shield	Hsg.	Hsg.	Hsg.	Hsg.	External shield	Hsg.

When using the 9-pin adapter block:

Control		Conn. cable 355484-xx		Adapter block 363987-02		Conn. cable 366964-xx			
Male	Assign-ment	Female	Color	Male	Female	Male	Female	Color	Female
1	Do not assign	1	Red	1	1	1	1	Red	1
2	RXD	2	Yellow	2	2	2	2	Yellow	3
3	TXD	3	White	3	3	3	3	White	2
4	DTR	4	Brown	4	4	4	4	Brown	6
5	Signal GND	5	Black	5	5	5	5	Black	5
6	DSR	6	Violet	6	6	6	6	Violet	4
7	RTS	7	Gray	7	7	7	7	Gray	8
8	CTR	8	White/ Green	8	8	8	8	White/ Green	7
9	Do not assign	9	Green	9	9	9	9	Green	9
Hsg.	External shield	Hsg.	External shield	Hsg.	Hsg.	Hsg.	Hsg.	External shield	Hsg.

## Non-HEIDENHAIN devices

The connector layout of a non-HEIDENHAIN device may substantially differ from that of a HEIDENHAIN device.

It depends on the unit and the type of data transfer. The table below shows the connector pin layout on the adapter block.

Adapter block 363987-02		Conn. cable 366964-xx		
Female	Male	Female	Color	Female
1	1	1	Red	1
2	2	2	Yellow	3
3	3	3	White	2
4	4	4	Brown	6
5	5	5	Black	5
6	6	6	Violet	4
7	7	7	Gray	8
8	8	8	White/Green	7
9	9	9	Green	9
Hsg.	Hsg.	Hsg.	External shield	Hsg.

## Ethernet interface RJ45 socket

Maximum cable length:

- Unshielded: 100 m
- Shielded: 400 m

Pin	Signal	Description
1	TX+	Transmit Data
2	TX–	Transmit Data
3	REC+	Receive Data
4	Vacant	
5	Vacant	
6	REC–	Receive Data
7	Vacant	
8	Vacant	

## 12.3 Specifications

### Explanation of symbols

- Standard function
- Axis option
- 1** Advanced Function Set 1
- 2** Advanced Function Set 2
- x** Software option, except Advanced Function Set 1 and Advanced Function Set 2

### Specifications

<b>Components</b>	<ul style="list-style-type: none"> <li>■ Operating panel</li> <li>■ Screen with soft keys or touchscreen</li> </ul>
<b>Program memory</b>	<ul style="list-style-type: none"> <li>■ 2 GB</li> </ul>
<b>Input resolution and display step</b>	<ul style="list-style-type: none"> <li>■ As fine as 0.01 µm for linear axes</li> <li>■ As fine as 0.000 01° for rotary axes</li> </ul>
<b>Input range</b>	<ul style="list-style-type: none"> <li>■ Maximum 999 999 999 mm or 999 999 999°</li> </ul>
<b>Interpolation</b>	<ul style="list-style-type: none"> <li>■ Linear in 4 axes</li> <li>■ Linear in 5 axes (option 9)</li> <li>■ Circular in 2 axes</li> <li>■ Circular in 3 axes (option 8)</li> <li>■ Helical: superimposition of circular and straight paths</li> </ul>
<b>Block processing time</b> 3-D straight line without radius compensation	<ul style="list-style-type: none"> <li>■ 1.5 ms</li> </ul>
<b>Axis feedback control</b>	<ul style="list-style-type: none"> <li>■ Position-loop resolution: signal period of the position encoder/1024</li> <li>■ Position controller cycle time: 3 ms</li> <li>■ Cycle time of speed controller: 200 µs</li> </ul>
<b>Range of traverse</b>	<ul style="list-style-type: none"> <li>■ Max. 100 m (3937 inches)</li> </ul>
<b>Spindle speed</b>	<ul style="list-style-type: none"> <li>■ Max. 100 000 rpm (analog speed command signal)</li> </ul>
<b>Error compensation</b>	<ul style="list-style-type: none"> <li>■ Linear and nonlinear axis errors, backlash, reversal peaks during circular movements, thermal expansion</li> <li>■ Static friction</li> </ul>

---

**Specifications**

---

**Data interfaces**

- One each RS-232-C / V.24 max. 115 kilobaud
- Extended data interface with LSV2 protocol for remote operation of the control through the data interface with the **TNCremo** software
- Ethernet interface 1000 BaseT
- 5 USB ports: 1 front USB 2.0 port and 4 rear USB 3.0 ports)

---

**Ambient temperature**

- Operation: 5 °C to +45 °C
- Storage: -20 °C to +60 °C

### Input formats and units of control functions

<b>Positions, coordinates, circle radii, chamfer lengths</b>	–99 999.9999 to +99 999.9999 (5, 4: number of digits before and after the decimal point) [mm]
<b>Tool numbers</b>	0 to 32 767.9 (5, 1)
<b>Tool names</b>	32 characters, enclosed by quotation marks in <b>TOOL CALL</b> block. Permitted special characters: # \$ % & . , - _
<b>Detail values for tool compensation</b>	–99.9999 to +99.9999 (2, 4) [mm]
<b>Spindle speeds</b>	0 to 99 999.999 (5, 3) [rpm]
<b>Feed rates</b>	0 to 99 999.999 (5, 3) [mm/min] or [mm/tooth] or [mm/1]
<b>Dwell time in Cycle 9</b>	0 to 3600.000 (4, 3) [s]
<b>Thread pitch in various cycles</b>	–99.9999 to +99.9999 (2, 4) [mm]
<b>Angle for spindle orientation</b>	0 to 360.0000 (3, 4) [°]
<b>Angle for polar coordinates, rotation, tilting the working plane</b>	–360.0000 to 360.0000 (3, 4) [°]
<b>Polar coordinate angles for helical interpolation (CP)</b>	–5400.0000 to 5400.0000 (4, 4) [°]
<b>Datum numbers in Cycle 7</b>	0 to 2999 (4, 0)
<b>Scaling factor in Cycles 11 and 26</b>	0.000001 to 99.999999 (2, 6)
<b>Miscellaneous functions M</b>	0 to 9999 (4, 0)
<b>Q parameter numbers</b>	0 to 1999 (4, 0)
<b>Q parameter values</b>	–999 999 999.999999 to +999 999 999.999999 (9, 6)
<b>Labels (LBL) for program jumps</b>	0 to 65535 (5, 0)
<b>Labels (LBL) for program jumps</b>	Any text string in quotes ("" )
<b>Number of program-section repeats REP</b>	1 to 65 534 (5, 0)
<b>Error number for Q parameter function FN 14</b>	0 to 1199 (4, 0)



## User functions

### User functions

<b>Short description</b>	<ul style="list-style-type: none"> <li>■ Basic version: 3 axes plus closed-loop spindle</li> <li>□ Additional axis for 4 axes plus closed-loop spindle</li> <li>□ Additional axis for 5 axes plus closed-loop spindle</li> </ul>
<b>Program entry</b>	In HEIDENHAIN conversational format and ISO (G codes)
<b>Position entry</b>	<ul style="list-style-type: none"> <li>■ Nominal positions for lines and arcs in Cartesian coordinates or polar coordinates</li> <li>■ Incremental or absolute dimensions</li> <li>■ Display and entry in mm or inches</li> </ul>
<b>Tool compensation</b>	<ul style="list-style-type: none"> <li>■ Tool radius in the working plane and tool length</li> <li>x Radius compensated contour look ahead for up to 99 blocks (M120)</li> </ul>
<b>Tool tables</b>	Multiple tool tables with any number of tools
<b>Constant contour speed</b>	<ul style="list-style-type: none"> <li>■ With respect to the path of the tool center</li> <li>■ With respect to the cutting edge</li> </ul>
<b>Parallel operation</b>	Creating an NC program with graphical support while another NC program is being run
<b>Cutting data</b>	Automatic calculation of spindle speed, cutting speed, feed per tooth, and feed per revolution
<b>3-D machining (Advanced Function Set 2)</b>	<ul style="list-style-type: none"> <li>2 Motion control with minimum jerk</li> <li>2 3-D tool compensation via surface-normal vectors</li> <li>2 Using the electronic handwheel to change the angle of the swivel head during program run without affecting the position of the tool center point (tool tip or center of sphere) (TCPM = <b>T</b>ool <b>C</b>enter <b>P</b>oint <b>M</b>anagement)</li> <li>2 Keeping the tool normal to the contour</li> <li>2 Tool radius compensation perpendicular to traversing and tool direction</li> </ul>
<b>Rotary table machining (Advanced Function Set 1)</b>	<ul style="list-style-type: none"> <li>1 Programming of cylindrical contours as if in two axes</li> <li>1 Feed rate in distance per minute</li> </ul>
<b>Contour elements</b>	<ul style="list-style-type: none"> <li>■ Straight line</li> <li>■ Chamfer</li> <li>■ Circular path</li> <li>■ Circle center</li> <li>■ Circle radius</li> <li>■ Tangentially connected arc</li> <li>■ Rounded corners</li> </ul>

---

**User functions**


---

**Approaching and departing the contour**

- Via straight line: tangential or perpendicular
- Via circular arc

**Free contour programming (FK)**

- x FK free contour programming in HEIDENHAIN Klartext format with graphic support for workpiece drawings not dimensioned for NC

**Program jumps**

- Subprograms
- Program section repeats
- External NC programs

**Machining cycles**

- Cycles for drilling, and conventional and rigid tapping
- x Cycles for pecking, reaming, boring, and counterboring
- x Cycles for milling internal and external threads
- Roughing and finishing rectangular and circular pockets
- x Roughing and finishing rectangular and circular studs
- x Cycles for clearing level and inclined surfaces
- x Cycles for milling linear and circular slots
- x Cartesian and polar point patterns
- x Contour pocket
- x Contour train
- x OEM cycles (special cycles developed by the machine manufacturer) can also be integrated

**Coordinate transformation**

- Datum shift, rotation, mirroring
- Scaling factor (axis-specific)
- 1 Tilting of the working plane (Advanced Function Set 1)

**Q parameters**

Programming with variables

- Mathematical functions =, +, -, \*, /, roots
  - Logical operations (=, ≠, <, >)
  - Calculating with parentheses
  - sin α, cos α, tan α, arc sin, arc cos, arc tan, a<sup>n</sup>, e<sup>n</sup>, ln, log, absolute value of a number, constant π, negation, truncation of digits before or after the decimal point
  - Functions for calculation of circles
  - String parameters
-

---

**User functions**


---

<b>Programming aids</b>	<ul style="list-style-type: none"> <li>■ Calculator</li> <li>■ Color highlighting of syntax elements</li> <li>■ Complete list of all current error messages</li> <li>■ Context-sensitive help function</li> <li>■ Graphic support for the programming of cycles</li> <li>■ Comment and structure blocks in the NC program</li> </ul>
<b>Teach-In</b>	<ul style="list-style-type: none"> <li>■ Actual positions can be transferred directly to the NC program</li> </ul>
<b>Test graphics</b>	<b>x</b> Graphic simulation before a program run, even while another NC program is being run
Display modes	<ul style="list-style-type: none"> <li><b>x</b> Plan view / projection in 3 planes / 3-D view / 3-D line graphics</li> <li><b>x</b> Detail enlargement</li> </ul>
<b>Programming graphics</b>	<ul style="list-style-type: none"> <li>■ In the <b>Programming</b> operating mode, the contours of the NC blocks are drawn on screen while they are being entered (2-D pencil-trace graphics), even while another NC program is being run</li> </ul>
<b>Program-run graphics</b>	<b>x</b> Graphic simulation of real-time machining in plan view / projection in 3 planes / 3-D view
Display modes	
<b>Machining time</b>	<ul style="list-style-type: none"> <li>■ Calculation of machining time in the <b>Test Run</b> operating mode</li> <li>■ Display of the current machining time in the <b>Program Run, Single Block</b> and <b>Program Run, Full Sequence</b> operating modes</li> </ul>
<b>Preset management</b>	<ul style="list-style-type: none"> <li>■ For saving any datums</li> </ul>
<b>Returning to the contour</b>	<ul style="list-style-type: none"> <li>■ Block scan in any NC block in the NC program, returning the tool to the calculated nominal position to continue machining</li> <li>■ NC program interruption, contour departure and return</li> </ul>
<b>Datum tables</b>	<ul style="list-style-type: none"> <li>■ Multiple datum tables for storing workpiece-specific datums</li> </ul>
<b>Touch probe cycles</b>	<ul style="list-style-type: none"> <li><b>x</b> Calibrating the touch probe</li> <li><b>x</b> Compensation of workpiece misalignment, manual or automatic</li> <li><b>x</b> Manual and automatic presetting</li> <li><b>x</b> Automatic workpiece measurement</li> <li><b>x</b> Tools can be measured automatically</li> </ul>

## Accessories

---

### Accessories

---

<b>Electronic handwheels</b>	■	HR 510: Portable handwheel
	■	HR 550FS: Portable radio handwheel with display
	■	HR 520: Portable handwheel with display
	■	HR 130: Panel-mounted handwheel
	■	HR 150: Up to three panel-mounted handwheels via handwheel adapter HRA 110
<b>Touch probes</b>	■	TS 248: workpiece touch trigger probe with cable connection
	■	TS 260: workpiece touch trigger probe with cable connection
	■	TS 460: workpiece touch trigger probe with infrared or radio transmission
	■	TS 642: workpiece touch trigger probe with infrared transmission
	■	TS 740: high-precision workpiece touch trigger probe with infrared transmission
	■	TT 160: tool touch trigger probe
	■	TT 460: tool touch trigger probe with infrared transmission

## 12.4 Differences between the TNC 620 and the iTNC 530

### Comparison: Specifications

Function	TNC 620	iTNC 530
Control loops	Maximum 8 control loops (including up to 2 spindles)	18 maximum
<b>Input resolution and display step:</b>		
■ Linear axes	■ 0.01 µm	■ 0.1 µm
■ Rotary axes	■ 0.00001°	■ 0.0001°
Display	15.1-inch screen with soft keys or 19-inch screen with touchscreen	19-inch screen or 15.1-inch screen with soft keys
Memory media for NC, PLC programs, and system files	CompactFlash memory card	Hard disk or SSDR solid state disk
Program memory for NC programs	2 GB	> 21 GB
Block processing time	1.5 ms	0.5 ms
<b>Interpolation:</b>		
■ Straight line	■ 5 axes	■ 5 axes
■ Circle	■ 3 axes	■ 3 axes
■ Helix	■ yes	■ Yes
■ Spline	■ No	■ Yes with option 9
Hardware	Compact in operating panel or modular in electrical cabinet	Modular in electrical cabinet

### Comparison: Data interfaces

Function	TNC 620	iTNC 530
RS-422/V.11 serial interface	-	X

**Further information:** "Setting up data interfaces", Page 401

## Comparison: PC software

Function	TNC 620	iTNC 530
<b>ConfigDesign</b> for the configuration of machine parameters	Available	Not available
<b>TNCAnalyzer</b> for the analysis and evaluation of service files	Available	Not available

## Comparison: User functions

Function	TNC 620	iTNC 530
<b>Program entry</b>		
■ smarT.NC	■ –	■ X
■ ASCII editor	■ X, directly editable	■ X, editable after conversion
<b>Position entry</b>		
■ Set the last tool position as pole (empty CC block)	■ X (error message if pole transfer is ambiguous)	■ X
■ Spline sets ( <b>SPL</b> )	■ –	■ X, with option 9
<b>Tool table</b>		
■ Flexible management of tool types	■ X	■ –
■ Filtered display of selectable tools	■ X	■ –
■ Sorting function	■ X	■ –
■ Column names	■ Sometimes with _	■ Sometimes with -
■ Form view	■ Switchover with Screen Layout key	■ Switchover by soft key
■ Exchange of tool table between TNC 620 and iTNC 530	■ X	■ Not possible
Touch probe table for managing different 3-D touch probes	X	–
<b>Cutting data calculator:</b> Automatic calculation of spindle speed and feed rate	<ul style="list-style-type: none"> <li>■ Simple cutting data calculator without stored table</li> <li>■ Cutting data calculator with stored technology tables</li> </ul>	Using stored technology tables

Function	TNC 620	iTNC 530
<b>Define any tables</b>	<ul style="list-style-type: none"> <li>■ Freely definable tables (.TAB files)</li> <li>■ Reading and writing with FN functions</li> <li>■ Definable via config. data</li> <li>■ The names of tables and table columns must start with a letter, and no arithmetic operators are permitted</li> <li>■ Reading and writing with SQL functions</li> </ul>	<ul style="list-style-type: none"> <li>■ Freely definable tables (.TAB files)</li> <li>■ Reading and writing with FN functions</li> </ul>
<b>Traverse in tool-axis direction</b>		
■ Manual operation (3-D ROT menu)	■ X	■ X, FCL2 function
■ With handwheel superimpositioning	■ X	■ X, option 44
<b>Entry of feed rates:</b>		
■ <b>FT</b> (time in seconds for path)	■ –	■ X
■ <b>FMAXT</b> (only for active rapid traverse potentiometer: time in seconds for path)	■ –	■ X
<b>FK free contour programming</b>		
■ Programming for workpiece drawings not dimensioned for NC programming	■ X, option 19	■ X
■ Conversion of FK program to Klartext conversational language	■ –	■ X
■ FK blocks in combination with <b>M89</b>	■ –	■ X
<b>Program jumps:</b>		
■ Maximum number of labels	■ 65535	■ 1000
■ Subprograms	■ X	■ X
■ Nesting depth for subprograms	■ 20	■ 6

Function	TNC 620	iTNC 530
<b>Q parameter programming:</b>		
■ FN 15: PRINT	■ –	■ X
■ FN 25: PRESET	■ –	■ X
■ FN 29: PLC LIST	■ X	■ –
■ FN31: RANGE SELECT	■ –	■ X
■ FN32: PLC PRESET	■ –	■ X
■ FN37: EXPORT	■ X	■ –
■ <b>FN 16</b>	■ X	■ –
■ Writing to LOG files	■ X	■ –
■ Configurable behavior for undefined or empty QS parameters		
■ Displaying parameter contents in the additional status display	■ X	■ –
■ <b>SQL</b> functions for writing and reading tables	■ X	■ –
<b>Graphic support</b>		
■ 2-D programming graphics	■ X	■ X
■ REDRAW function ( <b>REDRAW</b> )	■ –	■ X
■ Show grid lines as the background	■ X	■ –
■ Program run graphics (plan view, projection in 3 planes, 3-D view)	■ X, with option 20	■ X
■ High-resolution view	■ X	■ X
■ Test graphics (plan view, projection on 3 planes, 3-D view)	■ X, with option 20	■ X
■ Tool display	■ X, with option 20	■ X
■ Adjusting the simulation speed	■ X, with option 20	■ X
■ Coordinates of line intersection for projection in 3 planes	■ –	■ X
■ Expanded zoom functions (mouse operation)	■ X, with option 20	■ X
■ Displaying frame for workpiece blank	■ X, with option 20	■ X
■ Displaying the depth value in plan view during mouse-over	■ X, with option 20	■ X
■ Deliberately stop test run ( <b>STOP AT</b> )	■ X, with option 20	■ X
■ Factor in tool change macro	■ X (differing to actual execution)	■ X



Function	TNC 620	iTNC 530
<b>Preset table</b>		
■ Line 0 of the preset table can be edited manually	■ X	■ –
<b>Pallet management</b>		
■ Support of pallet files	■ X, option 22	■ X
■ Tool-oriented machining	■ X, option 22	■ X
■ Management of presets for a pallet in a table	■ X, option 22	■ X
<b>Programming aids:</b>		
■ Color highlighting of syntax elements	■ X	■ –
■ Calculator	■ X (scientific)	■ X (standard)
■ Convert NC blocks to comments	■ X	■ –
■ Structure blocks in NC program	■ X	■ X
■ Structure view in test run	■ –	■ X
<b>Dynamic Collision Monitoring (DCM):</b>		
■ Collision monitoring in Automatic operation	■ –	■ X, option 40
■ Collision monitoring in Manual operation	■ –	■ X, option 40
■ Graphic depiction of the defined collision objects	■ –	■ X, option 40
■ Collision checking in test run	■ –	■ X, option 40
■ Fixture monitoring	■ –	■ X, option 40
■ Tool carrier management	■ X	■ X, option 40
<b>CAM support:</b>		
■ Load contours from Step data and Iges data	■ X, option 42	■ –
■ Load machining positions from Step data and Iges data	■ X, option 42	■ –
■ Offline filter for CAM files	■ –	■ X
■ Stretch filter	■ X	■ –
<b>MOD functions:</b>		
■ User parameters	■ Config data	■ Numerical structure
■ OEM help files with service functions	■ –	■ X
■ Data medium inspection	■ –	■ X
■ Load service packs	■ –	■ X
■ Specify the axes for actual position capture	■ –	■ X
■ Configure counter	■ X	■ –

Function	TNC 620	iTNC 530
<b>Special functions:</b>		
■ Create reverse program	■ –	■ X
■ Adaptive Feed Control AFC	■ –	■ X, option 45
■ Define the counter with <b>FUNCTION COUNT</b>	■ X	■ –
■ Define the dwell time with <b>FUNCTION FEED</b>	■ X	■ –
■ Define the dwell time with <b>FUNCTION DWELL</b>	■ X	■ –
■ Determine the integration of the programmed coordinates with <b>FUNCTION PROG PATH</b>	■ X	■ –
<b>Functions for large molds and dies:</b>		
■ Global program settings (GS)	■ –	■ X, option 44
<b>Status displays:</b>		
■ Dynamic display of Q-parameter contents, definable number ranges	■ X	■ –
■ Graphic display of residual run time	■ –	■ X
Individual color settings of user interface	–	X

### Comparison: Touch probe cycles in the Manual operation and Electronic handwheel operating modes

Cycle	TNC 620	iTNC 530
Touch-probe table for managing 3-D touch probes	X	–
Calibrating the effective length	X, option 17	X
Calibrating the effective radius	X, option 17	X
Measuring a basic rotation using a line	X, option 17	X
Setting the preset on any axis	X, option 17	X
Setting a corner as preset	X, option 17	X
Setting a circle center as preset	X, option 17	X
Setting a center line as preset	X, option 17	X
Measuring a basic rotation using two holes/cylindrical studs	X, option 17	X
Setting the preset using four holes/cylindrical studs	X, option 17	X
Setting the circle center using three holes/cylindrical studs	X, option 17	X
Determine and offset misalignment of a plane	X, option 17	–
Support of mechanical touch probes by manually capturing the current position	By soft key or hard key	By hard key
Write measurement values to the preset table	X, option 17	X
Write measurement values to the datum table	X, option 17	X

## Comparison: Differences in programming

Function	TNC 620	iTNC 530
<b>File management:</b>		
■ Entry of name	■ Opens the <b>Select file</b> pop-up window.	■ Synchronizes the cursor
■ Support of key combinations	■ Not available	■ Available
■ Favorites Management	■ Not available	■ Available
■ Configuration of column structure	■ Not available	■ Available
Selecting a tool from the table	Selection via split-screen menu	Selection in a pop-up window
Programming special functions with the <b>SPEC FCT</b> key	Pressing the key opens a soft-key row as a submenu. To exit the submenu, press the <b>SPEC FCT</b> key again; then the control shows the last active soft-key row	Pressing the key adds the soft-key row as the last row. To exit the menu, press the <b>SPEC FCT</b> key again; then the control shows the last active soft-key row
Programming approach and departure motions with the <b>APPR DEP</b> key	Pressing the key opens a soft-key row as a submenu. To exit the submenu, press the <b>APPR DEP</b> key again; then the control shows the last active soft-key row	Pressing the key adds the soft-key row as the last row. To exit the menu, press the <b>APPR DEP</b> key again; then the control shows the last active soft-key row
Pressing the hard key <b>END</b> with active <b>CYCLE DEF</b> and <b>TOUCH PROBE</b> menus	Terminates the editing process and calls the file manager	Exits the respective menu
Calling the file manager if <b>CYCLE DEF</b> and <b>TOUCH PROBE</b> menus are active	Terminates the editing process and calls the file manager. The respective soft-key row remains selected when the file manager is exited	<b>Key non-functional</b> error message.
Calling the file manager if <b>CYCL CALL</b> , <b>SPEC FCT</b> , <b>PGM CALL</b> and <b>APPR DEP</b> menus are open	Terminates the editing process and calls the file manager. The respective soft-key row remains selected when the file manager is exited	Terminates the editing process and calls the file manager. The basic soft-key row is selected when the file manager is exited

Function	TNC 620	iTNC 530
<b>Datum table:</b>		
■ Sorting function by values within an axis	■ Available	■ Not available
■ Resetting the table	■ Available	■ Not available
■ Switching the list/form view	■ Switch via the screen layout key	■ Switchover by toggle soft key
■ Inserting individual line	■ Allowed everywhere, renumbering possible after request. Empty line is inserted, must be filled with zeros manually	■ Only allowed at the end of the table. Line with value 0 in all columns is inserted
■ Transfer of actual position values on individual axis to the datum table using the keys	■ Available in the <b>Program Run Single Block</b> and <b>Program Run, Full Sequence</b> operating modes	■ Available
■ Transfer of actual position values on all active axes to the datum table using the keys	■ Not available	■ Available
■ Capturing the last positions measured by TS using the keys	■ Not available	■ Available
<b>FK free contour programming:</b>		
■ Programming of parallel axes	■ With X/Y coordinates, independent of machine type; switchover with <b>FUNCTION PARAXMODE</b>	■ Machine-dependent with the existing parallel axes
■ Automatic correction of relative references	■ Relative references in contour subprograms are not corrected automatically	■ All relative references are corrected automatically
■ Specify the working plane during programming	■ BLK form ■ <b>Plane XY ZX YZ</b> soft key if the working plane differs	■ BLK form

Function	TNC 620	iTNC 530
<b>Q-parameter programming:</b>		
■ Q-parameter formula with SGN	<b>Q12 = SGN Q50</b> <ul style="list-style-type: none"> <li>■ If <b>Q50 = 0</b> then <b>Q12 = 0</b></li> <li>■ If <b>Q50 &gt; 0</b> then <b>Q12 = 1</b></li> <li>■ If <b>Q50 &lt; 0</b> then <b>Q12 -1</b></li> </ul>	<b>Q12 = SGN Q50</b> <ul style="list-style-type: none"> <li>■ If <b>Q50 &gt;= 0</b> then <b>Q12 = 1</b></li> <li>■ If <b>Q50 &lt; 0</b> then <b>Q12 -1</b></li> </ul>
■ Access to table data	<ul style="list-style-type: none"> <li>■ Via <b>SQL</b> commands and via <b>FN 18</b> or <b>TABREAD-TABWRITE</b> functions</li> <li>■ To tool and compensation-value tables via <b>TABDATA</b></li> </ul>	<ul style="list-style-type: none"> <li>■ Via <b>FN 18</b> or <b>TABREAD-TABWRITE</b> functions</li> </ul>
■ Access to machine parameters	<ul style="list-style-type: none"> <li>■ With the <b>CFGREAD</b> function</li> </ul>	<ul style="list-style-type: none"> <li>■ Via <b>FN 18</b> functions</li> </ul>
■ Creating interactive cycles with <b>CYCLE QUERY</b> , e.g. touch probe cycles in Manual Operation	<ul style="list-style-type: none"> <li>■ Available</li> </ul>	<ul style="list-style-type: none"> <li>■ Not available</li> </ul>
<b>Handling of error messages:</b>		
■ Help with error messages	<ul style="list-style-type: none"> <li>■ Call via <b>ERR</b> key</li> </ul>	<ul style="list-style-type: none"> <li>■ Call via <b>HELP</b> key</li> </ul>
■ Switching the operating mode while help menu is active	<ul style="list-style-type: none"> <li>■ Help menu is closed when the operating mode is switched</li> </ul>	<ul style="list-style-type: none"> <li>■ Operating mode switchover is not allowed (key is non-functional)</li> </ul>
■ Selecting the background operating mode while help menu is active	<ul style="list-style-type: none"> <li>■ Help menu is closed when F12 is used for switching</li> </ul>	<ul style="list-style-type: none"> <li>■ Help menu remains open when F12 is used for switching</li> </ul>
■ Identical error messages	<ul style="list-style-type: none"> <li>■ Are collected in a list</li> </ul>	<ul style="list-style-type: none"> <li>■ Are displayed only once</li> </ul>
■ Acknowledgment of error messages	<ul style="list-style-type: none"> <li>■ Every error message (even if it is displayed more than once) must be acknowledged, the <b>DELETE ALL</b> function is available</li> </ul>	<ul style="list-style-type: none"> <li>■ Error message to be acknowledged only once</li> </ul>
■ Access to protocol functions	<ul style="list-style-type: none"> <li>■ Log and powerful filter functions (errors, keystrokes) are available</li> </ul>	<ul style="list-style-type: none"> <li>■ Complete log without filter functions available</li> </ul>
■ Saving service files	<ul style="list-style-type: none"> <li>■ Available. No service file is generated upon a system crash</li> <li>■ Error number selectable for which a service file will be generated automatically</li> </ul>	<ul style="list-style-type: none"> <li>■ Available. A service file is generated automatically upon a system crash</li> </ul>

Function	TNC 620	iTNC 530
<b>Find function:</b>		
■ List of words recently searched for	■ Not available	■ Available
■ Show elements of active block	■ Not available	■ Available
■ Show list of all available NC blocks	■ Not available	■ Available
Starting the search function with the up/down arrow keys when highlighted	Works up to max. 50000 NC blocks, can be set via configuration datum	No limitation regarding program length
<b>Programming graphics:</b>		
■ True-to-scale display of grid	■ Available	■ Not available
■ Editing contour subprograms in SLII cycles with <b>AUTO DRAW ON</b>	■ With error messages, in the main program the cursor is positioned on the <b>CYCL CALL</b> NC block	■ With error messages, the cursor is positioned on the NC block in the contour subprogram that caused the error
■ Moving the zoom window	■ Repeat function not available	■ Repeat function available
<b>Programming minor axes:</b>		
■ Syntax <b>FUNCTION PARAXCOMP</b> : Define the behavior of the display and the paths of traverse	■ Available	■ Not available
■ Syntax <b>FUNCTION PARAXMODE</b> : Define the assignment of the parallel axes to be traversed	■ Available	■ Not available

### Comparison: Differences in Test Run, functionality

Function	TNC 620	iTNC 530
Entering a program with the <b>GOTO</b> key	Function only possible if the <b>START SINGLE</b> soft key was not pressed	Function also possible after <b>START SINGLE</b>
Calculation of machining time	Each time the simulation is repeated by pressing the START soft key, the machining time is totaled	Each time the simulation is repeated by pressing the START soft key, time calculation starts at 0
Single block	With point pattern cycles and <b>CYCL CALL PAT</b> , the control stops after each point	Point pattern cycles and <b>CYCL CALL PAT</b> are handled by the control as a single NC block

**Comparison: Differences in Test Run, operation**

Function	TNC 620	iTNC 530
Zoom function	Each sectional plane can be selected by individual soft keys	Sectional plane can be selected via three toggle soft keys
Machine-specific miscellaneous functions M	Lead to error messages if they are not integrated in the PLC	Are ignored during Test Run
Displaying/editing the tool table	Function available via soft key	Function not available
Tool depiction	<ul style="list-style-type: none"> <li>■ Turquoise: Tool length</li> <li>■ Red: Length of cutting edge and tool is engaged</li> <li>■ Blue: Length of cutting edge and tool is not engaged</li> </ul>	<ul style="list-style-type: none"> <li>■ -</li> <li>■ Red: Tool is engaged</li> <li>■ Green: Tool is not engaged</li> </ul>
View options of 3-D view	Available	Function not available
Adjustable model quality	Available	Function not available



## Comparison: Differences in Manual Operation, functionality

Function	TNC 620	iTNC 530
Jog increment function	The jog increment can be defined separately for linear and rotary axes	The jog increment applies for both linear and rotary axes
Preset table	<p>Basic transformation (translation and rotation) from machine table system to workpiece system via the <b>X</b>, <b>Y</b>, and <b>Z</b> columns, as well as spatial angles <b>SPA</b>, <b>SPB</b> and <b>SPC</b>.</p> <p>In addition, the columns <b>X_OFFS</b> to <b>W_OFFS</b> can be used to define the axis offset of each individual axis. The function of the axis offsets can be configured.</p> <p>Line 0 can also be edited manually.</p>	<p>Basic transformation (translation) from machine table system to workpiece system via the <b>X</b>, <b>Y</b> and <b>Z</b> columns, as well as a basic rotation <b>ROT</b> in the working plane (rotation).</p> <p>In addition, the columns <b>A</b> to <b>W</b> can be used to define presets in the rotary and parallel axes.</p> <p>Line 0 can only be edited by manual probing cycles.</p>
Behavior when presetting	<p>Presetting in a rotary axis has the same effect as an axis offset. This offset is also effective for kinematics calculations and during tilting of the working plane.</p> <p>In machine parameter <b>preset-ToAlignAxis</b> (no. 300203) your machine tool builder specifies for each axis what effect an offset of a rotational axis has on the preset.</p> <ul style="list-style-type: none"> <li>■ <b>True</b> (Default): Use offset for aligning the workpiece</li> <li>■ <b>False</b>: Use offset for inclined-tool machining</li> </ul>	<p>Rotary axis offsets defined by machine parameters do not influence the axis positions that were defined in the Tilt working plane function.</p> <p>MP7500, bit 3 permits you to define whether the current rotary axis position relative to the machine datum is taken into account or whether the first rotary axis (usually the C axis) is assumed to be in 0° position.</p>
Presetting	Only after a reference run is it possible to set a preset or to modify a preset via the preset table.	A preset can be set or modified via the preset table before a reference run.
<b>Handling of the preset table:</b>		
Defining the feed rates	<p>Feed rates can be defined separately for linear and rotary axes</p> <p>By pressing the <b>F</b> soft key in the <b>Manual operation</b> mode, you can define separate feed rates for linear and rotary axes. These feed rates apply only in the <b>Manual operation</b> mode.</p>	Only one feed-rate can be defined for linear and rotary axes

### Comparison: Differences in Manual Operation, operation

Function	TNC 620	iTNC 530
Capturing the position values from mechanical probes	Confirm actual position with a soft key or hard key	Actual-position capture by hard key

### Comparison: Differences in Program Run, operation

Function	TNC 620	iTNC 530
Operating mode switchover after program run has been suspended by switching to the <b>Program run, single block</b> operating mode and canceled with <b>INTERNAL STOP</b>	When you return to the <b>Program run, full sequence</b> mode: error message <b>Current block not selected</b> . Use block scan to select the point of interruption	Switching the operating mode is allowed, modal information is saved, program run can be continued by pressing NC start
<b>GOTO</b> is used to go to FK sequences after program run was interrupted there before switching the operating mode	Error message <b>FK programming: Undefined starting position</b> Entering with mid-program startup is permitted	GOTO allowed
<b>Mid-program startup:</b>		
Switching the screen layout for mid-program startup	Only possible, if startup position has already been approached	Possible in all operating states
Error messages	Error messages are still active after the error has been corrected and must be acknowledged separately	Error messages are sometimes acknowledged automatically after the error has been corrected
Point patterns in single block	With point pattern cycles and <b>CYCL CALL PAT</b> , the control stops after each point.	Point pattern cycles and <b>CYCL CALL PAT</b> are handled by the control as a single NC block

## Comparison: Differences in Program Run, traverse movements

### NOTICE

#### Danger of collision!

NC programs that were created on older controls can lead to unexpected axis movements or error messages on current control models. Danger of collision during machining!

- ▶ Check the NC program or program section using the graphic simulation
- ▶ Carefully test the NC program or program section in the **Program run, single block** operating mode
- ▶ Pay attention to the following known differences (the list below might not be complete!)

Function	TNC 620	iTNC 530
Handwheel-superimposed traversing with <b>M118</b>	Effective in the machine coordinate system	Effective in the machine coordinate system
Deleting basic rotation with <b>M143</b>	<b>M143</b> clears the entries from the <b>SPA</b> , <b>SPB</b> and <b>SPC</b> columns in the preset table	<b>M143</b> does <b>not</b> delete the entry in the <b>ROT</b> column in the preset table; but only in the NC program; reactivating the corresponding preset table line reactivates the deleted basic rotation
Scaling approach/departure movements ( <b>APPR/DEP/RND</b> )	Axis-specific scaling factor permitted, radius is not scaled	Error message
Approach/departure with <b>APPR/DEP</b>	Error message if <b>R0</b> is programmed in <b>APPR/DEP LN</b> or <b>APPR/DEP CT</b>	Tool radius 0 and compensation direction <b>RR</b> are assumed
Approach/departure with <b>APPR/DEP</b> if contour elements with length 0 are defined	Contour elements with length 0 are ignored. The approach/departure movements are calculated for the first and last valid contour element	An error message is issued if a contour element with length 0 is programmed after the <b>APPR</b> block (relative to the first contour point programmed in the <b>APPR</b> block)  For a contour element with length 0 before a <b>DEP</b> block, the iTNC 530 does not issue an error message, but uses the last valid contour element to calculate the departure movement

Function	TNC 620	iTNC 530
Effect of Q parameters	<b>Q60</b> to <b>Q99</b> ( <b>QS60</b> to <b>QS99</b> ) always have a local effect.	<b>Q60</b> to <b>Q99</b> ( <b>QS60</b> to <b>QS99</b> ) have a local or global effect, depending on MP7251 in converted cycle programs (.cyc). Nested calls may cause problems
Automatic cancelation of tool radius compensation	<ul style="list-style-type: none"> <li>■ NC block with <b>R0</b></li> <li>■ <b>DEP</b> block</li> <li>■ Program selection</li> <li>■ <b>END PGM</b></li> </ul>	<ul style="list-style-type: none"> <li>■ NC block with <b>R0</b></li> <li>■ <b>DEP</b> block</li> <li>■ Program selection</li> <li>■ Programming of Cycle <b>10 ROTATION</b></li> <li>■ <b>PGM CALL</b></li> </ul>
NC blocks with <b>M91</b>	No consideration of tool radius compensation	Consideration of tool radius compensation
Behavior with <b>M120 LA1</b>	No effect on the machining process, because the control interprets the input internally as an <b>LA0</b>	Possible undesired effect on the machining process, because the control interprets the entry internally as an <b>LA2</b>
Block scan in a point table	The tool is positioned above the next position to be machined	The tool is positioned above the last position that has been completely machined
Empty <b>CC</b> block (pole adoption from last tool position) in the NC program	Last positioning block in the working plane must contain both coordinates of the working plane	Last positioning block in the working plane must not necessarily contain both coordinates of the working plane. May cause problems with <b>RND</b> or <b>CHF</b> blocks
Axis-specific scaling of <b>RND</b> block	<b>RND</b> block is scaled, the result is an ellipse	Error message is issued
Reaction if a contour element with length 0 is defined before or after a <b>RND</b> or <b>CHF</b> block	Error message is issued	<p>Error message is issued if a contour element with length 0 is located before the <b>RND</b> or <b>CHF</b> block</p> <p>Contour element with length 0 is ignored if the contour element with length 0 is located after the <b>RND</b> or <b>CHF</b> block</p>

Function	TNC 620	iTNC 530
Circle programming with polar coordinates	The incremental rotation angle <b>IPA</b> and the direction of rotation <b>DR</b> must have the same sign. Otherwise, an error message will be issued	The algebraic sign of the direction of rotation is used if the sign defined for <b>DR</b> differs from the one defined for <b>IPA</b>
Tool radius compensation on circular arc or helix with angular length = 0	The transition between the adjacent elements of the arc/helix is generated. Also, the tool axis motion is executed right before this transition. If the element is the first or last element to be corrected, the next or previous element is dealt with in the same way as the first or last element to be corrected	The equidistant line of the arc/helix is used for generating the tool path
<b>SLII cycles 20 to 24:</b>		
<ul style="list-style-type: none"> <li>■ Number of definable contour elements</li> </ul>	<ul style="list-style-type: none"> <li>■ Max. 16384 blocks in up to 12 subcontours</li> </ul>	<ul style="list-style-type: none"> <li>■ Max. 8192 contour elements in up to 12 subcontours, no restrictions for subcontour</li> </ul>
<ul style="list-style-type: none"> <li>■ Define the working plane</li> </ul>	<ul style="list-style-type: none"> <li>■ Tool axis in <b>TOOL CALL</b> block defines the working plane</li> </ul>	<ul style="list-style-type: none"> <li>■ The axes of the first positioning block in the first subcontour define the working plane</li> </ul>
<ul style="list-style-type: none"> <li>■ Position at end of SL cycle</li> </ul>	<ul style="list-style-type: none"> <li>■ With the <b>posAfterContPocket</b> (no. 201007) parameter, you can define whether the end position is above the last programmed position, or whether the tool moves to clearance height in the tool axis</li> <li>■ If the tool moves to clearance height in the tool axis, both coordinates must be programmed with the first traverse movement</li> </ul>	<ul style="list-style-type: none"> <li>■ With MP7420, you can define whether the end position is above the last programmed position, or whether the tool moves only to clearance height in the tool axis</li> <li>■ If the tool moves to clearance height in the tool axis, one coordinate must be programmed with the first traverse movement</li> </ul>

Function	TNC 620	iTNC 530
<b>SLII cycles 20 to 24:</b>		
<ul style="list-style-type: none"> <li>■ Behavior with islands not contained in pockets</li> <li>■ Set operations in SL cycles with complex contour formulas</li> <li>■ Radius compensation active with <b>CYCL CALL</b></li> <li>■ Paraxial positioning blocks in contour subprogram</li> <li>■ Miscellaneous functions <b>M</b> in contour subprogram</li> </ul>	<ul style="list-style-type: none"> <li>■ Definition in complex contour formula is not possible</li> <li>■ Real set operation possible</li> <li>■ Error message is issued</li> <li>■ Error message is issued</li> <li>■ Error message is issued</li> </ul>	<ul style="list-style-type: none"> <li>■ Restricted definition in complex contour formula is possible</li> <li>■ Only restricted performance of real set operation possible</li> <li>■ Radius compensation is canceled, NC program is being run</li> <li>■ NC program is being run</li> <li>■ M functions are ignored</li> </ul>
<b>General cylinder surface machining:</b>		
<ul style="list-style-type: none"> <li>■ Contour definition</li> <li>■ Offset definition on cylinder surface</li> <li>■ Offset definition for basic rotation</li> <li>■ Circle programming with C/CC</li> <li>■ <b>APPR/DEP</b> blocks in contour definition</li> </ul>	<ul style="list-style-type: none"> <li>■ With X/Y coordinates, independent of machine type</li> <li>■ With datum shift in X/Y, regardless of machine type</li> <li>■ Function available</li> <li>■ Function available</li> <li>■ Function not available</li> </ul>	<ul style="list-style-type: none"> <li>■ Machine-dependent, with existing rotary axes</li> <li>■ Machine-specific datum shift in rotary axes</li> <li>■ Function not available</li> <li>■ Function not available</li> <li>■ Function available</li> </ul>
<b>Cylinder surface machining with Cycle 28:</b>		
Complete roughing-out of slot	Function available	Function not available
<b>Cylinder surface machining with Cycle 29</b>		
	Direct plunging to contour of ridge	Circular approach to contour of ridge
<b>Cycles 25x for pockets, studs, and slots:</b>		
<ul style="list-style-type: none"> <li>■ Plunging movements</li> </ul>	Error messages are triggered in limit areas (geometric conditions of tool/contour) if plunge movements lead to absurd/critical behavior	Vertical plunge movement in limit areas (geometric conditions of tool/contour) if necessary

Function	TNC 620	iTNC 530
<b>PLANE function:</b>		
<ul style="list-style-type: none"> <li>■ <b>TABLE ROT/COORD ROT</b></li> </ul>	<p>Effect:</p> <ul style="list-style-type: none"> <li>■ The transformation types are effective on all free rotary axes</li> <li>■ The control does not always position the free rotary axis with <b>TABLE ROT</b>, but depending on the current position, the programmed spatial angles and the machine kinematics</li> </ul> <p>Default with missing selection:</p> <ul style="list-style-type: none"> <li>■ <b>COORD ROT</b> is used</li> </ul>	<p>Effect</p> <ul style="list-style-type: none"> <li>■ The transformation types are only effective with a C rotary axis</li> <li>■ With <b>TABLE ROT</b> the control always positions the rotary axis</li> </ul> <p>Default with missing selection:</p> <ul style="list-style-type: none"> <li>■ <b>COORD ROT</b> is used</li> </ul>
<ul style="list-style-type: none"> <li>■ Positioning behavior</li> </ul>	<ul style="list-style-type: none"> <li>■ <b>SYM</b></li> <li>■ <b>SEQ</b></li> </ul>	<ul style="list-style-type: none"> <li>■ <b>SEQ</b></li> </ul>
<ul style="list-style-type: none"> <li>■ Machine is configured for axis angle</li> </ul>	<ul style="list-style-type: none"> <li>■ All <b>PLANE</b> functions can be used</li> </ul>	<ul style="list-style-type: none"> <li>■ Only <b>PLANE AXIAL</b> is executed</li> </ul>
<ul style="list-style-type: none"> <li>■ Programming an incremental spatial angle according to <b>PLANE AXIAL</b></li> </ul>	<ul style="list-style-type: none"> <li>■ Error message is issued</li> </ul>	<ul style="list-style-type: none"> <li>■ Incremental spatial angle is interpreted as an absolute value</li> </ul>
<ul style="list-style-type: none"> <li>■ Programming an incremental axis angle according to <b>PLANE SPATIAL</b> if the machine is configured for spatial angles</li> </ul>	<ul style="list-style-type: none"> <li>■ Error message is issued</li> </ul>	<ul style="list-style-type: none"> <li>■ Incremental axis angle is interpreted as an absolute value</li> </ul>
<ul style="list-style-type: none"> <li>■ Programming of <b>PLANE</b> functions with active Cycle 8 <b>MIRRORING</b></li> </ul>	<ul style="list-style-type: none"> <li>■ Mirroring has no influence on tilting by means of <b>PLANE AXIAL</b> and Cycle 19</li> </ul>	<ul style="list-style-type: none"> <li>■ Function is available with all <b>PLANE</b> functions</li> </ul>
<ul style="list-style-type: none"> <li>■ Axis positioning on machines with two rotary axes e.g., <b>L A+0 B+0 C+0</b> or <b>L A+Q120 B+Q121 C+Q122</b></li> </ul>	<ul style="list-style-type: none"> <li>■ Only possible after a tilting function (error message if without a tilting function)</li> <li>■ Parameters that are not defined are given the status <b>UNDEFINED</b>; they are not given the value 0</li> </ul>	<ul style="list-style-type: none"> <li>■ Possible at any time if spatial angles are used (machine parameter setting)</li> <li>■ The control assigns a value of 0 to parameters that are not defined</li> </ul>
<b>Special functions:</b>		
<ul style="list-style-type: none"> <li>■ FN 18</li> </ul>	<ul style="list-style-type: none"> <li>■ Values are always output in metric form</li> </ul>	<ul style="list-style-type: none"> <li>■ Values are output in the unit of the active NC program</li> </ul>
Compensation of tool length in the position display	The tool length entries <b>L</b> and <b>DL</b> from the tool table are taken into account in the position display, from <b>TOOL CALL</b> block depending on the machine parameter <b>progToolCallDL</b> (no. 124500), branch <b>CfgPositionDisplay</b> no. 124500)	The tool length entries <b>L</b> and <b>DL</b> from the tool table are taken into account in the position display

### Comparison: Differences in MDI operation

Function	TNC 620	iTNC 530
Miscellaneous functions	<ul style="list-style-type: none"> <li>■ Status display for Q parameters</li> <li>■ Block functions (e.g., <b>COPY BLOCK</b>)</li> <li>■ ACC setting</li> <li>■ Miscellaneous program functions, e.g. <b>FUNCTION DWELL</b></li> </ul>	
Skip NC blocks	Separate soft key for MDI mode	The soft key from the <b>Program Run Full Sequence</b> operating mode is effective

### Comparison: Differences in programming station

Function	TNC 620	iTNC 530
Demo version	NC programs with more than 100 NC blocks cannot be selected; an error message is issued	NC programs can be selected, max. 100 NC blocks are displayed, further NC blocks are truncated in the display
Demo version	If nesting with <b>PGM CALL</b> results in more than 100 NC blocks, there is no test graphic display; an error message is not issued	Nested NC programs can be simulated
Demo version	You can transfer up to 10 elements from the CAD viewer to an NC program.	You can transfer up to 31 lines from the DXF converter to an NC program.
Copying NC programs	Copying to and from the directory <b>TNC:\</b> is possible with Windows Explorer	<b>TNCremo</b> or file manager of programming station must be used for copying
Shifting the horizontal soft-key row	Clicking the soft-key bar shifts one soft-key row to the right or left	Clicking any soft-key bar activates the respective soft-key row



## Index

### 3

3-D basic rotation.....	223
3-D touch probe	
Calibrating.....	212
using.....	201

### A

About this manual.....	26
ACC.....	310
Accessories.....	122
Active Chatter Control.....	310
ADP.....	293
Automatic program start.....	295
Automatic tool measurement...	135
Axis display.....	67
Axis position, checking.....	165

### B

Backup.....	395
Basic rotation.....	220
measuring in Manual operation	
mode.....	220
Batch Process Manager.....	327
application.....	327
creating a job list.....	333
editing a job list.....	334
fundamentals.....	327
job list.....	328
opening.....	330
Behavior after receipt of ETX....	403
Block check character.....	403
Block scan.....	280
after a power failure.....	280
in a pallet table.....	285
in a point table.....	285
tool oriented.....	326
Browser.....	93
Bus Diagnosis.....	363

### C

Calling tool management.....	148
CAM programming.....	288
Checking the axis positions.....	187
Cleaning.....	63
Code number entry.....	341
Comparison of functions.....	505
Compensating workpiece	
misalignment	
By measuring two points on a	
straight surface.....	218
Condition of RTS line.....	403
Configuration data.....	478
Context-sensitive help.....	106
Control panel.....	62
Counter.....	312
Counter settings.....	348

### D

Data Backup.....	89, 395
Data interface.....	401
pin layout.....	495
setting up.....	401
Data transfer	
File system.....	403
Software.....	405
Data transmission	
Behavior after receipt of	
ETX.....	403
Block check character.....	403
Condition of RTS line.....	403
Data bits.....	402
Handshake.....	403
Parity.....	402
Protocol.....	402
Software TNC server.....	404
Stop bits.....	402
Datum table	
transferring probed values....	210
Diagnostics.....	363
Directory.....	80
Displaying an HTML file.....	93
Displaying an Internet file.....	93
Display screen.....	61
DNC.....	399
Downloading help files.....	110
DriveDiag.....	363

### E

EnDat encoder.....	165
Error message.....	99
deleting.....	102
filtering.....	101
help with.....	99
Ethernet interface.....	407
configuration.....	407, 414
connection possibility.....	407
introduction.....	407
Exporting the workpiece.....	261
Extended collision monitoring..	253
External access.....	352
External data transfer.....	87

### F

FCL function.....	33
Feature Content Level.....	33
Feed rate.....	181
changing.....	182
limiting.....	183
File	
importing.....	89
protecting.....	82
File management.....	78
external data transfer.....	87
External file types.....	80
File manager	

Calling.....	81
Directory.....	80
File type.....	78
Selecting files.....	83
File status.....	81
Firewall.....	398
FS functional safety.....	184
Functional Safety (FS).....	184
FUNCTION COUNT.....	312
Fundamentals.....	111

### G

Gestures.....	465
GOTO.....	266
Graphics.....	244
view options.....	246
Graphic settings.....	346
Graphic simulation.....	251
tool.....	247

### H

Handwheel.....	171
Hard disk.....	78
Hardware configuration.....	363
HEIDENHAIN OPC UA NC	
Server.....	453
Help system.....	106
Help with error message.....	99
HeROS	
information.....	363

### I

Import	
file from iTNC 530.....	89
table from iTNC 530.....	137
Indexed tool.....	129
Interrupt machining.....	272
iTNC 530.....	58

### J

Jumping	
with GOTO.....	266

### K

Kinematics.....	349
-----------------	-----

### L

Loading the machine configuration.	
342	
Login	
with password.....	443
with token.....	451

### M

M91, M92.....	302
Machine parameters.....	478
changing.....	478
changing the display.....	480
list.....	480

Machine settings.....	349
Manual axis.....	287
Manual datum setting	
circle center as preset.....	230
Manual datum setting.....	227
Manual presetting	
Corner as preset.....	229
On any axis.....	228
Setting a center line as	
preset.....	233
without a 3-D touch probe...	198
MDI.....	296
Measurement of machining	
time.....	254
Measuring workpieces.....	234
Miscellaneous functions.....	300
entering.....	300
For path behavior.....	305
For program run inspection.	301
For spindle and coolant.....	301
Miscellaneous functions for	
coordinate entries.....	302
Modes of Operation.....	64
MOD function.....	338
exiting.....	338
Overview.....	339
selecting.....	338
motion control.....	293
Move machine axes	
Jog positioning.....	170
Moving the machine axes.....	169
With axis direction keys.....	169
with the handwheel.....	171

**N**

NC error message.....	99
NC program	
structuring.....	269
Network connection.....	88
Network settings	
general.....	407
network drives.....	414

**O**

OPC UA NC Server.....	453
Opening a BMP file.....	97
Opening a GIF file.....	97
Opening a graphics file.....	97
Opening a JPG file.....	97
Opening an INI file.....	96
Opening a PNG file.....	97
Opening a TXT file.....	96
Opening a video file.....	97
Opening Excel files.....	92
Operating times.....	364
Option.....	30

**P**

Pallet table.....	316
Application.....	316
columns.....	316
editing.....	318
executing.....	320
inserting a column.....	319
selecting and exiting.....	319
tool-oriented.....	323
Path.....	80
PDF viewer.....	91
Pin layout	
data interface.....	495
Pocket table.....	140
Positioning.....	296
with manual data input.....	296
with tilted working plane.....	304
Post processor.....	289
Preset	
managing.....	189
Preset table.....	189, 189
transferring probed values....	211
Probing	
with a 3-D touch probe.....	201
With end mill.....	199
Probing a plane.....	223
Process chain.....	288
Program	
structuring.....	269
Program run.....	268
block scan.....	280
Interrupt.....	272
measuring.....	257
Overview.....	268
Resuming after interruption.	276
Retraction.....	277
running.....	268
skipping NC blocks.....	259
Program Test	
Overview.....	262
Protection zone.....	350

**Q**

Q parameters	
checking.....	270

**R**

Radio handwheel.....	174
configuring.....	359
Reference system.....	112
Basic.....	115
Input.....	119
Machine.....	113
Tool.....	120
Working plane.....	118
Workpiece.....	116
Remote Desktop Manager.....	366
external computer.....	372

private connection.....	376
VNC.....	371
Windows Terminal Service...	367
Restore.....	395
Retraction.....	277
After a power interruption....	277
Returning to the contour.....	286
Rotating, zooming and moving a	
graphic.....	250

**S**

Saving service files.....	105
Screen	
cleaning.....	476
touchscreen.....	462
Screen keypad.....	63, 63
Screen layout.....	62
Set BAUD rate.....	401
Set data transmission speed....	401
Shifting the sectional plane.....	252
Shut down.....	168
Software number.....	340
Software option.....	30
Spindle speed	
changing.....	182
Starting.....	164
Status display.....	67
Additional.....	70
axis.....	67
general.....	67
icon.....	68
technology.....	68
Stop at.....	265
Structuring NC programs.....	269
Superimposing handwheel	
positioning M118.....	305
Switching on.....	164
Switch off.....	168
System settings.....	362

**T**

Taskbar.....	380, 475
test run.....	294
executing up to a certain NC	
block.....	265
Execution.....	264
Setting speed.....	251
Text file	
opening.....	96
Tilting	
manual operation.....	237
Tilting the working plane	
manually.....	237
TNCdiag.....	363
TNCguide.....	106
TNCremo.....	405
Tool carrier management.....	157

Tool change.....	143	Selecting transmitter power.....	360
Tool data.....	126	Setting channel.....	360
entering into the table.....	133	Statistical data.....	361
Export.....	154	Wireless touch probe	
Import.....	154	Setup.....	355
indexing.....	137	Working space monitoring.....	<b>255</b>
Tool length.....	126	Workspace monitoring.....	264
Tool management.....	147	Writing probing values	
Editing.....	149	log.....	209
Tool types.....	152	to the datum table.....	210
Tool measurement.....	135	to the preset table.....	211
Tool name.....	126		
Tool number.....	126		
Tool-oriented machining.....	323		
Tool radius.....	127		
Tool table.....	128		
edit, exit.....	136		
editing functions.....	136		
filter function.....	130		
fundamentals.....	128		
importing.....	137		
input options.....	133		
Tool usage file.....	144, <b>352</b>		
Tool usage test.....	144		
Touch gestures.....	465		
Touch operating panel.....	463		
Touch probe cycles.....	203		
manual.....	203		
Manual operation mode.....	203		
Touch probe with radio			
transmission			
Configuration.....	357		
Touchscreen.....	462		
cleaning.....	476		
configuration.....	476		
Traverse limits.....	350		
Traverse reference point.....	164		

## U

USB device	
Connecting.....	85
Removing.....	86
User administration.....	418
configuration.....	419
deactivating.....	421
User parameters.....	478, 480
Using touch probe functions with	
mechanical probes or measuring	
dials.....	200

## V

Version number.....	<b>340</b>
Version numbers.....	342

## W

Window Manager.....	379
Wireless handwheel	
Assign handwheel holder.....	359

# HEIDENHAIN

---

**DR. JOHANNES HEIDENHAIN GmbH**

Dr.-Johannes-Heidenhain-Straße 5

**83301 Traunreut, Germany**

☎ +49 8669 31-0

FAX +49 8669 32-5061

E-mail: [info@heidenhain.de](mailto:info@heidenhain.de)

---

**Technical support** FAX +49 8669 32-1000

**Measuring systems** ☎ +49 8669 31-3104

E-mail: [service.ms-support@heidenhain.de](mailto:service.ms-support@heidenhain.de)

**NC support** ☎ +49 8669 31-3101

E-mail: [service.nc-support@heidenhain.de](mailto:service.nc-support@heidenhain.de)

**NC programming** ☎ +49 8669 31-3103

E-mail: [service.nc-pgm@heidenhain.de](mailto:service.nc-pgm@heidenhain.de)

**PLC programming** ☎ +49 8669 31-3102

E-mail: [service.plc@heidenhain.de](mailto:service.plc@heidenhain.de)

**APP programming** ☎ +49 8669 31-3106

E-mail: [service.app@heidenhain.de](mailto:service.app@heidenhain.de)

---

[www.heidenhain.de](http://www.heidenhain.de)

[www.klartext-portal.com](http://www.klartext-portal.com)

The Information Site for  
HEIDENHAIN Controls

## Klartext App

The Klartext on Your  
Mobile Device

Google  
Play Store

Apple  
App Store



---

## Touch probes from HEIDENHAIN

help you reduce non-productive time and improve the  
dimensional accuracy of the finished workpieces.


### Workpiece touch probes

**TS 248, TS 260** Signal transmission by cable

**TS 460** Radio or infrared transmission

**TS 640, TS 740** Infrared transmission

- Workpiece alignment
- Preset setting
- Workpiece measurement

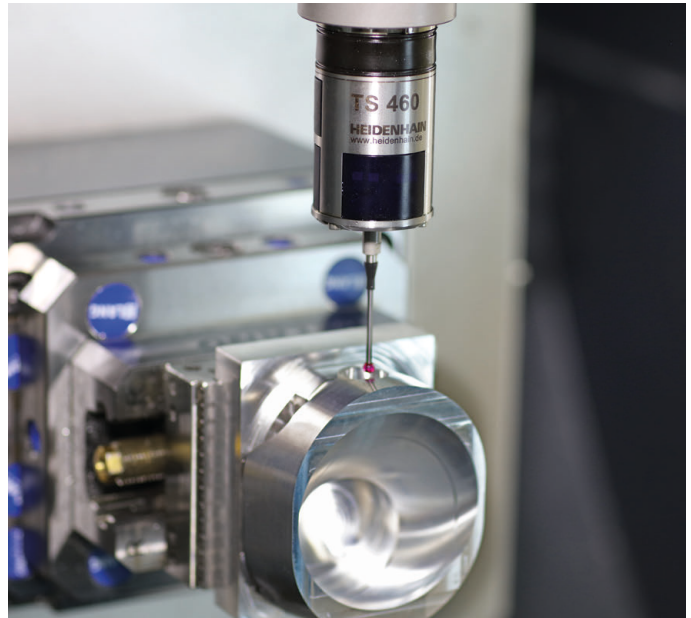

### Tool touch probes

**TT 160** Signal transmission by cable

**TT 460** Infrared transmission

- Tool measurement
- Wear monitoring
- Tool breakage detection

