




HEIDENHAIN

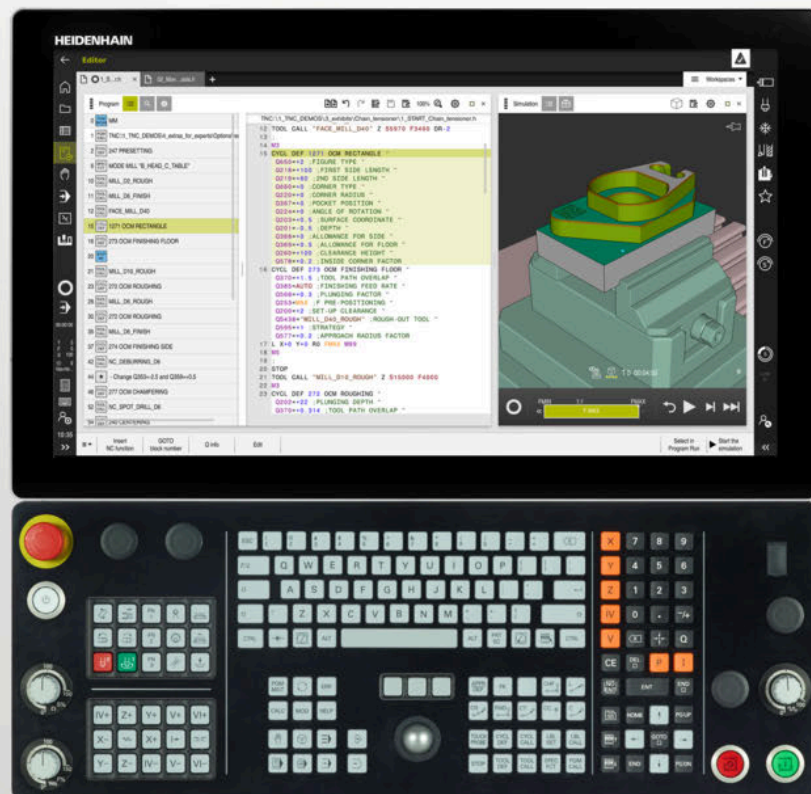

TNC7

User's Manual
Programming and Testing

NC Software
817620-16
817621-16
817625-16

English (en)
01/2022

Contents

1	About the User's Manual.....	29
2	About the Product.....	39
3	First Steps.....	75
4	NC and Programming Fundamentals.....	97
5	Technology-Specific NC Programming.....	121
6	Workpiece Blank.....	143
7	Tools.....	153
8	Path Functions.....	167
9	Programming Techniques.....	209
10	Coordinate Transformation.....	221
11	Compensations.....	303
12	Files.....	333
13	Collision Monitoring.....	351
14	Control Functions.....	365
15	Monitoring.....	375
16	Multiple-Axis Machining.....	381
17	Miscellaneous Functions.....	411
18	Variable Programming.....	453
19	Graphical Programming.....	515
20	User Aids.....	533
21	Simulation Workspace.....	557
22	Pallet Machining and Job Lists.....	577
23	Tables.....	591
24	Overviews.....	621

1	About the User's Manual.....	29
1.1	Target group: Users.....	30
1.2	Available user documentation.....	31
1.3	Types of notes used.....	32
1.4	Notes on using NC programs.....	33
1.5	User's Manual as integrated product help: TNCguide.....	34
1.5.1	Search in TNCguide.....	37
1.5.2	Copying NC examples to clipboard.....	37
1.6	Contact to the editorial staff.....	37

2	About the Product.....	39
2.1	The TNC7.....	40
2.1.1	Proper and intended operation.....	40
2.1.2	Intended place of operation.....	41
2.2	Safety precautions.....	42
2.3	Software.....	45
2.3.1	Software options.....	45
2.3.2	Feature Content Level.....	52
2.3.3	Information on licensing and use.....	52
2.4	Hardware.....	53
2.4.1	Monitor.....	53
2.4.2	Keyboard unit.....	55
2.5	Areas of the control's user interface.....	58
2.6	Overview of operating modes.....	59
2.7	Workspaces.....	61
2.7.1	Operating elements within the workspaces.....	61
2.7.2	Symbols within the workspaces.....	62
2.7.3	Overview of workspaces.....	62
2.8	Operating elements.....	65
2.8.1	Common gestures for the touchscreen.....	65
2.8.2	Operating elements of the keyboard unit.....	65
2.8.3	Icons on the control's user interface.....	71
2.8.4	Desktop menu workspace.....	73

3	First Steps.....	75
3.1	Chapter overview.....	76
3.2	Switching the machine and the control on.....	76
3.3	Programming and simulating a workpiece.....	78
3.3.1	Example task 1339889.....	78
3.3.2	Selecting the Editor operating mode.....	79
3.3.3	Configuring the control's user interface for programming.....	79
3.3.4	Creating a new NC program.....	80
3.3.5	Defining the workpiece blank.....	81
3.3.6	Structure of an NC program.....	83
3.3.7	Contour approach and departure.....	85
3.3.8	Programming a simple contour.....	86
3.3.9	Configuring the control's user interface for simulation.....	93
3.3.10	Simulating an NC program.....	94
3.4	Switching the machine off.....	95

4	NC and Programming Fundamentals.....	97
4.1	NC fundamentals.....	98
4.1.1	Programmable axes.....	98
4.1.2	Designation of the axes on milling machines.....	98
4.1.3	Position encoders and reference marks.....	99
4.1.4	Presets in the machine.....	99
4.2	Programming possibilities.....	101
4.2.1	Path functions.....	101
4.2.2	Graphical programming.....	101
4.2.3	Miscellaneous functions M.....	101
4.2.4	Subprograms and program-section repeats.....	101
4.2.5	Programming with variables.....	102
4.2.6	CAM programs.....	102
4.3	Programming fundamentals.....	102
4.3.1	Contents of an NC program.....	102
4.3.2	Editor operating mode.....	104
4.3.3	Program workspace.....	106
4.3.4	Editing NC programs.....	114

5	Technology-Specific NC Programming.....	121
5.1	Switching the operating mode with FUNCTION MODE.....	122
5.2	Turning (option 50).....	124
5.2.1	Fundamentals.....	124
5.2.2	Technology values for turning operations.....	126
5.2.3	Inclined turning.....	128
5.2.4	Simultaneous turning.....	130
5.2.5	Turning operation with FreeTurn tools.....	132
5.2.6	Unbalance in turning operations.....	134
5.3	Grinding operations (option 156).....	136
5.3.1	Fundamentals.....	136
5.3.2	Jig grinding.....	138
5.3.3	Dressing.....	138
5.3.4	Activating dressing mode with FUNCTION DRESS.....	140

6	Workpiece Blank.....	143
6.1	Defining a workpiece blank with BLK FORM.....	144
6.1.1	Cuboid workpiece blank with BLK FORM QUAD.....	146
6.1.2	Cylindrical workpiece blank with BLK FORM CYLINDER.....	147
6.1.3	Rotationally symmetric workpiece blank with BLK FORM ROTATION.....	148
6.1.4	STL file as workpiece blank with BLK FORM FILE.....	149
6.2	Blank form update in turning mode with FUNCTION TURNDATA BLANK (option 50).....	150

7	Tools.....	153
7.1	Fundamentals.....	154
7.2	Presets on the tool.....	154
7.2.1	Tool carrier reference point.....	155
7.2.2	Tool tip TIP.....	156
7.2.3	Tool center point (TCP, tool center point).....	157
7.2.4	Tool location point (TLP, tool location point).....	157
7.2.5	Tool rotation point (TRP, tool rotation point).....	158
7.2.6	Tool radius 2 center (CR2, center R2).....	158
7.3	Tool call.....	159
7.3.1	Tool call by TOOL CALL.....	159
7.3.2	Cutting data.....	162
7.3.3	Tool pre-selection by TOOL DEF.....	165

8	Path Functions.....	167
8.1	Fundamentals of coordinate definitions.....	168
8.1.1	Cartesian coordinates.....	168
8.1.2	Polar coordinates.....	168
8.1.3	Absolute entries.....	169
8.1.4	Incremental entries.....	170
8.2	Fundamentals of path functions.....	171
8.3	Path functions with Cartesian coordinates.....	174
8.3.1	Overview of path functions.....	174
8.3.2	Straight line L.....	175
8.3.3	Chamfer CHF.....	175
8.3.4	Rounding RND.....	177
8.3.5	Circle center point CC.....	178
8.3.6	Circular path C.....	178
8.3.7	Circular path CR.....	180
8.3.8	Circular path CT.....	181
8.3.9	Circular path in another plane.....	183
8.3.10	Example: Cartesian path functions.....	184
8.4	Path functions with polar coordinates.....	184
8.4.1	Overview of polar coordinates.....	184
8.4.2	Polar coordinate datum at pole CC.....	185
8.4.3	Straight line LP.....	186
8.4.4	Circular path CP around pole CC.....	187
8.4.5	Circular path CTP.....	188
8.4.6	Helix.....	189
8.4.7	Example: Polar straight lines.....	194
8.5	Approaching and departing from a contour.....	195
8.5.1	Overview of path shapes.....	195
8.5.2	Positions for approach and departure.....	197
8.5.3	Approach functions APPR LT and APPR PLT.....	198
8.5.4	Approach functions APPR LN and APPR PLN.....	199
8.5.5	Approach functions APPR CT and APPR PCT.....	200
8.5.6	Approach functions APPR LCT and APPR PLCT.....	201
8.5.7	Departure function DEP LT.....	203
8.5.8	Departure function DEP LN.....	203
8.5.9	Departure function DEP CT.....	205
8.5.10	Departure functions DEP LCT and DEP PLCT.....	206

9	Programming Techniques.....	209
9.1	Subprograms and program section repeats with the label LBL.....	210
9.2	Selection functions.....	214
9.2.1	Overview of selection functions.....	214
9.2.2	Calling an NC program with PGM CALL.....	214
9.2.3	Selecting an NC program and calling it with SEL PGM and CALL SELECTED PGM.....	216
9.3	Nesting of programming techniques.....	218
9.3.1	Example.....	219

10	Coordinate Transformation.....	221
10.1	Reference systems.....	222
10.1.1	Overview.....	222
10.1.2	Basics of coordinate systems.....	223
10.1.3	Machine coordinate system M-CS.....	223
10.1.4	Basic coordinate system B-CS.....	226
10.1.5	Workpiece coordinate system W-CS.....	228
10.1.6	Working plane coordinate system WPL-CS.....	230
10.1.7	Input coordinate system I-CS.....	232
10.1.8	Tool coordinate system T-CS.....	234
10.2	NC functions for preset management.....	237
10.2.1	Overview.....	237
10.2.2	Activating the preset with PRESET SELECT.....	237
10.2.3	Copying the preset with PRESET COPY.....	238
10.2.4	Correcting the preset with PRESET CORR.....	239
10.3	Datum table.....	240
10.3.1	Activating the datum table in the NC program.....	241
10.4	NC functions for coordinate transformation.....	242
10.4.1	Overview.....	242
10.4.2	Datum shift with TRANS DATUM.....	242
10.4.3	Mirroring with TRANS MIRROR.....	244
10.4.4	Rotations with TRANS ROTATION.....	246
10.4.5	Scaling with TRANS SCALE.....	248
10.5	Tilting the working plane (option 8).....	249
10.5.1	Fundamentals.....	249
10.5.2	Tilting the working plane with PLANE functions (option 8).....	250
10.6	Inclined machining (option 9).....	293
10.7	Compensating the tool angle of inclination with FUNCTION TCPM (option 9).....	295

11 Compensations.....	303
11.1 Tool compensation for tool length and radius.....	304
11.2 Tool radius compensation.....	306
11.3 Tooth radius compensation for turning tools (option 50).....	309
11.4 Tool compensation with compensation tables.....	312
11.4.1 Selecting a compensation table with SEL CORR-TABLE.....	314
11.4.2 Activating a compensation value with FUNCTION CORRDATA.....	314
11.5 Compensating turning tools with FUNCTION TURNDATA CORR (option 50).....	315
11.6 3D tool compensation (option 9).....	317
11.6.1 Fundamentals.....	317
11.6.2 Straight line LN.....	318
11.6.3 Tools for 3D tool compensation.....	319
11.6.4 3D tool compensation during face milling (option 9).....	321
11.6.5 3D tool compensation during peripheral milling (option 9).....	326
11.6.6 3D tool compensation with the entire tool radius with FUNCTION PROG PATH (option 9).....	328
11.7 3D radius compensation depending on the tool contact angle (option 92).....	330

12 Files.....	333
12.1 File management.....	334
12.1.1 Basic information.....	334
12.1.2 Open File workspace.....	343
12.1.3 Quick selection workspace.....	344
12.1.4 Adapting an iTNC 530 file.....	344
12.1.5 USB devices.....	345
12.2 Programmable file functions.....	347

13 Collision Monitoring.....	351
13.1 Dynamic Collision Monitoring (DCM, option 40).....	352
13.1.1 Activating Dynamic Collision Monitoring (DCM) for the simulation.....	356
13.1.2 Activating the graphic display of the collision objects.....	356
13.1.3 FUNCTION DCM: Deactivating and activating Dynamic Collision Monitoring (DCM) in NC programs.....	357
13.2 Fixture monitoring (option 40).....	358
13.2.1 Fundamentals.....	358
13.2.2 Loading and removing fixtures using the FIXTURE function (option 40).....	360
13.3 Advanced checks in the simulation.....	361
13.4 Automatic tool liftoff with FUNCTION LIFTOFF.....	362

14 Control Functions.....	365
14.1 Adaptive Feed Control (AFC, option 45).....	366
14.1.1 Fundamentals.....	366
14.1.2 Activating and deactivating AFC.....	368
14.2 Functions for controlling program run.....	371
14.2.1 Overview.....	371
14.2.2 Pulsing spindle speed with FUNCTION S-PULSE.....	372
14.2.3 Programmed dwell time with FUNCTION DWELL.....	373
14.2.4 Cyclic dwell time with FUNCTION FEED DWELL.....	373

15 Monitoring.....	375
15.1 Component Monitoring with MONITORING HEATMAP (option 155).....	376
15.2 Process Monitoring (option 168).....	378
15.2.1 Fundamentals.....	378
15.2.2 Defining monitoring sections with MONITORING SECTION (option 168).....	379

16 Multiple-Axis Machining.....	381
16.1 Working with the parallel axes U, V and W.....	382
16.1.1 Fundamentals.....	382
16.1.2 Defining behavior when positioning parallel axes with FUNCTION PARAXCOMP.....	382
16.1.3 Select three linear axes for machining with FUNCTION PARAXMODE.....	384
16.1.4 Parallel axes in conjunction with machining cycles.....	385
16.1.5 Example.....	386
16.2 Using the facing head with FACING HEAD POS (option 50).....	386
16.3 Machining with polar kinematics with FUNCTION POLARKIN.....	390
16.3.1 Example: SL cycles in the polar kinematics.....	394
16.4 CAM-generated NC programs.....	395
16.4.1 Output formats of NC programs.....	396
16.4.2 Types of machining according to number of axes.....	398
16.4.3 Process steps.....	400
16.4.4 Functions and function packages.....	407

17 Miscellaneous Functions.....	411
17.1 Miscellaneous functions M and the STOP function.....	412
17.1.1 Programming the STOP function.....	412
17.2 Overview of miscellaneous functions.....	413
17.3 Miscellaneous functions for coordinate entries.....	416
17.3.1 Traversing in the machine coordinate system M-CS with M91.....	416
17.3.2 Traversing in the M92 coordinate system with M92.....	417
17.3.3 Traversing in the non-tilted input coordinate system I-CS with M130.....	418
17.4 Miscellaneous functions for path behavior.....	419
17.4.1 Reducing the display for rotary axes to under 360° with M94.....	419
17.4.2 Machining small contour steps with M97.....	420
17.4.3 Machining open contour corners with M98.....	421
17.4.4 Reducing the feed rate for infeed movements with M103.....	422
17.4.5 Adapting the feed rate for circular paths with M109.....	423
17.4.6 Reducing the feed rate for internal radii with M110.....	424
17.4.7 Interpreting the feed rate for rotary axes as mm/min with M116 (option 8).....	425
17.4.8 Activating handwheel superimpositioning with M118.....	426
17.4.9 Pre-calculating a radius-compensated contour with M120.....	428
17.4.10 Shorter-path traversing of rotary axes with M126.....	431
17.4.11 Automatically compensating for tool inclination with M128 (option 9).....	432
17.4.12 Interpreting the feed rate as mm/rev with M136.....	437
17.4.13 Taking rotary axes into account during machining operations with M138.....	438
17.4.14 Retracting in the tool axis with M140.....	439
17.4.15 Rescinding basic rotations with M143.....	441
17.4.16 Factoring the tool offset into the calculations with M144 (option 9).....	442
17.4.17 Automatically lifting off upon an NC stop or a power failure with M148.....	444
17.4.18 Preventing rounding off of outside corners with M197.....	445
17.5 Miscellaneous functions for tools.....	447
17.5.1 Automatically inserting a replacement tool with M101.....	447
17.5.2 Permitting positive tool oversizes with M107 (option 9).....	449
17.5.3 Checking the radius of the replacement tool with M108.....	451
17.5.4 Suppressing touch probe monitoring with M141.....	451

18 Variable Programming.....	453
18.1 Overview of variable programming.....	454
18.2 Variables: Q, QL, QR and QS parameters.....	454
18.2.1 Basics.....	454
18.2.2 Preassigned Q parameters.....	459
18.2.3 Basic arithmetic folder.....	464
18.2.4 Trigonometric functions folder.....	466
18.2.5 Circle calculation folder.....	468
18.2.6 Jump commands folder.....	469
18.2.7 Special functions for programming with variables.....	470
18.2.8 Functions for freely definable tables.....	482
18.2.9 Formulas in the NC program.....	484
18.3 String functions.....	487
18.3.1 Assigning text to a QS parameter.....	491
18.3.2 Linking QS parameters.....	491
18.3.3 Converting variable text content to numeric values.....	492
18.3.4 Converting variable numeric values to text content.....	492
18.3.5 Copying a substring from a QS parameter.....	492
18.3.6 Searching for a substring within the content of a QS parameter.....	492
18.3.7 Determining the total number of characters in a QS parameter.....	492
18.3.8 Comparing the alphabetical order of two QS parameter contents.....	493
18.3.9 Accepting the contents of a machine parameter.....	493
18.4 Defining counters with FUNCTION COUNT.....	494
18.4.1 Example.....	495
18.5 Table access with SQL statements.....	495
18.5.1 Fundamentals.....	495
18.5.2 Binding a variable to a table column with SQL BIND.....	497
18.5.3 Reading out a table value with SQL SELECT.....	499
18.5.4 Executing SQL statements with SQL EXECUTE.....	501
18.5.5 Reading a line from a result set with SQL FETCH.....	505
18.5.6 Discarding changes to a transaction using SQL ROLLBACK.....	506
18.5.7 Completing a transaction with SQL COMMIT.....	508
18.5.8 Changing the row of a result set with SQL UPDATE.....	509
18.5.9 Creating a new row in the result set with SQL INSERT.....	511
18.5.10 Example.....	513

19 Graphical Programming.....	515
19.1 Fundamentals.....	516
19.1.1 Creating a new contour.....	523
19.1.2 Locking and unlocking elements.....	523
19.2 Importing contours into graphical programming.....	524
19.2.1 Importing contours.....	526
19.3 Exporting contours from graphical programming.....	527
19.4 First steps in graphical programming.....	530
19.4.1 Example task D1226664.....	530
19.4.2 Drawing a sample contour.....	531
19.4.3 Exporting a drawn contour.....	532

20 User Aids.....	533
20.1 Help workspace.....	534
20.2 Virtual keyboard of the control bar.....	536
20.2.1 Opening and closing the virtual keyboard.....	539
20.3 GOTO function.....	539
20.3.1 Selecting an NC block with GOTO.....	539
20.4 Adding comments.....	540
20.4.1 Adding a comment as an NC block.....	540
20.4.2 Adding a comment in an NC block.....	540
20.4.3 Commenting an NC block out or in.....	541
20.5 Hiding NC blocks.....	541
20.5.1 Hiding or showing NC blocks.....	541
20.6 Structuring of NC programs.....	541
20.6.1 Adding a structure item.....	542
20.7 Structure column in the Program workspace.....	542
20.7.1 Editing an NC block using the structure.....	544
20.8 Search column in the Program workspace.....	544
20.8.1 Search for and replace syntax elements.....	546
20.9 Program comparison.....	547
20.9.1 Applying differences to the active NC program.....	548
20.10 Context menu.....	548
20.11 Calculator.....	552
20.11.1 Opening and closing the calculator.....	553
20.11.2 Selecting a result from the history.....	553
20.11.3 Deleting the history.....	553
20.12 Cutting data calculator.....	553
20.12.1 Opening the cutting data calculator.....	555
20.12.2 Calculating the cutting data with tables.....	556

21 Simulation Workspace.....	557
21.1 Fundamentals.....	558
21.2 Pre-defined views.....	566
21.3 Exporting a simulated workpiece as STL file.....	567
21.3.1 Saving a simulated workpiece as STL file.....	569
21.4 Measuring function.....	569
21.4.1 Measuring the difference between the workpiece blank and the finished part.....	571
21.5 Cutout view in the simulation.....	571
21.5.1 Shifting the sectional plane.....	572
21.6 Model comparison.....	572
21.7 Center of rotation in the simulation.....	573
21.7.1 Setting the center of rotation to a corner of the simulated workpiece.....	574
21.8 Simulation speed.....	574
21.9 Simulating an NC program up to a certain NC block.....	575
21.9.1 Simulating an NC program up to a certain NC block.....	576

22 Pallet Machining and Job Lists.....	577
22.1 Fundamentals.....	578
22.1.1 Pallet counter.....	578
22.2 Job list workspace.....	578
22.2.1 Fundamentals.....	578
22.2.2 Batch Process Manager (option 154).....	582
22.3 Form workspace for pallets.....	585
22.4 Tool-oriented machining.....	586
22.5 Pallet preset table.....	589

23 Tables.....	591
23.1 Tables operating mode.....	592
23.1.1 Editing the contents of tables.....	593
23.2 Table workspace.....	593
23.3 Form workspace for tables.....	597
23.4 Accessing table values.....	599
23.4.1 Fundamentals.....	599
23.4.2 Reading table values with TABDATA READ.....	600
23.4.3 Writing table values with TABDATA WRITE.....	601
23.4.4 Adding table values with TABDATA ADD.....	601
23.5 Freely definable tables.....	602
23.5.1 Creating freely definable tables.....	603
23.6 Point table.....	603
23.6.1 Creating a point table.....	605
23.6.2 Hiding individual points during machining.....	605
23.7 Datum table.....	605
23.7.1 Creating a datum table.....	607
23.7.2 Editing a datum table.....	607
23.8 Tables for cutting data calculation.....	608
23.9 Pallet table.....	611
23.9.1 Creating and opening a pallet table.....	614
23.10 Compensation tables.....	615
23.10.1 Overview.....	615
23.10.2 Compensation table *.tco.....	615
23.10.3 Compensation table *.wco.....	617
23.10.4 Creating a compensation table.....	618
23.11 *.3DTC compensation table.....	618

24	Overviews.....	621
24.1	Preassigned error numbers for FN 14: ERROR.....	622
24.2	System data.....	628
24.2.1	List of FN functions.....	628

1

**About the
User's Manual**

1.1 Target group: Users

A user is anyone who uses the control to perform at least one of the following tasks:

- Operating the machine
 - Setting up tools
 - Setting up workpieces
 - Machining workpieces
 - Eliminating possible errors during program run
- Creating and testing NC programs
 - Creating NC programs at the control or externally using a CAM system
 - Using the Simulation mode to test the NC programs
 - Eliminating possible errors during program test

The depth of information in the User's Manual results in the following qualification requirements on the user:

- Basic technical understanding, e.g. ability to read technical drawings and spatial imagination
- Basic knowledge in the field of metal cutting, e.g. meaning of material-specific parameters
- Safety instructions, e.g. possible dangers and their avoidance
- Training on the machine, e.g. axis directions and machine configuration



HEIDENHAIN offers separate information products for other target groups:

- Leaflets and overview of the product program for potential buyers
- Service Manual for service technicians
- Technical Manual for machine manufacturers

Additionally, HEIDENHAIN provides users and lateral entrants with a wide range of training opportunities in the field of NC programming

HEIDENHAIN training portal

In line with the target group, this User's Manual only contains information on the operation and use of the control. The information products for other target groups contain information on further product life phases.

1.2 Available user documentation

User's Manual

HEIDENHAIN refers to this information product as User's Manual, regardless of the output or transport medium. Well-known designations with the same meaning include operator's manual and operating instructions.

The User's Manual for the control is available in the variants below:

- As a printed version, sub-divided into the modules below:
 - The **Setting up and running** User's Manual contains all information needed for setting up the machine and for running NC programs.
ID: 1358774-xx
 - The **Programming and testing** User's Manual contains all information needed for creating and testing NC programs. Touch probe and machining cycles are not included.
ID for Klartext programming: 1358773-xx
 - The **machining cycles** User's Manual contains all functions of the machining cycles.
ID: 1358775-xx
 - The **Measuring cycles for Workpieces and Tools** User's Manual contains all functions of the touch probe cycles.
ID: 1358777-xx

- As PDF files, sub-divided according to the printed versions or as complete PDF, containing all modules

TNCguide

- As HTML file for use as an integrated product help **TNCguide** directly on the control

TNCguide

The User's Manual supports you in the safe handling of the control according to its intended use.

Further information: "Proper and intended operation", Page 40

Further information products for users

The following information products are available to you as users:

- **Overview of new and modified software functions** informs you about the innovations of specific software versions.
TNCguide
- **HEIDENHAIN brochures** inform you about products and services by HEIDENHAIN, e.g. software options of the control.
HEIDENHAIN brochures
- The **NC Solutions** database offers solutions for frequently occurring tasks.
HEIDENHAIN NC solutions

1.3 Types of notes used

Safety precautions

Comply with all safety precautions indicated in this document and in your machine manufacturer's documentation!

Precautionary statements warn of hazards in handling software and devices and provide information on their prevention. They are classified by hazard severity and divided into the following groups:

⚠ DANGER
Danger indicates hazards for persons. If you do not follow the avoidance instructions, the hazard will result in death or severe injury .
⚠ WARNING
Warning indicates hazards for persons. If you do not follow the avoidance instructions, the hazard could result in death or serious injury .
⚠ CAUTION
Caution indicates hazards for persons. If you do not follow the avoidance instructions, the hazard could result in minor or moderate injury .
NOTICE
Notice indicates danger to material or data. If you do not follow the avoidance instructions, the hazard could result in property damage .

Sequence of information in precautionary statements

All precautionary statements contain the following four sections:

- Signal word indicating the hazard severity
- Type and source of hazard
- Consequences of ignoring the hazard, e.g.: "There is danger of collision during subsequent machining operations"
- Escape – hazard prevention measures

Informational notes

Observe the informational notes provided in these instructions to ensure reliable and efficient operation of the software.

In these instructions, you will find the following informational notes:



The information symbol indicates a **tip**.
A tip provides additional or supplementary information.



This symbol prompts you to follow the safety precautions of your machine manufacturer. This symbol also indicates machine-dependent functions. Possible hazards for the operator and the machine are described in the machine manual.



The book symbol represents a **cross reference** to external documentation, e.g. the documentation of your machine manufacturer or other supplier.

Have you found any errors or would you like to suggest changes?

We continuously strive to improve our documentation for you. Please help us by sending your suggestions to the following e-mail address:

tnc-userdoc@heidenhain.de

1.4 Notes on using NC programs

NC programs contained in this User's Manual are suggestions for solutions. The NC programs or individual NC blocks must be adapted before being used on a machine.

Change the following contents as needed:

- Tools
- Cutting parameters
- Feed rates
- Clearance height or safe position
- Machine-specific positions, e.g. with **M91**
- Paths of program calls

Some NC programs depend on the machine kinematics. Adapt these NC programs to your machine kinematics before the first test run.

In addition, test the NC programs using the simulation before the actual program run.



With a program test you determine whether the NC program can be used with the available software options, the active machine kinematics and the current machine configuration.

1.5 User's Manual as integrated product help: TNCguide

Application

The integrated product help **TNCguide** offers the full content of all User's Manuals.

Further information: "Available user documentation", Page 31

The User's Manual supports you in the safe handling of the control according to its intended use.

Further information: "Proper and intended operation", Page 40

Requirement

In the factory default setting, the control offers the integrated product help **TNCguide** in German and English language versions.

If the control cannot find a **TNCguide** language version matching the selected dialog language, it opens **TNCguide** in English.

If the control cannot find a **TNCguide** language version, it opens an information page with instructions. With the link available there and the steps provided, you can supplement the files missing in the control.



You can also open the information page manually by selecting the **index.html** e.g. at **TNC:\tncguide\en\readme**. The path depends on the desired language version, e.g. **en** for English.

With the steps provided you can also update the **TNCguide** version. Updating may be required e.g. after a software update.

Description of function

The integrated **TNCguide** product help can be selected within the **Help** application or in the **Help** workspace.


Further information: "Help application", Page 35

Further information: "Help workspace", Page 534

Operation of **TNCguide** is identical in both cases.

Further information: "Symbols", Page 36

Help application

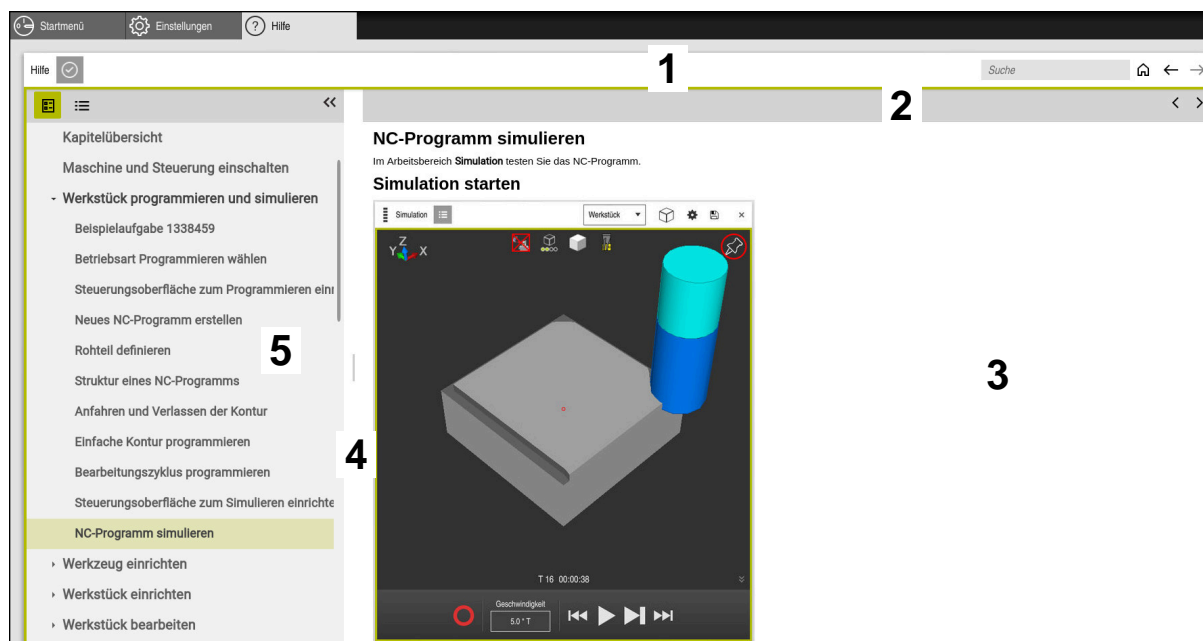






Help application with open TNCguide

The **Help** application includes the following areas:








- 1 Title bar in the **Help** application
Further information: "Symbols in the Help application", Page 36
- 2 Title bar of the integrated **TNCguide** product help
Further information: "Symbols in the integrated TNCguide product help ", Page 36
- 3 Content column of **TNCguide**
- 4 Separator between the columns of **TNCguide**
 Adjust the column width by means of the separator.
- 5 Navigation column of **TNCguide**

Symbols

Symbols in the Help application

Symbol	Function
	<p>Show start page</p> <p>The start page displays all available documentation. Select the desired documentation, using a navigation tiles, e.g. TNCguide.</p> <p>If only one piece of documentation is available, the control opens the content directly.</p> <p>When a documentation is open, you can use the search function.</p>
	Displaying tutorials
	Navigating between the last opened contents
	
	<p>Displaying or hiding search results</p> <p>Further information: "Search in TNCguide", Page 37</p>

Symbols in the integrated TNCguide product help

Symbol	Function
	<p>Display documentation structure</p> <p>The structure consists of the content headings.</p> <p>The structure serves for main navigation within the documentation.</p>
	<p>Display documentation index</p> <p>The index consists of important keywords.</p> <p>The index serves as an alternative navigation within the documentation.</p>
	Display previous or next page within the documentation
	
	Display or hide the navigation
	
	<p>Copy NC examples to clipboard</p> <p>Further information: "Copying NC examples to clipboard", Page 37</p>

1.5.1 Search in TNCguide

Using the search function, you can search for the entered search terms within the open documentation.

Use the search function as follows:

- ▶ Enter a character string



The entry field is located in the title bar, to the left of the Home symbol that you use for navigating to the start page.

The search starts automatically after you have entered e.g. a letter.

If you wish to delete the entry, use the X symbol within the entry field.

- > The control opens the column containing the search results.
- > The control marks references also within open content pages.
- ▶ Select the reference
- > The control opens the selected content.
- > The control continues displaying the results of the last search.
- ▶ Select an alternative reference if necessary
- ▶ Enter a new character string if required

1.5.2 Copying NC examples to clipboard

Use the copy function to copy NC examples from the documentation to the NC editor.

To use the copy function:

- ▶ Navigate to the desired NC example
- ▶ **Notes on using NC programs** Expand
- ▶ **Notes on using NC programs** Read and pay attention to
Further information: "Notes on using NC programs", Page 33



- ▶ Copy NC example to clipboard



- > The button switches colors while copying.
- > The clipboard contains the entire content of the copied NC example.
- ▶ Insert the NC example into the NC program
- ▶ Adapt the inserted contents according to the **Notes on using NC programs**
- ▶ Use the Simulation mode to test the NC program
Further information: "Simulation Workspace", Page 557

1.6 Contact to the editorial staff

Have you found any errors or would you like to suggest changes?

We continuously strive to improve our documentation for you. Please help us by sending your suggestions to the following e-mail address:

tnc-userdoc@heidenhain.de

2

About the Product

2.1 The TNC7

Every HEIDENHAIN control supports you with dialog-guided programming and finely detailed simulation. The TNC7 additionally offers you graphical or form-based programming to reach the desired result safe and sound.

Software options and optional hardware extensions can be used for flexibly increasing the range of functions and ease of use.

Such an extension provides e.g. the chance to perform turning and grinding in addition to milling and drilling processes.

Further information: "Technology-Specific NC Programming", Page 121

The ease of use increases e.g. when using touch probes, handwheels or a 3D mouse.

Further information: User's Manual for Setup and Program Run

Definitions

Abbreviation	Definition
TNC	TNC is derived from the acronym CNC (computerized numerical control). The T (tip or touch) represents the possibility to enter NC programs directly at the control or to program them graphically using gestures.
7	The product number indicates the control generation. The range of functions depends on the enabled software options.

2.1.1 Proper and intended operation

The information about the proper and intended operation supports you as user in the safe handling of a product such as a machine tool.

The control is a machine component but not a complete machine. This User's Manual describes the use of the control. Before using the machine including the control, take the OEM documentation to inform yourself about the safety-related aspects, the necessary safety equipment as well as the requirements on the qualified personnel.



HEIDENHAIN sells controls designed for milling and turning machines as well as for machining centers with up to 24 axes. If you as a user face a different constellation, then contact the owner immediately.

HEIDENHAIN contributes additionally to enhancing your safety and that of your products, notably by taking into consideration the customer feedback. This results e.g. in function adaptations of the controls and safety precautions in the information products.



Contribute actively to increasing the safety by reporting any missing or misleading information.

Further information: "Contact to the editorial staff", Page 37

2.1.2 Intended place of operation

In accordance with DIN EN 50370-1 standard referring to electromagnetic compatibility (EMC), the control is approved for use in industrial environments.

Definitions

Guideline	Definition
DIN EN 50370-1:2006-02	This standard deals, among other things, with interference emissions and immunity to interference of machine tools.

2.2 Safety precautions

Comply with all safety precautions indicated in this document and in your machine manufacturer's documentation!

The following safety precautions refer exclusively to the control as an individual component but not to the specific complete product, i.e. the machine tool.



Refer to your machine manual.

Before using the machine including the control, take the OEM documentation to inform yourself about the safety-related aspects, the necessary safety equipment as well as the requirements on the qualified personnel.

The following overview contains exclusively the generally valid safety precautions. Pay attention to additional safety precautions that may vary with the configuration and are given in the following chapters.



For ensuring maximum safety, all safety precautions are repeated at the relevant places within the chapters.

DANGER

Caution: hazard to the user!

Unsecured connections, defective cables, and improper use are always sources of electrical dangers. The hazard starts when the machine is powered up!

- ▶ Devices should be connected or removed only by authorized service technicians
- ▶ Only switch on the machine via a connected handwheel or a secured connection

DANGER

Caution: hazard to the user!

Machines and machine components always pose mechanical hazards. Electric, magnetic, or electromagnetic fields are particularly hazardous for persons with cardiac pacemakers or implants. The hazard starts when the machine is powered up!

- ▶ Read and follow the machine manual
- ▶ Read and follow the safety precautions and safety symbols
- ▶ Use the safety devices

WARNING

Caution: hazard to the user!

Manipulated data records or software can lead to an unexpected behavior of the machine. Malicious software (viruses, Trojans, malware, or worms) can cause changes to data records and software.

- ▶ Check any removable memory media for malicious software before using them
- ▶ Start the internal web browser only from within the sandbox

NOTICE**Danger of collision!**

The control does not automatically check whether collisions can occur between the tool and the workpiece. Incorrect pre-positioning or insufficient spacing between components can lead to a risk of collision when referencing the axes.

- ▶ Pay attention to the information on the screen
- ▶ If necessary, move to a safe position before referencing the axes
- ▶ Watch out for possible collisions

NOTICE**Danger of collision!**

The control uses the defined tool length from the tool table for compensating the tool length. Incorrect tool lengths will result in an incorrect tool length compensation. The control does not perform tool length compensation or a collision check for tools with a length of **0** and after **TOOL CALL 0**. Danger of collision during subsequent tool positioning movements!

- ▶ Always define the actual tool length of a tool (not just the difference)
- ▶ Use **TOOL CALL 0** only to empty the spindle

NOTICE**Danger of collision!**

NC programs that were created on older controls can lead to unexpected axis movements or error messages on current control models. Danger of collision during machining!

- ▶ Check the NC program or program section using the graphic simulation
- ▶ Carefully test the NC program or program section in the **Program run, single block** operating mode
- ▶ Pay attention to the following known differences (the list below might not be complete!)

NOTICE**Caution: Data may be lost!**

The **DELETE** function permanently deletes the file. The control does not perform an automatic backup of the file prior to deletion (e.g., there is no recycle bin). Files are thereby irreversibly deleted.

- ▶ Regularly back up important data to external drives

NOTICE**Caution: Data may be lost!**

Never remove a connected USB device during data transfer—data can be damaged or deleted!

- ▶ Use the USB port for data transfer and backup only; do not use it for editing and executing NC programs
- ▶ Use the soft key to remove a USB device when data the transfer is complete

NOTICE**Caution: Data may be lost!**

The control must be shut down so that running processes can be concluded and data can be saved. Immediate switch-off of the control by turning off the main switch can lead to data loss no matter what state the control was in!

- ▶ Always shut down the control
- ▶ Only operate the main switch after being prompted on the screen

NOTICE**Danger of collision!**

If you select an NC block in program run using the **GOTO** function and then execute the NC program, the control ignores all previously programmed NC functions, e.g. transformations. This means that there is a risk of collision during subsequent traversing movements!

- ▶ Use **GOTO** only when programming and testing NC programs
- ▶ Only use **Block scan** when executing NC programs

2.3 Software

This User's Manual describes the functions for setting up the machine as well as for programming and running your NC programs. These functions are available for a control featuring the full range of functions.



The actual range of functions depends, among other things, on the enabled software options.

Further information: "Software options", Page 45

The table shows the NC software numbers described in this User's Manual.



HEIDENHAIN has simplified the version schema, starting with NC software version 16:

- The publication period determines the version number.
- All control models of a publication period have the same version number.
- The version number of the programming stations corresponds to the version number of the NC software.

NC software number	Product
817620-16	TNC7
817621-16	TNC7 E
817625-16	TNC7 programming station



Refer to your machine manual.

This User's Manual describes the basic functions of the control. The machine manufacturer can adapt, enhance or restrict the control functions to the machine.

Check, on the basis of the machine tool manual, whether the machine manufacturer has adapted the functions of the control.

Definition

Abbreviation	Definition
E	The suffix E indicates the export version of the control. In this version, the software option 9 Advanced Function Set 2 is restricted to 4-axis interpolation.

2.3.1 Software options

Software options define the range of functions of the control. The optional functions are either machine- or application-specific. The software options give you the possibility of adapting the control to your individual needs.

You can check which software options are enabled on your machine.

Further information: User's Manual for Setup and Program Run

Overview and definitions

The **TNC7** features various software options, each of which can be enabled separately and even subsequently by the machine manufacturer. The following overview includes only those software options that are relevant for you as user.



The option numbers indicated in the User's Manual show you that a function is not included in the standard range of available functions. The Technical Manual informs about additional software options that are relevant for the machine manufacturer.



Keep in mind that particular software options also require hardware extensions.

Further information: User's Manual for Setup and Program Run

Software option	Definition and application
Additional Axis (options 0 to 7)	<p>Additional control loop</p> <p>A control loop is required for each axis or spindle moved to a programmed nominal value by the control.</p> <p>Additional control loops are required e.g. for detachable and motor-driven tilting tables.</p>
Advanced Function Set 1 (option 8)	<p>Advanced functions (set 1)</p> <p>On machines with rotary axes this software option enables the machining of multiple workpiece sides in a single setup.</p> <p>The software option includes the following functions:</p> <ul style="list-style-type: none"> ■ Tilting the working plane, e.g. with PLANE SPATIAL Further information: "PLANE SPATIAL", Page 255 ■ Programming of contours on the unrolled surface of a cylinder, e.g. by using Cycle 27 CYLINDER SURFACE Further information: User's Manual for Machining Cycles ■ Programming the rotary axis feed rate in mm/min with M116 Further information: "Interpreting the feed rate for rotary axes as mm/min with M116 (option 8)", Page 425 ■ 3-axis circular interpolation with a tilted working plane <p>The advanced functions (set 1) reduce the setup effort and increase the workpiece accuracy.</p>
Advanced Function Set 2 (option 9)	<p>Advanced functions (set 2)</p> <p>On machines with rotary axes this software option enables the simultaneous 5-axis machining of workpieces.</p> <p>The software option includes the following functions:</p> <ul style="list-style-type: none"> ■ TCPM (tool center point management): Automatic tracking of linear axes during the rotary axis positioning Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295 ■ Running of NC programs with vectors, including optional 3D tool compensation Further information: "3D tool compensation (option 9)", Page 317 ■ Manual moving of axes in the active tool coordinate system T-CS ■ Linear interpolation in more than 4 axes (max. 4 axes in case of an export version) <p>The advanced functions (set 2) can be used to produce free-form surfaces.</p>

Software option	Definition and application
HEIDENHAIN DNC (option 18)	<p>HEIDENHAIN DNC</p> <p>This software option enables external Windows applications to access data of the control via the TCP/IP protocol.</p> <p>Potential fields of application are e.g.:</p> <ul style="list-style-type: none"> ■ Connection to higher-level ERP or MES systems ■ Capture of machine and operating data <p>HEIDENHAIN DNC is required in conjunction with external Windows applications.</p>
Dynamic Collision Monitoring (option 40)	<p>Dynamic Collision Monitoring (DCM)</p> <p>The machine manufacturer can use this software option to define machine components as collision objects. The control monitors the defined collision objects during all machine movements.</p> <p>The software option includes the following functions:</p> <ul style="list-style-type: none"> ■ Automatic interruption of the program run whenever a collision is imminent. ■ Warnings in case of manual axis movements ■ Collision monitoring in Test Run mode <p>With DCM you can prevent collisions and thus avoid additional costs resulting from material damage or a machine downtime.</p> <p>Further information: User's Manual for Setup and Program Run</p>
CAD Import (option 42)	<p>CAD Import</p> <p>This software option is used to select positions and contours from CAD files and to transfer them into an NC program.</p> <p>With the CAD Import option you reduce the programming effort and prevent typical errors such as the incorrect entry of values. In addition, CAD Import contributes to paperless manufacturing.</p> <p>Further information: User's Manual for Setup and Program Run</p>
Global PGM Settings (option 44)	<p>Global Program Settings GPS</p> <p>This software option can be used for superimposed coordinate transformations and handwheel movements during program run without changing the NC program.</p> <p>With GPS you can adapt externally created NC programs to the machine and increase flexibility during program run.</p> <p>Further information: User's Manual for Setup and Program Run</p>
Adaptive Feed Control (option 45)	<p>Adaptive Feed Control AFC</p> <p>This software option enables an automatic feed control that depends on the current spindle load. The control increases the feed rate as the load decreases and reduces the feed rate as the load increases.</p> <p>With AFC you can shorten the machining time without adapting the NC program, while preventing machine damage from overload at the same time.</p> <p>Further information: User's Manual for Setup and Program Run</p>

Software option	Definition and application
KinematicsOpt (option 48)	<p>KinematicsOpt</p> <p>This software option uses automatic probing processes to check and optimize the active kinematics.</p> <p>With KinematicsOpt the control can correct position errors on rotary axes and thus increase the accuracy of machining operations in the tilted working plane and of simultaneous machining operations. In part, the control can compensate temperature-induced deviations through repeated measurements and corrections.</p> <p>Further information: User's Manual for Measuring Cycles for Workpieces and Tools</p>
Turning (option 50)	<p>Mill-turning</p> <p>This software option offers a comprehensive milling-specific function package for milling machines with rotary tables.</p> <p>The software option includes the following functions:</p> <ul style="list-style-type: none"> ■ Turning-specific tools ■ Turning-specific cycles and contour elements such as undercuts ■ Automatic tool radius compensation <p>Mill-turning enables mill-turning machining operations on only one machine, thus reducing e.g. the setup work effort considerably.</p> <p>Further information: "Turning (option 50)", Page 124</p>
KinematicsComp (option 52)	<p>KinematicsComp</p> <p>This software option uses automatic probing processes to check and optimize the active kinematics.</p> <p>With KinematicsComp the control can correct position and component errors in three dimensions. This means it can compensate the errors of rotary and linear axes in three dimensions. Compared to KinematicsOpt (option 48), the corrections are even far more comprehensive.</p> <p>Further information: User's Manual for Measuring Cycles for Workpieces and Tools</p>
OPC UA NC Server 1 to 6 (options 56 to 61)	<p>OPC UA NC Server</p> <p>The software options offer the OPC UA standardized interface for the external access to data and functions of the control.</p> <p>Potential fields of application are e.g.:</p> <ul style="list-style-type: none"> ■ Connection to higher-level ERP or MES systems ■ Capture of machine and operating data <p>Each software option enables one client connection each. Several parallel connections require the use of multiple OPC UA NC servers.</p> <p>Further information: User's Manual for Setup and Program Run</p>
4 Additional Axes (option 77)	<p>4 additional control loops</p> <p>see "Additional Axis (options 0 to 7)"</p>
8 Additional Axes (option 78)	<p>8 additional control loops</p> <p>see "Additional Axis (options 0 to 7)"</p>

Software option	Definition and application
3D-ToolComp (option 92)	<p>3D-ToolComp only in connection with Advanced Function Set 2 (option 9)</p> <p>With this software option, shape deviations on ball cutters and workpiece probes can be automatically compensated using a correction value table. 3D-ToolComp enables increasing the workpiece accuracy in conjunction with free-form surfaces, for example.</p> <p>Further information: "3D radius compensation depending on the tool contact angle (option 92)", Page 330</p>
Extended Tool Management (option 93)	<p>Extended tool management</p> <p>This software option extends tool management by the two tables Tooling list and T usage order.</p> <p>The tables show the following contents:</p> <ul style="list-style-type: none"> ■ The Tooling list shows the tool requirements of the NC program or pallet to be run ■ The T usage order shows the tool order of the NC program or pallet to be run <p>Further information: User's Manual for Setup and Program Run</p> <p>The extended tool management enables you to detect the tool requirements in time and thus prevent interruptions during program run.</p>
Advanced Spindle Interpolation (option 96)	<p>Interpolating Spindle</p> <p>This software option enables interpolation turning, as the control couples the tool spindle with the linear axes.</p> <p>The software option includes the following cycles:</p> <ul style="list-style-type: none"> ■ Cycle 291 COUPLG.TURNG.INTERP. for simple turning machining operations without contour subprograms ■ Cycle 292 CONTOUR.TURNG.INTRP. for finishing rotationally symmetrical contours <p>The interpolating spindle enables you to execute a turning operation also on machines without rotary table.</p> <p>Further information: User's Manual for Machining Cycles</p>
Spindle Synchronism (option 131)	<p>Spindle synchronism</p> <p>This software option synchronizes two or more spindles and thus enables e.g. the manufacture gears by hobbing.</p> <p>The software option includes the following functions:</p> <ul style="list-style-type: none"> ■ Spindle synchronism for special machining operation, e.g. polygonal turning ■ Cycle 880 GEAR HOBGING only in conjunction with mill-turning (option 50) <p>Further information: User's Manual for Machining Cycles</p>
Remote Desktop Manager (option 133)	<p>Remote Desktop Manager</p> <p>This software option is used to display and operate externally linked computer units.</p> <p>With Remote Desktop Manager you reduce the distances covered between several workplaces and as a result increase the efficiency.</p> <p>Further information: User's Manual for Setup and Program Run</p>

Software option	Definition and application
Dynamic Collision Monitoring v2 (option 140)	<p>Dynamic Collision Monitoring (DCM) version 2</p> <p>This software option includes the functions of software option 40 (Dynamic Collision Monitoring, DCM).</p> <p>In addition, this software option can be used for the collision monitoring of workpiece fixtures.</p> <p>Further information: User's Manual for Setup and Program Run</p>
Cross Talk Compensation (option 141)	<p>Compensation of axis couplings CTC</p> <p>Using this software option, the machine manufacturer can e.g. compensate acceleration-induced deviations at the tool and thus increase accuracy and dynamic performance.</p>
Position Adaptive Control (option 142)	<p>Position adaptive control PAC</p> <p>Using this software option, the machine manufacturer can e.g. compensate position-induced deviations at the tool and thus increase accuracy and dynamic performance.</p>
Load Adaptive Control (option 143)	<p>Load adaptive control LAC</p> <p>Using this software option, the machine manufacturer can e.g. compensate load-induced deviations at the tool and thus increase accuracy and dynamic performance.</p>
Motion Adaptive Control (option 144)	<p>Motion adaptive control MAC</p> <p>Using this software option, the machine manufacturer can e.g. change speed-dependent machine settings and thus increase the dynamic performance.</p>
Active Chatter Control (option 145)	<p>Active chatter control ACC</p> <p>With this software option the chatter tendency of a machine used for heavy machining can be reduced.</p> <p>The control can use ACC to improve the surface quality of the workpiece, increase the tool life and reduce the machine load. Depending on the type of machine, the metal-removal rate can be increased by more than 25 %.</p> <p>Further information: User's Manual for Setup and Program Run</p>
Machine Vibration Control (option 146)	<p>Vibration damping for machines MVC</p> <p>Damping of machine oscillations for improving the workpiece surface quality through the following functions:</p> <ul style="list-style-type: none"> ■ AVD Active Vibration Damping ■ FSC Frequency Shaping Control
CAD Model Optimizer (option 152)	<p>Optimization of CAD models</p> <p>This software option can be used, for example, to repair faulty files of fixtures and tool holders or to position STL files generated from the simulation for a different machining operation.</p> <p>Further information: User's Manual for Setup and Program Run</p>

Software option	Definition and application
Batch Process Manager (option 154)	<p>Batch Process Manager BPM</p> <p>This software option makes it easy to plan and execute multiple production jobs.</p> <p>If pallet management and extended tool management (option 93) are extended or combined, BPM offers the following additional data, for example:</p> <ul style="list-style-type: none"> ■ Machining time ■ Availability of necessary tools ■ Manual interventions to be made ■ Program test results of assigned NC programs <p>Further information: "Job list workspace", Page 578</p>
Component Monitoring (option 155)	<p>Component monitoring</p> <p>This software option enables the automatic monitoring of machine components configured by the machine manufacturer.</p> <p>Component monitoring assists the control in preventing machine damage due to overload by way of hazard warnings and error messages.</p>
Grinding (option 156)	<p>Jig grinding</p> <p>This software option offers a comprehensive grinding-specific function package for milling machines.</p> <p>The software option includes the following functions:</p> <ul style="list-style-type: none"> ■ Grinding-specific tools including dressing tools ■ Cycles for reciprocating stroke and dressing <p>Jig-turning enables complete machining operations on just one machine, thus reducing e.g. the setup work effort considerably.</p> <p>Further information: "Grinding operations (option 156)", Page 136</p>
Gear Cutting (option 157)	<p>Gear manufacturing</p> <p>This software option enables the manufacturing of cylindrical gears or helical gears of any angle.</p> <p>The software option includes the following cycles:</p> <ul style="list-style-type: none"> ■ Cycle 285 DEFINE GEAR to define the gear geometry ■ Cycle 286 GEAR HOBGING ■ Cycle 287 GEAR SKIVING <p>Gear manufacturing expands the scope of functionality of milling machines with rotary tables even without mill-turning (option 50).</p> <p>Further information: User's Manual for Machining Cycles</p>
Turning v2 (option 158)	<p>Mill-turning version 2</p> <p>This software option includes all functions of Mill-Turning (software option 50). In addition, this software option offers the following advanced turning functions:</p> <ul style="list-style-type: none"> ■ Cycle 882 SIMULTANEOUS ROUGHING FOR TURNING ■ Cycle 883 TURNING SIMULTANEOUS FINISHING <p>The advanced turning functions not only enable you to manufacture undercut workpieces but also to use a larger area of the indexable insert during the machining operation.</p> <p>Further information: User's Manual for Machining Cycles</p>

Software option	Definition and application
Optimized Contour Milling (option 167)	<p>Optimized contour machining (OCM)</p> <p>This software option enables the trochoidal milling of closed or open pockets and islands of any shape. During trochoidal milling, the full cutting edge is used under constant cutting conditions.</p> <p>The software option includes the following cycles:</p> <ul style="list-style-type: none"> ■ Cycle 271 OCM CONTOUR DATA ■ Cycle 272 OCM ROUGHING ■ Cycle 273 OCM FINISHING FLOOR and cycle 274 OCM FINISHING SIDE ■ Cycle 277 OCM CHAMFERING ■ In addition, the control offers OCM FIGURES for frequently needed contours <p>With OCM you can shorten the machining time while reducing tool wear at the same time.</p> <p>Further information: User's Manual for Machining Cycles</p>
Process Monitoring (option 168)	<p>Process monitoring</p> <p>Reference-based monitoring of the machining process</p> <p>The control uses this software option to monitor defined machining sections during program run. The control compares changes in conjunction with the tool spindle or the tool with the values of a reference machining operation.</p> <p>Further information: User's Manual for Setup and Program Run</p>

2.3.2 Feature Content Level

New functions or functional enhancements of the control software may be protected by software options or by means of the Feature Content Levels.

On purchasing a new control you will receive the highest level of the **FCL** possible with the installed software. A subsequent software update e.g. within the frame of a service requirement, does not automatically increase the **FCL** version.



As yet, no functions are protected by Feature Content Level. If functions are protected in future, the User's Manual will indicate the marking **FCL n**. The **n** shows the required number of the **FCL** version.

2.3.3 Information on licensing and use

Open-source software

The control software contains open-source software whose use is subject to explicit licensing terms. These special terms of use have priority.

To get to the licensing terms on the control:



- ▶ Select the **Home** operating mode

- ▶ Select the **Settings** application
- ▶ Select the **Operating system** tab



- ▶ Double-tap or double-click **About HeROS**
- The control opens the **HEROS Licence Viewer** window.

OPC UA

The control software contains binary libraries. For these libraries, additionally and preferentially the terms of use agreed between HEIDENHAIN and Softing Industrial Automation GmbH shall apply.

OPC UA NC Server (options 56 to 61) and HEIDENHAIN DNC (option 18) can be used to influence the behavior of the control. Before using these interfaces for productive purposes, system tests must be performed to exclude the occurrence of any malfunctions or performance failures of the control. The manufacturer of the software product that uses these communication interfaces is responsible for performing these tests.

Further information: User's Manual for Setup and Program Run

2.4 Hardware

This User's Manual describes functions for setting up and operating the machine. These functions primarily depend on the installed software.

Further information: "Software", Page 45

The actual range of functions also depends on hardware enhancements and the enabled software options.

2.4.1 Monitor



BF 360

The TNC7 is delivered with a 24-inch touchscreen.

The control is operated by means of touchscreen gestures and with the operating elements of the keyboard unit.

Further information: "Common gestures for the touchscreen", Page 65

Further information: "Operating elements of the keyboard unit", Page 65

Operation and cleaning



Avoiding electrostatic discharge when operating touchscreens

Touchscreens are based on a capacitive working principle, i.e. they are sensitive to electrostatic charges generated by the operators.

Users can discharge static electricity from their body by touching grounded metal objects. This problem can be avoided by wearing ESD clothing.

Capacitive sensors detect a contact as soon as a person's finger touches the touchscreen. Touchscreens can even be operated with dirty hands, as long as the touch sensors are able to detect the skin resistance. While small amounts of liquid will not cause a fault, larger quantities of liquid will cause erroneous input.



Use work gloves to prevent the device from becoming dirty. The rubber material of special touchscreen work gloves contains metal ions that transfer the skin resistance to the display.

In order to maintain the functionality of the touchscreen, use the following cleaners only:

- Glass cleaner
- Foaming screen cleaners
- Mild detergents



Do not apply the cleaner directly to screen, but slightly dampen a suitable cleaning cloth with it.

Switch off the control before cleaning the touchscreen. As an alternative, you can use the touchscreen cleaning mode.

Further information: User's Manual for Setup and Program Run



Never use the following cleaners or cleaning aids, in order to avoid damage to the touchscreen:

- Aggressive solvents
- Abrasives
- Compressed air
- Steam cleaners

2.4.2 Keyboard unit



TE 360 with standard potentiometer layout



TE 360 with alternative potentiometer layout



TE 361

The TNC7 is delivered with various keyboard units.

The control is operated by means of touchscreen gestures and with the operating elements of the keyboard unit.

Further information: "Common gestures for the touchscreen", Page 65

Further information: "Operating elements of the keyboard unit", Page 65



Refer to your machine manual.

Some machine tool builders do not use the standard HEIDENHAIN operating panel.

External keys, e.g. **NC START** or **NC STOP**, are described in your machine manual.

Cleaning



Use operating gloves to prevent the device from becoming dirty.

In order to maintain the functionality of the keyboard, use only cleaners stated to contain anionic or nonionic surfactants.



Do not apply the cleaner directly to the keyboard unit. Slightly dampen a suitable cleaning cloth with the cleaner.

Switch the control off before cleaning the keyboard unit.



Never use the following cleaners or cleaning aids, in order to avoid damage to the keyboard unit:

- Aggressive solvents
- Abrasives
- Compressed air
- Steam blasters



The trackball does not require periodic maintenance. Cleaning is required only if the trackball stops functioning.

If a trackball is embedded in the keyboard, clean the trackball as follows:

- ▶ Switch off the control
- ▶ Turn the pull-off ring by 100° in counterclockwise direction
- ▶ Turning the removable pull-off ring moves it upwards out of the keyboard unit.
- ▶ Remove the pull-off ring
- ▶ Take out the ball
- ▶ Carefully remove sand, chips, or dust from the shell area



Scratches in the shell area may impair the functionality or prevent proper functioning.

- ▶ Apply a small amount of an isopropyl alcohol cleaner to a lint-free and clean cloth



Please observe the information for the cleaner.

- ▶ Carefully wipe the shell area clean with the cloth until all smears or stains have been removed


Exchanging keycaps

If you need replacements for the keycaps of the keyboard unit, contact HEIDENHAIN or the machine manufacturer.



The IP54 protection rating cannot be guaranteed if the keyboard is missing any keys.


To exchange the keycaps:

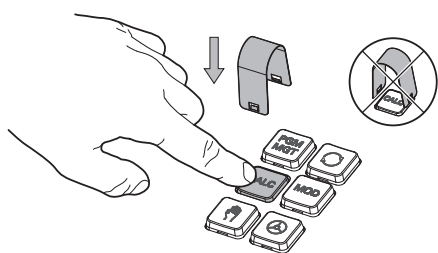


- Slide the keycap puller (ID 1325134-01) over the keycap until the grippers engage



Pressing the key will make it easier to apply the keycap puller.

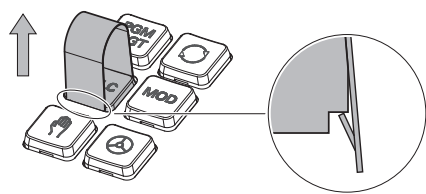

- Pull off the keycap

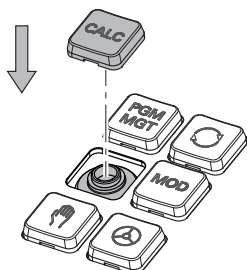


- Place the keycap onto the seal and push it down



The seal must not be damaged; otherwise the IP54 protection rating cannot be guaranteed.

- Verify proper seating and correct functioning

2.5 Areas of the control's user interface

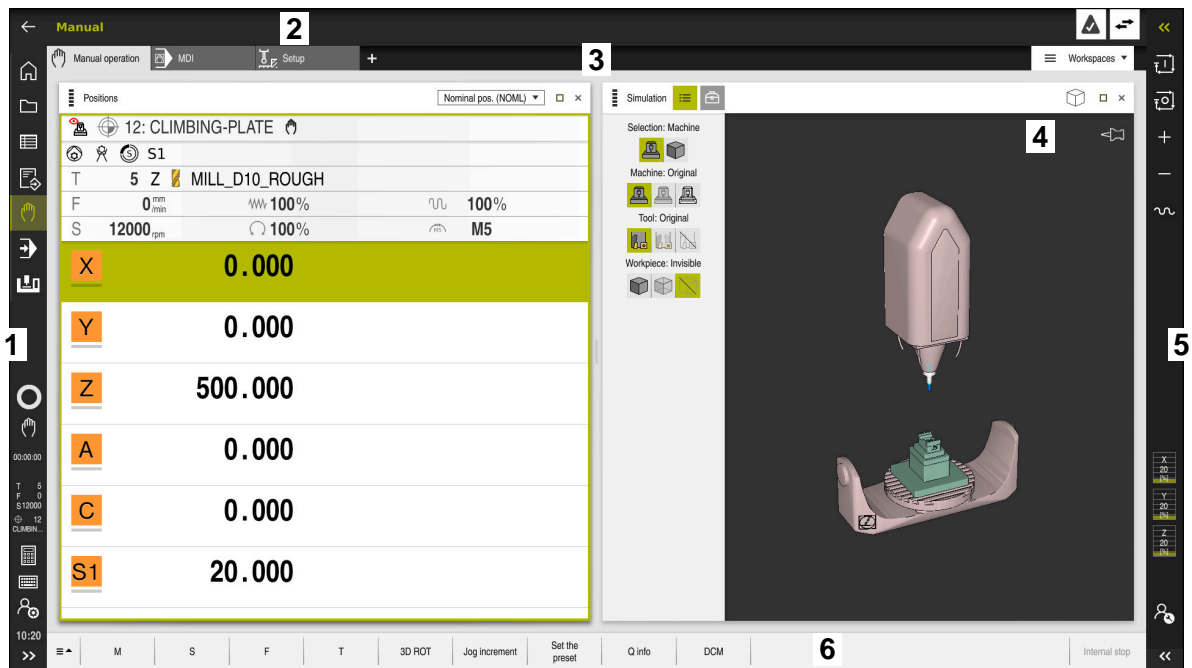

The control's user interface in the **Manual operation** application





The control's user interface shows the following areas:





- 1 TNC bar
 - Back
Use this function to go backwards in the application history since booting the control.
 - Operating modes
Further information: "Overview of operating modes", Page 59
 - Status overview
Further information: User's Manual for Setup and Program Run
 - Calculator
Further information: "Calculator", Page 552
 - Screen keyboard
Further information: "Virtual keyboard of the control bar", Page 536
 - Settings
In the settings you can choose among several pre-defined views for the control's user interface.
 - Date and time
- 2 Information bar
 - Active operating mode
 - Message menu
Further information: User's Manual for Setup and Program Run
 - Symbols

- 3 Application bar
 - Tabs of opened applications
 - Selection menu for workspaces
With the selection menu you define which workspaces are open in the active application.
- 4 Workspaces
Further information: "Workspaces", Page 61
- 5 Machine manufacturer bar
The machine manufacturer configures the machine manufacturer bar.
- 6 Function bar
 - Selection menu for buttons
With the selection menu you define which buttons the control displays in the function bar.
 - Button
With the buttons you activate individual functions of the control.

2.6 Overview of operating modes


The control provides the following operating modes:

Symbols	Operating modes	Further information
	The Home operating mode contains the following applications:	
	<ul style="list-style-type: none"> ■ Start/Login application During the startup process, the control is in the Start/Login application. 	
	<ul style="list-style-type: none"> ■ Settings application 	See the User's Manual for Setup and Program Run
	<ul style="list-style-type: none"> ■ Help application ■ Applications for machine parameters 	See the User's Manual for Setup and Program Run
	In the Files operating mode the control displays drives, folders and files. You can, for example, create or delete folders or files and can also connect drives.	Page 334
	In the Tables operating mode you can open various tables and edit them as necessary.	Page 592
	In the Editor operating mode you can do the following: <ul style="list-style-type: none"> ■ Create, edit and simulate NC programs ■ Create and edit contours ■ Create and edit pallet tables 	Page 104

Symbols	Operating modes	Further information
	The Manual operating mode contains the following applications:	
	■ Manual operation application	See the User's Manual for Setup and Program Run
	■ MDI application	See the User's Manual for Setup and Program Run
	■ Setup application	See the User's Manual for Setup and Program Run
	■ Move to ref. point application	See the User's Manual for Setup and Program Run
	In the Program Run operating mode you produce workpieces by having the control execute NC programs either one block at a time or in full sequence. You also execute pallet tables in this operating mode.	See the User's Manual for Setup and Program Run
	In the Retract application you can move the tool away from the workpiece, for example after a power failure.	See the User's Manual for Setup and Program Run
	If the machine manufacturer has defined an embedded workspace, then you can open full-screen mode with this operating mode. The machine manufacturer defines the name of the operating mode. Refer to your machine manual.	See the User's Manual for Setup and Program Run
	In the Machine operating mode the machine manufacturer defines his own functions, such as diagnostic functions for spindle and axes, or other applications. Refer to your machine manual.	

2.7 Workspaces

2.7.1 Operating elements within the workspaces

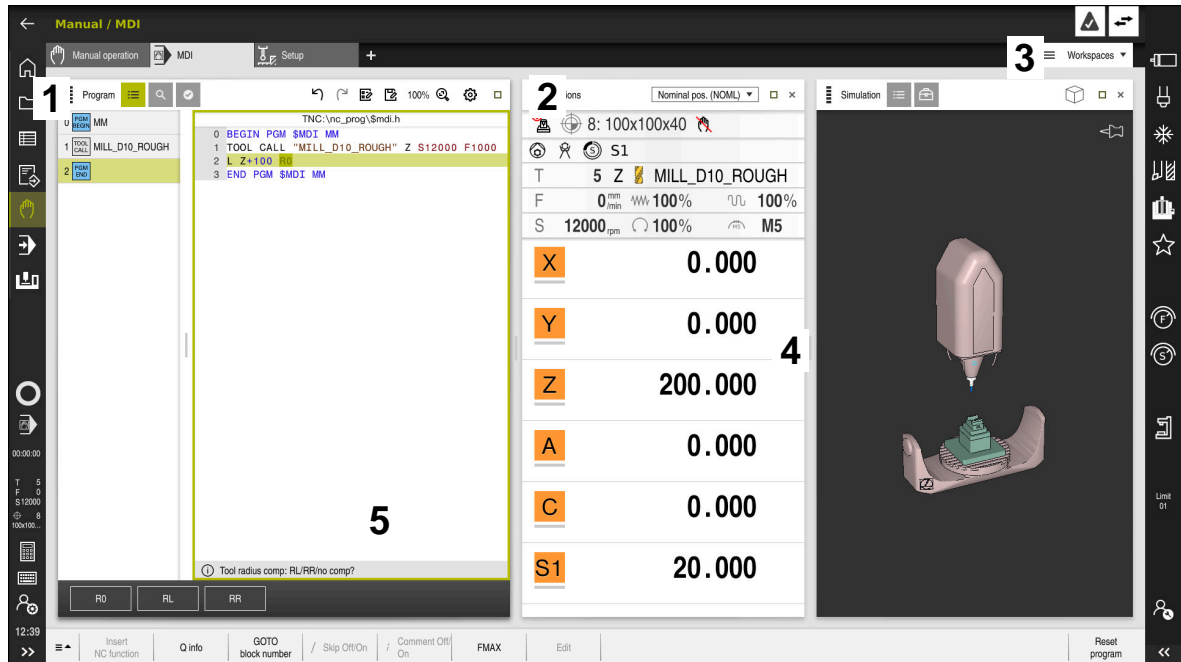




The control in the **MDI** application with three open workspaces

The control displays the following operating elements:

- 1 Gripper
Use the gripper in the title bar to change positions of the workspaces. You can also align two workspaces vertically above each other.
- 2 Title bar
In the title bar the control shows the title of the workspace, and different symbols or settings, depending on the workspace.
- 3 Selection menu for workspaces
Use the selection menu for workspaces in the application bar to open individual workspaces. The available workspaces depend on the active application.
- 4 Separator
You use the separator between two workspaces to change the scaling of the workspaces.
- 5 Action bar
In the action bar the control shows selection possibilities for the current dialog; for example, an NC function.

2.7.2 Symbols within the workspaces

If more than one workspace is open, the title bar contains the following symbols:

Icon	Function
	Maximize workspace
	Reduce workspace
	Close workspace

If you maximize a workspace, the control shows the workspace over the application's entire area. If you reduce the workspace, then all other workspaces return to their previous position.

2.7.3 Overview of workspaces

The control offers the following workspaces:

Workspace	Further information
Probing function In the Probing function workspace you set presets on the workpiece and determine and compensate for workpiece misalignment and rotations. You can also calibrate the touch probe, measure tools, and set up fixtures.	See the User's Manual for Setup and Program Run
Job list In the Job list workspace, you edit and execute pallet tables.	Page 578
Open File The Open File workspace allows e. g. selecting and creating files.	Page 343
Form for tables In the Form workspace, the control shows all contents of a selected table row. Depending on the table, you can edit the values in the form.	Page 597
Form for pallets In the Form workspace, the control shows the contents of the pallet table for the selected row.	Page 585
Retract In the Retract workspace you disengage the tool after a power interruption.	See the User's Manual for Setup and Program Run
GS (option 44) In the GS workspace you define selected transformations and settings without modifying the NC program.	See the User's Manual for Setup and Program Run
Desktop menu In the Desktop menu workspace the control displays selected control and HEROS functions.	Page 73

Workspace	Further information
Help In the Help workspace the control displays a help graphic for the current syntax element of an NC function or the TNCguide integrated product help.	Page 534
Contour In the Contour workspace you use lines and arcs to draw a 2D sketch and then generate a Klartext contour from it. You can also import program sections with contours from an NC program to the Contour workspace for graphical editing.	Page 515
List In the List workspace the control shows the machine parameter structure; you might be able to edit some of the parameters.	See the User's Manual for Setup and Program Run
Positions In the Positions workspace the control displays information about the status of various functions of the control and about current axis positions.	See the User's Manual for Setup and Program Run
Program The control displays the NC program in the Program workspace.	Page 106
RDP (option 133) If the machine manufacturer has defined an embedded workspace, you can see and operate the screen of an external computer on the control. The machine manufacturer can change the name of the workspace. Refer to your machine manual.	See the User's Manual for Setup and Program Run
Quick selection In the Quick selection workspace you open an existing table or create a file, e. g. an NC program.	Page 344
Simulation In the Simulation workspace the control shows the simulated or actual movements, depending on the operating mode.	Page 557
Simulation status In the Simulation status workspace the control shows data based on the simulation of the NC program.	
Start/Login In the Start/Login workspace the control shows the steps that are performed while booting.	Page 76
Status In the Status workspace the control shows the status and values of individual functions.	
Table In the Table workspace, the control shows the contents of a table. The control displays a column with filters and a search function on the left side of some tables.	Page 593










Workspace	Further information
<p>Table for machine parameters</p> <p>In the Table workspace the control shows the machine parameters; you might be able to edit some of them.</p>	<p>See the User's Manual for Setup and Program Run</p>
<p>Keyboard</p> <p>In the Keyboard workspace you can enter NC functions, letters and numbers, and also navigate.</p>	<p>Page 536</p>
<p>Overview</p> <p>In the Overview workspace the control displays the information on the status of individual functional safety (FS) aspects.</p>	<p>See the User's Manual for Setup and Program Run</p>
<p>Monitoring</p> <p>In the Process Monitoring workspace the control visualizes the machining process during program run. You can activate various monitoring tasks that are relevant to the process. If necessary, you can adapt the monitoring tasks.</p>	<p>See the User's Manual for Setup and Program Run</p>

2.8 Operating elements

2.8.1 Common gestures for the touchscreen

The screen of the control is multi-touch capable. That means the control can distinguish various gestures, even with two or more fingers at once.

You can use the following gestures:

Symbol	Gesture	Meaning
	Tap	A brief touch by a finger on the screen
	Double tap	Two brief touches on the screen
	Long press	Continuous contact of finger tip on the screen
<div>  <p>If you do not stop holding, the control will automatically cancel the holding gesture after approximately ten seconds. Permanent actuation is thus not possible.</p> </div>		
	Swipe	Flowing motion over the screen
	Drag	A combination of long-press and then swipe, moving a finger over the screen when the starting point is clearly defined
	Two-finger drag	A combination of long-press and then swipe, moving two fingers in parallel over the screen when the starting point is clearly defined
	Spread	Two fingers long-press and move away from each other
	Pinch	Two fingers move toward each other

2.8.2 Operating elements of the keyboard unit

Application

You operate the **TNC7** primarily through the touchscreen, meaning with gestures.




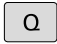

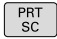


Further information: "Common gestures for the touchscreen", Page 65

In addition, the control's keyboard unit offers keys and other elements for alternative operating sequences.




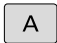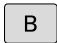


Description of function

The tables below describe the keyboard unit's operating elements.

Keycaps for alphabetic keyboard

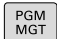Key	Function
  	Enter texts (e.g., file names)
SHIFT + 	Uppercase Q If an NC program is open, in the Editor operating mode for entering a Q parameter formula; in the Manual operating mode for opening the Q parameter list window Further information: "Q parameter list window", Page 457
	Close windows and context menus
	Create screenshot
	Left DIADUR key Open the HEROS menu
	In Klartext programming open a context menu

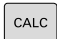Keycaps for operating aids

Key	Function
	Open the Open File workspace in the Editor and Program Run operating modes Further information: "Open File workspace", Page 343
	Select the button at the extreme right margin
	Open and close the message menu Further information: User's Manual for Setup and Program Run
	Open and close the calculator Further information: "Calculator", Page 552
	Open the Settings application Further information: User's Manual for Setup and Program Run
	Open the online help Further information: "User's Manual as integrated product help: TNCguide", Page 34

Operating modes



On the TNC7 the operating modes of the control are allocated differently than on the TNC 640. For reasons of compatibility and to facilitate ease of operation, the keys on the keyboard unit remain the same. Keep in mind that particular keys no longer activate a change of operating modes but e.g. Instead activate a switch.






Key	Function
	Opening the Manual operation application in the Manual operating mode Further information: User's Manual for Setup and Program Run
	Activating and deactivating the electronic handwheel in the Manual operating mode Further information: User's Manual for Setup and Program Run
	Opening the Tool Management tab in the Tables operating mode Further information: User's Manual for Setup and Program Run
	Opening the MDI application in the Manual operating mode Further information: User's Manual for Setup and Program Run
	Opening the Program Run operating mode in Single Block mode Further information: User's Manual for Setup and Program Run
	Opening the Program Run operating mode Further information: User's Manual for Setup and Program Run
	Opening the Editor operating mode Further information: "Editor operating mode", Page 104
	While the NC program is running, opening of the Simulation workspace in the Editor operating mode Further information: "Simulation Workspace", Page 557

Keycaps for NC dialog






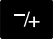


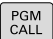









The following functions are valid for the **Editor** operating mode and the **MDI** application.











Key	Function
	In the Insert NC function window, open the Path contour folder in order to select an approach or departure function Further information: "Approaching and departing from a contour", Page 195
	Open the Contour workspace (e.g., to draw a milling contour) Only in the Editor operating mode Further information: "Graphical Programming", Page 515
	Program a chamfer Further information: "Chamfer CHF", Page 175
	Program a straight line segment Further information: "Straight line L", Page 175
	Program a circular arc with radius entry Further information: "Circular path CR", Page 180
	Program a rounding arc Further information: "Rounding RND", Page 177
	Program a circular arc with tangential connection to the preceding contour element Further information: "Circular path CT", Page 181
	Program a circle center or pole Further information: "Circle center point CC", Page 178
	Program a circular arc with reference to the circle center Further information: "Circular path C", Page 178
	In the Insert NC function window, open the Setup folder in order to select a touch probe cycle Further information: User's Manual for Measuring Cycles for Workpieces and Tools
	In the Insert NC function window, open the Cycles folder in order to select a cycle Further information: User's Manual for Machining Cycles
	In the Insert NC function window, open the Cycle call folder in order to select a machining cycle Further information: User's Manual for Machining Cycles
	Program a jump label Further information: "Defining a label with LBL SET", Page 210
	Program a subprogram or a program section repeat Further information: "Calling a label with CALL LBL", Page 211

Key	Function
	Program an intentional stop Further information: "Programming the STOP function", Page 412
	Pre-select a tool in the NC program Further information: "Tool pre-selection by TOOL DEF", Page 165
	Call the tool data in the NC program Further information: "Tool call by TOOL CALL", Page 159
	In the Insert NC function window, open the Special functions folder (e.g., for later programming of a workpiece blank)
	In the Insert NC function window, open the Selection folder (e.g., to call an external NC program)



Keycaps for axis input and value input

Key	Function
 ... 	Select axes in the Manual operating mode, or enter them in the Editor operating mode
 ... 	Enter numbers (e.g., coordinate values)
	Insert a decimal separator during entry
	Invert algebraic sign of entered value
	Delete values during entry
	Open position display of the status overview to copy axis values
	In the Editor operating mode, within the Insert NC function window, open the FN folder
	Clear entries or delete messages
	Delete NC block or cancel a dialog during programming
	Skip or remove optional syntax elements during programming
	Confirm entries and continue dialogs
	Conclude entry, e.g. finish an NC block
	Switch between entry of polar and Cartesian coordinates
	Switch between entry of incremental and absolute coordinates

Keycaps for navigation

Key	Function
 	Position the cursor
	<ul style="list-style-type: none"> Position the cursor by using the block number of an NC block Open the selection menu while editing
	Jump to first line of an NC program or first column of a table
	Jump to last line of an NC program or last column of a table
	Go one page up in an NC program or table
	Go one page down in an NC program or table
	Mark the active application in order to navigate between applications
 	Navigate between areas of an application

Potentiometers

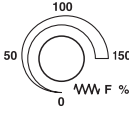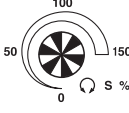









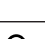









Poten-tiometer	Function
	Increase or reduce the feed rate Further information: "Feed rate F", Page 164
	Increase or reduce the spindle speed Further information: "Spindle speed S", Page 163

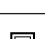







2.8.3 Icons on the control's user interface

Overview of icons not specific to any operating mode

This overview describes icons that are used in more than one operating mode or that are available regardless of operating mode.

Icons that are specific to individual workspaces are described there.

Icon or shortcut	Function
	Back
	Select the Home operating mode
	Select the Files operating mode
	Select the Tables operating mode
	Select the Editor operating mode
	Select the Manual operating mode
	Select the Program Run operating mode
	Select the Machine operating mode
	Open and close the calculator
	Open and close the virtual keyboard
	Open and close the settings
	<ul style="list-style-type: none"> ■ White: Expand control bar or machine manufacturer bar ■ Green: Collapse control bar or machine manufacturer bar or go back ■ Gray: Confirm message
	Add
	Open file
	Close
	Maximize workspace
	Reduce workspace
	<ul style="list-style-type: none"> ■ Black: Add to favorites ■ Yellow: Remove from favorites
 CTRL+S	Save
	Save as

Icon or shortcut	Function
 CTRL+F	Find
 CTRL+C	Copy
 CTRL+V	Paste
	Open settings
 CTRL+Z	Undo an action
 CTRL+Y	Redo an action
	Open selection menu
	Open message menu

2.8.4 Desktop menu workspace

Application

In the **Desktop menu** workspace the control displays selected control and HEROS functions.

Description of function

The **Desktop menu** workspace contains the following areas:

- **Control**

In this area you can open operating modes or applications.

Further information: "Overview of operating modes", Page 59

Further information: "Overview of workspaces", Page 62

- **Tools**

In this area you can open some tools from the HEROS operating system.

Further information: User's Manual for Setup and Program Run

- **Help**


In this area you can open training videos or TNCguide.

- **Favorites**

In this area you will find the favorites that you have chosen.

Further information: "Adding and removing favorites", Page 74

In the title bar you can perform a full-text search for any strings.

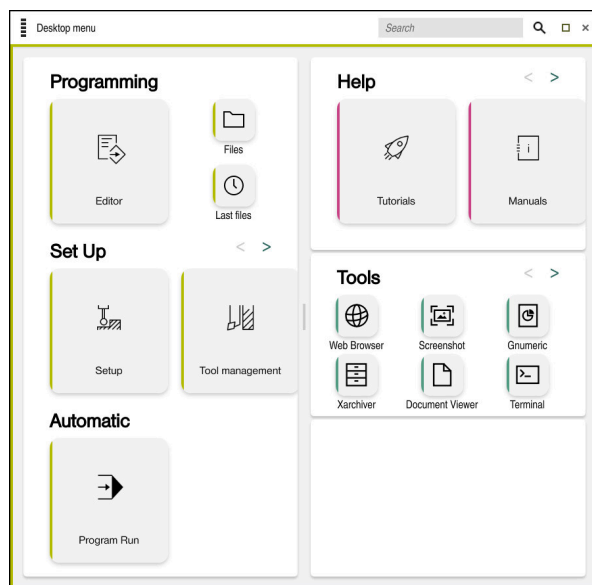

Desktop menu workspace

The **Desktop menu** workspace is available in the **Start/Login** application.

Showing or hiding an area

To show or hide an area in the **Desktop menu** workspace:

- ▶ Hold or right-click anywhere within the workspace
- > The control displays a plus sign or minus sign within each area.
- ▶ Select a plus sign
- > The controls shows that area.



Use the minus sign to hide an area.

Adding and removing favorites

Adding favorites

To add favorites in the **Desktop menu** workspace:

- ▶ Use the full-text search
- ▶ Hold or right-click the function's icon
- > The control displays the icon for **adding favorites**.



- ▶ Select **Add favorite**
- > The control adds the function to the **Favorites** area.

Removing favorites

To remove favorites from the **Desktop menu** workspace:

- ▶ Hold or right-click the function's icon
- > The control displays the icon for **removing favorites**.



- ▶ Select **Remove favorite**
- > The control removes the function from the **Favorites** area.

3

First Steps


3.1 Chapter overview

This chapter uses an example workpiece to explain how to operate the control: from switching the machine on to the finished workpiece.

The chapter covers the following topics:

- Switching the machine on
- Programming and simulating a workpiece
- Switching the machine off

3.2 Switching the machine and the control on

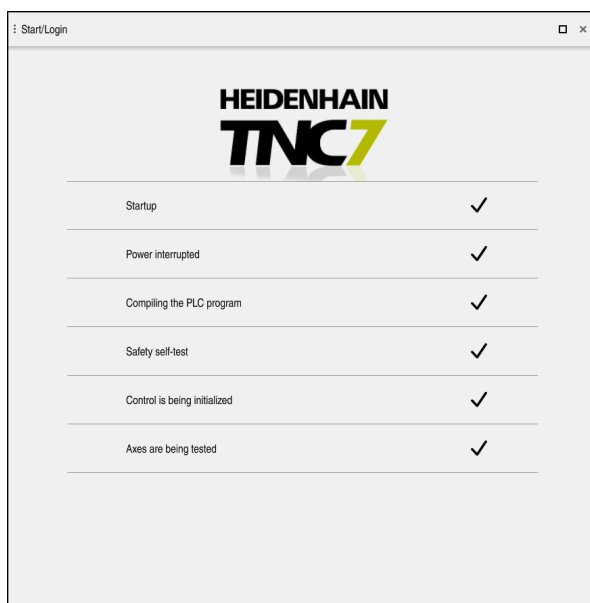

Start/Login workspace

DANGER

Caution: hazard to the user!

Machines and machine components always pose mechanical hazards. Electric, magnetic, or electromagnetic fields are particularly hazardous for persons with cardiac pacemakers or implants. The hazard starts when the machine is powered up!

- ▶ Read and follow the machine manual
- ▶ Read and follow the safety precautions and safety symbols
- ▶ Use the safety devices

 


Refer to your machine manual.

Switching on the machine and traversing the reference points can vary depending on the machine tool.

To switch the machine on:

- ▶ Switch the power supply of the control and of the machine on
- > The control is in start-up mode and shows the progress in the **Start/Login** workspace.
- > The control displays the **Power interrupted** dialog in the **Start/Login** workspace.



- ▶ Press **OK**
- > The control compiles the PLC program.
- ▶ Switch the machine control voltage on
- > The control checks the functioning of the emergency stop circuit.
- > If the machine is equipped with absolute linear and angle encoders, the control is now ready for operation.
- > If the machine is equipped with incremental linear and angle encoders, the control opens the **Move to ref. point** application.

Further information: User's Manual for Setup and Program Run



- ▶ Press the **NC Start** key
- > The control moves to all necessary reference points.
- > The control is ready for operation and the **Manual operation** application is open.


Further information: User's Manual for Setup and Program Run

More detailed information

- Switching on and off
Further information: User's Manual for Setup and Program Run
- Position encoders
Further information: "Position encoders and reference marks", Page 99

3.3 Programming and simulating a workpiece

3.3.1 Example task 1339889

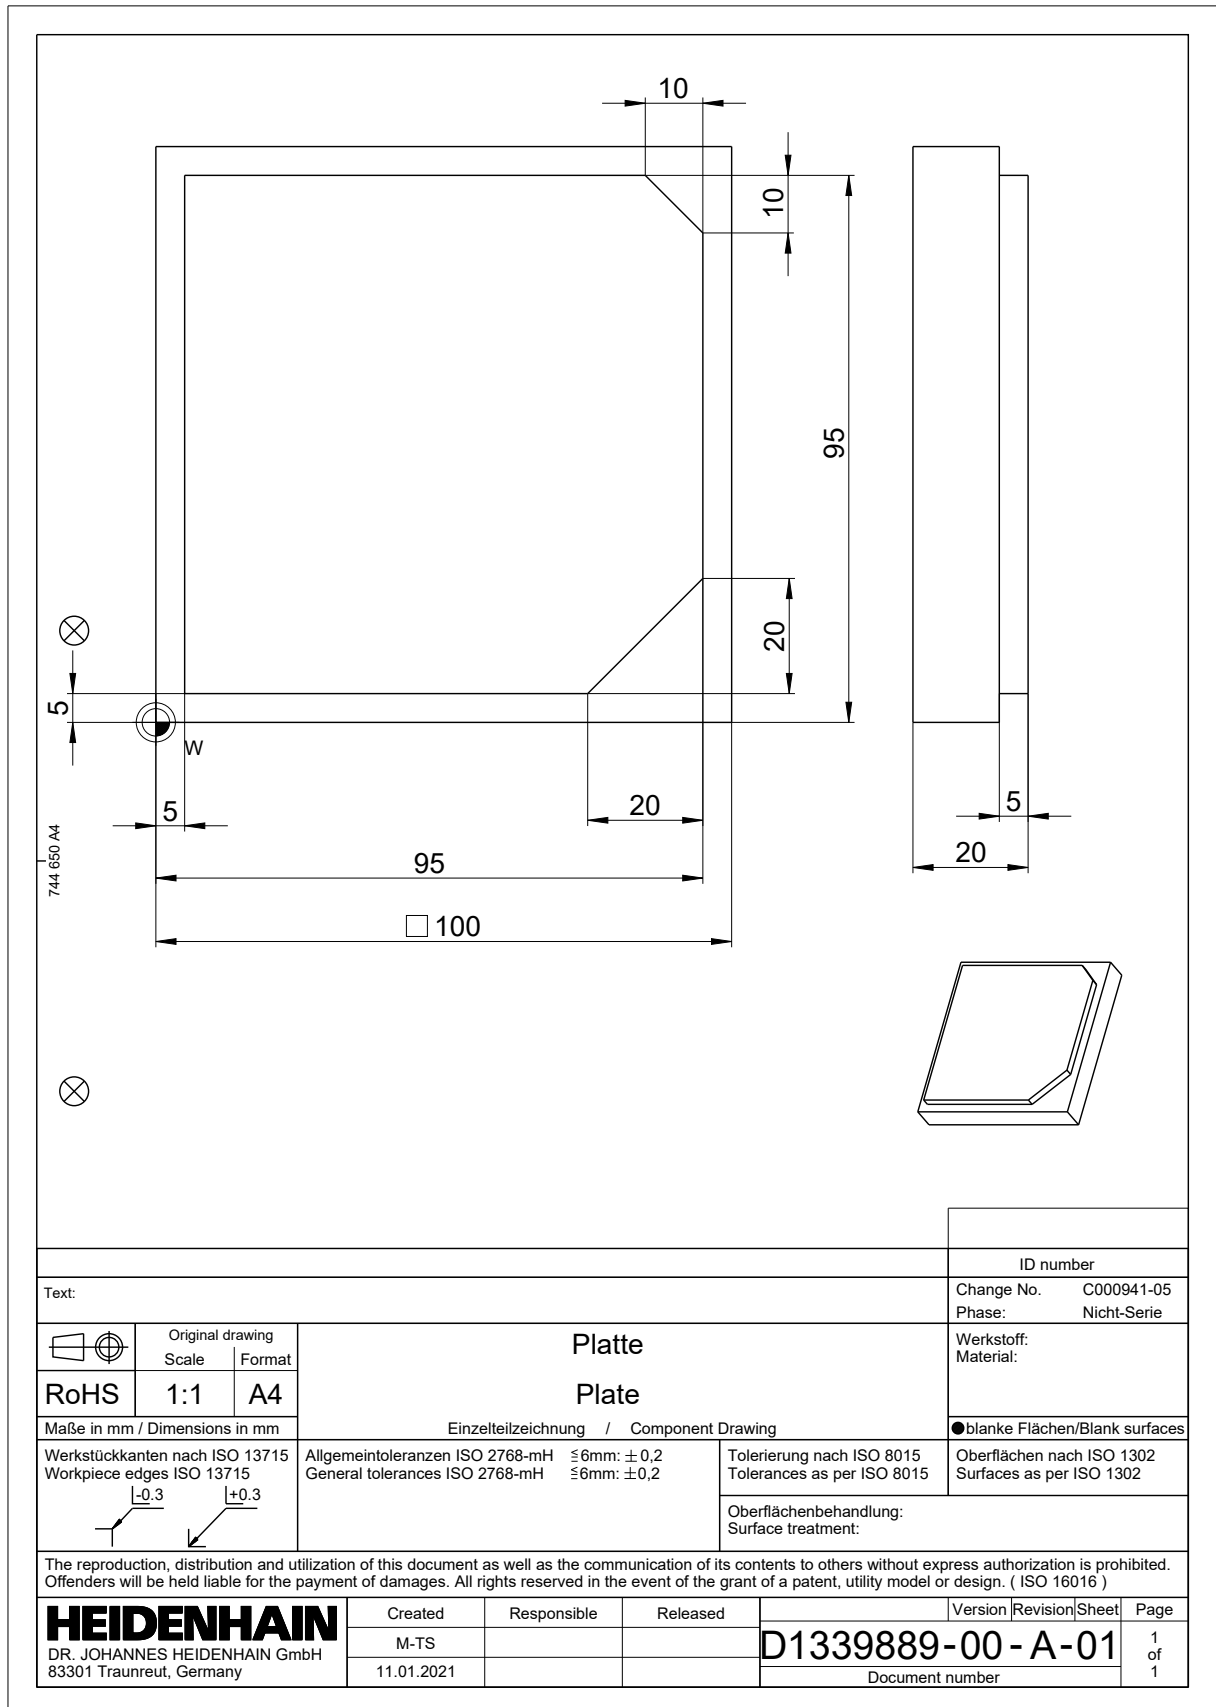

3.3.2 Selecting the Editor operating mode

NC programs are always programmed in the **Editor** operating mode.

Requirement

- It must be possible to select the icon of the operating mode
In order to be able to select the **Editor** operating mode, the control must have already progressed enough during booting that the operating mode icon is no longer dimmed.

Selecting the Editor operating mode

To select the **Editor** operating mode:



- ▶ Select the **Editor** operating mode
- > The control displays the **Editor** operating mode and the most recently opened NC program.

More detailed information

- Operating mode: **Editor**
Further information: "Editor operating mode", Page 104

3.3.3 Configuring the control's user interface for programming

The **Editor** operating mode gives you several possibilities for writing an NC program.



The first steps describe the procedure when you are in the **Klartext programming** mode and the **Form** column is open.

Opening the Form column

You can open the **Form** column only if an NC program is open.

To open the **Form** column:




- ▶ Select **Form**
- > The control opens the **Form** column

More detailed information

- Editing an NC program
Further information: "Editing NC programs", Page 114
- Column: **Form**
Further information: "Form column in the Program workspace", Page 113

3.3.4 Creating a new NC program

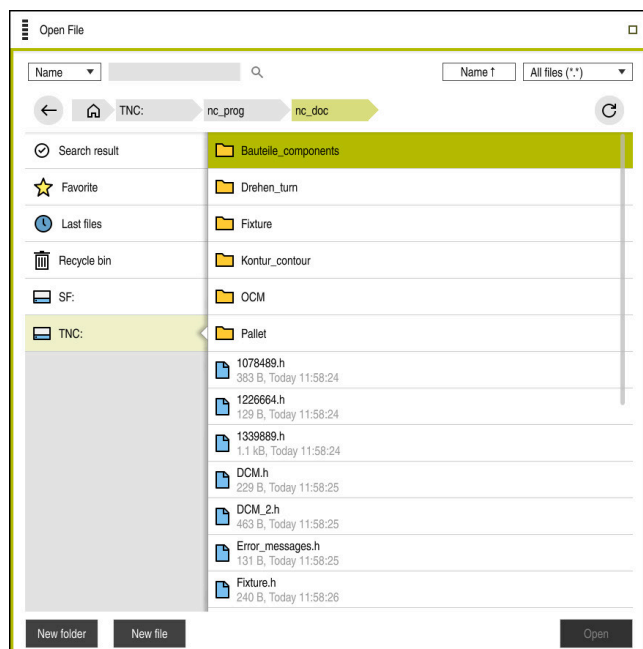

Open File workspace in the **Editor** operating mode

To create an NC program in the **Editor** operating mode:



- ▶ Select **Add**
- The control displays the **Quick selection** and **Open File** workspaces.



- ▶ Select the desired drive in the **Open File** workspace



- ▶ Select a folder



- ▶ Select **New file**



- ▶ Enter a file name (e.g., 1339889.h)
- ▶ Confirm with the **ENT** key



- ▶ Select **Open**
- The control opens a new NC program and the **Insert NC function** window for definition of the workpiece blank.

More detailed information


- Workspace: **Open File**
Further information: User's Manual for Setup and Program Run
- Operating mode: **Editor**
Further information: "Editor operating mode", Page 104

3.3.5 Defining the workpiece blank

For the NC program you can define a workpiece blank that the control then uses for the simulation. When creating an NC program, the control automatically displays the **Insert NC function** window for definition of the workpiece blank.




If you close the window without selecting a workpiece blank, you can use the **Insert NC function** button to select the definition of the workpiece blank.

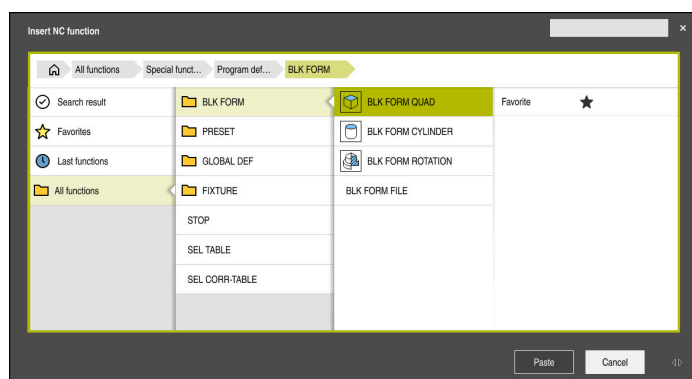

Insert NC function window for defining the workpiece blank

Defining a cuboid workpiece blank

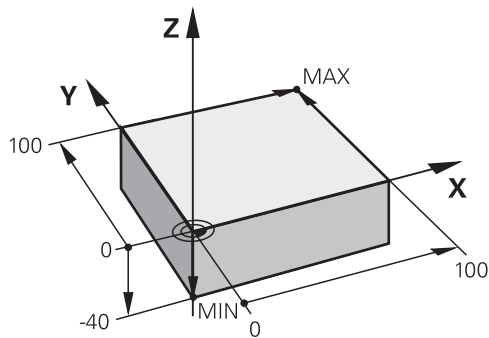

Cuboid workpiece blank with minimum point and maximum point

You define a cuboid through a diagonal in space by entering the minimum point and maximum point relative to the active workpiece preset.



You can confirm the entries as follows:

- **ENT** key
- Right arrow key
- Click or tap the next syntax element

To define a cuboid workpiece blank:



- ▶ Select **BLK FORM QUAD**



- ▶ Select **Paste**
- The control inserts the NC block for definition of the workpiece blank.



- ▶ Open the **Form** column
- ▶ Select the tool axis (e.g., **Z**)
- ▶ Confirm your input
- ▶ Enter the smallest X coordinate (e.g., **0**)
- ▶ Confirm your input
- ▶ Enter the smallest Y coordinate (e.g., **0**)
- ▶ Confirm your input
- ▶ Enter the smallest Z coordinate (e.g., **-40**)
- ▶ Confirm your input
- ▶ Enter the largest X coordinate (e.g., **100**)
- ▶ Confirm your input
- ▶ Enter the largest Y coordinate (e.g., **100**)
- ▶ Confirm your input
- ▶ Enter the largest Z coordinate (e.g., **0**)
- ▶ Confirm your input
- ▶ Select **Confirm**
- The control concludes the NC block.



Working spindle axis

X Y **Z**

Workpiece blank def.: MIN point

X 0 x

Y 0 x

Z -40 x

Workpiece blank def.: MAX point

X 100 x

Y 100 x

Z 0 x

Comment

Confirm Discard Delete line

Form column with the defined columns

0 BEGIN PGM 1339889 MM
1 BLK FORM 0.1 Z X+0 Y+0 Z-40
2 BLK FORM 0.2 X+100 Y+100 Z+0
3 END PGM 1339889 MM

More detailed information

- Inserting the workpiece blank
Further information: "Defining a workpiece blank with BLK FORM", Page 144
- Reference points in the machine
Further information: "Presets in the machine", Page 99

3.3.6 Structure of an NC program

Using a uniform structure for an NC program offers the following advantages:

- Improved overview
- Quicker programming
- Fewer sources of error

Recommended structure for a contouring program



The control automatically inserts the **BEGIN PGM** and **END PGM** NC blocks.




- 1 **BEGIN PGM** with selection of the unit of measure
- 2 Define the workpiece blank
- 3 Call the tool, with the tool axis and the technological data
- 4 Move the tool to a safe position, and switch the spindle on
- 5 Pre-position the tool in the working plane, near the first contour point
- 6 Pre-position the tool in the tool axis, turn coolant on if necessary
- 7 Approach the contour, activate tool radius compensation if necessary
- 8 Machine the contour
- 9 Depart from the contour, turn coolant off
- 10 Move the tool to a safe position
- 11 Conclude the NC program
- 12 **END PGM**

3.3.7 Contour approach and departure

When you program a contour, you need a starting point and end point outside the contour.

The following positions are necessary for contour approach and departure:

Help graphic

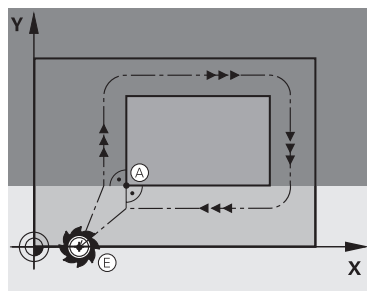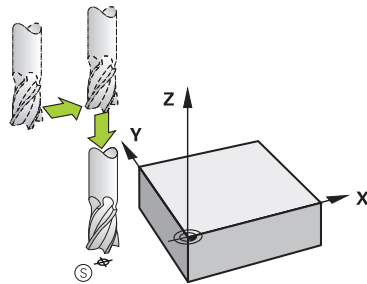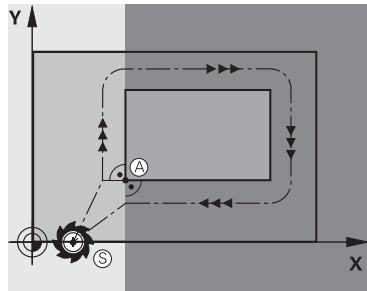

Position

Starting point

The following preconditions apply for the starting point:

- No tool radius compensation
- Approachable without danger of collision
- Near to the first contour point

The graphic shows the following information:

If you define the starting point to be in the dark gray area, the contour will be damaged when the first contour point is approached.

Approaching the starting point in the tool axis

Before approaching the first contour point, you must position the tool to the working depth in the tool axis. If there is a danger of collision, approach the starting point in the tool axis separately.

First contour point

The control moves the tool from the starting point to the first contour point.

You need to program tool radius compensation for the tool movement to the first contour point.


End point

The following preconditions apply for the end point:

- Approachable without danger of collision
- Near to the last contour point
- In order to make sure that the contour will not be damaged, the optimal ending point should lie on the extended tool path for machining the last contour element

The graphic shows the following information:

If you define the end point to be in the dark gray area, the contour will be damaged when the end point is approached.

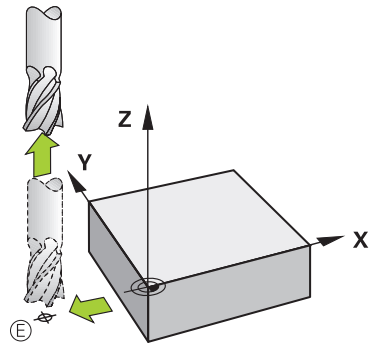Help graphic**Position****Departing from the end point in the tool axis**

Program the tool axis separately when departing from the end point.

Identical starting and end points


Do not program any tool radius compensation if the starting point and end point are the same.

In order to make sure that the contour will not be damaged, the optimal starting point should lie between the extended tool paths for machining the first and last contour elements.

More detailed information

- Functions for approaching and departing from the contour

Further information: "Approaching and departing from a contour", Page 195

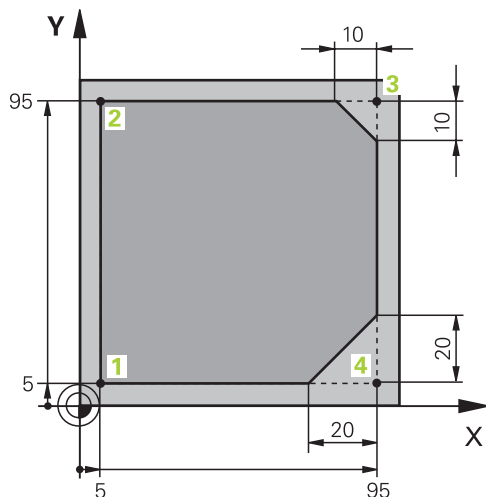3.3.8 Programming a simple contour

Workpiece to be programmed

The following texts show you how to mill once at a depth of 5 mm around the contour shown here. You have already defined the workpiece blank.

Further information: "Defining the workpiece blank", Page 81

After you have inserted an NC function, the control shows an explanation about the current syntax element in the dialog bar. You can enter the data directly in the form.



Always write an NC program as if the tool were moving. This makes it irrelevant whether a head axis or a table axis performs the motion.

Calling a tool

Form column with the syntax elements of the tool call

To call a tool:

TOOL
CALL

- ▶ Select **TOOL CALL**
- ▶ Select **Number** in the form
- ▶ Enter the tool number (e.g., **16**)
- ▶ Select the tool axis **Z**
- ▶ Select the spindle speed **S**
- ▶ Enter the spindle speed (e.g., **6500**)
- ▶ Select **Confirm**
- The control concludes the NC block.

Confirm

3 TOOL CALL 16 Z S6500

Moving the tool to a safe position

Form column with the syntax elements of a straight line

To move the tool to a safe position:



- ▶ Select the path function **L**



- ▶ Select **Z**
- ▶ Enter a value (e.g., **250**)
- ▶ Select tool radius compensation **R0**
- The control applies **R0**, which means there is no tool radius compensation.
- ▶ Select the **FMAX** feed rate
- The control adopts **FMAX** for rapid traverse.
- ▶ If needed, enter a miscellaneous function **M**, such as **M3** (turn spindle on)



- ▶ Select **Confirm**
- The control concludes the NC block.

4 L Z+250 R0 FMAX M3

Pre-positioning in the working plane

To pre-position in the working plane:



- ▶ Select the path function **L**



- ▶ Select **X**
- ▶ Enter a value (e.g., **-20**)



- ▶ Select **Y**
- ▶ Enter a value (e.g., **-20**)
- ▶ Select the **FMAX** feed rate



- ▶ Select **Confirm**
- The control concludes the NC block.

5 L X-20 Y-20 FMAX

Pre-positioning in the tool axis

To pre-position in the tool axis:



- ▶ Select the path function **L**



- ▶ Select **Z**
- ▶ Enter a value (e.g., **-5**)
- ▶ Select the feed rate **F**
- ▶ Enter the value for the positioning feed rate (e.g., **3000**)
- ▶ If needed, enter a miscellaneous function **M**, such as **M8** (turn coolant on)




Confirm

- ▶ Select **Confirm**
- The control concludes the NC block.

6 L Z-5 R0 F3000 M8

Approaching the contour

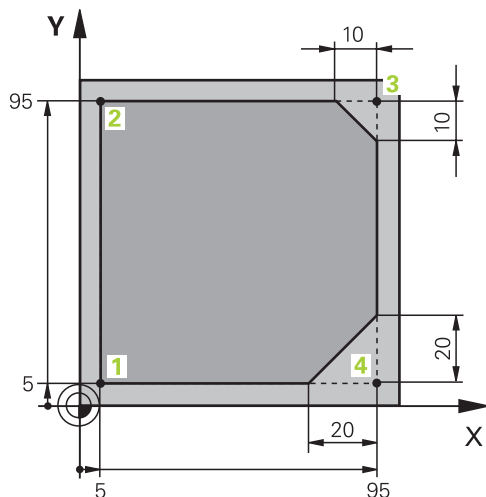

Workpiece to be programmed

Center angle

CCA 90 x

Radius of an arc

R 8 x

Radius compensation

R0 RL RR

Feed rate

F 700 x

M-Functions

Confirm Discard Delete line

Form column with the syntax elements of an approach function

To approach the contour:

APPR
/DEP




Paste

Confirm

- ▶ Select the **APPR DEP** path function
- > The control opens the **Insert NC function** window.
- ▶ Select **APPR**
- ▶ Select an approach function (e.g., **APPR CT**)
- ▶ Select **Paste**
- ▶ Enter the coordinates of starting point **1** (e.g., **X 5 Y 5**)
- ▶ For the center angle **CCA**, enter the approach angle (e.g., **90**)
- ▶ Enter the radius of the circular arc (e.g., **8**)
- ▶ Select **RL**
- > The control applies tool radius compensation to the left.
- ▶ Select the feed rate **F**
- ▶ Enter the value for the machining feed rate (e.g., **700**)
- ▶ Select **Confirm**
- > The control concludes the NC block.





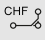

7 APPR CT X+5 Y+5 CCA90 R+8 RL F700

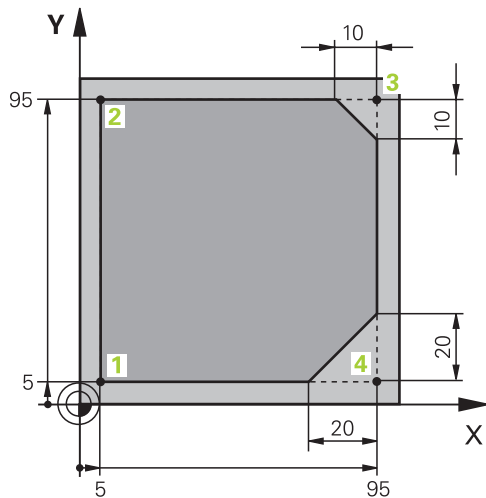Machining a contour



Workpiece to be programmed

To machine the contour:

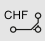- | | |
|---|---|
|  | <ul style="list-style-type: none"> ▶ Select the path function L ▶ Enter the coordinates of contour point 2 that differ (e.g., Y 95) ▶ Conclude the NC block with Confirm |
|  | <ul style="list-style-type: none"> ▶ Select the path function L ▶ Enter the coordinates of contour point 3 that differ (e.g., X 95) ▶ Conclude the NC block with Confirm |
|  | <ul style="list-style-type: none"> ▶ Select the path function CHF ▶ Enter the chamfer width (e.g., 10) ▶ Conclude the NC block with Confirm |
|  | <ul style="list-style-type: none"> ▶ Select the path function L ▶ Enter the coordinates of contour point 4 that differ (e.g., Y 5) ▶ Conclude the NC block with Confirm |
|  | <ul style="list-style-type: none"> ▶ Select the path function CHF ▶ Enter the chamfer width (e.g., 20) ▶ Conclude the NC block with Confirm |
|  | <ul style="list-style-type: none"> ▶ Select the path function L ▶ Enter the coordinates of contour point 1 that differ (e.g., X 5) ▶ Conclude the NC block with Confirm |

8 L Y+95

9 L X+95

10 CHF 10

11 L Y+5

12 CHF 20

13 L X+5

Departing from the contour

The screenshot shows a software interface for defining a departure function. It includes input fields for 'Center angle' (CCA) set to 90, 'Radius of an arc' (R) set to 8, 'Feed rate' (F) set to 3000, and 'M-Functions' (M) set to 9. There are also buttons for 'Confirm', 'Discard', and 'Delete line'.

Form column with the syntax elements of a departure function

To depart from the contour:

APPR
/DEP



Paste




Confirm

- ▶ Select the **APPR DEP** path function
- The control opens the **Insert NC function** window.
- ▶ Select **DEP**
- ▶ Select a departure function (e.g., **DEP CT**)
- ▶ Select **Paste**
- ▶ For the center angle **CCA**, enter the departure angle (e.g., **90**)
- ▶ Enter the departure radius (e.g., **8**)
- ▶ Select the feed rate **F**
- ▶ Enter the value for the positioning feed rate (e.g., **3000**)
- ▶ If needed, enter a miscellaneous function **M**, such as **M9** (turn coolant off)
- ▶ Select **Confirm**
- The control concludes the NC block.

14 DEP CT CCA90 R+8 F3000 M9

Moving the tool to a safe position and concluding the NC program

To move the tool to a safe position:

-  ▶ Select the path function **L**
-  ▶ Select **Z**
- ▶ Enter a value (e.g., **250**)
- ▶ Select tool radius compensation **R0**
- ▶ Select the **FMAX** feed rate
- ▶ Enter a miscellaneous function **M**, such as **M30** (program end)
-  ▶ Select **Confirm**
- > The control concludes the NC block and the NC program.

15 L Z+250 R0 FMAX M30


More detailed information

- Tool call
Further information: "Tool call by TOOL CALL", Page 159
- Line **L**
Further information: "Straight line L", Page 175
- Designation of the axes and the working plane
Further information: "Designation of the axes on milling machines", Page 98
- Functions for approaching and departing from the contour
Further information: "Approaching and departing from a contour", Page 195
- Chamfer **CHF**
Further information: "Chamfer CHF", Page 175
- Miscellaneous functions
Further information: "Overview of miscellaneous functions", Page 413

3.3.9 Configuring the control's user interface for simulation

In the **Editor** operating mode you can test NC programs graphically. The control simulates the active NC program in the **Program** workspace.

In order to simulate the NC program you must open the **Simulation** workspace.


 For the simulation you can close the **Form** column to get a better view of the NC program and the **Simulation** workspace.

Opening the Simulation workspace

You can open additional workspaces in the **Editor** operating mode only if an NC program is open.

To open the **Simulation** workspace:

- ▶ In the application bar, select **Workspaces**
- ▶ Select **Simulation**
- > The control then additionally displays the **Simulation** workspace.

 You can also open the **Simulation** workspace with the **Test Run** operating mode key.

Configuring the Simulation workspace

You can simulate the NC program without needing to enter any special settings. However, an adjustment to the simulation speed is recommended for best viewing of the simulation.

To adjust the speed of the simulation:

- ▶ Use the slider to select the factor (e.g., **5.0 * T**)
- The control then performs the subsequent simulation at five times the speed of the programmed feed rate.

If you use different tables, such as tool tables, for program run and the simulation, then you can define the tables in the **Simulation** workspace.

More detailed information


- Workspace: **Simulation**

Further information: "Simulation Workspace", Page 557

3.3.10 Simulating an NC program

You test the NC program in the **Simulation** workspace.

Starting the simulation

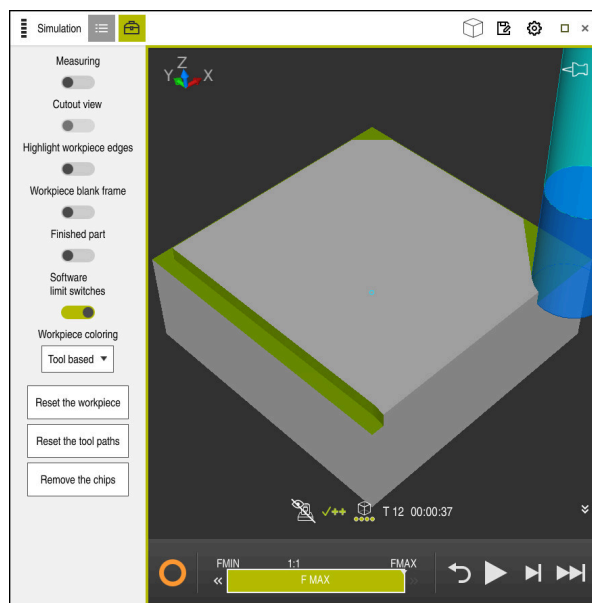

Simulation workspace in the **Editor** operating mode

You start the simulation as follows:



- ▶ Select **Start**
- The control asks whether the file should be saved.
- ▶ Select **Save**
- The control starts the simulation.
- The control uses the **Control-in-operation** symbol to show the simulation status.

Definition**Control-in-operation:**

The control uses the **Control-in-operation** symbol to show the current simulation status in the action bar and on the tab of the NC program:

- White: no movement command
- Green: active machining, axes are moving
- Orange: NC program interrupted
- Red: NC program stopped

More detailed information

- **Simulation** workspace

Further information: "Simulation Workspace", Page 557

3.4 Switching the machine off



Refer to your machine manual.
Switching off is a machine-dependent function.

NOTICE

Caution: Data may be lost!

The control must be shut down so that running processes can be concluded and data can be saved. Immediate switch-off of the control by turning off the main switch can lead to data loss no matter what state the control was in!

- ▶ Always shut down the control
- ▶ Only operate the main switch after being prompted on the screen

To shut down the control:



- ▶ Select the **Home** operating mode



Shut down

- ▶ Select **Shut down**
- > The control opens the **Shut down** window.



Shut down


- ▶ Select **Shut down**
- > The control shuts down.
- > Once shutdown has concluded, the control displays the text **Now you can switch off.**

4

**NC and
Programming
Fundamentals**

4.1 NC fundamentals

4.1.1 Programmable axes

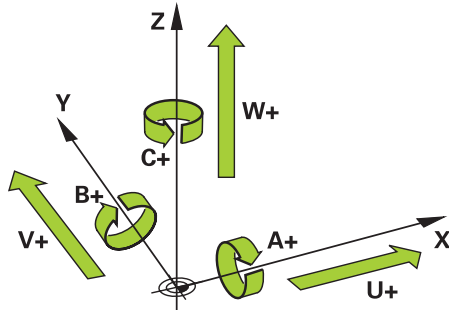

The programmable axes of the control are in accordance with the axis definitions specified in DIN 66217.

The programmable axes are designated as follows:

Main axis	Parallel axis	Rotary axis
X	U	A
Y	V	B
Z	W	C



Refer to your machine manual.

The number, designation and assignment of the programmable axes depend on the machine.

Your machine manufacturer can define further axes, such as PLC axes.

4.1.2 Designation of the axes on milling machines


The axes **X**, **Y** and **Z** on your milling machine are designated as the main axis (1st axis), secondary axis (2nd axis) and tool axis. The main axis and secondary axis define the working plane.

The axes are associated as follows:

Main axis	Secondary axis	Tool axis	Working plane
X	Y	Z	XY, also UV, XV, UY
Y	Z	X	YZ, also WU, ZU, WX
Z	X	Y	ZX, also VW, YW, VZ

4.1.3 Position encoders and reference marks

Fundamentals

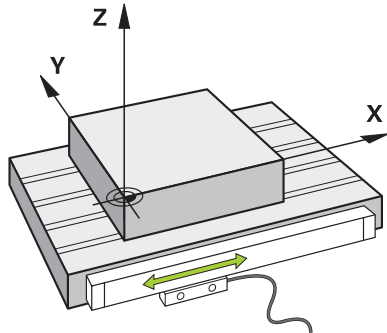

The position of the machine axes is ascertained with position encoders. As a rule, linear axes are equipped with linear encoders. Rotary tables and rotary axes feature angle encoders.

The position encoders detect the positions of the tool or machine table by generating an electrical signal during movement of an axis. The control ascertains the position of the axis in the current reference system from this electrical signal.

Further information: "Reference systems", Page 222

Position encoders can measure these positions through different methods:

- Absolutely
- Incrementally

The control cannot determine the position of the axes while the power is interrupted. Absolute and incremental position encoders behave differently once power is restored.

Absolute position encoders


On absolute position encoders, every position on the encoder is uniquely identified. The control can thus immediately determine the association between the axis position and the coordinate system after a power interruption.

Incremental position encoders

Incremental position encoders need to find the distance between the current position and a reference mark in order to determine the actual position. Reference marks indicate a machine-based reference point. A reference mark must be traversed in order to determine the current position after a power interruption.

If the position encoders feature distance-coded reference marks, then you need to move the linear encoders of the axes by no more than 20 mm. On angle encoders this distance is no more than 20 °.

Further information: User's Manual for Setup and Program Run

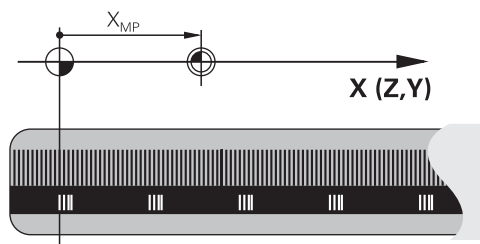






4.1.4 Presets in the machine

The following table contains an overview of the presets in the machine or on the workpiece.

Related topics

- Presets on the tool

Further information: "Presets on the tool", Page 154

Icon	Preset
	<p>Machine datum</p> <p>The machine datum is a fixed point defined in the machine configuration by the machine manufacturer.</p> <p>The machine datum is the origin of the machine coordinate system M-CS.</p> <p>Further information: "Machine coordinate system M-CS", Page 223</p> <p>If you program M91 in an NC block, the defined values are referenced to the machine datum.</p> <p>Further information: "Traversing in the machine coordinate system M-CS with M91", Page 416</p>
	<p>M92 datum M92-ZP (zero point)</p> <p>The M92 datum is a fixed point defined relative to the machine datum by the machine manufacturer in the machine configuration.</p> <p>The M92 datum is the origin of the M92 coordinate system. If you program M92 in an NC block, the defined values are referenced to the M92 datum.</p> <p>Further information: "Traversing in the M92 coordinate system with M92", Page 417</p>
	<p>Tool change position</p> <p>The tool change position is a fixed point defined relative to the machine datum by the machine manufacturer in the tool-change macro.</p>
	<p>Reference point</p> <p>The reference point is a fixed point for initializing position encoders.</p> <p>Further information: "Position encoders and reference marks", Page 99</p> <p>If the machine has incremental position encoders, the axes must traverse the reference point after booting.</p> <p>Further information: User's Manual for Setup and Program Run</p>
	<p>Workpiece preset</p> <p>With the workpiece preset you define the origin of the workpiece coordinate system W-CS.</p> <p>Further information: "Workpiece coordinate system W-CS", Page 228</p> <p>The workpiece preset is defined in the active row of the preset table. You determine the workpiece preset with a 3D touch probe, for example.</p> <p>If no transformations are defined, the entries in the NC program refer to the workpiece preset.</p>
	<p>Workpiece datum</p> <p>You define the workpiece datum with transformations in the NC program, for example with TRANS DATUM or a datum table. The entries in the NC program refer to the workpiece datum. If no transformations are defined in the NC program, the workpiece datum corresponds to the workpiece preset.</p> <p>If you tilt the working plane (option 8), the workpiece datum is the point around which the workpiece is rotated.</p>


4.2 Programming possibilities

4.2.1 Path functions

Use the path functions to program contours.

A workpiece contour consists of several contour elements, such as straight lines and circular arcs. You use path functions, such as straight line **L**, to program tool movements for these contours.

Further information: "Fundamentals of path functions", Page 171

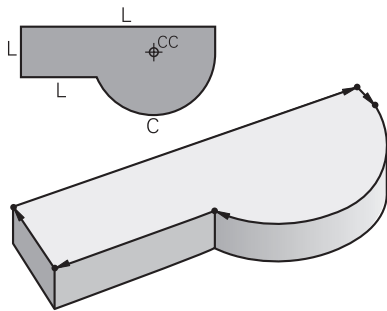

4.2.2 Graphical programming

As an alternative to Klartext programming you can program contours graphically in the **Contour graphics** workspace.

You can create 2D sketches by drawing lines and arcs and then export the contour to an NC program.

You can import existing contours from an NC program for graphical editing.

Further information: "Graphical Programming", Page 515

4.2.3 Miscellaneous functions M

You can use miscellaneous functions to control the following actions:

- Program run, e.g. **M0** Program STOP
- Machine functions, e.g. **M3** Spindle ON clockwise
- Contouring behavior of the tool, e.g. **M197** Corner rounding

Further information: "Miscellaneous Functions", Page 411

4.2.4 Subprograms and program-section repeats

Subprograms and program-section repeats enable you to program a machining sequence once and then run it as often as necessary.

Program sections that are defined in a label can be directly executed repeatedly as program-section repeats, or can be called as a subprogram at defined locations in the main program.

If you wish to execute a specific NC program section only under certain conditions, you also define this machining sequence as a subprogram.

Within an NC program you can call a separate NC program for execution.

Further information: "Subprograms and program section repeats with the label LBL", Page 210

4.2.5 Programming with variables

In an NC program, variables are used as placeholders for numerical values or texts. A numerical value or text is assigned to a variable elsewhere.

In the **Q parameter list** window, you can see and edit the numerical values and texts of the individual variables.

Further information: "Q parameter list window", Page 457

You can use the variables to program mathematical functions that control program execution or describe a contour.

You can also use variable programming, for example, to save and process measurement results determined by the 3D touch probe during program execution.

Further information: "Variables: Q, QL, QR and QS parameters", Page 454

4.2.6 CAM programs

You can also optimize and execute externally created NC programs on the control.

You use CAD (**Computer-Aided Design**) to create geometric models of the workpieces to be produced.

In a CAM system (**Computer-Aided Manufacturing**) you then define how the CAD model will be produced. You can use an internal simulation to check the resulting tool paths, which are not control-specific.

With a postprocessor in the CAM system you then generate the control- and machine-specific NC programs. This results not only in programmable path functions, but also in splines (**SPL**) and straight lines **LN** with surface normal vectors.

Further information: "Multiple-Axis Machining", Page 381

4.3 Programming fundamentals

4.3.1 Contents of an NC program

Application

You use NC programs to define the movements and behavior of your machine. NC programs consist of NC blocks that contain the syntax elements of the NC functions. With the HEIDENHAIN Klartext programming language, the control supports you by showing a dialog with information about the required content for every syntax element.

Related topics

- Creating a new NC program
Further information: "Creating a new NC program", Page 80
- NC programs using CAD files
Further information: "CAM-generated NC programs", Page 395
- Structure of an NC program for contour machining
Further information: "Structure of an NC program", Page 83

Description of function

You create NC programs in the **Editor** operating mode in the **Program** workspace.

Further information: "Program workspace", Page 106

The first and last NC blocks of the NC program contain the following information:

- Syntax **BEGIN PGM** or **END PGM**
- Name of the NC program
- Unit of measure of the NC program (mm or inches)

The control automatically inserts the **BEGIN PGM** and **END PGM** NC blocks when creating the NC program. You cannot delete these NC blocks.

The NC blocks created after **BEGIN PGM** contain the following information:

- Workpiece blank definition
- Tool calls
- Approaching a safe position
- Feed rates and spindle speeds
- Traverse movements, cycles and other NC functions

0 BEGIN PGM EXAMPLE MM	; Start of program
1 BLK FORM 0.1 Z X-50 Y-50 Z-20	
2 BLK FORM 0.2 X+50 Y+50 Z+0	; NC function for workpiece blank definition, consisting of two NC blocks
3 TOOL CALL 5 Z S3200 F300	; NC function for tool call
4 L Z+100 R0 FMAX M3	; NC function for straight-line traverse
* - ...	
11 M30	; NC function for concluding the NC program
12 END PGM EXAMPLE MM	; End of program

Syntax component	Meaning
NC block	<p>4 TOOL CALL 5 Z S3200 F300</p> <p>An NC block consists of the block number and the syntax of the NC function. An NC block can consist of multiple lines, such as with cycles.</p> <p>The control numbers the NC blocks in ascending sequence.</p>
NC function	<p>TOOL CALL 5 Z S3200 F300</p> <p>You use NC functions to define the behavior of the control. The block number is not a part of the NC functions.</p>
Syntax initiator	<p>TOOL CALL</p> <p>The syntax initiator clearly designates each NC function. Syntax initiators are used in the Insert NC function window.</p> <p>Further information: "Inserting NC functions", Page 115</p>

Syntax component	Meaning
Syntax element	TOOL CALL 5 Z S3200 F300 Syntax elements are all parts of the NC function, such as technology values S3200 or coordinate information. NC functions also contain optional syntax elements. The control shows certain syntax elements in color in the Program workspace. Further information: "Appearance of the NC program", Page 108
Value	3200 for spindle speed S Not every syntax element must contain a numerical value, such as tool axis Z .

If you create NC programs in a text editor or outside of the control, note the correct spelling and sequence of the syntax elements.

Notes

NOTICE

Danger of collision!

With NC software 81762x-16, the TNC7 does not support ISO programming. There is a risk of collision during execution due to the missing support.

- Use Klartext NC programs exclusively.

- NC functions can also consist of more than one NC block, such as **BLK FORM**.
- Miscellaneous functions **M** and comments can be both syntax elements within NC functions as well as their own NC functions.
- Always write an NC program as if the tool were moving. This makes it irrelevant whether a head axis or a table axis performs the motion.
- The file name extension ***.h** designates a Klartext program.

Further information: "Programming fundamentals", Page 102

4.3.2 Editor operating mode

Application

In the **Editor** operating mode you can do the following:

- Create, edit and simulate NC programs
- Create and edit contours
- Create and edit pallet tables

Description of function

With **Add** you can create a new file or open an existing one. The control displays up to ten tabs.

The **Editor** presents the following workspaces if an NC program is open:

- **Help**
Further information: "Help workspace", Page 534
- **Contour**
Further information: "Graphical Programming", Page 515
- **Program**
Further information: "Program workspace", Page 106
- **Simulation**
Further information: "Simulation Workspace", Page 557
- **Simulation status**
Further information: User's Manual for Setup and Program Run
- **Keyboard**
Further information: "Virtual keyboard of the control bar", Page 536

If you open a pallet table, the control displays the workspaces **Job list** and **Form** for pallets. You cannot edit these workspaces.

Further information: "Job list workspace", Page 578

Further information: "Form workspace for pallets", Page 585




If option 154 is active, **Batch Process Manager** lets you use the complete scope of functions when executing pallet tables.

Further information: "Job list workspace", Page 578

If an NC program or pallet table selected is in the **Program Run** operating mode, the controls shows the **M** status on the tab of the NC program. If the **Simulation** workspace for this NC program is open, the controls shows the **Control-in-operation** icon on the tab of the NC program.

Icons and buttons

The **Editor** operating mode contains the following icons and buttons:

Icon or button	Meaning
	The control uses this icon to show that an NC program is open.
	The control uses this icon to show that a contour is open. Further information: "Graphical Programming", Page 515
	The control uses this icon to show that a pallet table is open. Further information: "Pallet Machining and Job Lists", Page 577
Klartext programming	If this switch is active, then you are using dialog-guided programming. If this switch is not active, then you are programming in the text editor. Further information: "Editing NC programs", Page 114
Insert NC function	The control opens the Insert NC function window. Further information: "Editing NC programs", Page 114
GOTO block number	The control selects the block number that you defined. Further information: "GOTO function", Page 539
Q info	The control opens the Q parameter list window, where you can see and edit the current values and descriptions of the variables. Further information: "Q parameter list window", Page 457
/ Skip Off/On	Mark NC blocks with a / character. NC blocks marked with a / character will be ignored during program run as soon as the Skip / switch is active. Further information: "Hiding NC blocks", Page 541
; Comment Off/On	Insert or remove a ; character in front of an NC block. If an NC block begins with a ; character, then the block is a comment. Further information: "Adding comments", Page 540
Edit	The control opens the context menu. Further information: "Context menu", Page 548
Select in Program Run	The control opens the file in the Program Run operating mode. Further information: User's Manual for Setup and Program Run
Start the simulation	The control opens the Simulation workspace and starts graphic simulation. Further information: "Simulation Workspace", Page 557

4.3.3 Program workspace


Application

The control displays the NC program in the **Program** workspace.

You can edit the NC program in the **Editor** operating mode and in the **MDI** application, but not in the **Program Run** operating mode.

Description of function

Areas of the Program workspace

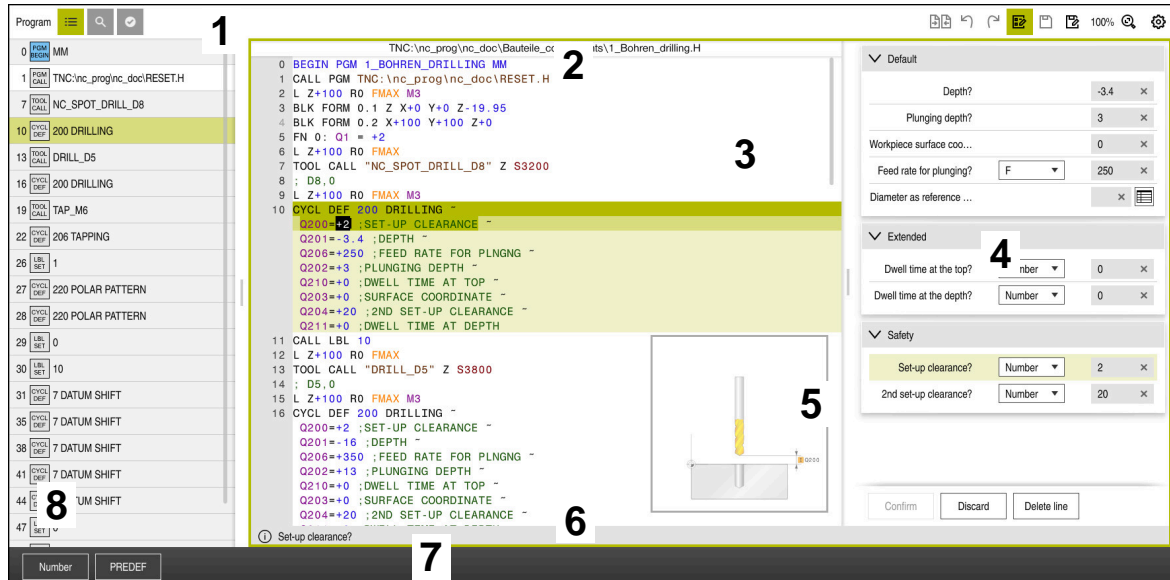

Program workspace with active structure, help graphic and form

1 Title bar

Further information: "Icons in the title bar", Page 108

2 File information bar

In the file information bar, the control shows the path and file name of the NC program.

3 Contents of the NC program

Further information: "Appearance of the NC program", Page 108

4 Form column

Further information: "Form column in the Program workspace", Page 113

5 Help graphic of the syntax element being edited

Further information: "Help graphic", Page 109

6 Dialog bar

In the dialog bar, the control shows additional information or instructions for the syntax element being edited.

7 Action bar

In the action bar, the control shows selection options for the syntax element being edited.

8 Structure, Search or Tool check column

Further information: "Structure column in the Program workspace", Page 542




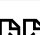




Further information: "Search column in the Program workspace", Page 544

Further information: User's Manual for Setup and Program Run

Icons in the title bar

The following icons are shown in the **Program** workspace in the title bar:

Further information: "Icons on the control's user interface", Page 71

Icon or shortcut	Function
	Open and close the Structure column Further information: "Structure column in the Program workspace", Page 542
 CTRL+F	Open and close the Search column Further information: "Search column in the Program workspace", Page 544
	Open and close the Tool check column Further information: User's Manual for Setup and Program Run
	Activate and end comparison functions Further information: "Program comparison", Page 547
	Show and hide the Form column Further information: "Form column in the Program workspace", Page 113
100%	Font size of the NC program
<div>  <p>When you select the percent value, the control will display icons for increasing and decreasing the font size.</p> </div>	
	Set font size of the NC program to 100%
	Open the Program settings window Further information: "Settings in the Program workspace", Page 109

Appearance of the NC program

By default, the control displays the syntax in black color. The control displays the following syntax elements in color within the NC program:

Color	Syntax element
Brown	Text entries, e.g. tool name or file name
Blue	<ul style="list-style-type: none"> Numerical values Structure items and texts
Dark green	Comments
Purple	<ul style="list-style-type: none"> Variables Miscellaneous functions M
Dark red	<ul style="list-style-type: none"> Definition of spindle speed Definition of feed rate
Orange	Rapid traverse FMAX

Help graphic

When you are editing an NC block, for some NC functions the control shows a help graphic for the current syntax element. The size of the help graphic depends on the size of the **Program** workspace.

The control shows the help graphic at the right edge of the workspace, or at the top or bottom edge. The help graphic is positioned in the half that does not contain the cursor.

When you tap or click the help graphic, the control will maximize the help graphic. If the **Help** workspace is open, the control displays the help graphic there.

Further information: "Help workspace", Page 534

Settings in the Program workspace


In the **Program settings** window you can influence contents shown in the **Program** workspace as well as the control's behavior there. The selected settings are modally effective.

The settings available in the **Program settings** window depend on the operating mode.

The **Program settings** window consists of the following areas:

- **Structure**
- **Editing**

Structure area

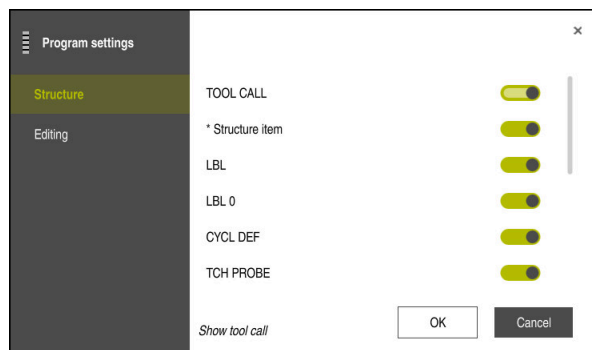

Structure area in the **Program settings** window

In the **Structure** area you use switches to choose which structure elements the control should display in the **Structure** column.

Further information: "Structure column in the Program workspace", Page 542

The following structure elements are available:

- **TOOL CALL**
- *** Structure block**
- **LBL**
- **LBL 0**
- **CYCL DEF**
- **TCH PROBE**
- **MONITORING SECTION START**
- **MONITORING SECTION STOP**
- **PGM CALL**
- **FUNCTION MODE**
- **M30 / M2**
- **M1**
- **M0 / STOP**

Editing area

The **Editing** area contains the following settings:

Setting	Meaning
Automatic saving	<p>Save changes to the NC program automatically or manually</p> <p>If the switch is active, the control saves the NC program automatically upon the following actions:</p> <ul style="list-style-type: none"> ■ Switching between tabs ■ Starting the simulation ■ Closing the NC program ■ Switching the operating mode <p>If the switch is not active, you must save manually. Upon the stated actions, the control asks whether the changes should be saved.</p>
Allow syntax errors in text mode	<p>If the switch is active, the control can save NC blocks in the text editor even if they contain syntax errors.</p> <p>If the switch is not active, you must correct all syntax errors within an NC block. Otherwise you cannot save the NC block.</p> <p>Further information: "Editing NC functions", Page 117</p>
	<p>Create relative or absolute path entries</p> <p>If the switch is active, the control uses absolute paths for called files, e.g.: TNC: \nc_prog\mdi.h.</p> <p>If the switch is not active, the control uses relative paths, e.g.: demo\reset.H. If the file is located at a higher level in the folder structure than the calling NC program, the control creates an absolute path.</p> <p>Further information: "Path", Page 338</p>
Always save formatted	<p>Format NC program while saving</p> <p>If an NC program has fewer than 30 000 characters, the control always formats the file when saving it, e.g.: capital letters for all syntax initiators.</p> <p>If the switch is active, the control also formats NC programs with more than 30 000 characters each time it saves the file. This can increase the time needed for saving.</p> <p>If the switch is not active, the control does not format NC programs with more than 30 000 characters.</p>









Using the Program workspace

The **Program** workspace can be used as follows:

- Touch operation
- Operation with keys and buttons
- Operation with a mouse

















Touch operation

You use gestures to perform the following functions:

Symbol	Gesture	Meaning
	Tap	<ul style="list-style-type: none"> ■ Select an NC block ■ Select a syntax element while editing
	Double tap	Edit an NC block
	Long press	Open the context menu <div data-bbox="726 750 1209 884">  If you are working with a mouse, click with the right mouse key. </div> <p>Further information: "Context menu", Page 548</p>
	Swipe	Scroll in an NC program
	Drag	Change the area in which NC blocks are marked. <p>Further information: "Context menu in the Program workspace", Page 551</p>
	Spread	Increase the syntax font size
	Pinch	Reduce the syntax font size

Keys and buttons

You use keys and buttons to perform the following functions:

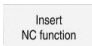Key or button	Function
 	<ul style="list-style-type: none"> ■ Navigate between NC blocks ■ During editing, search for the same syntax element in the NC program <p>Further information: "Searching for the same syntax elements in different NC blocks", Page 113</p>
 	<ul style="list-style-type: none"> ■ Edit an NC block ■ During editing, navigate to previous or next syntax element
CTRL+  CTRL+ 	Navigate one position to the right or left within the value of a syntax element
	<ul style="list-style-type: none"> ■ Use the block number to select an NC block directly <p>Further information: "GOTO function", Page 539</p> <ul style="list-style-type: none"> ■ Open selection menus during editing
	<p>Open position display of the control bar in order to copy the position</p> <p>If you select a line in the position display, the control copies the current value of this line to an open dialog.</p>
	Delete value of a syntax element
	Skip or remove optional syntax elements during programming
	Delete an NC block or cancel a dialog
	<ul style="list-style-type: none"> ■ Confirm entry and conclude an NC block ■ Open the Add tab
	Cancel editing without applying changes
	<p>Select Klartext programming mode or a text editor</p> <p>Further information: "Editing NC functions", Page 117</p>
	<p>Open the Insert NC function window</p> <p>Further information: "Inserting NC functions", Page 115</p>
	<p>Open the context menu</p> <p>Further information: "Context menu", Page 548</p>

Searching for the same syntax elements in different NC blocks

If you are editing an NC block, you can search for the same syntax element in the rest of the NC program.

To search for a syntax element in the NC program:

- ▶ Select an NC block



- ▶ Edit the NC block



- ▶ Navigate to the desired syntax element
- ▶ Press the arrow up or down key
- > The control marks the next NC block that contains the syntax element. The cursor is on the same syntax element as in the previous NC block. Press the arrow up key to search backwards.

Notes

- If you search for the same syntax element in a very long NC program, the control displays a pop-up window. You can cancel the search at any time.
- Use the optional machine parameter **maxLineCommandSrch** (no. 105412) to define how many NC blocks the control searches for the same syntax element.
- When you open an NC program, the control checks whether the NC program is complete and syntactically correct.
Use the optional machine parameter **maxLineGeoSrch** (no. 105408) to define up to which NC block the control should check the program.
- When you open an NC program without content, you can edit the **BEGIN PGM** and **END PGM** NC blocks and change the unit of measure of the NC program.
- An NC program is incomplete without the **END PGM** NC block.
If you open an incomplete NC program in the **Editor** operating mode, the control automatically inserts the NC block.
- You cannot edit an NC program in the **Editor** operating mode if this NC program is being executed in the **Program Run** operating mode.

Form column in the Program workspace

Application

In the **Form** column in the **Program** workspace, the control shows all possible syntax elements for the currently selected NC function. You can edit all syntax elements in the form.

Related topics





- **Form** workspace for pallet tables
Further information: "Form workspace for pallets", Page 585
- Editing an NC function in the **Form** column
Further information: "Editing NC functions", Page 117

Requirement

- **Klartext programming** mode must be active

Description of function

The control offers the following icons and buttons for using the **Form** column:

Icon or button	Function
	Show and hide the Form column
	Confirm entry and conclude an NC block
	Discard entries and conclude an NC block
	Delete NC block

The control groups the syntax elements in the form depending on their functions, such as coordinates or safety.

The control indicates the required syntax elements with a red frame. Only once you have defined all of the required syntax elements can you confirm the entries and conclude the NC block. The control highlights the syntax element currently being edited.

If an input is invalid, the control displays an information symbol ahead of the syntax element. When you select the information symbol, the control displays information on the error.

Notes

- In the following cases the control shows no contents in the form:
 - NC program is being run
 - NC blocks are being marked
 - NC block contains syntax error(s)
 - **BEGIN PGM** or **END PGM** NC blocks are selected
- If you define more than one miscellaneous function in an NC block, you can use the arrows in the form to change the sequence of the miscellaneous functions.
- If you define a label with a number, the control shows an icon next to the input area. The control uses this symbol to assign the next available number to the label.

4.3.4 Editing NC programs

Application

The editing of NC programs refers both to the insertion of NC functions as well as their modification. You can also edit NC programs that you previously generated with a CAM system and then transmitted to the control.

Related topics

- Using the **Program** workspace

Further information: "Using the Program workspace", Page 110

Requirements

You can edit NC programs only in the **Programming** operating mode and in the **MDI** application.



In the **MDI** application you edit only the NC program **\$mdi.h** or **\$mdi_inch.h**.

Description of function

Inserting NC functions

Inserting an NC function directly with keys or buttons

You can directly insert frequently needed NC functions, such as path functions, with keys.

As an alternative to the keys, the control offers both the screen keyboard as well as the **Keyboard** workspace in NC input mode.


Further information: "Virtual keyboard of the control bar", Page 536

To insert frequently needed NC functions:



- ▶ Select **L**
- > The control creates a new NC block and starts the dialog.
- ▶ Follow the instructions in the dialog

Inserting an NC function through selection

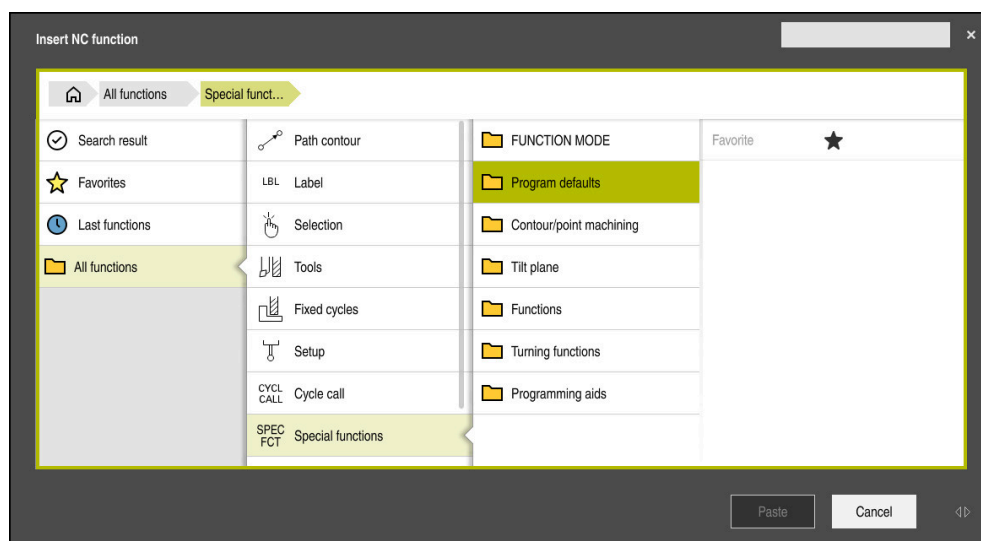

Insert NC function window

You can select all NC functions through the **Insert NC function** window.

You can navigate through the **Insert NC function** window as follows:

- Navigate through the tree structure manually, starting from **All functions**
- Use keys or buttons to narrow down the selection possibilities, e.g.: **CYCL DEF** key opens the cycle groups

Further information: "Keycaps for NC dialog", Page 68

- Ten most recently used NC functions under **Last functions**
- NC functions marked as favorites under **Favorites**

Further information: "Icons on the control's user interface", Page 71

- Enter a search term under **Search for NC functions**

The control displays the results under **Search result**.



You can begin the search as soon as the **Insert NC function** window opens by entering a character.

To insert a new NC function:



- ▶ Select **Insert NC function**
- The control opens the **Insert NC function** window.
- ▶ Navigate to the desired NC function
- The control highlights the selected NC function.



- ▶ Select **Paste**
- The control creates a new NC block and starts the dialog.
- ▶ Follow the instructions in the dialog

Editing NC functions

Editing an NC function in the Klartext programming mode

By default, the control opens newly created and syntactically correct NC programs in the **Klartext programming** mode.

To edit an existing NC function in the **Klartext programming** mode:

- ▶ Navigate to the desired NC function
- ▶ Navigate to the desired syntax element
- ▶ The control displays alternative syntax elements in the action bar.
- ▶ Select a syntax element
- ▶ Define a value, if necessary



- ▶ Conclude entry, e.g. by pressing **END**

Editing an NC function in the Form column

If the **Klartext programming** mode is active, you can also use the **Form** column.

The **Form** does not just show the syntax elements selected and used, but rather all those that are possible for the current NC function.

To edit an existing NC function in the **Form** column:

- ▶ Navigate to the desired NC function



- ▶ Show the **Form** column
- ▶ Select an alternative syntax element if necessary, e.g.: **LP** instead of **L**
- ▶ If necessary, edit or add the value
- ▶ If necessary, enter an optional syntax element or select from a list, e.g.: miscellaneous function **M8**
- ▶ Conclude entry, e.g. by pressing **Confirm**



Editing an NC function in the text editor mode

The control tries to correct syntax errors in the NC program automatically. If automatic correction is not possible, the control switches to text editor mode while editing this NC block. You must correct all errors before you can switch to **Klartext programming** mode.



- If text editor mode is active, the **Klartext programming** switch is to the left and gray.
- If you are editing an NC block with syntax errors, the only way to cancel editing is to press the **ESC** key.

To edit an existing NC function in the text editor mode

- The control underscores the faulty syntax element with a jagged red line and shows an information symbol before the NC function, e.g: for **FMX** instead of **FMAX**.

- Navigate to the desired NC function



- Select the information symbol
- The control might open the **NC block auto-correction** window with a solution proposal.
- Apply the proposal to the NC program with **Yes** or cancel auto-correction.

Yes



- The control cannot offer solution proposals in all cases.
- The text editor mode supports all navigation possibilities of the **Program** workspace. But you can work more quickly in the text editor mode by using gestures or a mouse, since then you can select the information symbol directly, for example.

Notes

NOTICE

Danger of collision!

With NC software 81762x-16, the TNC7 does not support ISO programming. There is a risk of collision during execution due to the missing support.

- Use Klartext NC programs exclusively.

- The instructions include emphasized text strings, e.g: **200 DRILLING**. You can use these text strings for better searching in the **Insert NC function** window.
- When you are editing an NC function, use the arrows to navigate left and right to the syntax elements, even within cycles. The up and down arrows search for the same syntax element in the rest of the NC program.
Further information: "Searching for the same syntax elements in different NC blocks", Page 113
- If you are editing an NC block and haven't saved yet, the **Undo** and **Redo** functions affect the individual syntax elements of the NC function.
Further information: "Icons on the control's user interface", Page 71
- Press the **actual-position-capture** key for the control to open the position display of the status overview. You can copy the current value of an axis into the programming dialog.
See the User's Manual for Setup and Program Run
- Always write an NC program as if the tool were moving. This makes it irrelevant whether a head axis or a table axis performs the motion.
- You cannot edit an NC program in the **Editor** operating mode if this NC program is being executed in the **Program Run** operating mode.

5

**Technology-
Specific NC
Programming**

5.1 Switching the operating mode with FUNCTION MODE

Application

The control offers a **FUNCTION MODE** operating mode for each of the technologies milling, milling-turning and grinding. Additionally, you can use **FUNCTION MODE SET** to activate settings defined by the machine manufacturer, e.g.: switching the traverse range.

Related topics

- Milling-turning operations (option 50)
Further information: "Turning (option 50)", Page 124
- Grinding operations (option 156)
Further information: "Grinding operations (option 156)", Page 136
- Editing kinematic models in the **Settings** application
Further information: User's Manual for Setup and Program Run

Requirements

- Control adapted by the machine manufacturer
The machine manufacturer defines which internal functions the control performs with this function. The machine manufacturer must define selection possibilities for the **FUNCTION MODE SET** function.
- For **FUNCTION MODE TURN**: software option 50 (Milling/turning)
- For **FUNCTION MODE GRIND**: software option 156 (Jig grinding)

Description of function

When the operating modes are switched, the control executes a macro that defines the machine-specific settings for the specific operating mode. With the NC functions **FUNCTION MODE TURN** and **FUNCTION MODE MILL**, you can activate a machine kinematic model that the machine manufacturer has defined and saved in the macro.

If the machine manufacturer has enabled the selection of various kinematic models, then you can switch between them using the **FUNCTION MODE** function.

If turning mode is active, the control shows a corresponding icon in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

Input

12 FUNCTION MODE TURN "AC_TURN"	; Activate turning mode with the selected kinematic model
11 FUNCTION MODE SET "Range1"	; Activate the machine manufacturer setting

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION MODE	Syntax initiator for the machining mode
MILL, TURN, GRIND or SET	Select the machining mode or machine manufacturer setting
" " or QS	Name of a kinematic model or machine manufacturer setting or QS parameter with the name You use choose the setting from a selection menu. Optional syntax element

Notes

WARNING

Caution: Significant property damage!

Very high physical forces are generated during turning, for example due to high rotational speeds and heavy or unbalanced workpieces. Incorrect machining parameters, neglected unbalances or improper fixtures lead to an increased risk of accidents during machining!

- ▶ Clamp the workpiece in the spindle center
- ▶ Clamp workpiece securely
- ▶ Program low spindle speeds (increase as required)
- ▶ Limit the spindle speed (increase as required)
- ▶ Eliminate unbalance (calibrate)


- In the optional machine parameter **CfgModeSelect**(no. 132200), the machine manufacturer defines the settings for the **FUNCTION MODE SET** function. If the machine manufacturer does not define the machine parameter, then **FUNCTION MODE SET** is not available.
- If the **Tilt working plane** or **TCPM** functions are active, you cannot switch the operating mode.
- The preset must be in the center of the turning spindle in turning mode.

5.2 Turning (option 50)

5.2.1 Fundamentals

Depending on the machine and kinematics, it is possible to perform both milling and turning operations on milling machines. A workpiece can thus be machined completely on one machine, even if complex milling and turning applications are required.


In a turning operation, the tool is in a fixed position, whereas the rotary table and the clamped workpiece rotate.

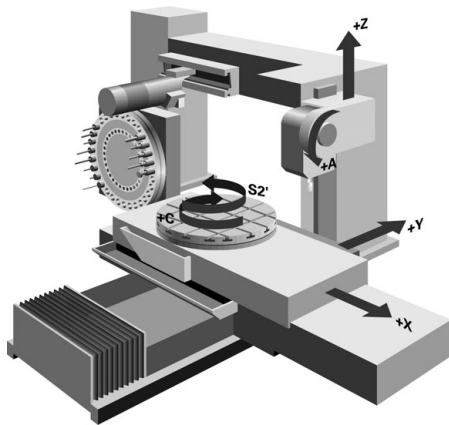

NC fundamentals for turning

The assignment of the axes with turning is defined so that the X coordinates describe the diameter of the workpiece and the Z coordinates the longitudinal positions.

Machining is thus always done in the **ZX** working plane. The machine axes to be used for the required movements depend on the respective machine kinematics and are determined by the machine manufacturer. This makes NC programs with turning functions largely exchangeable and independent of the machine model.

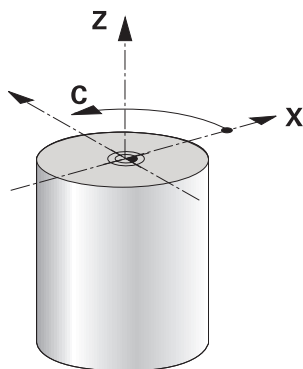

Workpiece preset for turning operations

On the control, you can simply switch between milling and turning mode within your NC program. In turning mode, the rotary table serves as lathe spindle, whereas the milling spindle with the tool is fixed. This way, it is possible to machine rotationally symmetric contours. The tool reference point must always be at the center of the lathe spindle.

Further information: User's Manual for Setup and Program Run

If you use a facing slide, you can set the workpiece preset to a different location, since in this case the tool spindle performs the turning operation.

Further information: "Using the facing head with FACING HEAD POS (option 50)", Page 386

Production processes

Depending on the machining direction and task, turning applications can be subdivided into different production processes, e.g.:

- Longitudinal turning
- Face turning
- Recess turning
- Thread cutting

The control provides several cycles for each of the various production processes.

Further information: User's Manual for Machining Cycles

You can run the cycles with an inclined tool in order to produce undercuts.

Further information: "Inclined turning", Page 128

Tools for turning operations

When managing turning tools, other geometric descriptions than those for milling or drilling tools are required. To execute a tool-tip radius compensation, for example, the definition of the cutting-edge radius is required. The control provides a special tool table for turning tools. In tool management, the control displays only the required tool data for the current tool type.

Further information: User's Manual for Setup and Program Run

Further information: "Tooth radius compensation for turning tools (option 50)", Page 309

You can correct turning tool values in the NC program.

The control offers the following functions for this:

- Cutter radius compensation
Further information: "Tooth radius compensation for turning tools (option 50)", Page 309
- Compensation Tables
Further information: "Tool compensation with compensation tables", Page 312
- The **FUNCTION TURNDATA CORR** function
Further information: "Compensating turning tools with FUNCTION TURNDATA CORR (option 50)", Page 315

Notes

WARNING

Caution: Significant property damage!

Very high physical forces are generated during turning, for example due to high rotational speeds and heavy or unbalanced workpieces. Incorrect machining parameters, neglected unbalances or improper fixtures lead to an increased risk of accidents during machining!

- ▶ Clamp the workpiece in the spindle center
- ▶ Clamp workpiece securely
- ▶ Program low spindle speeds (increase as required)
- ▶ Limit the spindle speed (increase as required)
- ▶ Eliminate unbalance (calibrate)

- The orientation of the tool spindle (spindle angle) depends on the machining direction. The tool tip is aligned to the center of the turning spindle for outside machining. For inside machining, the tool points away from the center of the turning spindle.

The direction of spindle rotation must be adapted when the machining direction (outside/inside machining) is changed.

Further information: "Overview of miscellaneous functions", Page 413

- During turning, the cutting edge and the center of the turning spindle must be at the same level. During turning, the tool therefore has to be pre-positioned to the Y coordinate of the turning-spindle center.
- In turning mode, diameter values are displayed on the X axis position display. The control then shows an additional diameter symbol.

Further information: User's Manual for Setup and Program Run

- In turning mode, the spindle potentiometer is active for the turning spindle (rotary table).
- In turning mode, no coordinate conversion cycles are permitted except for the datum shift.

Further information: "Datum shift with TRANS DATUM", Page 242

- In turning mode, the **SPA**, **SPB** and **SPC** transformations from the preset table are not permitted. If you activate one of these transformations while executing the NC program in turning mode, the control will display the **Transformation not possible** error message.

- The machining times determined using the graphic simulation do not correspond to the actual machining times. Reasons for this during combined milling-turning operations include the switching of operating modes.

Further information: "Simulation Workspace", Page 557

5.2.2 Technology values for turning operations

Defining the spindle speed for turning with FUNCTION TURNDATA SPIN


Application

With turning you can machine both at constant spindle speed and constant cutting speed.

Use **FUNCTION TURNDATA SPIN** to define the speed.

Requirement

- Machine with at least two rotary axes
- Combined milling/turning (software option 50)

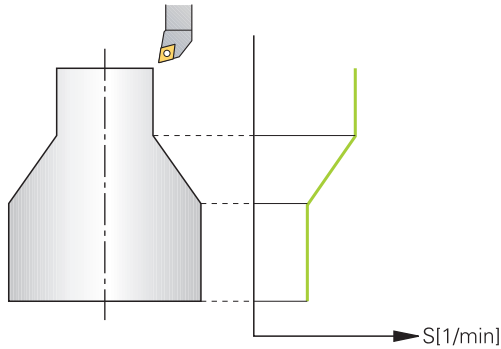Description of function

If you machine at constant cutting speed **VCONST:ON**, the control modifies the speed according to the distance of the tool tip to the center of the turning spindle. For positioning movements toward the center of rotation, the control increases the table speed; for movements away from the center of rotation, it reduces the table speed.

For processing with constant spindle speed **VCONST:Off**, speed is independent of the tool position.

With **FUNCTION TURNDATA SPIN** you can define a maximum speed for the constant speed.

Input

11 FUNCTION TURNDATA SPIN ; Constant surface speed with gear range 2
VCONST:ON VC:100 GEARRANGE:2

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION TURNDATA SPIN	Syntax initiator for speed definition in turning mode
VCONST OFF or ON	Definition of a constant cutting speed or constant surface speed Optional syntax element
VC	Value for the surface speed Optional syntax element
S or SMAX	Constant speed or speed limitation Optional syntax element
GEARRANGE	Gear range for the lathe spindle Optional syntax element

Notes

- If you machine at constant cutting speed, the selected gear range limits the possible spindle speed range. The possible gear ranges (if applicable) depend on your machine.
- When the maximum speed has been reached, the control displays **SMAX** instead of **S** in the status display.
- To reset the speed limitation, program **FUNCTION TURNDATA SPIN SMAX0**.
- In turning mode, the spindle potentiometer is active for the turning spindle (rotary table).
- Cycle **800** limits the maximum spindle speed during eccentric turning. The control restores a programmed limitation of the spindle speed after eccentric turning.

Further information: User's Manual for Machining Cycles

Feed rate


Application

With turning, feed rates are often specified in millimeters per revolution. Use the miscellaneous function **M136** for this on the control.

Further information: "Interpreting the feed rate as mm/rev with M136", Page 437

Description of function

With turning, feed rates are often specified in millimeters per revolution. The control thus moves the tool at a defined value for every spindle rotation. The resulting contouring feed rate is thus dependent on the speed of the turning spindle. The control increases the feed rate at high spindle speeds and reduces it at low spindle speeds. This enables you to machine with uniform cutting depth and constant cutting force, thus achieving constant chip thickness

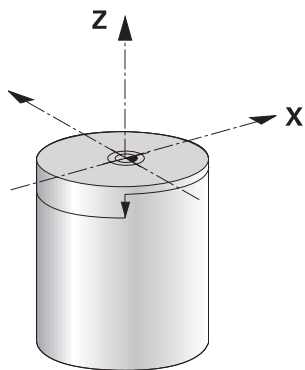

Note

During many turning operations, it is not possible to maintain constant surface speeds (**VCONST: ON**) because the maximum spindle speed is reached first. Use the machine parameter **facMinFeedTurnSMAX** (no. 201009) to define the behavior of the control after the maximum speed has been reached.

5.2.3 Inclined turning


Application

It may sometimes be necessary for you to bring the swivel axes into a specific position to machine a specific process. This can be necessary, for example, when you can only machine contour elements according to a specific position due to tool geometry.

Requirement

- Machine with at least two rotary axes
- Combined milling/turning (software option 50)

Description of function

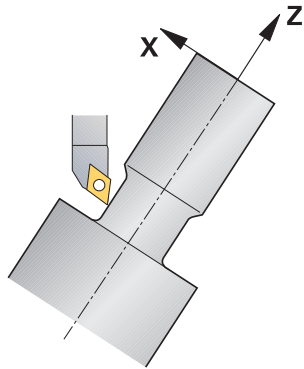

The control offers the following methods of inclined turning:

Function	Description	Further information
M144	The control uses M144 in subsequent traverse movements to compensate for tool offsets that result from inclined rotary axes.	Page 442
M128	With M128 the control behaves like with M144 , but you cannot use cutter radius compensation outside of cycles.	Page 432
FUNCTION TCPM with REFPNT TIP-CENTER	Use FUNCTION TCPM with the selection REFPNT TIP-CENTER to activate the virtual tool tip. If you activate inclined machining with FUNCTION TCPM with REFPNT TIP-CENTER , then tool-tip radius compensation is also possible without a cycle; that is, in traversing blocks with RL/RR . HEIDENHAIN recommends using FUNCTION TCPM with REFPNT TIP-CENTER .	Page 295
Cycle 800	Use Cycle 800 ADJUST XZ SYSTEM to define an inclination angle.	See the User's Manual for Machining Cycles

If you execute turning cycles with **M144**, **FUNCTION TCPM**, or **M128**, then the angles of the tool relative to the contour will change. The control automatically takes these modifications into account and therefore also monitors the inclined machining operation.

Notes

- Threading cycles can be run with inclined machining only if the tool is at a right angle (+90°, or -90°).
- Tool compensation **FUNCTION TURNDATA CORR-TCS** is always effective in the tool coordinate system, even during inclined machining.

Further information: "Compensating turning tools with FUNCTION TURNDATA CORR (option 50)", Page 315

5.2.4 Simultaneous turning

Application

You can combine the turning operation with function **M128** or **FUNCTION TCPM** and **REFPNT TIP-CENTER**. This enables you to manufacture contours in one cut, for which you have to change the inclination angle (simultaneous machining).

Related topics

- Cycles for simultaneous turning (option 158)
Further information: User's Manual for Machining Cycles
- Miscellaneous function **M128** (option 9)
Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432
- **FUNCTION TCPM** (option 9)
Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

Requirements

- Machine with at least two rotary axes
- Combined milling/turning (software option 50)
- Software option 9: Advanced Functions (set 2)

Description of function

The simultaneous turning contour is a turning contour for which a rotary axis whose inclination does not violate the contour can be programmed on **CP** polar circles and **L** linear blocks. Collisions with lateral cutting edges or holders are not prevented. This makes it possible to finish contours with one tool in a continuous movement, even though different sections of the contour are accessible only in different tool inclinations.

In the NC program you define how the rotary axis has to be inclined to reach the different contour parts without collisions.

Use the cutter radius oversize **DRS** to leave an equidistant oversize on the contour.

Use **FUNCTION TCPM** and **REFPNT TIP-CENTER** to measure the theoretical tool tip of the turning tools being used for this.

The following requirements apply if you want to use **M128** for simultaneous turning:

- Only for NC programs programmed on the path of the tool center.
- Only for button turning tools with TO 9
Further information: User's Manual for Setup and Program Run
- The tool must be measured at the center of the tool-tip radius

Further information: "Presets on the tool", Page 154

Example

An NC program with simultaneous turning includes the following components:

- Activate turning mode
- Insert a turning tool
- Adjust the coordinate system with cycle **800 ADJUST XZ SYSTEM**
- Activate **FUNCTION TCPM** with **REFPNT TIP-CENTER**
- Activate cutter radius compensation with **RL/RR**
- Program simultaneous turning contour
- End cutter radius compensation with **R0** or by departing the contour
- Reset **FUNCTION TCPM**

0 BEGIN PGM TURNSIMULTAN MM	
* - ...	
12 FUNCTION MODE TURN	; Activate turning mode
13 TOOL CALL "TURN_FINISH"	; Insert turning tool
14 FUNCTION TURNDATA SPIN VCONST:OFF S500	
15 M140 MB MAX	
* - ...	; Adjust the coordinate system
16 CYCL DEF 800 ADJUST XZ SYSTEM ~	
Q497=+90 ;PRECESSION ANGLE ~	
Q498=+0 ;REVERSE TOOL ~	
Q530=+0 ;INCLINED MACHINING ~	
Q531=+0 ;ANGLE OF INCIDENCE ~	
Q532= MAX ;FEED RATE ~	
Q533=+0 ;PREFERRED DIRECTION ~	
Q535=+3 ;ECCENTRIC TURNING ~	
Q536=+0 ;ECCENTRIC W/O STOP	
17 FUNCTION TCPM F TCP AXIS POS PATHCTRL AXIS REFPNT TIP-CENTER	; Activate FUNCTION TCPM
18 FUNCTION TURNDATA CORR-TCS:Z/X DRS:-0.1	
19 L X+100 Y+0 Z+10 R0 FMAX M304	
20 L X+45 RR FMAX	; Activate cutter radius compensation with RR
* - ...	
26 L Z-12.5 A-75	; Program simultaneous turning contour
27 L Z-15	
28 CC X+69 Z-20	
29 CP PA-90 A-45 DR-	
30 CP PA-180 A+0 DR-	
* - ...	
47 L X+100 Z-45 R0 FMAX	; End cutter radius compensation with R0
48 FUNCTION RESET TCPM	; Reset FUNCTION TCPM
49 FUNCTION MODE MILL	
* - ...	
71 END PGM TURNSIMULTAN MM	

5.2.5 Turning operation with FreeTurn tools

Application

The control makes it possible to define FreeTurn tools and to use them, e.g., for inclined or simultaneous turning operations.

FreeTurn tools are lathe tools that are equipped with multiple cutting edges. Depending on the variant, a single FreeTurn tool may be capable of axis-parallel and contour-parallel roughing and finishing.

Thanks to the use of FreeTurn tools, fewer tool changes are required, reducing the machining time. Due to the tool orientation to the workpiece, only outside machining is possible.


Related topics

- Inclined turning
Further information: "Inclined turning", Page 128
- Simultaneous turning operation
Further information: "Simultaneous turning", Page 130
- FreeTurn tools
Further information: User's Manual for Setup and Program Run
- Indexed tools
Further information: User's Manual for Setup and Program Run

Requirements

- Machine whose tool spindle is perpendicular to the workpiece spindle or can be inclined.
Depending on the machine kinematics, a rotary axis is required for the orientation of the spindles to each other.
- Machine with controlled tool spindle
The control inclines the cutting edge by means of inclining the tool spindle.
- Combined milling/turning (software option 50)
- Kinematics description
The machine manufacturer provides the kinematics description. Based on the kinematics description, the control can take, e.g., the tool geometry into account.
- Machine-manufacturer macros for simultaneous turning with FreeTurn tools
- FreeTurn tool with suitable tool carrier
- Tool definition
A FreeTurn tool always includes three cutting edges of an indexed tool.

Description of function

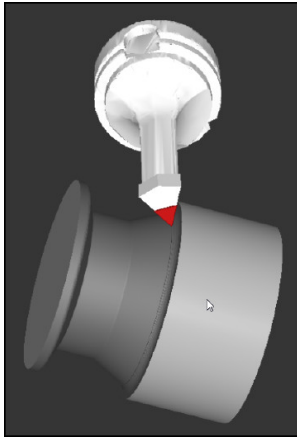


FreeTurn tool in simulation


To use FreeTurn tools, call only the desired cutting edge of the correctly defined indexed tool in your NC program.

Further information: User's Manual for Machining Cycles


FreeTurn tools

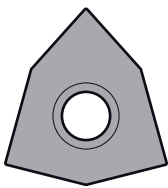

FreeTurn indexable insert
for roughing

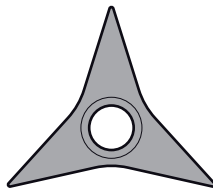

FreeTurn indexable insert
for finishing

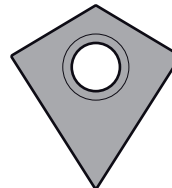

FreeTurn indexable insert
for roughing and finishing

The control supports all variants of FreeTurn tools:

- Tool with finishing cutting edge
- Tool with roughing cutting edge
- Tool with finishing and roughing cutting edge

In the **TYPE** column of the tool management, select a turning tool (**TURN**) as the tool type. In the **TYPE** column, assign the appropriate technology-specific tool type to each cutting edge, i.e. roughing tool (**ROUGH**) or finishing tool (**FINISH**).

Further information: User's Manual for Setup and Program Run

A FreeTurn tool must be defined as an indexed tool with three cutting edges that are offset by the **ORI** angle of orientation. Each cutting edge has the **TO 18** tool orientation.

Further information: User's Manual for Setup and Program Run

FreeTurn tool carrier



Tool carrier template for a FreeTurn tool

There is a suitable tool carrier for each FreeTurn tool variant. HEIDENHAIN provides ready-to-use tool carrier templates for download that are included in the programming station software. You can then assign the tool-carrier kinematics descriptions generated from the templates to the respective indexed cutting edge.

Further information: User's Manual for Setup and Program Run

Notes

NOTICE

Danger of collision!

The shaft length of the turning tool limits the diameter that can be machined. There is a risk of collision during machining!

- Check the machining sequence in the simulation

- Due to the tool orientation to the workpiece, only outside machining is possible.
- Please note that FreeTurn tools can be combined with various machining strategies. Therefore, make sure to observe the specific notes, e.g. in conjunction with the selected machining cycles.

5.2.6 Unbalance in turning operations

Application

In a turning operation, the tool is in a fixed position, whereas the rotary table and the clamped workpiece rotate. Depending on the size of the workpiece, the mass that is set in rotation can be very large. As the workpiece rotates, it creates an outward centrifugal force.

The control offers functions to detect the unbalance and support you in compensating for it.

Related topics

- Cycle **892 CHECK UNBALANCE**
Further information: User's Manual for Machining Cycles
- Cycle **239 ASCERTAIN THE LOAD** (option 143)
Further information: User's Manual for Machining Cycles


Description of function



Refer to your machine manual.

Unbalance functions are not required and available on all machine tool types.

The unbalance functions described here are basic functions that are set up and adapted to the machine by the machine manufacturer. The scope and effect of the described functions may therefore vary from machine to machine. The machine manufacturer may also provide different unbalance functions.

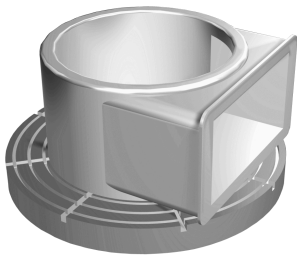

The centrifugal force that occurs basically depends on the rotational speed, the mass and the unbalance of the workpiece. A body with an uneven mass distribution that is put into rotary motion produces an unbalance. If the mass object is rotating, this creates outward-acting centrifugal forces. If the rotating mass is evenly distributed, the centrifugal forces cancel each other out. You compensate for the arising centrifugal forces by attaching balancing weights.

With Cycle **892 CHECK UNBALANCE** you define the maximum permissible unbalance and the maximum shaft speed. The control monitors these entries.

Further information: User's Manual for Machining Cycles

Unbalance monitor

The Unbalance Monitor function monitors the unbalance of a workpiece in turning mode. If a maximum unbalance limit specified by the machine manufacturer is exceeded, the control issues an error message and initiates an emergency stop.

In addition, you can further decrease the permissible unbalance limit by setting the optional machine parameter **limitUnbalanceUsr** (no. 120101). If this limit is exceeded, the control issues an error message. The control does not stop table rotation.

The control automatically activates the Unbalance Monitor function when you switch to turning mode. The unbalance monitor is effective until you switch back to milling mode.

Further information: "Switching the operating mode with FUNCTION MODE", Page 122

Notes

⚠ WARNING

Caution: Significant property damage!


Very high physical forces are generated during turning, for example due to high rotational speeds and heavy or unbalanced workpieces. Incorrect machining parameters, neglected unbalances or improper fixtures lead to an increased risk of accidents during machining!

- ▶ Clamp the workpiece in the spindle center
 - ▶ Clamp workpiece securely
 - ▶ Program low spindle speeds (increase as required)
 - ▶ Limit the spindle speed (increase as required)
 - ▶ Eliminate unbalance (calibrate)
- The rotation of the workpiece creates centrifugal forces that lead to vibration (resonance), depending on the unbalance. This vibration has a negative effect on the machining process and reduces the tool life.
 - The removal of material during machining will change the mass distribution within the workpiece. This generates the unbalance, which is why an unbalance test is recommended even between the machining steps.
 - To compensate an unbalance, several balancing weights at different positions may be required.

5.3 Grinding operations (option 156)

5.3.1 Fundamentals

Special types of milling machines allow performing both milling and grinding operations. A workpiece can thus be machined completely on one machine, even if complex milling and grinding operations are required.

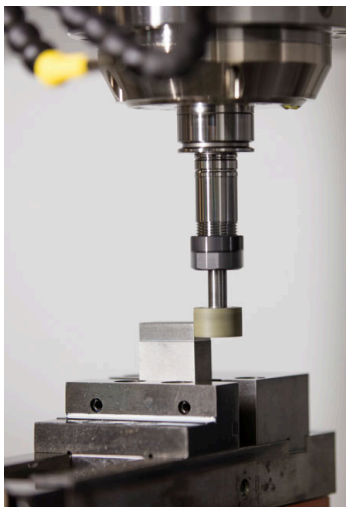

Requirements

- Software option 156 Jig grinding
- Available kinematics description for jig grinding
The machine manufacturer creates the kinematics description.

Production processes

The term grinding encompasses many types of machining that differ in quite a few respects, e.g.:

- Jig grinding
- Cylindrical grinding
- Surface grinding

The TNC7 currently features jig grinding.

Jig grinding is the grinding of a 2D contour. The tool movement in the plane is optionally superimposed by a reciprocation movement along the active tool axis.

Further information: "Jig grinding", Page 138

If grinding is enabled on your milling machine, (Option 156), the dressing function is also available. This means that you can shape or resharpen the grinding wheel in the machine.

Further information: "Dressing", Page 138

Reciprocating stroke

For jig grinding, the movement of the tool in the plane can be superimposed by a stroke movement, the so-called reciprocating stroke. The superimposed stroke movement is effective in the active tool axis.

You define an upper and a lower stroke limit and can start and stop the reciprocating stroke and reset the corresponding values. The reciprocating stroke is effective until you stop it. **M2** or **M30** will stop the reciprocating stroke automatically.

The control provides cycles for defining, starting, and stopping reciprocating strokes.

As long as the reciprocating stroke is active in the program run, you cannot change to the other applications of the **Manual** operating mode.

The control presents the reciprocating stroke in the **Simulation** workspace of the **Program Run** operating mode.

Tools for grinding

When managing grinding tools, other geometric descriptions than those for milling or drilling tools are required. The control provides a special tool table for grinding and dressing tools. In tool management, the control displays only the required tool data for the current tool type.

Further information: User's Manual for Setup and Program Run

You can use compensation tables to change the values of grinding tools during program run.

Further information: "Tool compensation with compensation tables", Page 312

Structure of an NC program for grinding

An NC program for grinding is structured as follows:

- Dressing of the grinding tool, if required
- Defining the reciprocating stroke
- If necessary, explicitly starting the reciprocating stroke
- Moving along the contour
- Stopping the reciprocating stroke

You can use specific machining cycles (e.g., cycles for grinding, for machining pockets or studs, or SL cycles) to define the contour.

Further information: User's Manual for Machining Cycles

5.3.2 Jig grinding

Application

On a milling machine, jig grinding will mainly be used for finishing a pre-machined contour with a grinding tool. There is not much of a difference between jig grinding and milling. Instead of a milling cutter, a grinding tool is used, such as a grinding pin or a grinding wheel. Jig grinding produces more precise results and a better surface quality than milling.

Related topics

- Cycles for grinding
Further information: User's Manual for Machining Cycles
- Tool data for grinding tools
Further information: User's Manual for Setup and Program Run
- Dressing of grinding tools
Further information: "Dressing", Page 138

Requirements

- Software option 156 Jig grinding
- Available kinematics description for jig grinding
The machine manufacturer creates the kinematics description.

Description of function

Machining is performed in milling mode, i.e. with **FUNCTION MODE MILL**.

Grinding cycles provide special movements for the grinding tool. A stroke or oscillating movement, the so-called reciprocating stroke, is superimposed with the movement in the working plane.

Grinding is also possible with a tilted working plane. The tool reciprocates along the active tool axis in the current working plane coordinate system (**WPL-CS**).

Notes

- The control does not support block scans while the reciprocating stroke is active.
Further information: User's Manual for Setup and Program Run
- The reciprocating stroke continues to be effective during a programmed **STOP** or **M0** as well as in **Single Block** mode even after the end of an NC block.
- If no cycle has been programmed and a contour is being ground whose smallest inside radius is smaller than the tool radius, the control will display an error message.
- If you machine with SL cycles, only those areas will be ground that are suitable for the given tool radius. In this case, the resulting contour will not be completely finished and may need to be reworked.

5.3.3 Dressing

Application

The term "dressing" refers to the sharpening or trueing up of a grinding tool inside the machine. During dressing, the dresser machines the grinding wheel. Thus, in dressing, the grinding tool is the workpiece.

Related topics

- Activating dressing mode with **FUNCTION DRESS**
Further information: "Activating dressing mode with FUNCTION DRESS", Page 140
- Cycles for dressing
Further information: User's Manual for Machining Cycles
- Tool data for dressing tools
Further information: User's Manual for Setup and Program Run
- Jig grinding
Further information: "Jig grinding", Page 138

Requirements

- Software option 156 Jig grinding
- Available kinematics description for jig grinding
 The machine manufacturer creates the kinematics description.

Description of function

The dresser removes material and thereby changes the dimensions of the grinding wheel. Dressing the diameter, for example, causes the radius of the grinding wheel to become smaller.



In dressing, the workpiece datum is located on an edge of the grinding wheel. Select the respective edge using Cycle **1030 ACTIVATE WHEEL EDGE**.

During dressing, the axes are arranged such that the X coordinates describe positions on the radius of the grinding wheel, and the Z coordinates describe the positions along the axis of the grinding wheel. The dressing programs are thus not contingent on the machine type.

The machine manufacturer defines which machine axes will perform the programmed movements.

Simplified dressing with a macro

Your machine tool builder can program the entire dressing mode in a macro.

In this case, the machine manufacturer determines the dressing sequence. It is not necessary to program **FUNCTION DRESS BEGIN**.

Depending on this macro, you can start the dressing mode with one of the following cycles:

- Cycle **1010 DRESSING DIAMETER**
- Cycle **1015 PROFILE DRESSING**
- Cycle **1016 DRESSING OF CUP WHEEL**
- OEM cycle

Notes

- For dressing operations, the machine must be prepared accordingly by the machine manufacturer. The machine manufacturer may provide his own cycles.
- Measure the grinding tool after dressing so that the control enters the correct delta values.
- Not all grinding tools require dressing. Comply with the information provided by your tool manufacturer.

5.3.4 Activating dressing mode with FUNCTION DRESS

Application

With **FUNCTION DRESS** you activate a dressing kinematic model for dressing a grinding tool. The grinding tool is then the workpiece and the axes may move in the opposite direction.

Your machine manufacturer might provide a simplified dressing procedure.

Further information: "Simplified dressing with a macro", Page 139

Related topics

- Cycles for dressing
Further information: User's Manual for Machining Cycles
- Fundamentals of dressing
Further information: "Dressing", Page 138

Requirements

- Software option 156 Jig grinding
- Available kinematics description for dressing
The machine manufacturer creates the kinematics description.
- Grinding tool is inserted
- Grinding tool without assigned tool-carrier kinematics

Description of function

NOTICE

Danger of collision!

When you activate **FUNCTION DRESS BEGIN**, the control switches the kinematics. The grinding wheel becomes the workpiece. The axes may move in the opposite direction. There is a risk of collision during the execution of the function and during the subsequent machining!

- ▶ Activate the **FUNCTION DRESS** dressing mode in the **Program run, single block** or **Program run, full sequence** operating mode only
- ▶ Before starting **FUNCTION DRESS BEGIN**, position the grinding wheel near the dressing tool
- ▶ Once you have activated **FUNCTION DRESS BEGIN**, use exclusively cycles from HEIDENHAIN or from your machine tool builder

For the control to switch to the kinematic model for dressing, you must program the dressing process between the functions **FUNCTION DRESS BEGIN** and **FUNCTION DRESS END**.

If dressing mode is active, the control shows a corresponding icon in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

You can switch back to normal operation with the function **FUNCTION DRESS END**.

In the event of an NC program abort or a power interruption, the control automatically activates normal operation and the kinematic model that was active prior to dressing mode.

Input

11 FUNCTION DRESS BEGIN "Dress"

; Activate dressing mode with the **Dress** kinematics

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION DRESS	Syntax initiator for dressing mode
BEGIN or END	Activate or deactivate dressing mode
Name or QS	Name of the selected kinematic model Fixed or variable name Only if BEGIN has been selected Optional syntax element

Notes

NOTICE

Danger of collision!

The dressing cycles position the dressing tool at the programmed grinding wheel edge. Positioning occurs simultaneously in two axes of the working plane. The control does not perform collision checking during this movement!

- ▶ Before starting **FUNCTION DRESS BEGIN**, position the grinding wheel near the dressing tool
- ▶ Make sure there is no risk of collision
- ▶ Verify the NC program by slowly executing it block by block

NOTICE

Danger of collision!

With an active kinematic model, the machine movements may be in the opposite direction. There is a risk of collision when moving the axes!

- ▶ In case the NC program is aborted or in case of a power interruption, check the traverse directions of the axes
- ▶ If necessary, program a kinematic switch-over

- During dressing, the cutting edge of the dresser must be at the same height as the grinding wheel. The programmed Y coordinate must be 0.
- With the switch to dressing mode, the grinding tool remains in the spindle and retains its current rotational speed.
- The control does not support a block scan during the dressing process. If, during a block scan, you select the first NC block after the dressing operation, then the control moves to the most recently approached position in the dressing operation.

Further information: User's Manual for Setup and Program Run

- If the "tilt working plane" function or **TCPM** function is active, then you cannot switch to dressing mode.
- The control resets the manual tilting functions (option 8) and **FUNCTION TCPM** (option 9) when dressing mode is activated.

Further information: User's Manual for Setup and Program Run

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

- In dressing mode you can use **TRANS DATUM** to change the workpiece datum. No other NC functions or coordinate conversion cycles are permitted in dressing mode. The control displays an error message.

Further information: "Datum shift with TRANS DATUM", Page 242

- The **M140** function is not allowed in dressing mode. The control displays an error message.
- The control does not graphically depict the dressing operation. The times determined by the simulation do not reflect the actual machining times. One reason for this is the necessary switching of the kinematic model.

6

Workpiece Blank

6.1 Defining a workpiece blank with BLK FORM

Application

You use the **BLK FORM** function to define a workpiece blank for graphic simulation of the NC program.


Related topics

- Depiction of the workpiece blank in the **Simulation** workspace
Further information: "Simulation Workspace", Page 557
- Blank form update with **FUNCTION TURNDATA BLANK** (option 50)
Further information: "Compensating turning tools with FUNCTION TURNDATA CORR (option 50)", Page 315

Description of function

You define the blank relative to the workpiece preset.

Further information: "Presets in the machine", Page 99

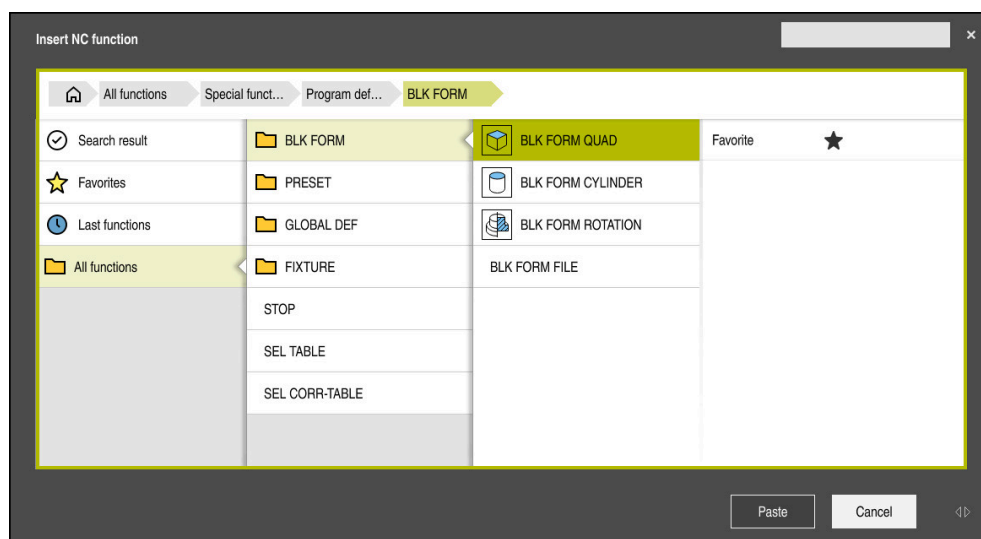

The **Insert NC function** window for workpiece blank definition

When you create a new NC program, the control automatically opens the **Insert NC function** window for workpiece blank definition.

Further information: "Creating a new NC program", Page 80

The control offers the following workpiece blank definitions:

Icon	Function	Further information
	BLK FORM QUAD Cuboid workpiece blank	Page 146
	BLK FORM CYLINDER Cylindrical workpiece blank	Page 147
	BLK FORM ROTATION Rotationally symmetric blank with a definable contour	Page 148
	BLK FORM FILE STL file as workpiece blank and finished part	Page 149

Notes

NOTICE

Danger of collision!

Even if Dynamic Collision Monitoring (DCM) is active, the control does not automatically monitor the workpiece for collisions, neither with the tool nor with other machine components. There is a risk of collision during machining!

- ▶ Enable the **Advanced checks** switch for simulations
- ▶ Check the machining sequence using a simulation
- ▶ Carefully test your NC program or program section in the **Single Block** mode

- You can select files or subprograms in the following ways:
 - Enter the file path
 - Enter the number or name of the subprogram
 - Select a file or subprogram by means of a selection window
 - Define the file path or name of the subprogram in a QS parameter
 - Define the number of the subprogram in a Q, QL, or QR parameter

If the called file is located in the same folder as the calling NC program, it is also possible to simply enter the file name.
- In order for the control to show the workpiece blank in the simulation, the workpiece blank must have minimum dimensions. The minimum dimensions are 0.1 mm or 0.004 inches in all axes as well as in the radius.
- The control shows the workpiece blank in the simulation only after it has executed the complete workpiece blank definition.
- Even if you want to close the **Insert NC function** window or add a workpiece blank definition after writing an NC program, you can always define a workpiece blank via the **Insert NC function** window.
- The **Advanced checks** function in the simulation uses the information from the workpiece blank definition for workpiece monitoring. The control can monitor only the active workpiece blank, even if several workpieces are clamped in the machine!

Further information: "Advanced checks in the simulation", Page 361
- In the **Simulation** workspace you can export the current view of the workpiece as an STL file. This function allows you to create missing 3-D models, for example semifinished parts if there are several machining steps.


Further information: "Exporting a simulated workpiece as STL file", Page 567

6.1.1 Cuboid workpiece blank with BLK FORM QUAD

Application

With **BLK FORM QUAD** you define a cuboid workpiece blank. You use a MIN point and a MAX point to define a spatial diagonal.

Description of function

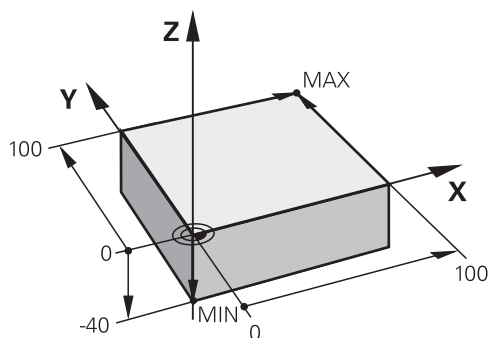

Cuboid workpiece blank with MIN point and MAX point

The sides of the cuboid are parallel to the **X**, **Y** and **Z** axes.

You define the cuboid by entering a MIN point for the bottom front left corner and a MAX point for the top rear right corner.

You define the coordinates of the points in the **X**, **Y** and **Z** relative to the workpiece preset. If you define a positive value for the MAX point in the Z coordinate, the blank is given an oversize.

Further information: "Presets in the machine", Page 99

If you use a cuboid workpiece blank for turning (option 50), keep the following in mind:

Even if the turning operation takes place in a two-dimensional plane (Z and X coordinates), you have to program the Y values for a rectangular blank in the definition of the workpiece blank.

Further information: "Fundamentals", Page 124

Input

1 BLK FORM 0.1 Z X+0 Y+0 Z-40	
2 BLK FORM 0.2 X+100 Y+100 Z+0	; Cuboid workpiece blank

The NC function includes the following syntax elements:


Syntax element	Meaning
BLK FORM	Syntax initiator for cuboid workpiece blank
0.1	Designation of the first NC block
Z	Tool axis Other possibilities might be available, depending on the machine.
X Y Z	Coordinate definition of the MIN point
0.2	Designation of the second NC block
X Y Z	Coordinate definition of the MAX point

6.1.2 Cylindrical workpiece blank with BLK FORM CYLINDER

Application

With **BLK FORM CYLINDER** you define a cylindrical workpiece blank. You can define a cylinder either as a solid piece or as a hollow pipe.

Description of function

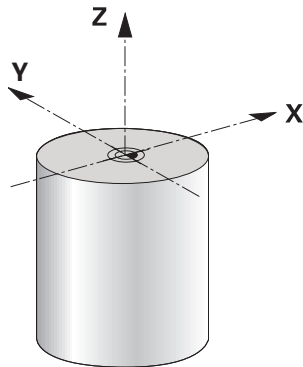

Cylindrical blank

To define the cylinder, enter at least the radius or diameter and the height.

The workpiece preset is in the cylinder center in the working plane. Optionally you can define an oversize and the inside radius or diameter of the blank.

Input

1 BLK FORM CYLINDER Z R50 L105 DIST ; Cylindrical blank
+5 RI10

The NC function includes the following syntax elements:


Syntax element	Meaning
BLK FORM CYLINDER	Syntax initiator for cylindrical workpiece blank
Z	Tool axis Other possibilities might be available, depending on the machine.
R or D	Radius or diameter of the cylinder
L	Total height of the cylinder
DIST	Oversize of the cylinder relative to the workpiece preset Optional syntax element
RI or DI	Inside radius diameter of the core hole Optional syntax element

6.1.3 Rotationally symmetric workpiece blank with BLK FORM ROTATION

Application

With **BLK FORM ROTATION** you define a rotationally symmetric workpiece blank with a definable contour. You define the contour in a subprogram or separate NC program.

Description of function

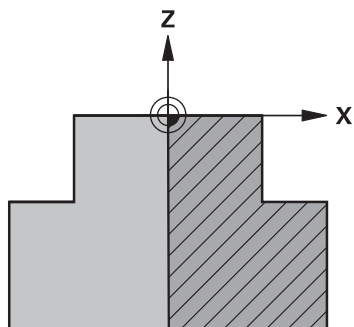

Blank contour with tool axis **Z** and main axis **X**

In the workpiece blank definition you refer to the contour description.

In the contour description, you program a half-section of the contour around the tool axis as the rotational axis.

The following conditions apply to the contour description:

- Only coordinates of the main axis and tool axis
- Starting point defined in both axes
- Closed contour
- Only positive values in the main axis
- Positive and negative values are possible in the tool axis

The workpiece preset is in the center of the blank in the working plane. You define the coordinates of the blank contour relative to the workpiece preset. You can also define an oversize.

Input

1 BLK FORM ROTATION Z DIM_R LBL "BLANK"	; Rotationally symmetric blank
* - ...	
11 LBL "BLANK"	; Subprogram start
12 L X+0 Z+0	; Beginning of contour
13 L X+50	; Coordinates in positive direction of main axis
14 L Z+50	
15 L X+30	
16 L Z+70	
17 L X+0	
18 L Z+0	; End of contour
19 LBL 0	; End of subprogram

The NC function includes the following syntax elements:

Syntax element	Meaning
BLK FORM ROTATION	Syntax initiator for rotationally symmetric workpiece blank
Z	Active tool axis Other possibilities might be available, depending on the machine.
DIM_R or DIM_D	Interpret values in the main axes in the contour description as radius or diameter
LBL or FILE	Name or number of the contour subprogram or path of the separate NC program

Notes

- If you program the contour description with incremental values, the control interprets the values as radii regardless of whether **DIM_R** or **DIM_D** is selected.
- With software option 42 CAD Import, you can load contours from CAD files and save them in subprograms or separate NC programs.

Further information: User's Manual for Setup and Program Run

6.1.4 STL file as workpiece blank with BLK FORM FILE**Application**

You can integrate 3D models in STL format as workpiece blank and optionally as finished part. This function is particularly convenient in combination with CAM programs, where the required 3D models are available in addition to the NC program.

Requirement

- Max. 20 000 triangles per STL file in ASCII format
- Max. 50 000 triangles per STL file in binary format

Description of function

The dimensions of the NC program come from the same source as the dimensions of the 3D model.

Input

1 BLK FORM FILE "TNC:\CAD\blank.stl" TARGET "TNC:\CAD\finish.stl"	; STL file as workpiece blank and finished part
--	---

The NC function includes the following syntax elements:

Syntax element	Meaning
BLK FORM FILE	Syntax initiator for an STL file as workpiece blank
" "	Path of the STL file
TARGET	STL file as finished part Optional syntax element
" "	Path of the STL file


Notes

- In the **Simulation** workspace you can export the current view of the workpiece as an STL file. This function allows you to create missing 3-D models, for example semifinished parts if there are several machining steps.
Further information: "Exporting a simulated workpiece as STL file", Page 567
- If you have integrated a workpiece blank and a finished part, you can compare the models in the simulation and easily identify any residual material.
Further information: "Model comparison", Page 572
- The control loads STL files in binary format faster than STL files in ASCII format.

6.2 Blank form update in turning mode with FUNCTION TURNDATA BLANK (option 50)

Application

Using the blank form update feature, the control detects the already machined areas and adapts all approach and departure paths to the specific, current machining situation. Thus, air cuts are avoided and the machining time is significantly reduced. You define the workpiece blank for blank form update in a subprogram or separate NC program.

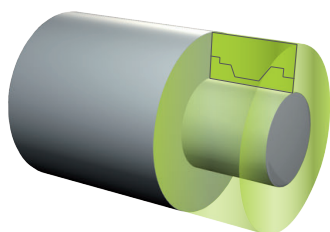


Related topics

- Subprograms
Further information: "Subprograms and program section repeats with the label LBL", Page 210
- Turning mode: **FUNCTION MODE TURN**
Further information: "Fundamentals", Page 124
- Defining a workpiece blank with **BLK FORM** for simulation
Further information: "Defining a workpiece blank with BLK FORM", Page 144

Requirements

- Combined milling/turning (software option 50)
- **FUNCTION MODE TURN** must be active
Blank form update is only possible with cycle machining in turning mode.
- Closed blank contour for blank form updating
The starting and end positions must be identical. The workpiece blank corresponds to the cross-section of a rotationally symmetrical body.

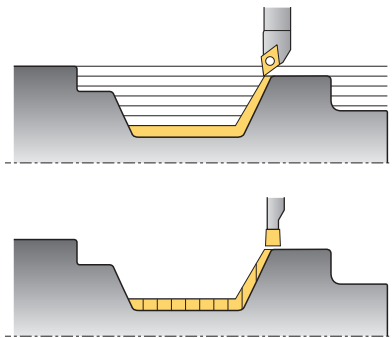Description of function

With **TURNDATA BLANK** you call a contour description used by the control as an updated workpiece blank.

You can define the workpiece blank in a subprogram within the NC program or as a separate NC program.

You can select files or subprograms in the following ways:

- Enter the file path
- Enter the number or name of the subprogram
- Select a file or subprogram by means of a selection window
- Define the file path or name of the subprogram in a QS parameter
- Define the number of the subprogram in a Q, QL, or QR parameter

Use **FUNCTION TURNDATA BLANK OFF** to deactivate blank form update.

Input

1 FUNCTION TURNDATA BLANK LBL "BLANK"	; Blank form update with a workpiece blank from the subprogram "BLANK"
* - ...	
11 LBL "BLANK"	; Subprogram start
12 L X+0 Z+0	; Beginning of contour
13 L X+50	; Coordinates in positive direction of main axis
14 L Z+50	
15 L X+30	
16 L Z+70	
17 L X+0	
18 L Z+0	; End of contour
19 LBL 0	; End of subprogram

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION TURNDATA BLANK	Syntax initiator for blank form update in turning mode
OFF, File, QS or LBL	Deactivate blank form update, blank contour as separate NC program, or call as subprogram
Number, Name or QS	Number or name of the separate NC program or subprogram Fixed or variable number or name If File , QS or LBL is selected

7

Tools

7.1 Fundamentals

To use the control's functions, you must define the tools for the control using real data, e. g. the radius. This makes programming easier and improves process reliability.

To add a tool to the machine, follow the sequence below:

- Prepare your tool and clamp the tool into a suitable tool holder.
- To measure the tool dimensions, starting from the tool carrier preset, measure the tool, e. g. using a tool presetter. The control needs these dimensions for calculating the paths.

Further information: "Tool carrier reference point", Page 155

- Further tool data are needed to completely define the tool. Take these tool data e. g. from the manufacturer's tool catalog.

Further information: User's Manual for Setup and Program Run

- Save all collected tool data of this tool in the tool management.

Further information: User's Manual for Setup and Program Run

- As needed, assign a tool carrier to the tool in order to achieve realistic simulation and collision protection.

Further information: User's Manual for Setup and Program Run

- After finishing tool definition, program a tool call within an NC program.

Further information: "Tool call by TOOL CALL", Page 159

- If your machine is equipped with a chaotic tool changer system and a double gripper, the tool change time may be shortened by pre-selecting the tool.

Further information: "Tool pre-selection by TOOL DEF", Page 165

- If needed, perform a tool usage test before starting the program. This process checks if the tools are available in the machine and have sufficient remaining tool life.

Further information: User's Manual for Setup and Program Run

- After machining a workpiece and measuring it, you may correct the tools.

Further information: "Tool radius compensation", Page 306

7.2 Presets on the tool


The control distinguishes the following presets on the tool for different calculations or applications.

Related topics

- Presets in the machine or on the workpiece

Further information: "Presets in the machine", Page 99

7.2.1 Tool carrier reference point

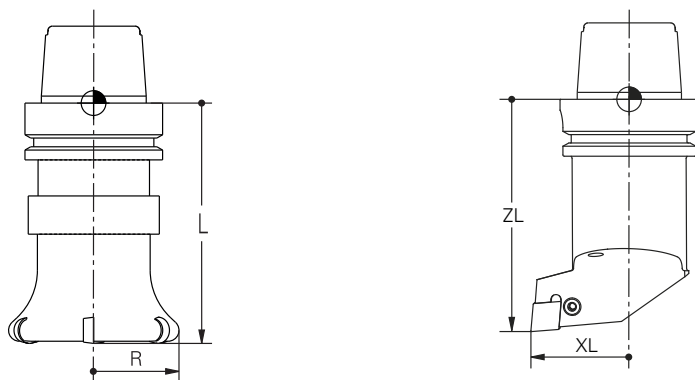


The tool carrier reference point is a fixed point defined by the machine manufacturer. The tool carrier reference point is usually located on the spindle nose.

Starting from the tool carrier reference point, define the tool dimensions in the tool management, e. g. length L and radius R .

Further information: User's Manual for Setup and Program Run

7.2.2 Tool tip TIP

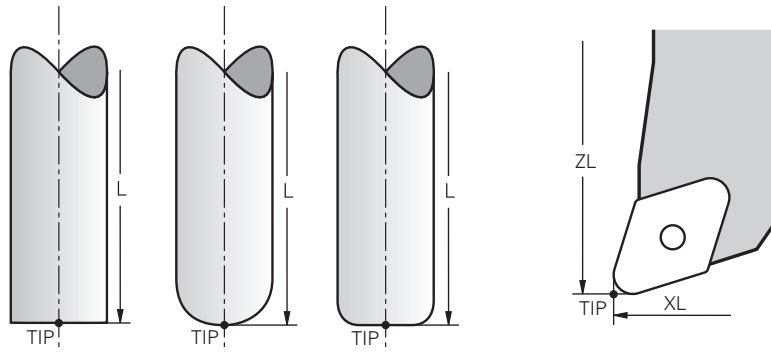

The tool tip has the greatest distance from the tool carrier reference point. The tool tip is the origin of the tool coordinate system **T-CS**.

Further information: "Tool coordinate system T-CS", Page 234

In case of milling cutters, the tool tip is at the center of the tool radius **R** and at the longest point of the tool on the tool axis.


You define the tool tip with the following columns of the tool management relative to the tool carrier reference point:

- **L**
- **DL**
- **ZL** (option 50, option 156)
- **XL** (option 50, option 156)
- **YL** (option 50, option 156)
- **DZL** (option 50, option 156)
- **DXL** (option 50, option 156)
- **DYL** (option 50, option 156)
- **LO** (option 156)
- **DLO** (option 156)

Further information: User's Manual for Setup and Program Run

In the case of lathe tools (option 50), the control uses the theoretical tool tip, i. e. the point of intersection of the defined values **ZL**, **XL** and **YL**.

7.2.3 Tool center point (TCP, tool center point)

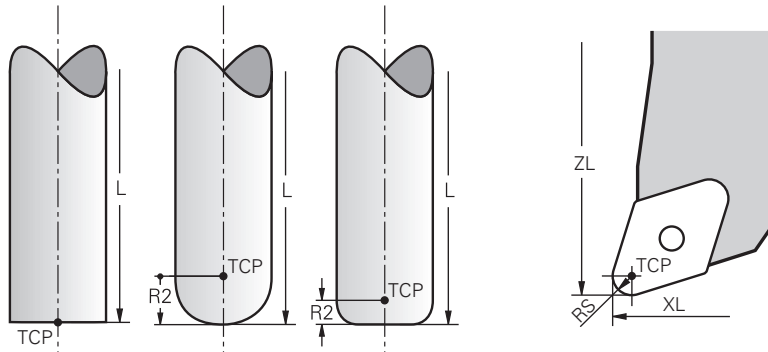


The tool center point is the center of the tool radius **R**. If a second tool radius (**R2**) is defined, the tool center point is offset from the tool tip by this value.

In the case of turning tools (option 50), the tool center point is at the center of cutter radius **RS**.

Making entries in the tool management relative to the tool carrier reference point defines the tool center point.

Further information: User's Manual for Setup and Program Run

7.2.4 Tool location point (TLP, tool location point)

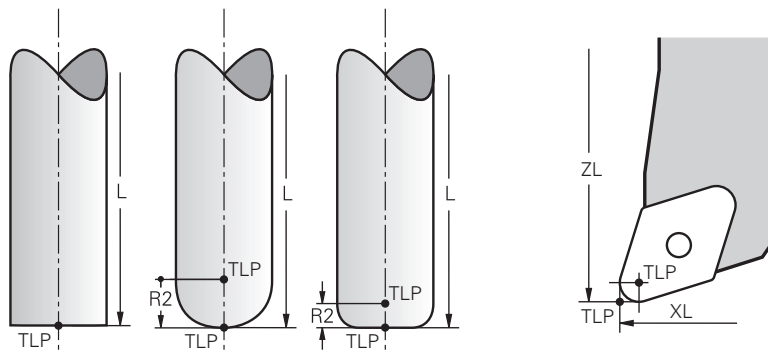


The control positions the tool on the tool location point. By default, the tool location point is at the tool tip.

In the **FUNCTION TCPM** function (option 9), you can also choose the tool location point to be at the tool center point.

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

7.2.5 Tool rotation point (TRP, tool rotation point)

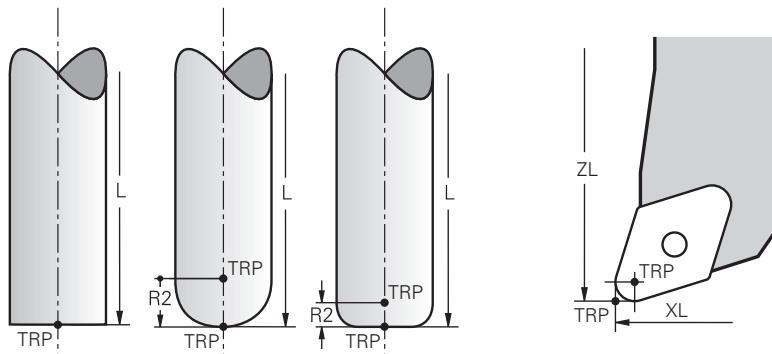

When applying the tilting function with **MOVE** (option 8), the control tilts around the tool rotation point. By default, the tool rotation point is at the tool tip.


When selecting **MOVE** in **PLANE** functions, the syntax element **DIST** is used to define the relative position between the workpiece and the tool. The control shifts the tool rotation point from the tool tip by this value. When **DIST** is not defined, the control keeps the tool tip constant.

Further information: "Rotary axis positioning", Page 284

In the **FUNCTION TCPM** function (option 9), you can also choose the tool rotation point to be at the tool center point.

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

7.2.6 Tool radius 2 center (CR2, center R2)

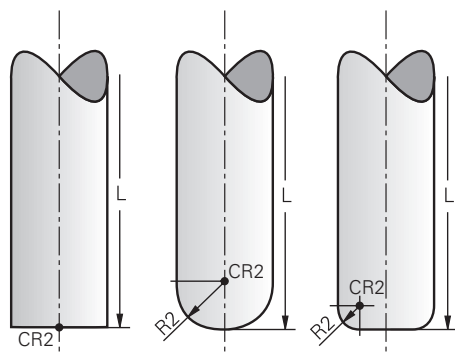

The control uses the tool radius 2 center in conjunction with 3D tool compensation (option 9). In the case of straight lines **LN**, the surface normal vector points to that point and defines the direction of the 3D tool compensation.

Further information: "3D tool compensation (option 9)", Page 317

The tool radius 2 center is offset from the tool tip and the cutting edge by the **R2** value.

7.3 Tool call

7.3.1 Tool call by TOOL CALL

Application

The **TOOL CALL** function calls a tool in the NC program. When the tool is in the tool magazine, the control inserts the tool into the spindle. When the tool is not in the magazine, you can insert it by hand.

Related topics

- Automatic tool change with **M101**

Further information: "Automatically inserting a replacement tool with M101", Page 447

- Tool table **tool.t**

Further information: User's Manual for Setup and Program Run

- Pocket table **tool_p.tch**

Further information: User's Manual for Setup and Program Run

Requirement

- Tool defined

To call a tool, the tool must be defined in the tool management.

Further information: User's Manual for Setup and Program Run

Description of function

Upon calling a tool, the control reads the associated row from the tool management. The tool data are visible on the **Tool** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run




HEIDENHAIN recommends switching the spindle on with **M3** or **M4** after every tool call. That way you avoid problems during program run, such as when restarting after an interruption.

Further information: "Overview of miscellaneous functions", Page 413

Input

**11 TOOL CALL 4 .1 Z S10000 F750 DL
+0,2 DR+0,2 DR2+0,2** ; Call the tool

The NC function includes the following syntax elements:

Syntax element	Meaning
TOOL CALL	Syntax initiator for a tool call
4, QS4 or "MILL_D8_ROUGH"	Tool definition as a fixed or variable number or name <div>  Only the tool definition as a number is unique because the tool names of several tools may be identical! </div>
	Syntax element depending on technology or application Selection by means of a selection window Further information: "Technology-dependent differences when calling tools", Page 161
.1	Step index of the tool Optional syntax element Further information: User's Manual for Setup and Program Run
Z	Tool axis By default, tool axis Z is used. Other possibilities might be available, depending on the machine. Syntax element depending on technology or application Further information: "Technology-dependent differences when calling tools", Page 161
S or S(VC =)	Spindle speed or cutting speed Optional syntax element Further information: "Spindle speed S", Page 163
F, FZ or FU	Feed rate Alternative feed specifications: feed per tooth or feed per revolution Optional syntax element Further information: "Feed rate F", Page 164
DL	Delta value of tool length Optional syntax element Further information: "Tool compensation for tool length and radius", Page 304
DR	Delta value of the tool radius Optional syntax element Further information: "Tool compensation for tool length and radius", Page 304
DR2	Delta value of the tool radius 2 Optional syntax element Further information: "Tool compensation for tool length and radius", Page 304

Technology-dependent differences when calling tools

Milling cutter tool call

The following tool data of a milling cutter can be defined:

- Fixed or variable number or name of tool
- Step index of the tool
- Tool axis
- Spindle speed
- Feed rate
- DL
- DR
- DR2

Calling a milling cutter requires the number or the name of the tool, the tool axis and the spindle speed.

Further information: User's Manual for Setup and Program Run

Tool call of a turning tool (option 50)

The following tool data of a turning tool can be defined:

- Fixed or variable number or name of tool
- Step index of the tool
- Feed rate

Calling a turning tool requires the number or the name of the tool.

Further information: User's Manual for Setup and Program Run

Tool call of a grinding tool(option 156)

The following tool data of a grinding tool can be defined:

- Fixed or variable number or name of tool
- Step index of the tool
- Tool axis
- Spindle speed
- Feed rate

Calling a grinding tool requires the number or the name of the tool and the tool axis.

Further information: User's Manual for Setup and Program Run

Tool call of a dressing tool (option 156)

The following tool data of a dressing tool can be defined:

- Fixed or variable number or name of tool
- Step index of the tool
- Feed rate

Calling a dressing tool requires the number or the name of the tool!

Further information: User's Manual for Setup and Program Run

A dressing tool can be called only in dressing mode!

Further information: "Activating dressing mode with FUNCTION DRESS", Page 140

Tool call of a workpiece touch probe (option 17)

The following tool data of a workpiece touch probe can be defined:

- Fixed or variable number or name of tool
- Step index of the tool
- Tool axis

Calling a workpiece touch probe requires the number or the name of the tool and the tool axis!

Further information: User's Manual for Setup and Program Run

Updating tool data

A **TOOL CALL** allows updating the data of the active tool even without tool change, e. g. change the cutting data or delta values. The tool data that can be changed depend on the technology.

In the cases below, the control updates only the data of the active tool:

- Without tool number or tool name and without tool axis
- Without tool number or tool name and with the same tool axis as in the previous tool call



When a tool number or a tool name or a changed tool axis is programmed in the **TOOL CALL** data record, the control runs a tool change macro.

This may cause the control to insert a replacement tool because the service life has expired.

Further information: "Automatically inserting a replacement tool with M101", Page 447

Notes

- The machine manufacturer uses the machine parameter **allowToolDefCall** (no. 118705) to specify whether a tool can be defined by its name, its number or both in the **TOOL CALL** and **TOOL DEF** functions.

Further information: "Tool pre-selection by TOOL DEF", Page 165


- The machine manufacturer uses the optional machine parameter **prog-ToolCallIDL** (no. 124501) to define whether the control will consider delta values from a tool call in the **Positions** workspace.

Further information: "Tool compensation for tool length and radius", Page 304

7.3.2 Cutting data

Application

The cutting data consist of spindle speed **S** or alternatively constant cutting speed **VC** and feed rate **F**.

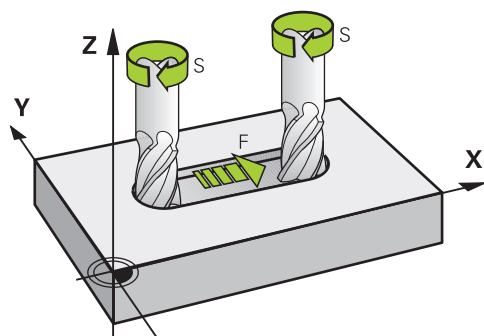

Description of function

Spindle speed S

The spindle speed **S** can be defined:

- Tool call by **TOOL CALL**

Further information: "Tool call by TOOL CALL", Page 159

- Button **S** of **Manual operation** application

Further information: User's Manual for Setup and Program Run

The spindle speed **S** is defined in the unit of spindle revolutions per minute (rpm). Alternatively, the constant cutting speed **VC** in meters per minute (m/min) can be defined.

Further information: "Technology values for turning operations", Page 126

Effect

The spindle speed or the cutting speed is effective until a new spindle speed or cutting speed is defined in a **TOOL CALL** data block.

Potentiometer

The speed potentiometer allows varying the spindle speed between 0 % and 150 % while the program is running. The speed potentiometer setting is effective only for machines with infinitely variable spindle drive. The maximum spindle speed depends on the machine.

Further information: "Potentiometers", Page 70

Status displays

The control displays the current spindle speed in the following workspaces:

- **Positions** workspace
- **POS** tab of the **Status** workspace

Feed rate F

The feed rate **F** can be defined in the following ways:

- Tool call by **TOOL CALL**

Further information: "Tool call by TOOL CALL", Page 159

- Positioning block

Further information: "Path Functions", Page 167

- Button **F** of the **Manual operation** application

Further information: User's Manual for Setup and Program Run

The linear axes feed rate is defined in millimeters per minute (mm/min).

The rotary axes feed rate is defined in degrees per minute (°/min).

The feed rate can be defined with an accuracy of three decimal places.

Alternatively, the feed rate can be defined in the NC program or in a tool call in the following units:

- Feed rate per tooth **FZ** in mm/tooth

FZ defines the path in millimeters that the tool covers per tooth.



When using **FZ**, the number of teeth must be defined in the **CUT** column of the tool management.

Further information: User's Manual for Setup and Program Run

- Feed rate per revolution **FU** in mm/rev

FU defines the path in millimeters that the tool covers per spindle revolution.

The feed rate per revolution is used above all when turning (option 50).

Further information: "Feed rate", Page 128

The feed rate defined in a **TOOL CALL** can be called up within the NC program, using **F AUTO**.

Further information: "F AUTO", Page 164

The feed rate defined in the NC program is effective up to the NC block in which a new feed rate is programmed.

F MAX

When defining **F MAX**, the control moves at rapid traverse. **F MAX** is effective only in the block where it is called. Starting with the following NC block, the last defined feed rate is effective. The maximum feed rate depends on the machine and may depend on the axis.

Further information: User's Manual for Setup and Program Run

F AUTO

When defining a feed rate in a **TOOL CALL** block, this feed rate can be used in the following positioning blocks, using **F AUTO**.

Button F of the Manual operation application

- If you enter $F=0$, then the feed rate that the machine manufacturer has defined as minimum feed rate is effective
- If the feed rate entered exceeds the maximum value that has been defined by the machine manufacturer, then the value defined by the machine manufacturer is effective

Further information: User's Manual for Setup and Program Run

Potentiometer

The feed rate potentiometer allows varying the feed rate between 0 % and 150 % while the program is running. The setting of the feed rate potentiometer is effective only for the programmed feed rate. As long as the programmed feed rate has not yet been reached, the feed rate potentiometer has no effect.

Further information: "Potentiometers", Page 70

Status displays

The control displays the current feed rate in mm/min in the following workspaces:

- **Positions** workspace
- **POS** tab of the **Status** workspace



In the **Manual operation** application, the control displays the feed rate including the decimal points on the **POS** tab. The control displays the feed rate with a total of six decimal points.

- The control displays the feed rate.
 - When **3D ROT** is active the machining feed rate is shown if several axes are moved
 - If **3-D ROT** is inactive, the feed rate display remains empty when more than one axis is moved simultaneously

Further information: User's Manual for Setup and Program Run

Notes

- In inch programs, the feed rate must be defined in 1/10 inch/min.
- To move your machine at rapid traverse, you can also program the corresponding numerical value, e.g. **F30000**. Unlike **FMAX**, this rapid traverse remains in effect not only in the individual block but in all blocks until you program a new feed rate.
- When moving an axis, the control checks whether the defined rotational speed has been reached. The control does not check the rotational speed in positioning blocks with **FMAX** as feed rate.

7.3.3 Tool pre-selection by TOOL DEF

Application

Using **TOOL DEF**, the control prepares a tool in the magazine, thus reducing the tool change time.



Refer to your machine manual.

The preselection of tools with **TOOL DEF** can vary depending on the individual machine tool.


Description of function

If your machine is equipped with a chaotic tool changer system and a double gripper, you can perform tool pre-selection. To do this, program the **TOOL DEF** function after a **TOOL CALL** data record and select the tool to be used next in the NC program. The control prepares the tool while the program is running.

Input

11 TOOL DEF 2 .1	; Tool pre-selection
------------------	----------------------

The NC function includes the following syntax elements:

Syntax element	Meaning
TOOL DEF	Syntax initiator for tool pre-selection
2, QS2 or "MILL_D4_ROUGH"	Tool definition as a fixed or variable number or name
	<div>  Only the tool definition as a number is unique because the tool names of several tools may be identical! </div>
.1	Step index of the tool Further information: User's Manual for Setup and Program Run Optional syntax element

This function can be used for all technologies except for dressing tools (option 156).

Application example

11 TOOL CALL 5 Z S2000	; Call the tool
12 TOOL DEF 7	; Pre-select the next tool
* - ...	
21 TOOL CALL 7	; Call the pre-selected tool

8

Path Functions


8.1 Fundamentals of coordinate definitions

You program a workpiece by defining the path contours and the target coordinates. Depending on the dimensioning used in the technical drawing, you use Cartesian or polar coordinates with absolute or incremental values.

8.1.1 Cartesian coordinates

Application

A Cartesian coordinate system consists of two or three axes that are all mutually perpendicular. Cartesian coordinates are relative to the datum (origin) of the coordinate system, which is at the intersection of the axes.

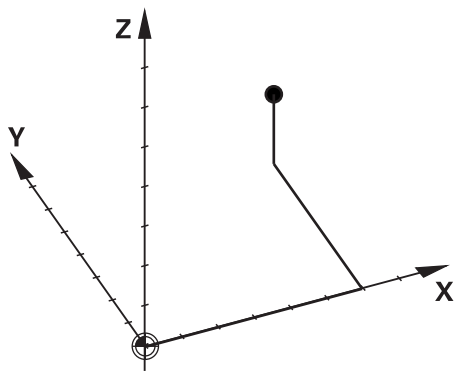

With Cartesian coordinates you can uniquely specify a point in space by defining the three axis values.

Description of function

In the NC program you define the values in the linear axes **X**, **Y**, and **Z**, such as with a straight line **L**.

```
11 L X+60 Y+50 Z+20 RL F200
```


The programmed coordinates are modally effective. As long as the value of an axis remains the same, you do not need to program the value for further path contours.

8.1.2 Polar coordinates

Application

You define polar coordinates in one of the three planes of a Cartesian coordinate system.


Polar coordinates are relative to a previously defined pole. From this pole you define a point by its distance to the pole and the angle to the angle reference axis.

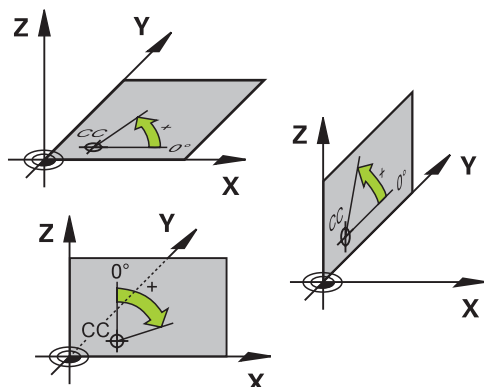

Description of function

Polar coordinates can be used in, for example, the following situations:

- Points on circular paths
- Workpiece drawings with angular information, such as bolt hole circles

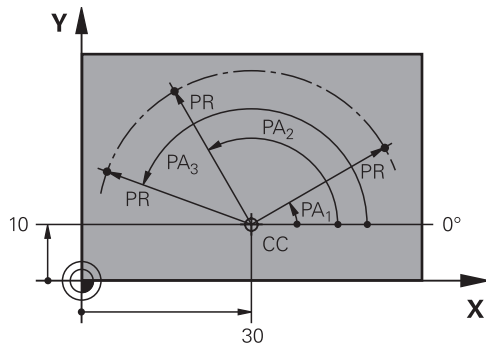

You define the pole **CC** with Cartesian coordinates in two axes. These axes specify the plane and the angle reference axis.

The pole is modally effective within an NC program.

The angle reference axis is related to the plane as follows:

Plane	Angle reference axis
XY	+X
YZ	+Y
ZX	+Z

11 CC X+30 Y+10

The polar coordinate radius **PR** is relative to the pole. **PR** defines the distance of this point from the pole.

The polar coordinate angle **PA** defines the angle between the angle reference axis and this point.

11 LP PR+30 PA+10 RR F300


The programmed coordinates are modally effective. As long as the value of an axis remains the same, you do not need to program the value for further path contours.

8.1.3 Absolute entries**Application**


Absolute entries always refer to an origin. For Cartesian coordinates the origin is the datum, and for polar coordinates the origin is the pole and the angle reference axis.

Description of function

Absolute entries define the point that the control positions to.

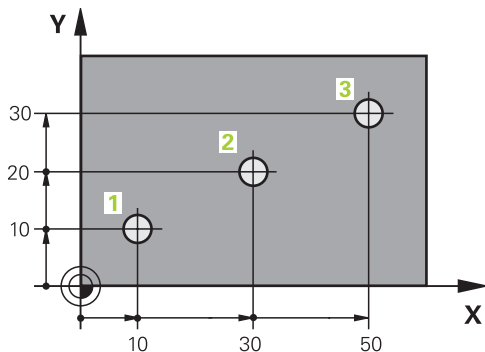

11 L X+10 Y+10 RL F200 M3	; Position to point 1
12 L X+30 Y+20	; Position to point 2
13 L X+50 Y+30	; Position to point 3

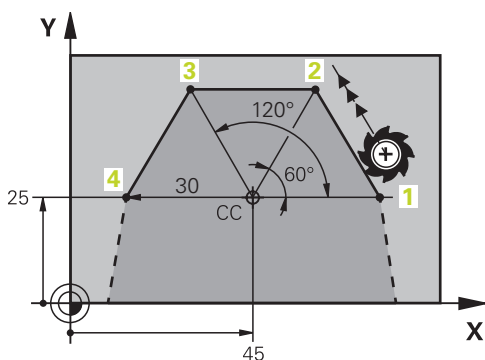

11 CC X+45 Y+25	; Define the pole in two axes with Cartesian coordinates
12 LP PR+30 PA+0 RR F300 M3	; Position to point 1
13 LP PA+60	; Position to point 2
14 LP PA+120	; Position to point 3
15 LP PA+180	; Position to point 4


8.1.4 Incremental entries

Application


Incremental entries are always referenced to the previously programmed coordinates. For Cartesian coordinates those are the values in the axes **X**, **Y**, and **Z**, and for polar coordinates the value of the polar coordinate radius **PR** and the polar coordinate angle **PA**.

Description of function

Incremental entries define the value by which the control positions. The previously programmed coordinates serve as the respective datum of the coordinate system. You define incremental coordinates with an **I** before each axis designation.

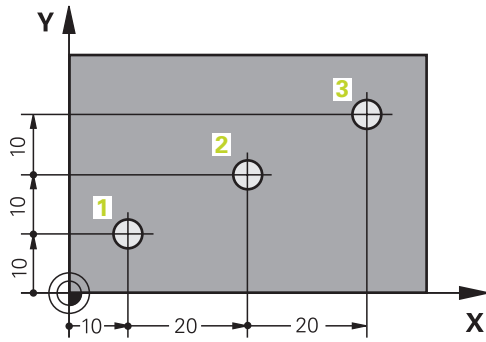

11 L X+10 Y+10 RL F200 M3	; Position to point 1 absolutely
12 L IX+20 IY+10	; Position to point 2 incrementally
13 L IX+20 IY+10	; Position to point 3 incrementally

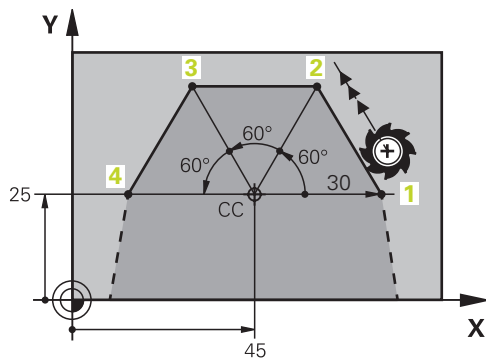

11 CC X+45 Y+25	; Define the pole absolutely in two axes with Cartesian coordinates
12 LP PR+30 PA+0 RR F300 M3	; Position to point 1 absolutely
13 LP IPA+60	; Position to point 2 incrementally
14 LP IPA+60	; Position to point 3 incrementally
15 LP IPA+60	; Position to point 4 incrementally

8.2 Fundamentals of path functions

Application

When creating an NC program, you can use the path functions to program the individual contour elements. To do so, use coordinates to define the end points of the contour elements.

The control then uses the coordinate entries, the tool data, and the radius compensation to calculate the traverse path. The control simultaneously positions all machine axes that you programmed in the NC block of a path function.

Description of function


Inserting a path function

The gray path function keys initiate the dialog. The control inserts the NC block in the NC program and prompts you for each piece of necessary information.



Depending on the design of the machine tool, either the tool moves or the machine table moves. When programming a path function, you always assume that the tool is in motion.

Motion in one axis

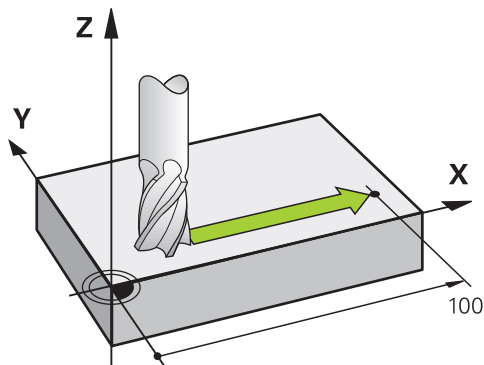


If the NC block contains one coordinate, the control moves the tool parallel to the programmed machine axis.

Example

L X+100

The tool retains the Y and Z coordinates and moves to the position **X+100**.

Motion in two axes

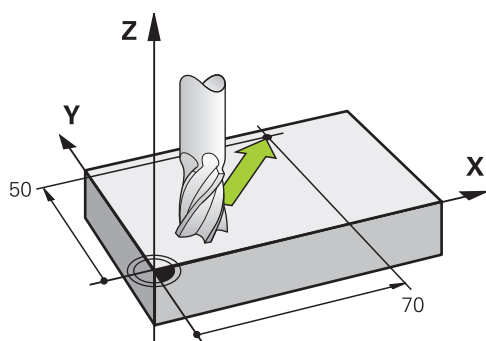

If the NC block contains two coordinates, the control moves the tool in the programmed plane.


Example

L X+70 Y+50

The tool retains the Z coordinate and moves in the XY plane to the position **X+70 Y+50**.

You define the working plane by entering the tool axis when calling the tool with **TOOL CALL**.

Further information: "Designation of the axes on milling machines", Page 98

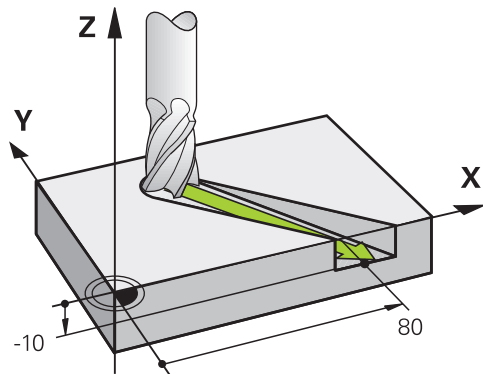Motion in more than two axes

If the NC block contains three coordinate entries, the control moves the tool spatially to the programmed position.


Example

```
L X+80 Y+0 Z-10
```

Depending on the kinematics of your machine, you can program up to six axes in a linear **L** block.


Example

```
L X+80 Y+0 Z-10 A+15 B+0 C-45
```

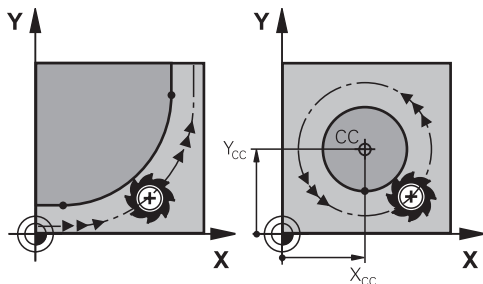Circles and arcs

Use the path functions for circular arcs to program circular motions in the working plane.

The control moves the tool in two axes simultaneously on a circular path relative to the workpiece. You can program circular paths with a circle center point **CC**.

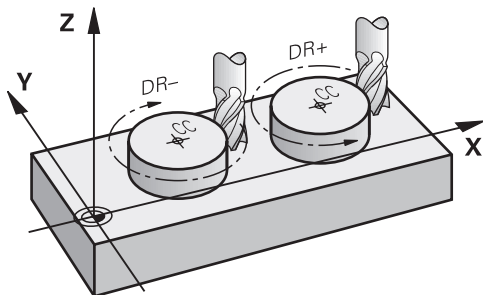Direction of rotation DR for circular motions

When a circular path has no tangential transition to another contour element, define the direction of rotation as follows:

- Clockwise direction of rotation: **DR-**
- Counterclockwise direction of rotation: **DR+**

Tool radius compensation

Tool radius compensation is defined in the NC block of the first contour element.
Do not activate tool radius compensation in an NC block for a circular path. Activate tool radius compensation in a preceding straight line.

Further information: "Tool radius compensation", Page 306

Pre-positioning

NOTICE


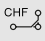





Danger of collision!

The control does not automatically check whether collisions can occur between the tool and the workpiece. Incorrect pre-positioning can also lead to contour damage. There is danger of collision during the approach movement!

- ▶ Program a suitable pre-position
- ▶ Check the sequence and contour with the aid of the graphic simulation

8.3 Path functions with Cartesian coordinates

8.3.1 Overview of path functions


Key	Function	Further information
	Straight line L (line)	Page 175
	Chamfer CHF (chamfer) Chamfer between two straight lines	Page 175
	Rounding RND (rounding of corner) Circular arc with tangential connection to the preceding and subsequent contour elements	Page 177
	Circle center point CC (circle center)	Page 178
	Circular path C (circle) Circular path around a circle center CC to an end point	Page 178
	Circular path CR (circle by radius) Circular path with a specified radius	Page 180
	Circular path CT (circle tangential) Circular path with tangential connection to the preceding contour element	Page 181

8.3.2 Straight line L

Application

With a straight line **L** you program a straight traverse motion in any direction.

Description of function

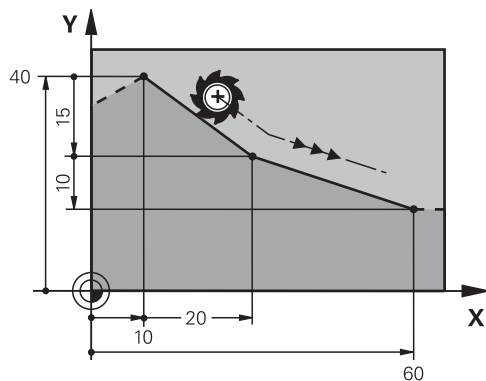

The control moves the tool in a straight line from its current position to the defined end point. The starting point is the end point of the preceding NC block.

Depending on the kinematics of your machine, you can program up to six axes in a linear **L** block.

Programming a straight line L

To program a straight line:



- ▶ Select **L**
- ▶ Define the coordinates of the end point
- ▶ Select radius compensation, if necessary
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Example

```
7 L X+10 Y+40 RL F200 M3
```

```
8 L IX+20 IY-15
```

```
9 L X+60 IY-10
```

8.3.3 Chamfer CHF


Application

With the chamfer function **CHF** you can insert a chamfer at the intersection of two straight lines.

Requirements

- Straight lines in the working plane before and after the chamfer
- Identical tool compensation before and after the chamfer
- Chamfer is machinable with the current tool

Description of function

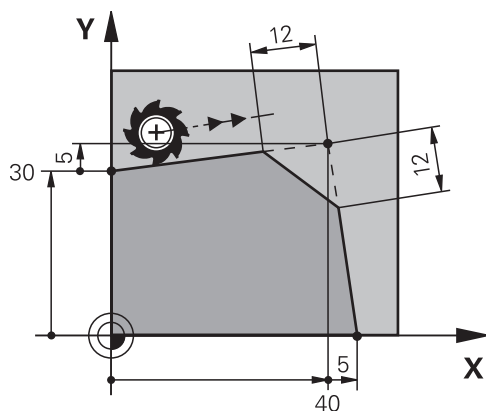

Cutting two straight lines creates contour corners. You can insert a chamfer at these contour corners. The angle of the corner is irrelevant; you simply define the length by which each straight line is shortened. The control does not traverse to the corner point.

If you program a feed rate in the **CHF** block, then this feed rate is in effect only while cutting the chamfer.

Programming a chamfer

To program a chamfer:



- ▶ Select **CHF**
- ▶ Define the length of the chamfer
- ▶ Define the feed rate, if necessary

Example

```
7 L X+0 Y+30 RL F300 M3
```

```
8 L X+40 IY+5
```

```
9 CHF 12 F250
```

```
10 L IX+5 Y+0
```

8.3.4 Rounding RND


Application

With the rounding function **RND** you can use a circular path to round off the intersection of two path functions.

Requirements

- Path functions before and after the rounding arc
- Identical tool compensation before and after the rounding arc
- Rounding is machinable with the current tool

Description of function

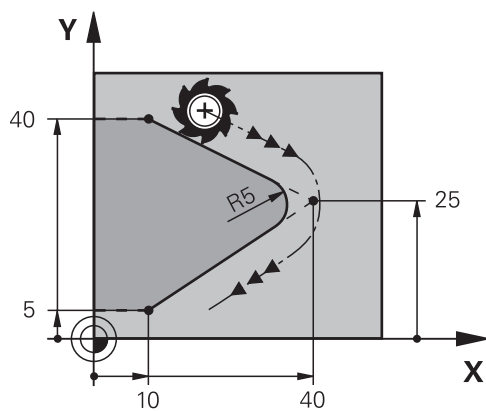

You program the rounding arc between two path functions. The circular arc connects tangentially to the previous and subsequent contour element. The control does not traverse to the intersection.

If you program a feed rate in the **RND** block, then this feed rate is in effect only while cutting the rounding arc.

Program rounding RND

To program a rounding **RND**:



- ▶ Select **RND**
- ▶ Define the radius
- ▶ Define the feed rate, if necessary

Example

```
5 L X+10 Y+40 RL F300 M3
```

```
6 L X+40 Y+25
```

```
7 RND R5 F100
```


```
8 L X+10 Y+5
```

8.3.5 Circle center point CC

Application

You use the circle center point function **CC** to define a position as circle center point.

Description of function

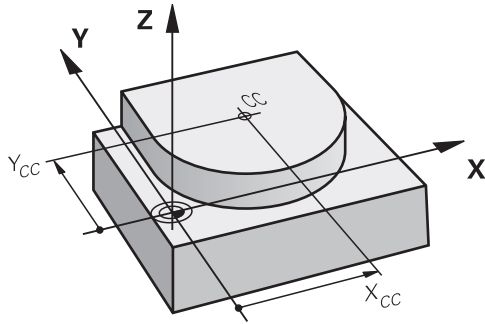

You define a circle center point by entering coordinates for at most two axes. If you do not enter coordinates, the control uses the last defined position. The circle center point remains active until you define a new circle center point. The control does not traverse to the circle center point.

You need to define a circle center point before you can program a circular path with **C**.



The control simultaneously uses the **CC** function as the pole for polar coordinates.

Further information: "Polar coordinate datum at pole CC", Page 185

Programming the circle center point CC

To program a circle center point **CC**:



- ▶ Select **CC**
- ▶ Define the coordinates of the circle center point

Example

```
5 CC X+25 Y+25
```

or

```
10 L X+25 Y+25
```

```
11 CC
```

8.3.6 Circular path C

Application


You use the circular path function **C** to program a circular path around a circle center point.

Requirement

- Circle center point **CC** is defined

Further information: "Circle center point CC", Page 178

Description of function

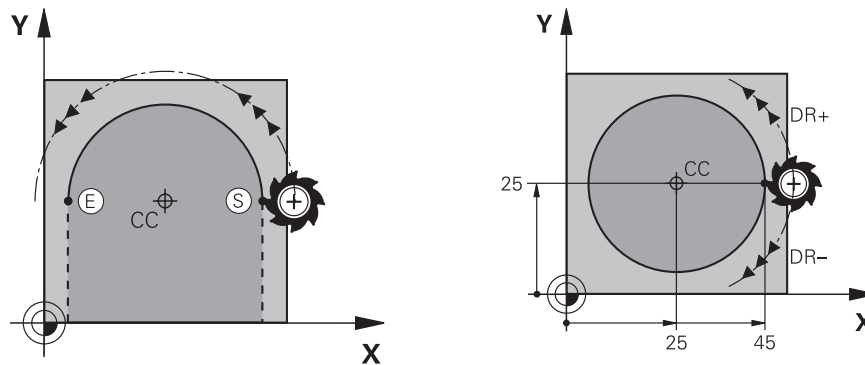

The control moves the tool on a circular path from the current position to the defined end point. The starting point is the end point of the preceding NC block. You can use at most two axes to define the new end point.

If you want to program a full circle, then define the same coordinates for the starting and end point. These points must lie on the circular path.



In the machine parameter **circleDeviation** (no. 200901) you can define the permissible deviation of the circle radius. The maximum permissible deviation is 0.016 mm.

With the direction of rotation you define whether the control moves along the circular path in a clockwise or counterclockwise direction.

Definition of the direction of rotation:

- Clockwise: direction of rotation **DR-** (with radius compensation **RL**)
- Counterclockwise: direction of rotation **DR+** (with radius compensation **RL**)

Programming a circular path C

To program a circular path with **C**:



- ▶ Select **C**
- ▶ Define the coordinates of the end point
- ▶ Select the direction of rotation
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Example

```
5 CC X+25 Y+25
```

```
6 L X+45 Y+25 RR F200 M3
```

```
7 C X+45 Y+25 DR+
```


8.3.7 Circular path CR

Application

You use a radius to program a circular path with the circular path function **CR**.

Description of function

The control moves the tool on a circular path, with the radius **R**, from the current position to the defined end point. The starting point is the end point of the preceding NC block. You can use at most two axes to define the new end point.

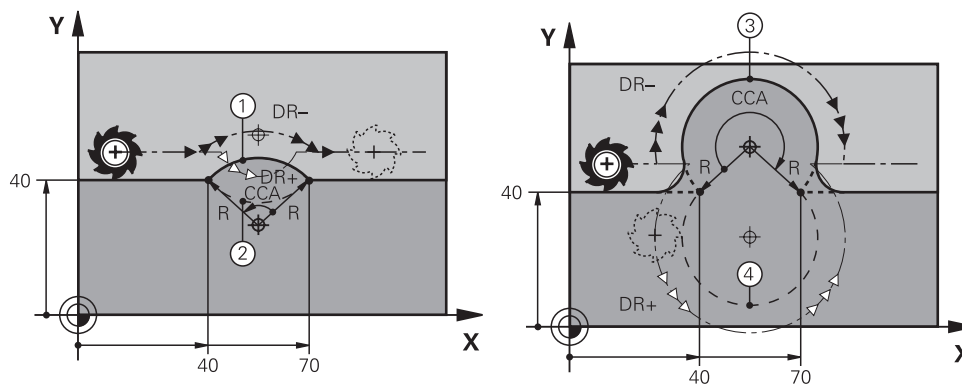

The starting and end points can be connected with four different circular paths of the same radius. You define the correct circular path with the central angle **CCA** of the circular path radius **R** and the direction of rotation **DR**.

The algebraic sign of the circular path radius **R** is decisive for whether the control selects a central angle that is greater than or less than 180°.


The radius has the following effects on the central angle:

- Smaller circular path: **CCA** < 180°
Radius with a positive sign **R** > 0
- Longer circular path: **CCA** > 180°
Radius with a negative sign **R** < 0

With the direction of rotation you define whether the control moves along the circular path in a clockwise or counterclockwise direction.

Definition of the direction of rotation:

- Clockwise: direction of rotation **DR-** (with radius compensation **RL**)
- Counterclockwise: direction of rotation **DR+** (with radius compensation **RL**)

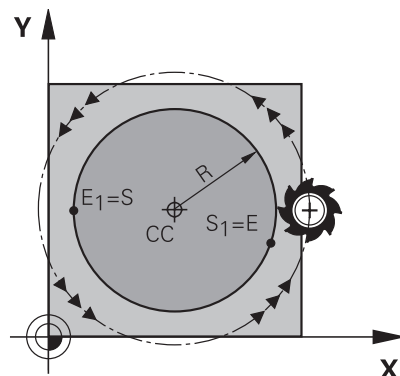

For a full circle, program two circular paths in succession. The end point of the first circular path is the starting point of the second. The end point of the second circular path is the starting point of the first.

Programming a circular path CR

To program a circular path with **CR**:



- ▶ Select **CR**
- ▶ Define the coordinates of the end point
- ▶ Define a positive or negative radius
- ▶ Select the direction of rotation
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Note

The distance between the starting and end points must not be greater than the circle diameter.

Example

10 L X+40 Y+40 RL F200 M3	
11 CR X+70 Y+40 R+20 DR-	; Circular path 1

or

11 CR X+70 Y+40 R+20 DR+	
11 CR X+70 Y+40 R-20 DR-	; Circular path 3

or

or

11 CR X+70 Y+40 R-20 DR+	
11 CR X+70 Y+40 R-20 DR+	; Circular path 4

8.3.8 Circular path CT


Application

You use the circular path function **CT** to program a circular path that connects tangentially to the previously programmed contour element.

Requirement

- Previous contour element programmed
Before you can program a circular path with **CT** you must program a contour element to which the circular path can connect tangentially. This requires at least two NC blocks.

Description of function

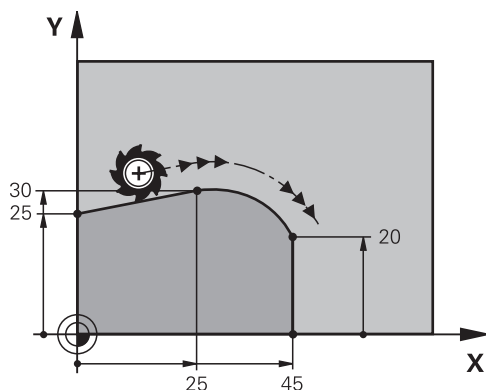

The control moves the tool on a circular path, with a tangential connection, from the current position to the defined end point. The starting point is the end point of the preceding NC block. You can use at most two axes to define the new end point. When contour elements uniformly merge into another without kinks, then this transition is referred to as tangential.

Programming a circular path CT

To program a circular path with **CT**:



- ▶ Select **CT**
- ▶ Define the coordinates of the end point
- ▶ Select radius compensation, if necessary
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Note

Both coordinates of the contour element must lie in the same plane as the coordinates of the circular path.

Example

```
7 L X+0 Y+25 RL F300 M3
```

```
8 L X+25 Y+30
```

```
9 CT X+45 Y+20
```


```
10 L Y+0
```

8.3.9 Circular path in another plane

Application

You can also program circular paths that do not lie in the active working plane.

Description of function

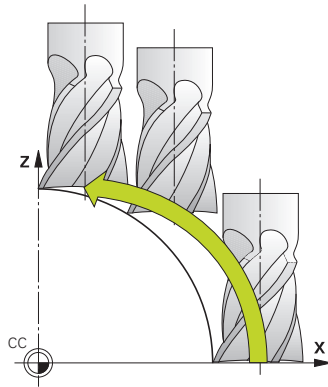

You program circular paths that lie in another plane by entering one axis of the working plane and the tool axis.

Further information: "Designation of the axes on milling machines", Page 98

You can program circular paths that lie in another plane with the following functions:

- **C**
- **CR**
- **CT**



If you want to use the function **C** for circular paths in another plane, you must first define the circle center point **CC** by entering one of the axes of the working plane and the tool axis.


Spatial arcs are created when these circular paths rotate. When machining spatial arcs, the control moves in three axes.

Example

```

3 TOOL CALL 1 Z S4000
4 ...
5 L X+45 Y+25 Z+25 RR F200 M3
6 CC X+25 Z+25
7 C X+45 Z+25 DR+
  
```

8.3.10 Example: Cartesian path functions

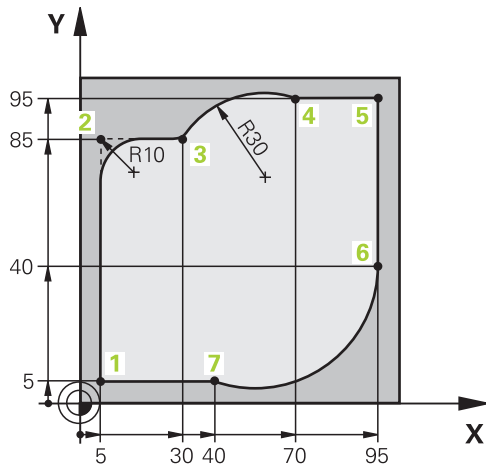









0 BEGIN PGM CIRCULAR MM	
1 BLK FORM 0.1 Z X+0 Y+0 Z-20	
2 BLK FORM 0.2 X+100 Y+100 Z+0	; Define the workpiece blank for workpiece simulation
3 TOOL CALL 1 Z S4000	; Call the tool in the tool axis and with the spindle speed
4 L Z+250 R0 FMAX	; Retract the tool in the tool axis at rapid traverse FMAX
5 L X-10 Y-10 R0 FMAX	; Pre-position the tool
6 L Z-5 R0 F1000 M3	; Move to working depth at feed rate F = 1000 mm/min
7 APPR LCT X+5 Y+5 R5 RL F300	; Approach the contour at point 1 on a circular path with tangential connection
8 L X+5 Y+85	; Program the first straight line for corner 2
9 RND R10 F150	; Program a rounding with R = 10 mm, feed rate F = 150 mm/min
10 L X+30 Y+85	; Move to point 3: starting point of the circular path CR
11 CR X+70 Y+95 R+30 DR-	; Move to point 4: end point of the circular path CR, with radius R = 30 mm
12 L X+95	; Move to point 5
13 L X+95 Y+40	; Move to point 6: starting point of the circular path CT
14 CT X+40 Y+5	; Move to point 7: end point of the circular path CT, arc with tangential connection to point 6; the control calculates the radius automatically
15 L X+5	; Move to last contour point 1
16 DEP LCT X-20 Y-20 R5 F1000	; Depart contour on a circular path with tangential connection
17 L Z+250 R0 FMAX M2	; Retract the tool, end program
18 END PGM CIRCULAR MM	

8.4 Path functions with polar coordinates

8.4.1 Overview of polar coordinates

With polar coordinates you can define a position in terms of its angle **PA** and its distance **PR** relative to a previously defined pole **CC**.

Overview of path functions with polar coordinates


Key	Function	Further information
 + 	Straight line LP (line polar)	Page 186
 + 	Circular path CP (circle polar) Circular path around circle center point or pole CC to arc end point	Page 187
 + 	Circular path CTP (circle tangential polar) Circular path with tangential connection to the preceding contour element	Page 188
 + 	Helix with circular path CP (circle polar) Combination of a circular and a linear motion	Page 189

8.4.2 Polar coordinate datum at pole CC

Application

You must define a pole before you can program with polar coordinates. All polar coordinates are relative to the pole.


Description of function

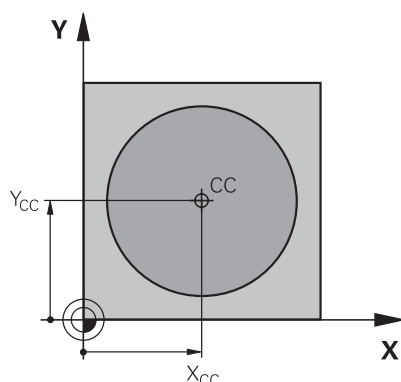

You use the **CC** function to define a position as the pole. You define a pole by entering coordinates for at most two axes. If you do not enter coordinates, the control uses the last defined position. The pole remains active until you define a new pole. The control does not traverse to this position.

Programming the CC pole

To program a **CC** pole:

- 
 - ▶ Select **CC**
 - ▶ Define the coordinates of the pole

Example

```
11 CC X+30 Y+10
```

8.4.3 Straight line LP

Application

With the straight line function **LP** you program a straight traverse motion in any direction using polar coordinates.


Requirement

- Pole **CC**

You must define a pole **CC** before programming with polar coordinates.

Further information: "Polar coordinate datum at pole CC", Page 185

Description of function

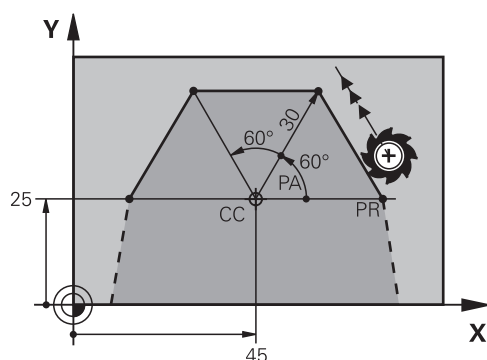

The control moves the tool in a straight line from its current position to the defined end point. The starting point is the end point of the preceding NC block.

You define the straight line with the polar coordinate radius **PR** and the polar coordinate angle **PA**. The polar coordinate radius **PR** is the distance from the end point to the pole.

The algebraic sign of **PA** depends on the angle reference axis:

- If the angle from the angle reference axis to **PR** is counterclockwise: **PA**>0
- If the angle from the angle reference axis to **PR** is clockwise: **PA**<0

Programming a straight line LP

To program a straight line:



- ▶ Select **L**



- ▶ Select **P**
- ▶ Define the polar coordinate radius **PR**
- ▶ Define the polar coordinate angle **PA**
- ▶ Select radius compensation, if necessary
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Note

The **Form** column allows toggling between the syntaxes for Cartesian and polar coordinate entry.

Further information: "Form column in the Program workspace", Page 113

Example

12 CC X+45 Y+25
13 LP PR+30 PA+0 RR F300 M3
14 LP PA+60
15 LP IPA+60
16 LP PA+180

8.4.4 Circular path CP around pole CC

Application

You use the circular path function **CP** to program a circular path around the defined pole.


Requirement

- Pole **CC**

You must define a pole **CC** before programming with polar coordinates.

Further information: "Polar coordinate datum at pole CC", Page 185

Description of function

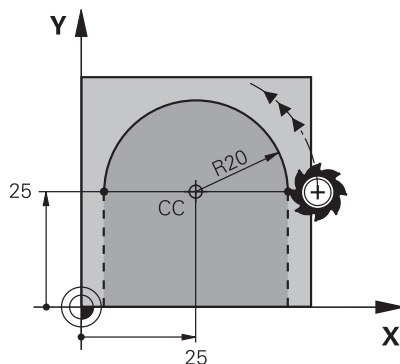

The control moves the tool on a circular path from the current position to the defined end point. The starting point is the end point of the preceding NC block.

The distance from the starting point to the pole is automatically both the polar coordinate radius **PR** as well as the radius of the circular path. You define the polar coordinate angle **PA** that the control moves to with this radius.

Programming a circular path CP

To program a circular path with **CP**:



- ▶ Select **C**



- ▶ Select **P**
- ▶ Define the polar coordinate angle **PA**
- ▶ Select the direction of rotation
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Notes

- In the **Form** workspace you can toggle between the syntaxes for Cartesian and polar coordinate entry.
- If you define **PA** incrementally, you must define the direction of rotation with the same algebraic sign.
Consider this behavior when importing NC programs from earlier controls, and adapt the NC programs if necessary.

Example

```
18 LP PR+20 PA+0 RR F250 M3
```

```
19 CC X+25 Y+25
```

```
20 CP PA+180 DR+
```

8.4.5 Circular path CTP


Application

You use the **CTP** function to program a circular path with polar coordinates that connects tangentially to the previously programmed contour element.

Requirements

- Pole **CC**
You must define a pole **CC** before programming with polar coordinates.
Further information: "Polar coordinate datum at pole CC", Page 185
- Previous contour element programmed
Before you can program a circular path with **CTP** you must program a contour element to which the circular path can connect tangentially. This requires at least two positioning blocks.

Description of function

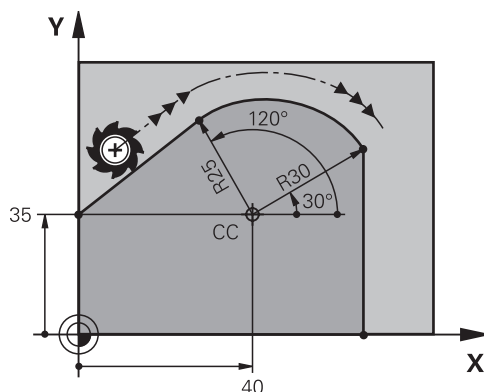

The control moves the tool on a circular path, with a tangential connection, from the current position to the end point defined with polar coordinates. The starting point is the end point of the preceding NC block.

When contour elements uniformly merge into another, without kinks or corners, then this transition is referred to as tangential.

Programming a circular path CTP

To program a circular path with **CTP**:



- ▶ Select **CT**
- ▶ Select **P**
- ▶ Define the polar coordinate radius **PR**
- ▶ Define the polar coordinate angle **PA**
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary

Notes

- The pole is **not** the center of the contour circle!
- The **Form** column allows toggling between the syntaxes for Cartesian and polar coordinate entry.

Further information: "Form column in the Program workspace", Page 113

Example

12 L X+0 Y+35 RL F250 M3
13 CC X+40 Y+35
14 LP PR+25 PA+120
15 CTP PR+30 PA+30
16 L Y+0

8.4.6 Helix

Application

A helix is a cylindrical spiral that is programmed on a circular path with a constant pitch.

Requirements


The path contours for a helix can only be programmed with a circular path **CP**.

Further information: "Circular path CP around pole CC", Page 187

You must define a pole **CC** before programming with polar coordinates.

Further information: "Polar coordinate datum at pole CC", Page 185

Description of function

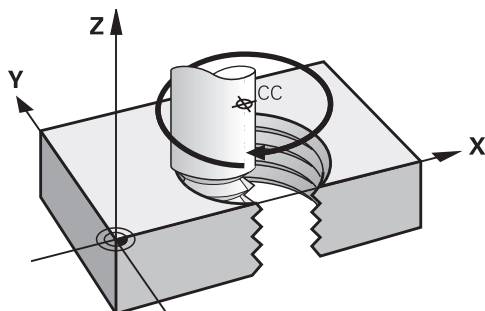

A helix is a combination of a circular path **CP** and a linear motion perpendicular to this path. You program the circular path **CP** in the working plane.

Helices are used in the following cases:


- Large-diameter internal and external threads
- Lubrication grooves

Dependencies of different thread shapes

The table shows the dependencies between machining direction, direction of rotation and radius compensation for the different thread shapes:

Internal thread	Work direction	Direction of rotation	Radius compensation
Right-handed	Z+	DR+	RL
	Z-	DR-	RR
Left-handed	Z+	DR-	RR
	Z-	DR+	RL
External thread	Work direction	Direction of rotation	Radius compensation
Right-handed	Z+	DR+	RR
	Z-	DR-	RL
Left-handed	Z+	DR-	RL
	Z-	DR+	RR

Programming a helix

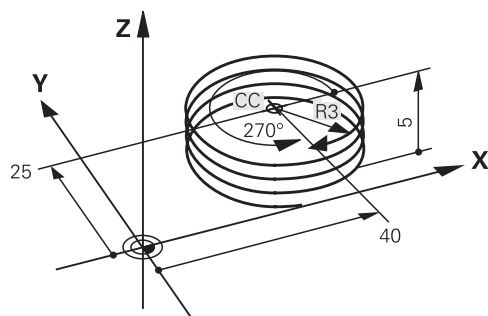

Define the same algebraic sign for the direction of rotation **DR** and the incremental total angle **IPA**. The tool may otherwise move on a wrong path.

To program a helix:



► Select **C**



► Select **P**



► Select **I**

► Define the incremental total angle **IPA**

► Define the incremental total height **IZ**


► Select the direction of rotation

► Select radius compensation

► Define the feed rate, if necessary

► Define a miscellaneous function, if necessary

Example

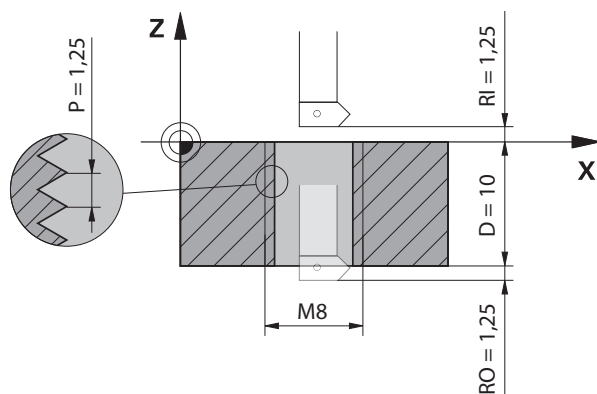

This example includes the following default values:

- **M8** thread
- Left-handed thread miller

The drawing and the default values allow deriving the following information:

- Internal machining
- Right-hand thread
- **RR** radius compensation

The derived information requires the machining direction Z-.

Further information: "Dependencies of different thread shapes", Page 190

Specify and calculate the values below:

- Incremental total machining depth
- Number of thread grooves
- Incremental total angle

Formula	Definition
$IZ = D + RI + RO$	The incremental total machining depth IZ results from the thread depth D (depth) and from the optional thread run-in values RI (run-in) and thread run-out values RO (run-out).
$n = IZ \div P$	The number of thread grooves n (number) results from the incremental total machining depth IZ divided by the pitch P (pitch).
$IPA = n \times 360^\circ$	The incremental total angle IPA results from the number of thread grooves n (number) multiplied by 360° for one complete revolution.

11 L Z+1,25 R0 FMAX	; Pre-position in the tool axis
12 L X+4 Y+0 RR F500	; Pre-position in the plane
13 CC X+0 Y+0	; Activate the pole
14 CP IPA-3600 IZ-12.5 DR-	; Cut the thread

Alternative solution with repetition of program parts


11 L Z+1.25	; Pre-position in the tool axis
12 L X+4 Y+0 RR F500	; Pre-position in the plane
13 CC X+0 Y+0	; Activate the pole
14 LBL 1	
15 CP IPA-360 IZ-1.25 DR-	; Cut the first thread groove
16 LBL CALL 1 REP 9	; Cut the next nine thread grooves, REP 9 = number of remaining machining processes

The solution approach uses the thread pitch directly as the incremental plunging depth per revolution.

REP shows the number of necessary repeats required for reaching the calculated ten infeed runs.

Further information: "Subprograms and program section repeats with the label LBL", Page 210

8.4.7 Example: Polar straight lines

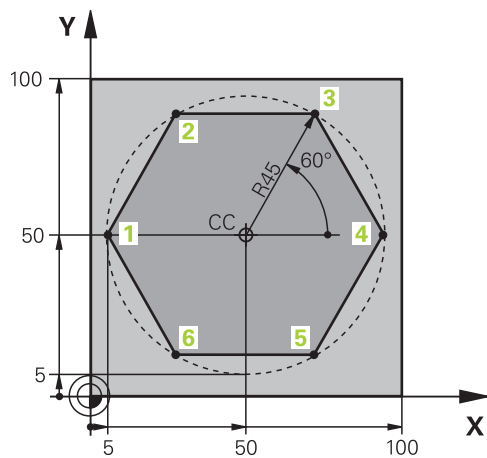





0 BEGIN PGM LINEARPO MM	
1 BLK FORM 0.1 Z X+0 Y+0 Z-20	
2 BLK FORM 0.2 X+100 Y+100 Z+0	; Workpiece blank definition
3 TOOL CALL 1 Z S4000	; Tool call
4 CC X+50 Y+50	; Define the datum for polar coordinates
5 L Z+250 R0 FMAX	; Retract the tool
6 LP PR+60 PA+180 R0 FMAX	; Pre-position the tool
7 L Z-5 R0 F1000 M3	; Move to working depth
8 APPR PLCT PR+45 PA+180 R5 RL F250	; Approach the contour at point 1 on a circular path with tangential connection
9 LP PA+120	; Move to point 2
10 LP PA+60	; Move to point 3
11 LP PA+0	; Move to point 4
12 LP PA-60	; Move to point 5
13 LP PA-120	; Move to point 6
14 LP PA+180	; Move to point 1
15 DEP PLCT PR+60 PA+180 R5 F1000	; Depart contour on a circular path with tangential connection
16 L Z+250 R0 FMAX M2	; Retract the tool, end program
17 END PGM LINEARPO MM	

8.5 Approaching and departing from a contour


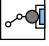


8.5.1 Overview of path shapes

Approach and departure functions are used to gently move the tool to or from a contour, without leaving any machining marks on the workpiece.

The **APPR** folder of the **Insert NC function** window contains the following functions:

Symbol	Function	Further information
	APPR LT or APPR PLT Use Cartesian or polar coordinates to approach a contour on a straight line with a tangential connection	Page 198
	APPR LN or APPR PLN Use Cartesian or polar coordinates to approach a contour on a straight line perpendicular to the first contour point	Page 199
	APPR CT or APPR PCT Use Cartesian or polar coordinates to approach a contour on a circular path with a tangential connection	Page 200
	APPR LCT or APPR PLCT Use Cartesian or polar coordinates to approach a contour on a circular path with a tangential connection and a straight line	Page 201

The **DEP** folder of the **Insert NC function** window contains the following functions:

Symbol	Function	Further information
	DEP LT Depart contour on a straight line with a tangential connection	Page 203
	DEP LN Depart contour on a straight line perpendicular to the last contour point	Page 203
	DEP CT Depart contour on a circular path with a tangential connection	Page 205
	DEP LCT or DEP PLCT Use Cartesian or polar coordinates to depart a contour on a circular path with a tangential connection and a straight line	Page 205



You can switch between entry of Cartesian and polar coordinates in the form or by pressing the **P** key.


Further information: "Fundamentals of coordinate definitions", Page 168

Approaching or departing a helix

The tool approaches and departs a helix in the extension of the helix by moving on a circular path that connects tangentially to the contour. Use the **APPR CT** and **DEP CT** functions for this.

Further information: "Helix", Page 189

8.5.2 Positions for approach and departure

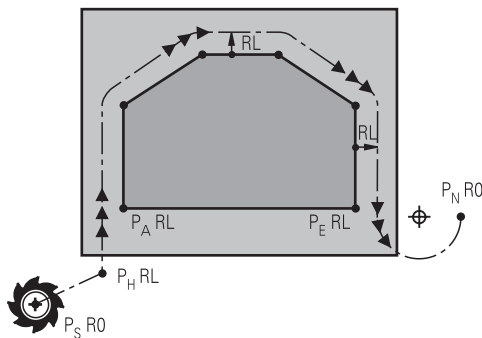

NOTICE

Danger of collision!

The control traverses from the current position (starting point P_S) to the auxiliary point P_H at the last feed rate entered. If you programmed **FMAX** in the last positioning block before the approach function, the control also approaches the auxiliary point P_H at rapid traverse.

- ▶ Program a feed rate other than **FMAX** before the approach function

The control uses the following positions when approaching and departing a contour:

- Starting point P_S
You program the starting point P_S before an approach block without radius compensation. The starting point is located outside of the contour.
- Auxiliary point P_H
For some path shapes an auxiliary point P_H is necessary for approaching or departing the contour. The control calculates the auxiliary point from the information in the approach or departure blocks.
- First contour point P_A
You program the first contour point P_A in the approach block together with the radius compensation.
- Last contour point P_E
You program the last contour point P_E with any path function.
- End point P_N
The position P_N is located outside of the contour and results from the information in the departure block. The departure block automatically rescinds the radius compensation.

NOTICE

Danger of collision!

The control does not automatically check whether collisions can occur between the tool and the workpiece. Incorrect pre-positioning and incorrect auxiliary points P_H can also lead to contour damage. There is danger of collision during the approach movement!


- ▶ Program a suitable pre-position
- ▶ Check the auxiliary point P_H , the sequence and the contour with the aid of the graphic simulation

8.5.3 Approach functions APPR LT and APPR PLT

Application

The control uses these functions to approach a contour on a straight line with tangential connection. You use **APPR LT** to define the starting point of the contour with Cartesian coordinates, and **APPR PLT** for polar coordinates.

Description of function

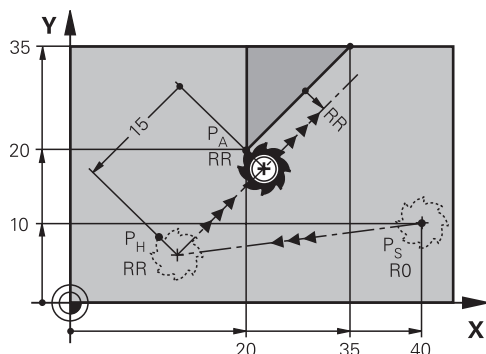

The control approaches the contour as follows:

- On a straight line from the starting point P_S to an auxiliary point P_H
- On a straight line, tangentially from the auxiliary point P_H to the first contour point P_A

The auxiliary point P_H is separated from the first contour point P_A by the distance **LEN**.

Programming APPR LT and APPR PLT



If you want to program this path shape with polar coordinates, then you must first define a pole **CC**.

Further information: "Polar coordinate datum at pole CC", Page 185

To define the approach function:

- Use any path function to approach the starting point P_S

APPR
/DEP



- Select **APPR DEP**
- The control opens the **Insert NC function** window.
- Select the path shape, for example **APPR LT**
- Define the coordinates of the first contour point P_A
- Use **LEN** to define the distance to the auxiliary point P_H
- Select radius compensation **RR/RL**

Example APPR LT


11 L X+40 Y+10 R0 FMAX M3	; Approach P_S without radius compensation
12 APPR LT X+20 Y+20 Z-10 LEN15 RR F100	; P_A with radius compensation RR; distance P_H to P_A : LEN 15
13 L X+35 Y+35	; End point of first contour element
14 L ...	; Next contour element

8.5.4 Approach functions APPR LN and APPR PLN

Application

The control uses these functions to approach a contour on a straight line perpendicular to the first contour point. You use **APPR LN** to define the starting point of the contour with Cartesian coordinates, and **APPR PLN** for polar coordinates.

Description of function

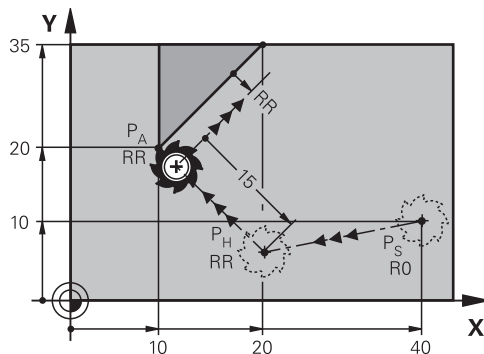

The control approaches the contour as follows:

- On a straight line from the starting point P_S to an auxiliary point P_H
- On a straight line, perpendicularly from the auxiliary point P_H to the first contour point P_A

The auxiliary point P_H is separated from the first contour point P_A by the distance **LEN**.



If you program **R0**, the control stops the machining/simulation with an error message.

This behavior differs from the iTNC 530 control.

Programming APPR LN and APPR PLN



If you want to program this path shape with polar coordinates, then you must first define a pole **CC**.

Further information: "Polar coordinate datum at pole CC", Page 185

To define the approach function:

- Use any path function to approach the starting point P_S

APPR
/DEP



- Select **APPR DEP**
- The control opens the **Insert NC function** window.
- Select the path shape, for example **APPR LN**
- Define the coordinates of the first contour point P_A
- Use **LEN** to define the positive distance to the auxiliary point P_H
- Select radius compensation **RR/RL**

Example APPR LN


11 L X+40 Y+10 R0 FMAX M3	; Approach P _S without radius compensation
12 APPR LN X+10 Y+20 Z-10 LEN15 RR F100	; P _A with radius compensation RR; distance P _H to P _A : LEN 15
13 L X+20 Y+35	; End point of first contour element
14 L ...	; Next contour element

8.5.5 Approach functions APPR CT and APPR PCT

Application

The control uses these functions to approach a contour on a circular path with tangential connection. You use **APPR CT** to define the starting point of the contour with Cartesian coordinates, and **APPR PCT** for polar coordinates.

Description of function

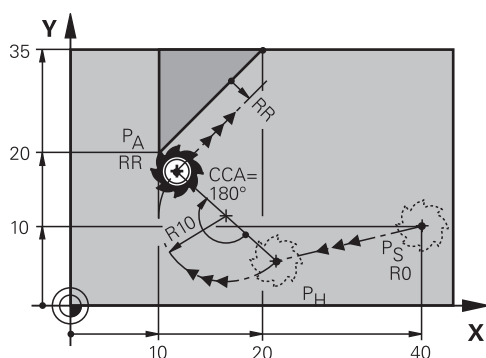

The control approaches the contour as follows:

- On a straight line from the starting point P_S to an auxiliary point P_H
- On a circular path that tangentially transitions to the first contour element, from the auxiliary point P_H to the first contour point P_A

The circular path from P_H to P_A is defined by center angle **CCA** and radius **R**. The direction of rotation of the circular path depends on the active radius compensation and the algebraic sign of radius **R**.

The table shows the relationship between the radius compensation, the algebraic sign of the radius **R**, and the direction of rotation:

Radius compensation	Algebraic sign of R	Direction of rotation
RL	Positive	Counterclockwise
RL	Negative	Clockwise
RR	Positive	Clockwise
RR	Negative	Counterclockwise

The following applies regarding the center angle **CCA**:

- Only positive input values
- Maximum input value 360°

Programming APPR CT and APPR PCT



If you want to program this path shape with polar coordinates, then you must first define a pole **CC**.

Further information: "Polar coordinate datum at pole CC", Page 185

To define the approach function:

- Use any path function to approach the starting point P_S

APPR
/DEP



- Select **APPR DEP**
- The control opens the **Insert NC function** window.
- Select the path shape, for example **APPR CT**
- Define the coordinates of the first contour point P_A
- Define the circle center angle **CCA**
- Define the radius **R** of the circular path
- Select radius compensation **RR/RL**

Notes

- If you enter a negative value for the radius **R**, the position of the auxiliary point P_H changes.
- If you program **R0**, the control stops the machining/simulation with an error message. This behavior differs from the iTNC 530 control.

Example APPR CT


11 L X+40 Y+10 R0 FMAX M3	; Approach P_S without radius compensation
12 APPR CT X+10 Y+20 Z-10 CCA180 R+10 RR F100	; P_A with radius compensation RR, radius of the circular path: R 10
13 L X+20 Y+35	; End point of first contour element
14 L ...	; Next contour element

8.5.6 Approach functions APPR LCT and APPR PLCT

Application

The control uses these functions to approach a contour on a circular path with tangential connection and a straight line. You use **APPR LCT** to define the starting point of the contour with Cartesian coordinates, and **APPR PLCT** for polar coordinates.

Description of function

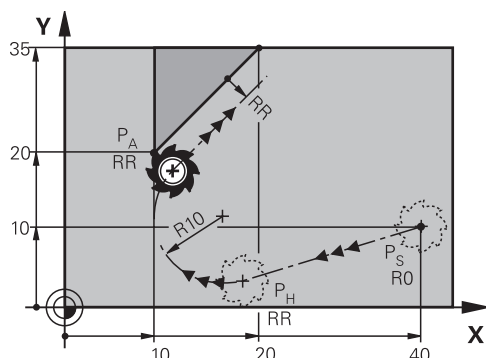

The control approaches the contour as follows:

- On a straight line from the starting point P_S to an auxiliary point P_H
If you program the Z coordinate in the approach block, the control simultaneously moves the tool from the starting point P_S to the auxiliary point P_H .
- On a circular path in the working plane from the auxiliary point P_H to the first contour point P_A
The circular path is connected tangentially both to the line P_S to P_H as well as to the first contour element. Once this information is entered, the radius R suffices to unambiguously define the tool path.



The feed rate programmed in the approach block is effective for the entire path that the control traverses in the approach block. If no feed rate is programmed before the approach block, the control generates an error message.

Programming APPR LCT and APPR PLCT



If you want to program this path shape with polar coordinates, then you must first define a pole **CC**.

Further information: "Polar coordinate datum at pole CC", Page 185

To define the approach function:

- Use any path function to approach the starting point P_S

APPR
/DEP



- Select **APPR DEP**
- The control opens the **Insert NC function** window.
- Select the path shape, for example **APPR LCT**
- Define the coordinates of the first contour point P_A
- Define a positive value for the radius R of the circular path
- Select radius compensation **RR/RL**

Example APPR LCT


11 L X+40 Y+10 R0 FMAX M3	; Approach P_S without radius compensation
12 APPR LCT X+10 Y+20 Z-10 R10 RR F100	; P_A with radius compensation RR, radius of the circular path: R 10
13 L X+20 Y+35	; End point of first contour element
14 L ...	; Next contour element

8.5.7 Departure function DEP LT

Application

The control uses the **DEP LT** function to depart a contour on a straight line with tangential connection.

Description of function

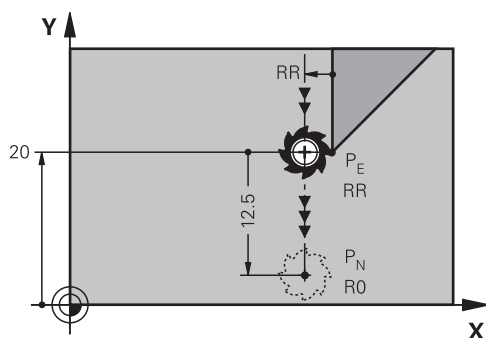

The control departs the contour as follows:

- On a straight line from the last contour point P_E to the end point P_N
- The line lies on the extension of the last contour element.
 P_N is separated from P_E by the distance **LEN**.

Programming DEP LT

To define the departure function:

- Program the last contour element with the end point P_E and radius compensation



- Select **APPR DEP**
- The control opens the **Insert NC function** window.



- Select **DEP LT**
- Use **LEN** to define the distance to the auxiliary point P_H

Example


11 L Y+20 RR F100	; Last contour element P_E with radius compensation RR
12 DEP LT LEN12.5 F100	; Distance from P_E to P_N : LEN 12.5
13 L Z+100 FMAX M2	; Retract in Z, return jump, end program

8.5.8 Departure function DEP LN

Application

The control uses the **DEP LN** function to depart a contour on a straight line perpendicular to the last contour point.

Description of function

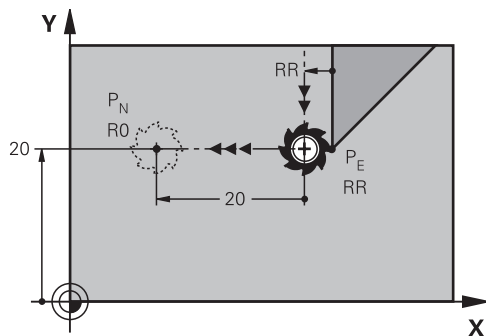

The control departs the contour as follows:

- On a straight line from the last contour point P_E to the end point P_N
- The line leads away from the last contour point P_E on a perpendicular path.
 P_N is separated from P_E by the distance **LEN** plus the tool radius.

Programming DEP LN

To define the departure function:

- Program the last contour element with the end point P_E and radius compensation

APPR
/DEP

- Select **APPR DEP**
- The control opens the **Insert NC function** window.



- Select **DEP LN**
- Use **LEN** to define the positive distance to the auxiliary point P_H

Example


11 L Y+20 RR F100	; Last contour element P_E with radius compensation RR
12 DEP LN LEN+20 F100	; Distance from P_E to P_N : LEN 20
13 L Z+100 FMAX M2	; Retract in Z, return jump, end program

8.5.9 Departure function DEP CT

Application

The control uses the **DEP CT** function to depart a contour on a circular path with tangential connection.

Description of function

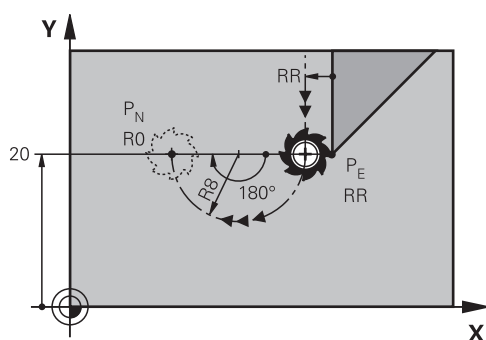

The control departs the contour as follows:

- On a circular path from the last contour point P_E to the end point P_N
- The circular path connects tangentially to the last contour element
The circular path from P_E to P_N is defined by center angle **CCA** and radius **R**. The direction of rotation of the circular path depends on the active radius compensation and the algebraic sign of radius **R**.

The table shows the relationship between the radius compensation, the algebraic sign of the radius **R**, and the direction of rotation:

Radius compensation	Algebraic sign of R	Direction of rotation
RL	Positive	Counterclockwise
RL	Negative	Clockwise
RR	Positive	Clockwise
RR	Negative	Counterclockwise

The following applies regarding the center angle **CCA**:

- Only positive input values
- Maximum input value 360°

Note

If you enter a negative value for the radius **R**, the position of the end point P_N changes.

Example


11 L Y+20 RR F100	; Last contour element P_E with radius compensation RR
12 DEP CT CCA 180 R+8 F100	; Center angle CCA 180°, radius of the circular path: R 8
13 L Z+100 FMAX M2	; Retract in Z, return jump, end program

8.5.10 Departure functions DEP LCT and DEP PLCT

Application

The control uses these functions to depart a contour on a circular path with tangential connection and a straight line. You use **DEP LCT** to define the end point with Cartesian coordinates, and **DEP PLCT** for polar coordinates.

Description of function

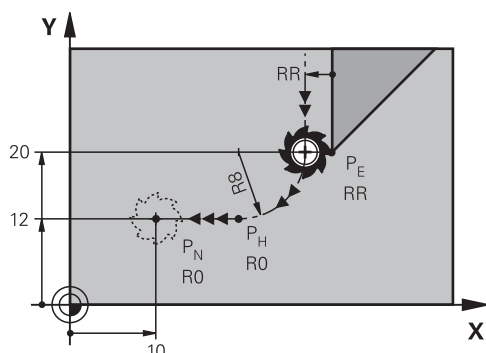

The control departs the contour as follows:

- On a circular path from the last contour point P_E to the auxiliary point P_H
- On a straight line from the auxiliary point P_H to the end point P_N

If you program the Z coordinate in the departure block, the control simultaneously moves the tool from the auxiliary point P_H to the end point P_N .

The circular path is connected tangentially both to the last contour element as well as to the line P_H to P_N . Once this information is entered, the radius **R** suffices to unambiguously define the tool path.

Programming DEP LCT and DEP PLCT



If you want to program this path shape with polar coordinates, then you must first define a pole **CC**.

Further information: "Polar coordinate datum at pole CC", Page 185

To define the departure function:

- Program the last contour element with the end point P_E and radius compensation



- Select **APPR DEP**
- The control opens the **Insert NC function** window.
- Select the path shape, for example **DEP LN**
- Define the coordinates of the end point P_N
- Define a positive value for the radius **R** of the circular path

Example DEP LCT

11 L Y+20 RR F100	; Last contour element P_E with radius compensation RR
12 DEP LCT X+10 Y+12 R+8 F100	; Coordinates P_N , radius of the circular path: R 8
13 L Z+100 FMAX M2	; Retract in Z, return jump, end program

Definitions

Abbreviation	Definition
APPR (approach)	Approach function
DEP (departure)	Departure function
L (line)	Line segment
C (circle)	Circle
T (tangential)	Continuous, smooth transition
N (normal)	Perpendicular line

9

**Programming
Techniques**

9.1 Subprograms and program section repeats with the label LBL

Application

Subprograms and program section repeats enable you to program a machining sequence once and then run it as often as necessary. Use subprograms to insert contours or complete machining steps after the end of the program and call them in the NC program. Program section repeats repeat single or several NC blocks during the NC program. Subprograms and program section repeats can also be combined. Subprograms and program section repeats are programmed with the NC function **LBL**.




Related topics

- Executing NC programs within another NC program
Further information: "Calling an NC program with PGM CALL", Page 214
- Jumps with conditions as if-then decisions.
Further information: " Jump commands folder", Page 469

Description of function

The label **LBL** is used for defining the machining steps for subprograms and program section repeats.

The control offers the following keys and icons in connection with labels:

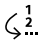Key or icon	Function
	Create LBL
	Call LBL : Jump to the label in the NC program
	In case of LBL number: Enter the next free number automatically

Defining a label with LBL SET

The **LBL SET** function defines a new label in the NC program.

Each label must be unambiguously identifiable in the NC program by a number or a name. If a number or a name exists twice in an NC program, the control shows a warning ahead of the NC block.

LBL 0 marks the end of a subprogram. This number is the only one which may exist any number of times in the NC program.

Input

11 LBL "Reset"	; Subprogram for resetting a coordinate transformation
12 TRANS DATUM RESET	
13 LBL 0	

The NC function includes the following syntax elements:

Syntax element	Meaning
LBL	Syntax initiator for a label
0 or " "	Number or name of the label. Fixed or variable number or name Input: 0...65535 or text width 32 Use an icon to enter the next free number automatically. Further information: "Description of function", Page 210

Calling a label with CALL LBL

The **CALL LBL** function calls a label in the NC program.

When the control reads **CALL LBL**, it jumps to the defined label and continues executing the NC program from this NC block. When the control reads **LBL 0**, it jumps back to the next NC block after **CALL LBL**.

In case of program section repeats, you can optionally define that the control executes that jump several times.


Input

11 CALL LBL 1 REP2	; Call label 1 twice
--------------------	----------------------

The NC function includes the following syntax elements:

Syntax element	Meaning
CALL LBL	Syntax initiator for calling a label
Number, " " or QS	Number or name of the label. Fixed or variable number or name Input: 1...65535 or text width 32 or 0...1999 The label can be selected from a selection menu including all labels available in the NC program.
REP	Number of repetitions until the control executes the next NC block Optional syntax element

Subprograms

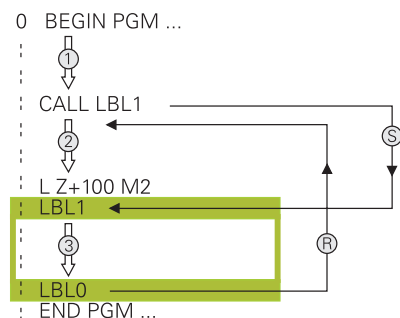

A subprogram allows calling parts of an NC program any number of times at different points of the NC program, e. g. machining positions or a contour.

A subprogram starts with a **LBL** label and ends with **LBL 0**. **CALL LBL** calls the subprogram from any point in the NC program. In this process, repetitions must not be defined with **REP**.

The control executes the NC program as follows:

- 1 The control executes the NC program up to the **CALL LBL** function.
- 2 The control jumps to the beginning of the defined subprogram **LBL**.
- 3 The control executes the subprogram up to the subprogram end **LBL 0**.
- 4 After that, the control jumps to the next NC block after **CALL LBL** and continues executing the NC program.


The following conditions apply to subprograms:

- A subprogram cannot call itself
- **CALL LBL 0** is not permitted (Label 0 is only used to mark the end of a subprogram).
- Write subprograms after the NC block with M2 or M30
 - If subprograms are located in the NC program before the NC block with M2 or M30, they will be executed at least once even if they are not called

The control displays information about the active subprogram on the **LBL** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

Program-section repeats

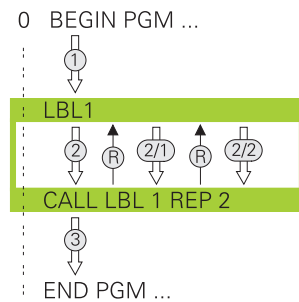

A program section repeat allows repeating a part of an NC program any number of times, e. g. contour machining with incremental infeed.

A program section repeat starts with a **LBL** label and ends after the last programmed repetition **REP** of the label call **CALL LBL**.

The control executes the NC program as follows:

- 1 The control executes the NC program up to the **CALL LBL** function.
In this process, the control already executes the program section once because the program section to be repeated is positioned ahead of the **CALL LBL** function.
- 2 The control jumps to the beginning of the program section repeat **LBL**.
- 3 The control repeats the program section as many times as programmed under **REP**.
- 4 After that, the control continues executing the NC program.

The following conditions apply to program section repeats:

- Program the program section repeat before the end of the program with **M30** or **M2**.
- No **LBL 0** can be defined with a program section repeat.
- The total number of times the program section is executed is always one more than the programmed number of repeats, because the first repeat starts after the first machining process.

The control displays information about the active program section repeat on the **LBL** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run






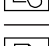
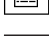
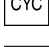

Notes

- The control displays the NC function **LBL SET** in the structure by default.
Further information: "Structure column in the Program workspace", Page 542
- You can repeat a program section up to 65 534 times in succession
- The following characters are allowed in the name of a label: # \$ % & , - _ . 0 1 2 3 4 5 6 7 8 9 @ a b c d e f g h i j k l m n o p q r s t u v w x y z - A B C D E F G H I J K L M N O P Q R S T U V W X Y Z
- The following characters are not allowed in the name of a label: <blank> ! " ' () * + ; < = > ? [/] ^ ` { | } ~
- Before creating your NC program, compare the subprogram and program section repeat programming techniques using if-then decisions.
You can thereby avoid possible misunderstandings and programming errors.
Further information: " Jump commands folder", Page 469

9.2 Selection functions

9.2.1 Overview of selection functions

The **Selection functions** folder of the **Insert NC function** window contains the following functions:

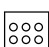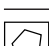Icon	Function	Further information
	Call an NC program with PGM CALL	Page 214
	Select a datum table with SEL TABLE	Page 241
	Select a point table with SEL PATTERN	See the User's Manual for Machining Cycles
	Select a contour program with SEL CONTOUR	See the User's Manual for Machining Cycles
	Select an NC program with SEL PGM	Page 216
	Call the last selected file with CALL SELECTED PGM	Page 216
	Select any NC program with SEL CYCLE as a machining cycle	See the User's Manual for Machining Cycles
	Select a correction table with SEL CORR-TABLE	Page 312
	Open the file with OPEN FILE	Page 347

9.2.2 Calling an NC program with PGM CALL


Application

The **PGM CALL** function calls another separate NC program from an NC program. The control executes the called NC program at the point where you called it in the NC program. This allows executing e. g. a machining process with different transformations.

Related topics

- Program call with cycle **12 PGM CALL**
Further information: User's Manual for Machining Cycles
- Program call following selection
Further information: "Selecting an NC program and calling it with SEL PGM and CALL SELECTED PGM ", Page 216
- Executing several NC programs as a job list
Further information: "Pallet Machining and Job Lists", Page 577

Description of function

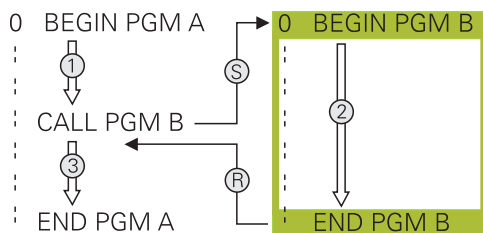

The control executes the NC program as follows:

- 1 The control executes the calling NC program until another NC program is called with **CALL PGM**.
- 2 After that, the control executes the called NC program up to the last NC block.
- 3 Then the control continues executing the calling NC program from the next NC block after **CALL PGM**.

The following conditions apply to program calls:

- The called NC program must not contain a **CALL PGM** call into the calling NC program. This creates an endless loop.
- The called NC program must not contain a miscellaneous function **M30** or **M2**. If you have defined subprograms with labels in the called NC program, you can replace **M30** or **M2** by the jump function **FN 9: If +0 EQU +0 GOTO LBL 99**. Now the control will not execute e. g. subprograms without a call.

Further information: "Unconditional jump", Page 470

If the called NC program contains the miscellaneous functions, the control generates an error message.

- The called NC program must be complete. If the NC block **END PGM** is missing, the control outputs an error message.

Input

11 CALL PGM reset.h

Call NC program

The NC function includes the following syntax elements:

Syntax element	Meaning
CALL PGM	Syntax initiator for calling an NC program
reset.h	Path of the called NC program The NC program can be selected in a selection menu.

Notes

NOTICE

Danger of collision!

The control does not automatically check whether collisions can occur between the tool and the workpiece. If you do not specifically rescind the coordinate transformations in the called NC program, these transformations will also take effect in the calling NC program. Danger of collision during machining!

- ▶ Reset used coordinate transformations in the same NC program
- ▶ Check the machining sequence using a graphic simulation if required

- The program call path including the name of the NC program may contain no more than 255 characters.
- If the called file is located in the same directory as the file you are calling it from, you can also enter just the file name without the path. If you select the file using the selection menu, the control automatically proceeds in this manner.
- If you want to program variable program calls in connection with string parameters, use the **SEL PGM** function.
Further information: "Selecting an NC program and calling it with SEL PGM and CALL SELECTED PGM", Page 216
- As a rule, Q parameters are effective globally with a **PGM CALL**. So please note that changes to Q parameters in the called NC program can also influence the calling NC program. If required, use QL parameters which are effective only in the active NC program.
- While the control is executing the calling NC program, editing of all called NC programs is disabled.

9.2.3 Selecting an NC program and calling it with SEL PGM and CALL SELECTED PGM

Application

The function **SEL PGM** allows selecting another separate NC program that you can call at a different position in the active NC program. The control executes the selected NC program at the position where you call it in the calling NC program using **CALL SELECTED PGM**.

Related topics

- Calling the NC program directly
Further information: "Calling an NC program with PGM CALL", Page 214

Description of function

The control executes the NC program as follows:

- 1 The control executes the NC program until another NC program is called with **CALL PGM**. When the control reads **SEL PGM**, it remembers the defined NC program.
- 2 When the control reads **CALL SELECTED PGM**, it calls the NC program previously selected at this point.
- 3 After that, the control executes the called NC program up to the last NC block.
- 4 Then the control continues executing the calling NC program with the next NC block after **CALL SELECTED PGM**.

The following conditions apply to program calls:

- The called NC program must not contain a **CALL PGM** call into the calling NC program. This creates an endless loop.
- The called NC program must not contain a miscellaneous function **M30** or **M2**. If you have defined subprograms with labels in the called NC program, you can replace **M30** or **M2** by the jump function **FN 9: If +0 EQU +0 GOTO LBL 99**. Now the control will not execute e. g. subprograms without a call.

Further information: "Unconditional jump", Page 470

If the called NC program contains the miscellaneous functions, the control generates an error message.

- The called NC program must be complete. If the NC block **END PGM** is missing, the control outputs an error message.

Input

11 SEL PGM "reset.h"	; Select an NC program for calling
* - ...	
21 CALL SELECTED PGM	; Call the selected NC program

The NC function **SEL PGM** includes the following syntax elements:

Syntax element	Meaning
SEL PGM	Syntax initiator for selecting an NC program to be called
" " or QS	Path of the called NC program Fixed or variable name The NC program can be selected in a selection menu.

The NC function **CALL SELECTED PGM** includes the following syntax elements:

Syntax element	Meaning
CALL SELECTED PGM	Syntax for calling the selected NC program

Notes

- Within the **SEL PGM** function, the NC program can also be selected with QS parameters so that the program call can be variably controlled.
- If an NC program called by **CALL SELECTED PGM** is missing, the control interrupts the execution or simulation of the program with an error message. In order to avoid undesired interruptions during program run, you can use the function **FN 18: SYSREAD (ID10 NR110 and NR111)** to check all paths at the beginning of the program.

Further information: "Read system data with FN 18: SYSREAD", Page 476

- If the called file is located in the same directory as the file you are calling it from, you can also enter just the file name without the path. If you select the file using the selection menu, the control automatically proceeds in this manner.
- As a rule, Q parameters are effective globally with a **PGM CALL**. So please note that changes to Q parameters in the called NC program can also influence the calling NC program. If required, use QL parameters which are effective only in the active NC program.
- While the control is executing the calling NC program, editing of all called NC programs is disabled.

9.3 Nesting of programming techniques

Application

Programming techniques can also be combined with one another, e. g. another separate NC program or a subprogram can be called in a program section repeat.

The nesting depth defines, among other things, how often program sections or subprograms may contain further subprograms or program section repeats.

Related topics

- Subprograms
Further information: "Subprograms", Page 212
- Program section repeats
Further information: "Program-section repeats", Page 213
- Calling a separate NC program
Further information: "Selection functions", Page 214

Description of function

The following maximum nesting depths apply to NC programs:

- Maximum nesting depth for subprograms: 19
- Maximum nesting depth for external NC programs: 19, for which a **CYCL CALL** has the effect of calling an external program
- You can nest program section repeats as often as desired

9.3.1 Example

Subprogram call within a subprogram

0 BEGIN PGM UPGMS MM	
* - ...	
11 CALL LBL "UP1"	; Call subprogram LBL "UP1"
* - ...	
21 L Z+100 R0 FMAX M30	; Last program block of main program with M30
22 LBL "UP1"	; Start of subprogram "UP1"
* - ...	
31 CALL LBL 2	; Call subprogram LBL 2
* - ...	
41 LBL 0	; End of sub program "UP1"
42 LBL 2	; Start of subprogram LBL 2
* - ...	
51 LBL 0	; End of subprogram LBL 2
52 END PGM UPGMS MM	

The control executes the NC program as follows:

- 1 NC program UPGMS is executed up to NC block 11.
- 2 Subprogram UP1 is called and executed up to NC block 31.
- 3 Subprogram 2 is called, and executed up to NC block 51. End of subprogram 2 and return jump to the subprogram from which it was called.
- 4 Subprogram UP1 is called, and executed from NC block 32 up to NC block 41. End of subprogram UP1 and return jump to NC program UPGMS.
- 5 NC program UPGMS is executed from NC block 12 up to NC block 21. Program end with return jump NC block 1.

Program-section repeat within a program section repeat

0 BEGIN PGM REPS MM	
* - ...	
11 LBL 1	; Start of program section 1
* - ...	
21 LBL 2	; Start of program section 2
* - ...	
31 CALL LBL 2 REP 2	; Call program section 2 and repeat twice
* - ...	
41 CALL LBL 1 REP 1	; Call program section 1 including program section 2 and repeat once
* - ...	
51 END PGM REPS MM	

The control executes the NC program as follows:

- 1 NC program REPS is executed up to NC block 31.
- 2 The program section between NC block 31 and NC block 21 is repeated twice, meaning that it is executed three times in total.
- 3 NC program REPS is executed from NC block 32 up to NC block 41.
- 4 The program section between NC block 41 and NC block 11 is repeated once, meaning that it is executed twice in total (including the program section repeat between NC block 21 and NC block 31).
- 5 NC program REPS is executed from NC block 42 up to NC block 51. Program end with return jump to NC block 1.

Subprogram call within a program section repeat

0 BEGIN PGM UPGREP MM	
* - ...	
11 LBL 1	; Start of program section 1
12 CALL LBL 2	; Call subprogram 2
13 CALL LBL 1 REP 2	; Call program section 1 and repeat twice
* - ...	
21 L Z+100 R0 FMAX M30	; Last NC block of main program with M30
22 LBL 2	; Start of subprogram 2
* - ...	
31 LBL 0	; End of subprogram 2
32 END PGM UPGREP MM	

The control executes the NC program as follows:

- 1 NC program UPGREP is executed up to NC block 12.
- 2 Subprogram 2 is called, and executed up to NC block 31.
- 3 The program section between NC block 13 and NC block 11 (including subprogram 2) is repeated twice, meaning that it is executed three times in total.
- 4 NC program UPGREP is executed from NC block 14 up to NC block 21. Program end with return jump to NC block 1.

10

**Coordinate
Transformation**

10.1 Reference systems

10.1.1 Overview

A control requires unambiguous coordinates in order to move an axis to a defined position correctly. For coordinates to be unambiguous, they not only require the values but also a reference system in which these values are valid.

The control differentiates between the following reference systems:

Abbrevia- tion	Meaning	Further information
M-CS	Machine coordinate system machine coordinate system	Page 223
B-CS	Basic coordinate system basic coordinate system	Page 226
W-CS	Workpiece coordinate system workpiece coordinate system	Page 228
WPL-CS	Working plane coordinate system working plane coordinate system	Page 230
I-CS	Input coordinate system input coordinate system	Page 232
T-CS	Tool coordinate system tool coordinate system	Page 234

The control uses different reference systems for different purposes. For example, this makes it possible to always exchange tools at the exact same position while maintaining the possibility of adapting an NC program to the workpiece position.

The reference systems build upon each other. The machine coordinate system **M-CS** is the fundamental reference system. The position and orientation of the following reference systems are determined by transformations of the M-CS.

Definition

Transformations

Translatory transformations each enable a shift along a number line. Rotatory transformations enable a rotation around a point.

10.1.2 Basics of coordinate systems


Types of coordinate systems

For coordinates to be unambiguous they must define one point in all axes of the coordinate system:

Axes	Function
One	In a one-dimensional coordinate system, one coordinate defines one point on a number line. Example: on a machine tool, a linear encoder represents a number line.
Two	In a two-dimensional coordinate system, two coordinates define one point in a plane.
Three	In a three-dimensional coordinate system, three coordinates define one point in space.


If the axes are arranged perpendicularly to each other, they create a Cartesian coordinate system.

Using the right-hand rule you can recreate a three-dimensional Cartesian coordinate system. The fingertips point in the positive directions of the three axes.

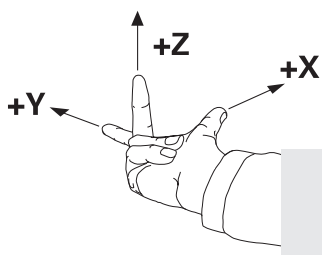

Origin of the coordinate system

Unambiguous coordinates require a defined reference point to which the values refer, starting from zero. This point is the coordinate origin, which lies at the intersection of the axes for all three-dimensional Cartesian coordinate systems of the control. The coordinate origin has the coordinates **X+0**, **Y+0**, and **Z+0**.

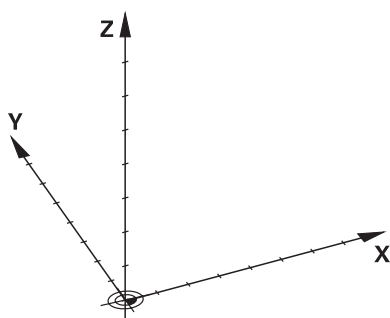

10.1.3 Machine coordinate system M-CS

Application


In the machine coordinate system **M-CS** you program constant positions, such as a safe position for retraction. The machine manufacturer also defines constant positions in the **M-CS**, such as the tool-change point.

Description of function

Properties of M-CS machine coordinate system


The machine coordinate system **M-CS** corresponds to the kinematics description and therefore to the actual mechanical design of the machine tool. The physical axes of a machine tool are not necessarily always exactly perpendicular to each other, and therefore do not represent a Cartesian coordinate system. The **M-CS** thus consists of multiple one-dimensional coordinate systems that correspond to the axes of the machine.

The machine manufacturer defines the position and orientation of the one-dimensional coordinate systems in the kinematics description.

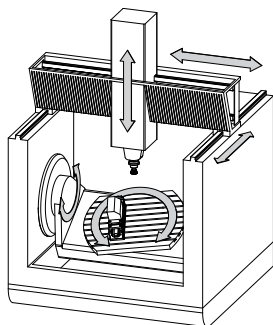

The machine datum is the coordinate origin of the **M-CS**. The machine manufacturer defines the machine datum in the machine configuration.

The values in the machine configuration define the zero positions of the position encoders and the corresponding machine axes. The machine datum does not necessarily have to be located in the theoretical intersection of the physical axes. It can also be located outside of the traverse range.

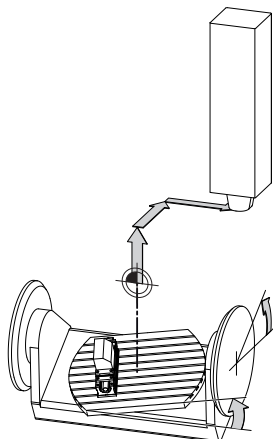

Position of the machine datum in the machine

Transformations in the machine coordinate system M-CS

The following transformations can be defined in the **M-CS** machine coordinate system:

- Axis-specific shifts in the **OFFS** columns of the preset table

Further information: User's Manual for Setup and Program Run



The machine manufacturer configures the **OFFS** columns of the preset table in accordance with the machine.

- The **Additive offset (M-CS)** function for rotary axes in the **GS** workspace (option 44)

Further information: User's Manual for Setup and Program Run



The machine manufacturer can also define further transformations.

Further information: "Note", Page 225

Position display

The following modes of the position display are referenced to the machine coordinate system **M-CS**:

- **Nominal reference position (RFNOML)**
- **Actual reference position (RFACTL)**

The difference between the values for the **RFACTL** and **ACTL** modes of an axis result from all stated offsets as well as all active transformations in other reference systems.

Programming coordinate entry in machine coordinate system M-CS

With miscellaneous function **M91** you program the coordinates relative to the machine datum.

Further information: "Traversing in the machine coordinate system M-CS with M91", Page 416

Note

The machine manufacturer can define the following further transformations in the machine coordinate system **M-CS**:

- Additive axis shifts for parallel axes with the **OEM-offset**
- Axis-specific shifts in the **OFFS** columns of the pallet preset table

Further information: "Pallet preset table", Page 589

NOTICE

Danger of collision!

The control may feature an additional pallet preset table, depending on the machine. Values that the machine manufacturer defined in the pallet preset table take effect before values that you defined in the preset table. Since the values of the pallet preset table are neither visible nor editable, there is a risk of collision during any movement!

- ▶ Refer to the machine manufacturer's documentation
- ▶ Use pallet presets only in conjunction with pallets

Example

This example illustrates the difference between traverse movements with and without **M91**. The example shows the behavior with a Y axis as oblique axis that is not arranged perpendicularly to the ZX plane.

Traverse movement without M91

```
11 L IY+10
```

You use the Cartesian input coordinate system **I-CS** for programming. The **ACTL.** and **NOML.** modes of the position display show only a movement of the Y axis in the **I-CS**.

The control uses the defined values to determine the required traverse paths of the machine axes. Since the machine axes are not arranged perpendicularly to each other, the control moves the axes **Y** and **Z**.

Since the machine coordinate system **M-CS** is a projection of the machine axes, the **RFACTL** and **RFNOML** modes of the position display show movements of the Y axis and Z axis in the **M-CS**.

Traverse movement with M91

```
11 L IY+10 M91
```

The control moves the machine axis **Y** by 10 mm. The **RFACTL** and **RFNOML** modes of the position display show only a movement of the Y axis in the **M-CS**.

In contrast to the **M-CS**, the **I-CS** is a Cartesian coordinate system; the axes of the two reference systems do not coincide. The **ACTL.** and **NOML.** modes of the position display show movements of the Y axis and Z axis in the **I-CS**.

10.1.4 Basic coordinate system B-CS

Application

In the basic coordinate system **B-CS** you define the position and orientation of the workpiece. You determine these values by using a 3D touch probe, for example. The control saves the values in the preset table.

Description of function

Properties of the basic coordinate system B-CS

The basic coordinate system **B-CS** is a three-dimensional Cartesian coordinate system. Its coordinate origin is the end of the kinematics description.

The machine manufacturer defines the coordinate origin and orientation of the **B-CS**.


Transformations in the basic coordinate system B-CS

The following columns of the preset table have an effect in the basic coordinate system **B-CS**:

- X
- Y
- Z
- SPA
- SPB
- SPC

You determine the position and orientation of the workpiece coordinate system **W-CS** by using a 3D touch probe, for example. The control saves the determined values as basic transformations in the **B-CS** in the preset table.

Further information: User's Manual for Setup and Program Run

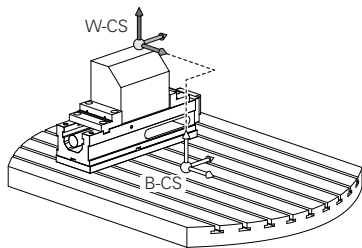

The machine manufacturer configures the **BASE TRANSFORM.** columns of the preset table in accordance with the machine.

The machine manufacturer can also define further transformations.

Further information: "Note", Page 227

Note

The machine manufacturer can define additional basic transformations and store them in the pallet preset table.

NOTICE

Danger of collision!

The control may feature an additional pallet preset table, depending on the machine. Values that the machine manufacturer defined in the pallet preset table take effect before values that you defined in the preset table. Since the values of the pallet preset table are neither visible nor editable, there is a risk of collision during any movement!

- ▶ Refer to the machine manufacturer's documentation
- ▶ Use pallet presets only in conjunction with pallets

10.1.5 Workpiece coordinate system W-CS

Application

In the workpiece coordinate system **W-CS** you define the position and orientation of the working plane. You do this by programming transformations and tilting the working plane.


Description of function

Properties of the workpiece coordinate system W-CS

The workpiece coordinate system **W-CS** is a three-dimensional Cartesian coordinate system. Its coordinate origin is the active workpiece preset from the preset table.

Both the position and orientation of the **W-CS** are defined by basic transformations in the preset table.

Further information: User's Manual for Setup and Program Run

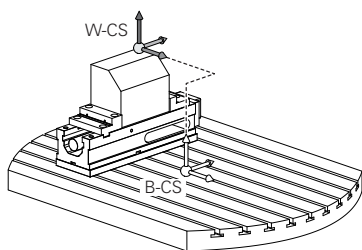

Transformations in the workpiece coordinate system (W-CS)


HEIDENHAIN recommends using the following transformations in the workpiece coordinate system **W-CS**:

- **TRANS DATUM** function before tilting the working plane
Further information: "Datum shift with TRANS DATUM", Page 242
- Function **TRANS MIRROR** or Cycle **8 MIRRORING** before tilting the working plane with spatial angles
Further information: "Mirroring with TRANS MIRROR", Page 244
Further information: User's Manual for Machining Cycles
- **PLANE** functions for tilting the working plane (option 8)
Further information: "Tilting the working plane with PLANE functions (option 8)", Page 250



The control also offers Cycle **19 WORKING PLANE** for tilting the working plane.

With these transformations, the position and orientation of the working plane coordinate system **WPL-CS** are changed.

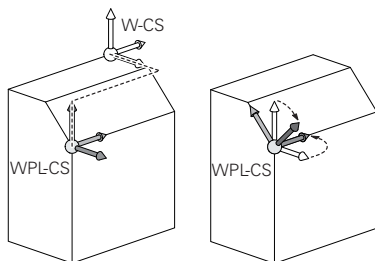

NOTICE**Danger of collision!**

The control reacts differently to the various types of transformations as well as their programmed sequence. Unexpected movements or collisions can occur if the functions are not suitable.

- ▶ Program only the recommended transformations in the respective reference system
- ▶ Use tilting functions with spatial angles instead of with axis angles
- ▶ Use the Simulation mode to test the NC program



In the machine parameter **planeOrientation** (no. 201202) the machine manufacturer defines whether the control interprets input values of Cycle **19 WORKING PLANE** as spatial angles or as axis angles.

The type of tilting function has the following effects on the result:

- If you tilt using spatial angles (**PLANE** functions except for **PLANE AXIAL** or Cycle **19**), previously programmed transformations will change the position of the workpiece datum and the orientation of the rotary axes:
 - Shifting with the **TRANS DATUM** function will change the position of the workpiece datum.
 - Mirroring changes the orientation of the rotary axes. The entire NC program, including the spatial angles, will be mirrored.
- If you tilt using axis angles (**PLANE AXIAL** or Cycle **19**), a previously programmed mirroring has no effect on the orientation of the rotary axes. You use these functions for direct positioning of the machine axes.

Additional transformations with Global Program Settings (GPS, option 44)

In the **GS** workspace (option 44) you can define additional transformations in the workpiece coordinate system **W-CS**:

- **Additive basic rotat. (W-CS)**
The effects of this function are added to a basic rotation or a 3D basic rotation from the preset table or the pallet preset table. This function is the first transformation that is possible in the **W-CS**.
- **Shift (W-CS)**
This function is in effect in addition to a datum shift defined in the NC program with the **TRANS DATUM** function and before the working plane is tilted.
- **Mirroring (W-CS)**
The function is effective in addition to a mirror image (function **TRANS MIRROR** or Cycle **8 MIRRORING**) defined in the NC program and before tilting the working plane.
- **Shift (mW-CS)**
This function is in effect in the modified workpiece coordinate system. This function is in effect after the **Shift (W-CS)** and **Mirroring (W-CS)** functions and before the working plane is tilted.

Further information: User's Manual for Setup and Program Run

Notes

- The programmed values in the NC program refer to the input coordinate system **I-CS**. If you do not program any transformations in the NC program, then the origin and position of the workpiece coordinate system **W-CS**, the working plane coordinate system **WPL-CS**, and the **I-CS** are identical.
Further information: "Input coordinate system I-CS", Page 232
- During pure 3-axis machining, the workpiece coordinate system **W-CS** and the working plane coordinate system **WPL-CS** are identical. In this case, all transformations influence the input coordinate system **I-CS**.
Further information: "Working plane coordinate system WPL-CS", Page 230
- The result of transformations built upon each other depends on the programming sequence.

10.1.6 Working plane coordinate system WPL-CS

Application

In the working plane coordinate system **WPL-CS** you define the position and orientation of the input coordinate system **I-CS** and therefore the reference for the coordinate system in the NC program. You do this by programming transformations after having tilted the working plane.

Further information: "Input coordinate system I-CS", Page 232


Description of function

Properties of the working plane coordinate system WPL-CS

The working plane coordinate system **WPL-CS** is a three-dimensional Cartesian coordinate system. You use transformations in the workpiece coordinate system **W-CS** to define the coordinate origin of the **WPL-CS**.

Further information: "Workpiece coordinate system W-CS", Page 228

If no transformations are defined in the **W-CS**, then the position and orientation of the **W-CS** and **WPL-CS** are identical.

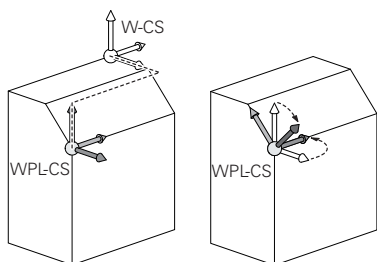


Transformations in the working plane coordinate system WPL-CS

HEIDENHAIN recommends using the following transformations in the working plane coordinate system **WPL-CS**:

- **TRANS DATUM** function
Further information: "Datum shift with TRANS DATUM", Page 242
- **TRANS MIRROR** or Cycle **8 MIRRORING** function
Further information: "Mirroring with TRANS MIRROR", Page 244
Further information: User's Manual for Machining Cycles
- **TRANS ROTATION** function or Cycle **10 ROTATION**
Further information: "Rotations with TRANS ROTATION", Page 246
Further information: User's Manual for Machining Cycles
- **TRANS SCALE** function or Cycle **11 SCALING FACTOR**
Further information: "Scaling with TRANS SCALE", Page 248
Further information: User's Manual for Machining Cycles
- Cycle **26 AXIS-SPECIFIC SCALING**
Further information: User's Manual for Machining Cycles
- **PLANE RELATIV** function (option 8)
Further information: "PLANE RELATIV", Page 275

With these transformations you modify the position and orientation of the input coordinate system **I-CS**.

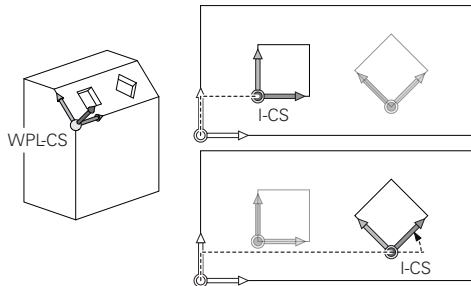

NOTICE

Danger of collision!

The control reacts differently to the various types of transformations as well as their programmed sequence. Unexpected movements or collisions can occur if the functions are not suitable.

- ▶ Program only the recommended transformations in the respective reference system
- ▶ Use tilting functions with spatial angles instead of with axis angles
- ▶ Use the Simulation mode to test the NC program

Additional transformations with Global Program Settings (GPS, option 44)

The **Rotation (WPL-CS)** transformation in the **GS** workspace is in effect in addition to a rotation in the NC program.

Further information: User's Manual for Setup and Program Run

Additional transformations with mill-turning (option 50)

The following additional transformations are available with the mill-turning software option:

- Precession angle with the following cycles:
 - Cycle **800 ADJUST XZ SYSTEM**
 - Cycle **801 RESET ROTARY COORDINATE SYSTEM**
 - Cycle **880 GEAR HOBBING**
- OEM transformations defined by machine manufacturers for special turning kinematics



Machine manufacturers can also define an OEM transformation and a precession angle without software option 50.

An OEM transformation takes effect before the precession angle.

If an OEM transformation or a precession angle is defined, the control shows the values on the **POS** tab of the **Status** workspace. These transformations are also in effect in milling mode!

Further information: User's Manual for Setup and Program Run

Additional transformation with Gear Cutting (option 157)

You can use the following cycles to define a precession angle:

- Cycle **286 GEAR HOBBING**
- Cycle **287 GEAR SKIVING**



Machine manufacturers can also define a precession angle without Gear Cutting (software option 157)

Notes

- The programmed values in the NC program refer to the input coordinate system **I-CS**. If you do not program any transformations in the NC program, then the origin and position of the workpiece coordinate system **W-CS**, the working plane coordinate system **WPL-CS**, and the **I-CS** are identical.
Further information: "Input coordinate system I-CS", Page 232
- During pure 3-axis machining, the workpiece coordinate system **W-CS** and the working plane coordinate system **WPL-CS** are identical. In this case, all transformations influence the input coordinate system **I-CS**.
- The result of transformations built upon each other depends on the programming sequence.
- As a **PLANE** function (option 8), **PLANE RELATIV** has an effect in the workpiece coordinate system **W-CS** and orients the working plane coordinate system **WPL-CS**. The values of additive tilting always relate to the current **WPL-CS**.

10.1.7 Input coordinate system I-CS

Application

The programmed values in the NC program refer to the input coordinate system **I-CS**. You use positioning blocks to program the position of the tool.


Description of function

Properties of the input coordinate system I-CS

The input coordinate system **I-CS** is a three-dimensional Cartesian coordinate system. You use transformations in the working plane coordinate system **WPL-CS** to define the coordinate origin of the **I-CS**.

Further information: "Working plane coordinate system WPL-CS", Page 230

If no transformations are defined in the **WPL-CS**, then the position and orientation of the **WPL-CS** and **I-CS** are identical.

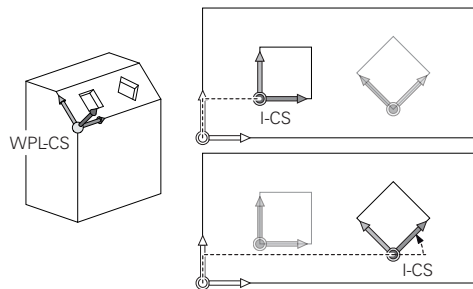

Positioning blocks in the input coordinate system I-CS

In the input coordinate system **I-CS** you use positioning blocks to define the position of the tool. The position of the tool defines the position of the tool coordinate system **T-CS**.

Further information: "Tool coordinate system T-CS", Page 234

You can define the following positioning blocks:

- Paraxial positioning blocks
- Path functions with Cartesian or polar coordinates
- Straight lines **LN** with Cartesian coordinates and surface normal vectors (option 9)
- Cycles

11 X+48 R+	; Paraxial positioning block
-------------------	------------------------------

11 L X+48 Y+102 Z-1.5 R0	; Path function L
---------------------------------	--------------------------

11 LN X+48 Y+102 Z-1.5 NX-0.04658107 NY0.00045007 NZ0.8848844 R0	; Straight line LN with Cartesian coordinates and surface normal vector
---	--

Position display

The following modes of the position display are referenced to the input coordinate system **I-CS**:

- **Nominal pos. (NOML)**
- **Actual pos. (ACT)**

Notes

- The programmed values in the NC program refer to the input coordinate system **I-CS**. If you do not program any transformations in the NC program, then the origin and position of the workpiece coordinate system **W-CS**, the working plane coordinate system **WPL-CS**, and the **I-CS** are identical.
- During pure 3-axis machining, the workpiece coordinate system **W-CS** and the working plane coordinate system **WPL-CS** are identical. In this case, all transformations influence the input coordinate system **I-CS**.

Further information: "Working plane coordinate system WPL-CS", Page 230

10.1.8 Tool coordinate system T-CS

Application

In the tool coordinate system **T-CS** the control implements tool compensations and tool inclinations.

Description of function

Properties of the tool coordinate system T-CS

The tool coordinate system **T-CS** is a three-dimensional Cartesian coordinate system. Its coordinate origin is the tool tip TIP.

You make entries in the tool management to define the tool tip relative to the tool carrier reference point. The machine manufacturer usually defines the tool carrier reference point on the spindle tip.

Further information: "Presets in the machine", Page 99

You define the tool tip with the following columns of the tool management relative to the tool carrier reference point:

- **L**
- **DL**
- **ZL** (option 50, option 156)
- **XL** (option 50, option 156)
- **YL** (option 50, option 156)
- **DZL** (option 50, option 156)
- **DXL** (option 50, option 156)
- **DYL** (option 50, option 156)
- **LO** (option 156)
- **DLO** (option 156)

Further information: "Tool carrier reference point", Page 155

You use positioning blocks in the input coordinate system **I-CS** to define the position of the tool and therefore the position of the **T-CS**.

Further information: "Input coordinate system I-CS", Page 232


You can use miscellaneous functions to also program in other reference systems, such as **M91** for the machine coordinate system **M-CS**.

Further information: "Traversing in the machine coordinate system M-CS with M91", Page 416

The orientation of the **T-CS** in most cases is identical to that of the **I-CS**.

If the following functions are active, the orientation of the **T-CS** depends on the tool angle of inclination:

- Miscellaneous function **M128** (option 9)
Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432
- **PLANE RELATIV** function (option 9)
Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

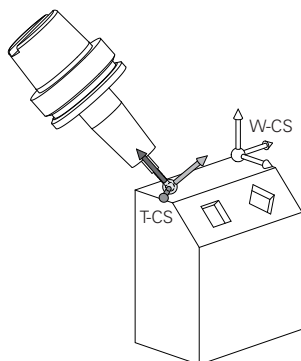

Use the miscellaneous function **M128** to define the tool angle of inclination in the machine coordinate system **M-CS** using axis angles. The effects of the tool angle of inclination depend on the machine kinematics:

Further information: "Notes", Page 436

11 L X+10 Y+45 A+10 C+5 R0 M128

; Straight line with miscellaneous function **M128** and axis angles

You can also define a tool angle of inclination in the working plane coordinate system **WPL-CS**, for example with **FUNCTION TCPM** or a straight line **LN**.

11 FUNCTION TCPM F TCP AXIS SPAT
PATHCTRL AXIS

; **FUNCTION TCPM** with spatial angles

12 L A+0 B+45 C+0 R0 F2500

11 LN X+48 Y+102 Z-1.5
NX-0.04658107 NY0.00045007
NZ0.8848844 TX-0.08076201
TY-0.34090025 TZ0.93600126 R0
M128

; Straight line **LN** with surface normal vector and tool orientation

Transformations in the tool coordinate system T-CS

The following tool compensations have an effect in the tool coordinate system **T-CS**:

- Compensation values from the tool management
Further information: "Tool compensation for tool length and radius", Page 304
- Compensation values from the tool call
Further information: "Tool compensation for tool length and radius", Page 304
- Values of the compensation tables ***.tco**
Further information: "Tool compensation with compensation tables", Page 312
- Values of **FUNCTION TURNDATA CORR T-CS** (option 50)
Further information: "Compensating turning tools with FUNCTION TURNDATA CORR (option 50)", Page 315
- 3D tool compensation with surface normal vectors (option 9)
Further information: "3D tool compensation (option 9)", Page 317
- 3D tool radius compensation depending on the tool's contact angle using compensation-value tables (option 92)
Further information: "3D radius compensation depending on the tool contact angle (option 92)", Page 330

Position display

The display of the virtual tool axis **VT** refers to the tool coordinate system **T-CS**.

The control shows the values of **VT** in the **GS workspace** (option 44) and on the **GS** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

The HR 520 and HR 550 FS handwheels show the values of **VT** in the display.

Further information: User's Manual for Setup and Program Run

10.2 NC functions for preset management

10.2.1 Overview

The control provides the following functions for modifying a preset directly in the NC program after it has been defined in the preset table:

- Activate the preset
- Copy the preset
- Correct the preset

10.2.2 Activating the preset with PRESET SELECT

Application

The **PRESET SELECT** function allows you to use a preset defined in the preset table and activate it as a new preset.

Requirement

- The preset table contains values
Further information: User's Manual for Setup and Program Run
- Workpiece preset has been defined
Further information: User's Manual for Setup and Program Run

Description of function

To activate the preset, use the preset number or the entry in the **Doc** column. If the entry in the **Doc** column is not unique, the control will activate the preset with the smallest preset number.

The **KEEP TRANS** syntax element allows defining that the control retains the transformations below:

- the **TRANS DATUM** function
- Cycle **8 MIRRORING** and the **TRANS MIRROR** function
- Cycle **10 ROTATION** and the **TRANS ROTATION** function
- Cycle **11 SCALING FACTOR** and the **TRANS SCALE** function
- Cycle **26 AXIS-SPECIFIC SCALING**

Input

11 PRESET SELECT #3 KEEP TRANS WP

; Activate row 3 of the table as the workpiece preset and maintain transformations

The NC function includes the following syntax elements:

Syntax element	Meaning
PRESET SELECT	Syntax initiator for activating a preset
#, " " or QS	Select the row of the preset table Fixed or variable number or name The row can be selected from a selection menu. For names the control only displays the rows in the preset table where the Doc column is defined.
KEEP TRANS	Retain simple transformations Optional syntax element
WP or PAL	Activate the preset for the workpiece or pallet Optional syntax element

Note

If you program **PRESET SELECT** without optional parameters, the behavior is the same as with Cycle **247 SET PRESET**.

Further information: User's Manual for Machining Cycles

10.2.3 Copying the preset with PRESET COPY

Application

The function **PRESET COPY** allows you to copy a preset defined in the preset table and activate the preset copied.

Requirement

- The preset table contains values
Further information: User's Manual for Setup and Program Run
- Workpiece preset has been defined
Further information: User's Manual for Setup and Program Run

Description of function

To select the preset to be copied, use the preset number or the entry in the **Doc** column. If the entry in the **Doc** column is not unique, the control will select the preset with the smallest preset number.

Input

**11 PRESET COPY #1 TO #3 SELECT
TARGET KEEP TRANS**

; Copy row 1 of the preset table to row 3,
activate row 3 as the workpiece preset and
maintain transformations

The NC function includes the following syntax elements:

Syntax element	Meaning
PRESET COPY	Syntax initiator for copying and activating a workpiece preset
#, " " or QS	Select the row of the preset table to be copied Fixed or variable number or name The row can be selected from a selection menu. For names the control only displays the rows in the preset table where the Doc column is defined.
TO #, " " or QS	Select the new row of the preset table Fixed or variable number or name The row can be selected from a selection menu. For names the control only displays the rows in the preset table where the Doc column is defined.
SELECT TARGET	Activate the copied row of the preset table as the workpiece preset Optional syntax element
KEEP TRANS	Optional syntax element

10.2.4 Correcting the preset with PRESET CORR

Application

The function **PRESET CORR** allows you to correct the active preset.

Requirement

- The preset table contains values
Further information: User's Manual for Setup and Program Run
- Workpiece preset has been defined
Further information: User's Manual for Setup and Program Run

Description of function

If both the basic rotation and a translation are corrected in an NC block, the control will first correct the translation and then the basic rotation.

The compensation values are given with respect to the active coordinate system. When correcting the OFFS values, the values are referenced to the machine coordinate system **M-CS**.

Further information: "Reference systems", Page 222

Input**11 PRESET CORR X+10 SPC+45**; Correct the workpiece preset in **X** by +10 mm and in **SPC** by +45°

The NC function includes the following syntax elements:

Syntax element	Meaning
PRESET CORR	Syntax initiator for correcting the workpiece preset
X, Y, Z	Compensation values in the principal axes Optional syntax element
SPA, SPB, SPC	Compensation values for the spatial angle Optional syntax element
X_OFFSETS, Y_OFFSETS, Z_OFFSETS, A_OFFSETS, B_OFFSETS, C_OFFSETS, U_OFFSETS, V_OFFSETS, W_OFFSETS	Compensation value for the offsets, referenced to the machine datum Optional syntax element

10.3 Datum table

Application

A datum table saves positions on the workpiece. To use a datum table, you must activate it. Within an NC program, the datums can be called, e. g. to execute machining processes on several workpieces at the same position. The active row of the preset table serves as the workpiece preset in the NC program.

Related topics

- Contents and preparing a datum table
Further information: "Datum table", Page 605
- Editing a datum table during a program run
Further information: User's Manual for Setup and Program Run
- Preset table
Further information: User's Manual for Setup and Program Run

Description of function

The datums from a datum table are referenced to the current workpiece preset. The coordinate values from datum tables are only effective as absolute coordinate values.

Datum tables can be used in the following situations:

- Frequent use of the same datum shift
- Recurring machining sequences on different workpieces
- Recurring machining sequences at different positions on the workpiece

Activating the datum table manually

A datum table can be activated manually for the **Program Run** operating mode. In the **Program Run** operating mode, the **Program settings** window contains the **Tables** area. In this area, a datum table and both compensation tables can be selected in one selection window for running the program. When activating a table, the control will highlight this table with the status **M**.

10.3.1 Activating the datum table in the NC program


To activate a datum table in the NC program:



- ▶ **Select Insert NC function**
 - > The control opens the **Insert NC function** window.
- ▶ **Select SEL TABLE**
 - > The control opens the action bar.
- ▶ **Select Selection**
 - > A file selection window opens.
- ▶ **Select datum table**
- ▶ **Select Select**

If the datum table is not stored in the same directory as the NC program, the complete path name must be defined. The **Program settings** window allows defining whether the control creates absolute or relative paths.

Further information: "Settings in the Program workspace", Page 109



If you enter the datum table name manually, please note the following:

- If the datum table is stored in the same directory as the NC program, enter the file name only.
- If the datum table is not stored in the same directory as the NC program, enter the complete path.

Definition

File format	Definition
.d	Datum table

10.4 NC functions for coordinate transformation

10.4.1 Overview

The control provides the following **TRANS** functions:


Syntax	Function	Further information
TRANS DATUM	Shift the workpiece datum	Page 242
TRANS MIRROR	Mirror an axis	Page 244
TRANS ROTATION	Rotation about the tool axis	Page 246
TRANS SCALE	Scale contours and positions	Page 248

Define the functions in the sequence in which they are listed in the table and reset them in reverse order. The sequence of programming will have an impact on the result.

For example, if you first shift the workpiece datum and then mirror the contour and then reverse the sequence, the contour will be mirrored at the original workpiece datum.

All **TRANS** functions reference the workpiece datum. The workpiece datum is the origin of the input coordinate system (**I-CS**).

Further information: "Input coordinate system I-CS", Page 232

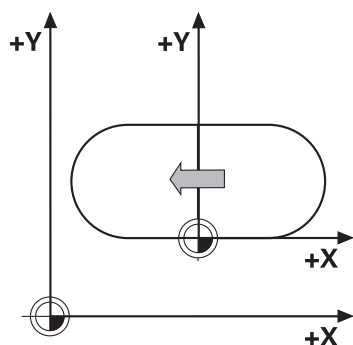

Related topics

- Coordinate transformation cycles
Further information: User's Manual for Machining Cycles
- **PLANE** functions (option 8)
Further information: "Tilting the working plane with PLANE functions (option 8)", Page 250
- Reference systems
Further information: "Reference systems", Page 222

10.4.2 Datum shift with TRANS DATUM

Application

The **TRANS DATUM** function allows you to shift the workpiece datum by either entering fixed or variable coordinates or by specifying a table row in the datum table.

Use the **TRANS DATUM RESET** function to reset the datum shift.

Related topics

- Contents of the datum table
Further information: "Datum table", Page 605
- Activating the datum table
Further information: "Activating the datum table in the NC program", Page 241
- Machine presets
Further information: "Presets in the machine", Page 99

Description of function**TRANS DATUM AXIS**

You can define a datum shift by entering values in the respective axis with the **TRANS DATUM AXIS** function. You can define up to nine coordinates in one NC block, and incremental entries are possible.

The control displays the result of the datum shift in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

TRANS DATUM TABLE

You can use the **TRANS DATUM TABLE** function to define a datum shift by selecting a row from a datum table.

Optionally, you can set the path to a datum table. If you do not define a path, the control will use the datum table that has been activated with **SEL TABLE**.

Further information: "Activating the datum table in the NC program", Page 241

The control displays the datum shift and the path to the datum table on the **TRANS** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

TRANS DATUM RESET

Use the **TRANS DATUM RESET** function to cancel a datum shift. How you previously defined the datum is irrelevant.

Input

11 TRANS DATUM AXIS X+10 Y+25 Z+42	; Shift the workpiece datum in the X , Y and Z axes
---	--

The NC function includes the following syntax elements:

Syntax element	Meaning
TRANS DATUM	Start of syntax for a datum shift
AXIS , TABLE or RESET	Datum shift with coordinate input, with a datum table or reset of the datum shift
X , Y , Z , A , B , C , U , V or W	Possible axes for coordinate input Fixed or variable number Only if AXIS has been selected
TABLINE	Row in the datum table Fixed or variable number Only if TABLE has been selected
" " or QS	Path to the datum table Fixed or variable name Optional syntax element Only if TABLE has been selected

Notes

- The **TRANS DATUM** function replaces Cycle **7 DATUM SHIFT**. If you import an NC program from a previous control model, the control converts Cycle **7** into the **TRANS DATUM** NC function.
- Absolute values reference the workpiece preset. Incremental values reference the workpiece datum.

Further information: "Presets in the machine", Page 99

- In machine parameter **transDatumCoordSys** (no. 127501), the machine manufacturer defines the reference system referred to by the values in the position display.

Further information: "Reference systems", Page 222

10.4.3 Mirroring with TRANS MIRROR

Application

Use the **TRANS MIRROR** function to mirror contours or positions about one or more axes.

The **TRANS MIRROR RESET** function allows you to reset the mirroring.

Related topics


- Cycle **8 MIRRORING**
Further information: User's Manual for Machining Cycles
- Additive mirroring within the global program settings GPS (option 44)
Further information: User's Manual for Setup and Program Run

Description of function


Mirroring is a modal function that is effective as soon as it has been defined in the NC program.

The control mirrors contours or positions about the active workpiece datum. If the datum is outside the contour, the control will also mirror the distance to the datum.

Further information: "Presets in the machine", Page 99

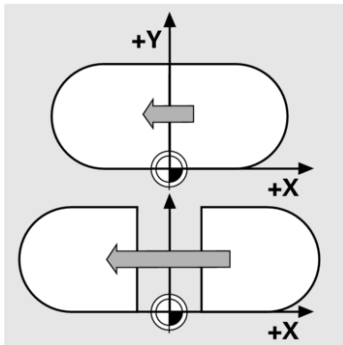

If you mirror only one axis, the machining direction of the tool is reversed. The rotational direction defined in a cycle will remain unchanged, e.g. if defined within one of the OCM cycles (option 167).

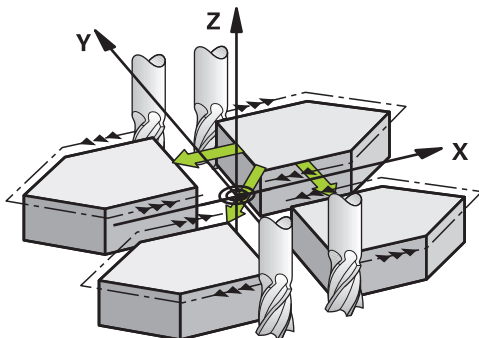


Depending on the selected **AXIS** axis values, the control will mirror the following working planes:

- **X:** The control mirrors the **YZ** working plane
- **Y:** The control mirrors the **ZX** working plane
- **Z:** The control mirrors the **XY** working plane

Further information: "Designation of the axes on milling machines", Page 98

You can select up to three axis values.

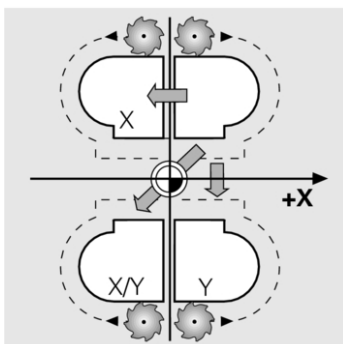

If mirroring is active, the control displays it on the **TRANS** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

Input

11 TRANS MIRROR AXIS X

; Mirror the machining operations about the X axis

The NC function includes the following syntax elements:

Syntax element	Meaning
TRANS MIRROR	Start of syntax for mirroring
AXIS or RESET	Enter mirroring of axis values or reset mirroring
X, Y or Z	Axis values to be mirrored Only if AXIS has been selected

Note

This function can only be used in the **FUNCTION MODE MILL** machining mode.

Further information: "Switching the operating mode with FUNCTION MODE", Page 122

Notes on using these functions in conjunction with tilting functions

NOTICE

Danger of collision!

The control reacts differently to the various types of transformations as well as their programmed sequence. Unexpected movements or collisions can occur if the functions are not suitable.

- ▶ Program only the recommended transformations in the respective reference system
- ▶ Use tilting functions with spatial angles instead of with axis angles
- ▶ Use the Simulation mode to test the NC program

The type of tilting function has the following effects on the result:

- If you tilt using spatial angles (**PLANE** functions except for **PLANE AXIAL** or Cycle **19**), previously programmed transformations will change the position of the workpiece datum and the orientation of the rotary axes:
 - Shifting with the **TRANS DATUM** function will change the position of the workpiece datum.
 - Mirroring changes the orientation of the rotary axes. The entire NC program, including the spatial angles, will be mirrored.
- If you tilt using axis angles (**PLANE AXIAL** or Cycle **19**), a previously programmed mirroring has no effect on the orientation of the rotary axes. You use these functions for direct positioning of the machine axes.

Further information: "Workpiece coordinate system W-CS", Page 228

10.4.4 Rotations with TRANS ROTATION

Application

With the **TRANS ROTATION** function, you can rotate contours or positions around a rotation angle.

The **TRANS DATUM RESET** function allows you to reset the rotation.

Related topics■ Cycle **10 ROTATION****Further information:** User's Manual for Machining Cycles

■ Additive rotation within the global program settings GPS (option 44)

Further information: User's Manual for Setup and Program Run**Description of function**


Rotation is a modal function that is effective as soon as it has been defined in the NC program.

The control rotates machining in the working plane about the active workpiece datum.

Further information: "Presets in the machine", Page 99

The control rotates the input coordinate system (**I-CS**) as follows:

- Based on the angle reference axis, i.e. the main axis
- About the tool axis

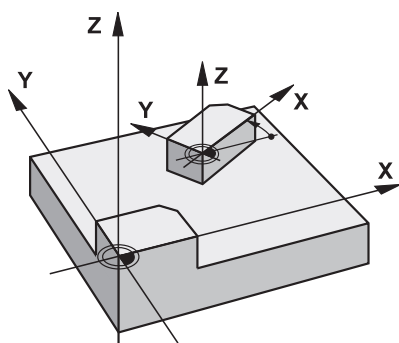Further information: "Designation of the axes on milling machines", Page 98

A rotation can be programmed as follows:

- Absolute, relative to the positive main axis
- Incremental, relative to the last active rotation

If rotation is active, the control displays it on the **TRANS** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run**Input****11 TRANS ROTATION ROT+90**

; Rotate machining by 90°

The NC function includes the following syntax elements:

Syntax element	Meaning
TRANS ROTATION	Start of syntax for a rotation
ROT or RESET	Enter an absolute or incremental angle of rotation or reset rotation
	Fixed or variable number

Note

This function can only be used in the **FUNCTION MODE MILL** machining mode.

Further information: "Switching the operating mode with FUNCTION MODE", Page 122

10.4.5 Scaling with TRANS SCALE

Application

With the **TRANS SCALE** function, you can scale contours or positions and thus enlarge or reduce these uniformly. This enables you to program shrinkage and oversize allowances, for example.

Use the **TRANS SCALE RESET** function to reset the scaling.

Related topics

- Cycle **11 SCALING FACTOR**

Further information: User's Manual for Machining Cycles


Description of function

Scaling is a modal function that is effective as soon as it has been defined in the NC program.

Depending on the position of the workpiece datum, scaling is carried out as follows:

- Workpiece datum at the center of the contour:
The contour is scaled uniformly in all directions.
- Workpiece datum at the bottom left of the contour:
The contour is scaled in the positive X and Y axis directions.
- Workpiece datum at the top right of the contour:
The contour is scaled in the negative X and Y axis directions.

Further information: "Presets in the machine", Page 99

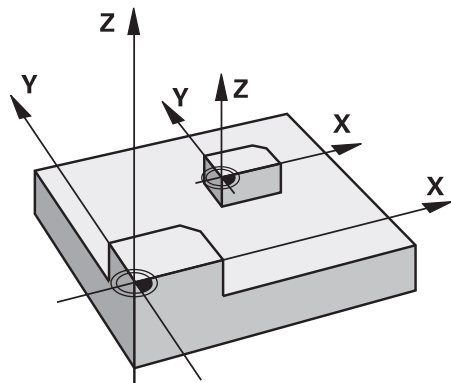

If you enter a scaling factor **SCL** less than 1, the contour will be reduced in size. If you enter a scaling factor **SCL** greater than 1, the contour will be enlarged.

When scaling, the control takes the coordinate input and dimensions from all cycles into account.

If scaling is active, the control displays it on the **TRANS** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

Input

11 TRANS SCALE SCL1.5

; Enlarge the contour by the factor 1.5

The NC function includes the following syntax elements:

Syntax element	Meaning
TRANS SCALE	Start of syntax for scaling
SCL or RESET	Enter the scaling factor or reset scaling Fixed or variable number

Notes

- This function can only be used in the **FUNCTION MODE MILL** machining mode.
Further information: "Switching the operating mode with FUNCTION MODE", Page 122
- If you want to reduce the size of a contour with inside radii, make sure to select an appropriate tool. Otherwise, residual material might remain.

10.5 Tilting the working plane (option 8)


10.5.1 Fundamentals

Machines with rotary axes allow machining e. g. several workpiece sides after one clamping process by tilting the working plane. The tilting functions also allow aligning a workpiece clamped at an incorrect angle.

The working plane can be tilted only when tool axis **Z** is active.

The control functions for tilting the working plane are coordinate transformations. The working plane is always perpendicular to the direction of the tool axis.

Further information: "Working plane coordinate system WPL-CS", Page 230

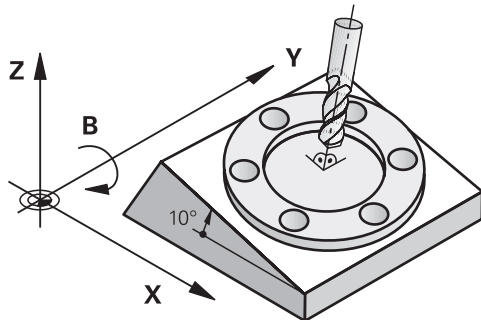

There are three functions available for tilting the working plane:

- Manual tilting with the **3-D rotation** window in the **Manual operation** application
Further information: User's Manual for Setup and Program Run
- Tilting under program control with the **PLANE** functions in the NC program
Further information: "Tilting the working plane with PLANE functions (option 8)", Page 250
- Tilting under program control with Cycle **19 WORKING PLANE**
Further information: User's Manual for Machining Cycles

Notes concerning different machine kinematics

When no transformations are active and the working plane is not tilted, the linear machine axes move in parallel with the basic coordinate system **B-CS**. In this process, machines behave almost identically, regardless of the kinematics.

Further information: "Basic coordinate system B-CS", Page 226


When tilting the working plane, the control moves the machine axes according to the kinematics.

Please observe the aspects below regarding the machine kinematics:

■ Machine with table rotary axes

With this kinematics, the table rotary axes execute the tilting movement and the position of the workpiece in the work envelope changes. The linear machine axes move in the tilted working plane coordinate system **WPL-CS** just as they do in the non-tilted **B-CS**.


Further information: "Working plane coordinate system WPL-CS", Page 230

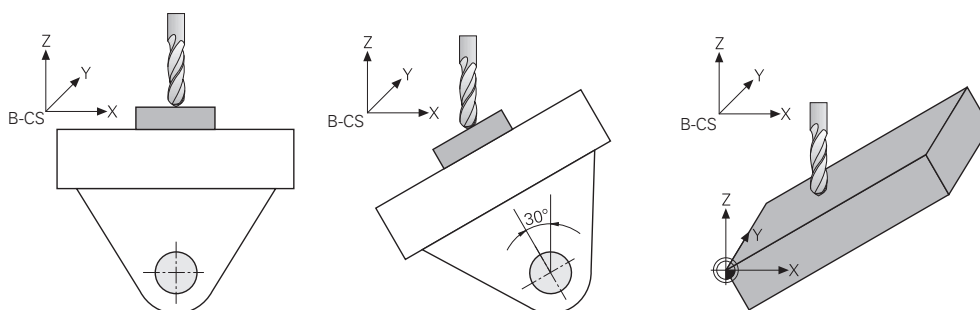

■ Machine with head rotary axes

With this kinematics, the head rotary axes execute the tilting movement and the position of the workpiece in the work envelope remains the same. In the tilted **WPL-CS**, at least two linear machine axes no longer move in parallel with the non-tilted **B-CS**, depending on the rotary angle.

Further information: "Working plane coordinate system WPL-CS", Page 230

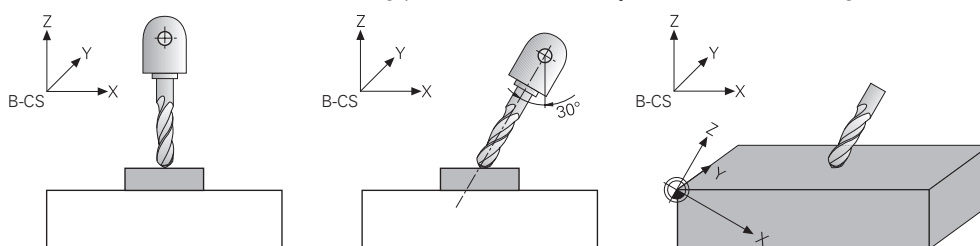

10.5.2 Tilting the working plane with PLANE functions (option 8)

Fundamentals

Application

Machines with rotary axes allow machining e. g. several workpiece sides after one clamping process by tilting the working plane.

The tilting functions also allow aligning a workpiece clamped at an incorrect angle.

Related topics

- Machining types by number of axes
Further information: "Types of machining according to number of axes", Page 398
- Adopt tilted working plane in the **Manual** operating mode with the **3-D rotation** window
Further information: User's Manual for Setup and Program Run

Requirements

- Machine with rotary axes
 3+2 axes machining requires at least two rotary axes. Removable axes as an additional top table are also possible.
- Kinematics description
 To calculate the tilting angles, the control requires a kinematics description prepared by the machine manufacturer.
- Advanced Functions Set 1 (software option 8)
- Tool with tool axis **Z**

Description of function

Tilting the working plane defines the orientation of the working plane coordinate system **WPL-CS**.

Further information: "Reference systems", Page 222



The position of the workpiece datum and consequently the orientation of the working plane coordinate system **WPL-CS** can be defined by using the **TRANS DATUM** function before tilting the working plane in the workpiece coordinate system **W-CS**.

A datum shift is always effective in the active **WPL-CS**, meaning after the tilting function if applicable. If the workpiece datum is shifted for the tilting process, an active tilting function may have to be reset.

Further information: "Datum shift with TRANS DATUM", Page 242

In practice, workpiece drawings show different specified angles, which is why the control offers different **PLANE** functions with different options for defining angles.

Further information: "Overview of PLANE functions", Page 252

In addition to the geometric definition of the working plane, every **PLANE** function allows specifying how the control positions the rotary axes.

Further information: "Rotary axis positioning", Page 284

If the geometric definition of the working plane results in no unambiguous tilting position, the desired tilting solution can be selected.

Further information: "Tilting solution", Page 287

Depending on the defined angles and the machine kinematics, there is a choice whether the control positions the rotary axes or orients the working plane coordinate system **WPL-CS** exclusively.

Further information: "Transformation types", Page 291

Status display

Positions workspace

As soon as the working plane has tilted, the General status display in the **Positions** workspace contains an icon.

Further information: User's Manual for Setup and Program Run



When deactivating or resetting the tilting function correctly, the icon indicating the tilted working plane must disappear.

Further information: "PLANE RESET", Page 279

Status workspace

When the working plane is tilted, the **POS** and **TRANS** tabs in the **Status** workspace contain information about the active orientation of the working plane.

When defining the working plane by using axis angles, the control displays the defined axis values. All alternative geometric definition options display the resulting spatial angles.

Further information: User's Manual for Setup and Program Run

Overview of PLANE functions

The control provides the following **PLANE** functions:

Syntax element	Function	Further information
SPATIAL	Defines the working plane by means of three spatial angles	Page 255
PROJECTED	Defines the working plane by means of two projection angles and one rotation angle	Page 260
EULER	Defines the working plane by means of three Euler angles	Page 265
VECTOR	Defines the working plane by means of two vectors	Page 268
POINTS	Defines the working plane by means of the coordinates of three points	Page 271
RELATIV	Defines the working plane by means of a single spatial angle with incremental effect	Page 275
AXIAL	Defines the working plane by means of a maximum of three absolute or incremental axis angles	Page 280
RESET	Resets tilting of the working plane	Page 279

Notes

NOTICE**Danger of collision!**

When the machine is switched on, the control tries to restore the switch-off status of the tilted plane. This is prevented under certain conditions. For example, this applies if axis angles are used for tilting while the machine is configured with spatial angles, or if you have changed the kinematics.

- ▶ If possible, reset tilting before shutting the system down
- ▶ Check the tilted condition when switching the machine back on

NOTICE**Danger of collision!**

Cycle **8 MIRRORING** can have different effects in conjunction with the **Tilt working plane** function. The programming sequence, the mirrored axes, and the tilting function used are critical in this regard. There is a risk of collision during the tilting operation and subsequent machining!

- ▶ Check the sequence and positions using a graphic simulation
- ▶ Carefully test the NC program or program section in the **Program run, single block** operating mode

Examples

- 1 When Cycle **8 MIRRORING** is programmed before the tilting function without rotary axes:
 - The tilt of the **PLANE** function used (except **PLANE AXIAL**) is mirrored
 - Mirroring takes effect after tilting with **PLANE AXIAL** or Cycle **19**
- 2 When Cycle **8 MIRRORING** is programmed before the tilting function with a rotary axis:
 - The mirrored rotary axis has no effect on the tilt specified in the **PLANE** function used, because only the movement of the rotary axis is mirrored

NOTICE**Danger of collision!**

Rotary axes with Hirth coupling must move out of the coupling to enable tilting. There is a danger of collision while the axis moves out of the coupling and during the tilting operation.

- ▶ Make sure to retract the tool before changing the position of the rotary axis

- If you use the **PLANE** function when **M120** is active, the control automatically rescinds the radius compensation, which also rescinds the **M120** function.
- Always use **PLANE RESET** to cancel **PLANE** functions. Entering 0 in all **PLANE** parameters (e.g. all three spatial angles) exclusively resets the angles, but not the function.
- If you restrict the number of tilting axes with the **M138** function, your machine may provide only limited tilting possibilities. The machine manufacturer will decide whether the control takes the angles of deselected axes into account or sets them to 0.
- The control only supports tilting the working plane with spindle axis Z.

Tilting the working plane without rotary axes



Refer to your machine manual.

This function must be enabled and adapted by the machine manufacturer.

The machine manufacturer must take the precise angle into account, e.g. the angle of a mounted angle head in the kinematics description.

You can also orient the programmed working plane perpendicularly to the tool without defining rotary axes, e.g. when adapting the working plane for a mounted angle head.

Use the **PLANE SPATIAL** function and the **STAY** positioning behavior to swivel the working plane to the angle specified by the machine manufacturer.

Example of mounted angle head with permanent tool direction **Y**:

Example

```
11 TOOL CALL 5 Z S4500
```

```
12 PLANE SPATIAL SPA+0 SPB-90 SPC+0 STAY
```



The tilt angle must be precisely adapted to the tool angle, otherwise the control will generate an error message.

PLANE SPATIAL

Application

Use the **PLANE SPATIAL** function to define the working plane by three spatial angles.




Spatial angles are the most frequently used definition option for a working plane. The definition is not machine-specific, meaning that it is independent of the rotary axes actually present.

Related topics


- Defining a single spatial angle with incremental effect
Further information: "PLANE RELATIV", Page 275
- Entering the axis angle
Further information: "PLANE AXIAL", Page 280

Description of function

Spatial angles define a working plane through three independent rotations in the workpiece coordinate system (**W-CS**), i. e. in the non-tilted working plane.

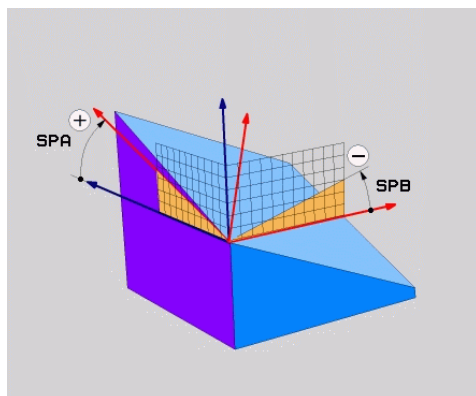


Spatial angles **SPA** and **SPB**

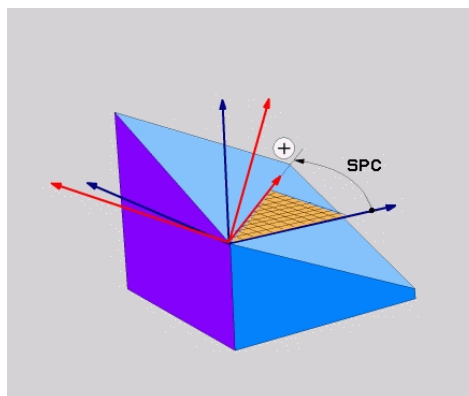

Spatial angle **SPC**

All three angles must be defined even if one or several angles equals 0.

As the spatial angles are programmed independently of the physically existing rotary axes, there is no need to differentiate between the head and the table axes as far as the signs are concerned. Always use the extended right-hand rule.

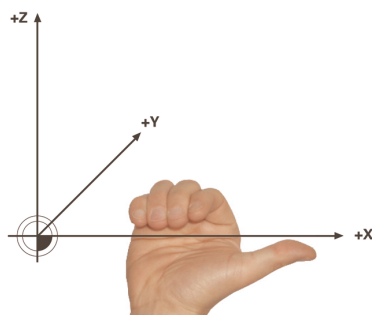

The thumb of your right hand points in the positive direction of the axis around which the rotation occurs. If you curl your fingers, the curled fingers point in the positive direction of rotation.

Entering the spatial angles as three independent rotations in the workpiece coordinate system **W-CS** in the programming sequence **A-B-C** is a challenge to many users. The challenge in particular is to take two coordinate systems into account simultaneously: the unmodified **W-CS** and the modified working plane coordinate system **WPL-CS**.

This is why the spatial angle can be alternatively defined by imagining three rotations layered on top of one another in the tilting sequence **C-B-A**. This alternative allows considering one coordinate system exclusively, meaning the modified working plane coordinate system **WPL-CS**.

Further information: "Notes", Page 259



This view equals three **PLANE RELATIV** functions programmed one-by-one, first with **SPC**, then with **SPB** and finally with **SPA**. The spatial angles with incremental effect **SPB** and **SPA** are referenced to the working plane coordinate system **WPL-CS**, i. e. to a tilted working plane.


Further information: "PLANE RELATIV", Page 275

Application example

Example


11 PLANE SPATIAL SPA+45 SPB+0 SPC+0 TURN MB MAX FMAX SYM- TABLE ROT

Initial state

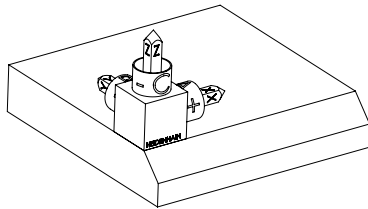

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

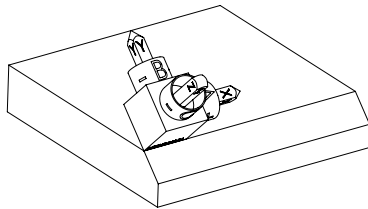

Using the defined spatial angle **SPA+45**, the control orients the tilted Z axis of **WPL-CS** to be perpendicular with the chamfer surface. The rotation by the **SPA** angle is around the non-tilted X axis.

The orientation of the tilted X axis equals the orientation of the non-tilted X axis.

The orientation of the tilted Y axis results automatically because all axes are perpendicular to one another.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced by using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following spatial angles:

- **SPA+45, SPB+0** and **SPC+90** for the second chamfer

Further information: "Notes", Page 259

- **SPA+45, SPB+0** and **SPC+180** for the third chamfer

- **SPA+45, SPB+0** and **SPC+270** for the fourth chamfer


The values are referenced to the non-tilted workpiece coordinate system **W-CS**.

Remember that the workpiece datum must be shifted before each working plane definition.

Input

```
11 PLANE SPATIAL SPA+45 SPB+0 SPC+0 TURN MB MAX FMAX SYM- TABLE ROT
```

The NC function includes the following syntax elements:


Syntax element	Meaning
PLANE SPATIAL	Defines the working plane by means of three spatial angles
SPA	Properties of the workpiece coordinate system W-CS Input: -360.0000000...+360.0000000
SPB	Properties of the workpiece coordinate system W-CS Input: -360.0000000...+360.0000000
SPC	Properties of the workpiece coordinate system W-CS Input: -360.0000000...+360.0000000
MOVE, TURN or STAY	Type of rotary axis positioning <div><div></div><div>Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined.</div></div> <div>Further information: "Rotary axis positioning", Page 284</div>
SYM or SEQ	Select an unambiguous tilting solution Further information: "Tilting solution", Page 287 Optional syntax element
COORD ROT or TABLE ROT	Transformation type Further information: "Transformation types", Page 291 Optional syntax element

Notes**Comparison of views - Example: chamfer****Example**

11 PLANE SPATIAL SPA+45 SPB+0 SPC+90 TURN MB MAX FMAX SYM- TABLE ROT



View A-B-C

Initial state

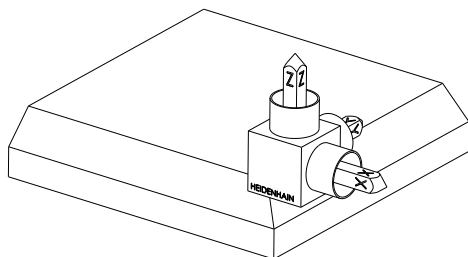**SPA+45**


Orientation of tool axis **Z**

Rotation around the X axis of the non-tilted workpiece coordinate system

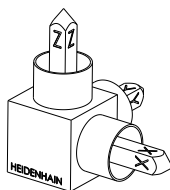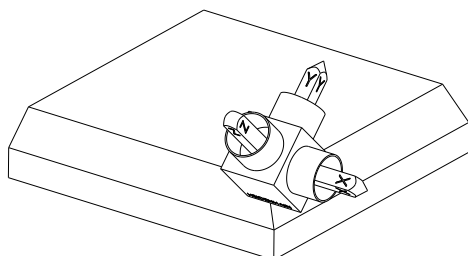W-CS**SPB+0**


Rotation around the Y axis of the non-tilted **W-CS**

No rotation with value 0

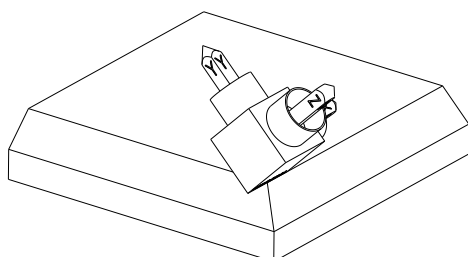
**SPC+90**


Orientation of main axis **X**

Rotation around the Z axis of the non-tilted **W-CS**

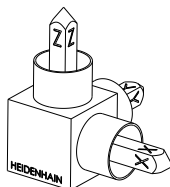**View C-B-A**


Initial state

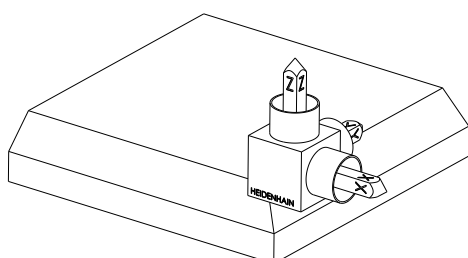

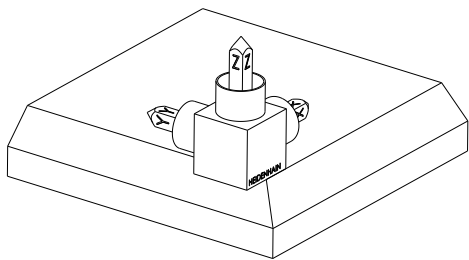

SPC+90
Orientation of main axis **X**
Rotation around the Z axis of the
workpiece coordinate system **W-CS**,
meaning in the non-tilted working plane

SPB+0
Rotation around the Y axis in the
working plane coordinate system
WPL-CS, meaning in the tilted working
plane
No rotation with value 0

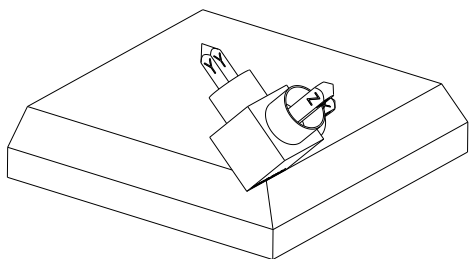

SPA+45
Orientation of tool axis **Z**
Rotation around the X axis in **WPL-CS**,
meaning in the tilted working plane

Both views have an identical result.

Definition

Abbreviation	Definition
SP e. g. in SPA	Spatial

PLANE PROJECTED

Application


Use the **PLANE PROJECTED** function to define the working plane by two projection angles. Use an additional rotation angle to optionally align the X axis in the tilted working plane.

Description of function

Projection angles define a working plane through two independent angles in the working planes **ZX** and **YZ** of the non-tilted working plane coordinate system **W-CS**.

Further information: "Designation of the axes on milling machines", Page 98

Use an additional rotation angle to optionally align the X axis in the tilted working plane.

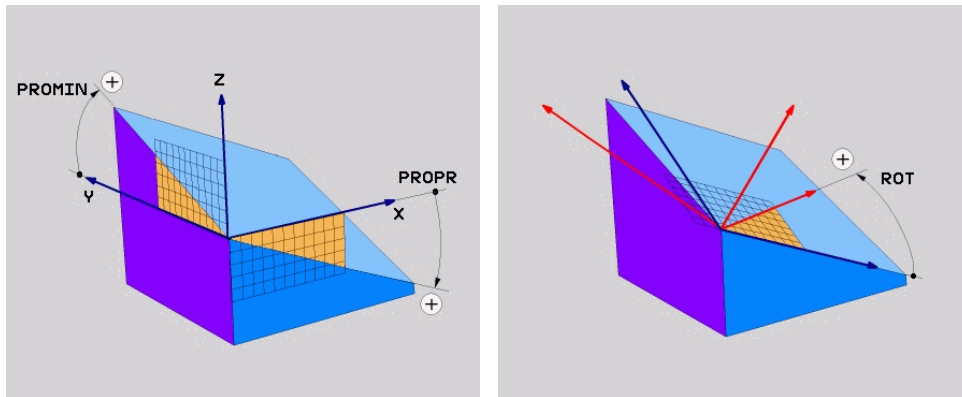

Projection angles **PROMIN** and **PROPR** Rotation angle **ROT**

All three angles must be defined even if one or several angles equals 0.

Entering the projection angles is easy for rectangular workpieces because the workpiece edges are the same as the projection angles.

The projection angles of non-rectangular workpieces can be obtained by imagining the working planes **ZX** and **YZ** as transparent panels with angle scales. When viewing the workpiece from the front through the **ZX** plane, the difference between the X axis and the workpiece edge equals the projection angle **PROPR**. Use the same procedure to obtain the projection angle **PROMIN** by viewing the workpiece from the left.



When using **PLANE PROJECTED** for multi-side or internal machining, the hidden workpiece edges must be used or projected. Imagine the workpiece to be transparent in such cases.


Further information: "Notes", Page 264

Application example

Example


11 PLANE PROJECTED PROPR+0 PROMIN+45 ROT+0 TURN MB MAX FMAX SYM- TABLE ROT

Initial state

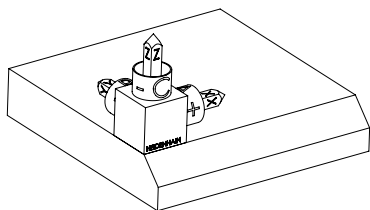

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

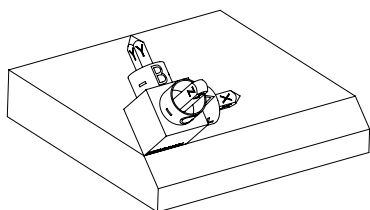

Using the defined projection angle **PROMIN+45**, the control orients the Z axis of **WPL-CS** to be perpendicular with the chamfer surface. The angle from **PROMIN** is effective in the working plane **YZ**.

The orientation of the tilted X axis equals the orientation of the non-tilted X axis.

The orientation of the tilted Y axis results automatically because all axes are perpendicular to one another.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced by using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following projection and rotation angles:

- **PROPR+45, PROMIN+0** and **ROT+90** for the second chamfer
- **PROPR+0, PROMIN-45** and **ROT+180** for the third chamfer
- **PROPR-45, PROMIN+0** and **ROT+270** for the fourth chamfer


The values are referenced to the non-tilted workpiece coordinate system **W-CS**.

Remember that the workpiece datum must be shifted before each working plane definition.

Input


11 PLANE PROJECTED PROPR+0 PROMIN+45 ROT+0 TURN MB MAX FMAX SYM- TABLE ROT

The NC function includes the following syntax elements:


Syntax element	Meaning
PLANE PROJECTED	Syntax initiator for the working plane definition by means of two projection angles and one rotation angle
PROPR	Angle in working plane ZX , i. e. around the Y axis of the workpiece coordinate system W-CS Input: -89.999999...+89.9999
PROMIN	Angle in the working plane YZ , i. e. around the X axis of W-CS Input: -89.999999...+89.9999
ROT	Rotation around the Z axis of the tilted working plane coordinate system WPL-CS Input: -360.0000000...+360.0000000
MOVE, TURN or STAY	Type of rotary axis positioning <div>  Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined. </div>
	Further information: "Rotary axis positioning", Page 284
SYM or SEQ	Select an unambiguous tilting solution Further information: "Tilting solution", Page 287 Optional syntax element
COORD ROT or TABLE ROT	Transformation type Further information: "Transformation types", Page 291 Optional syntax element

Notes

Procedure in case of hidden workpiece edges, using the example of a diagonal hole

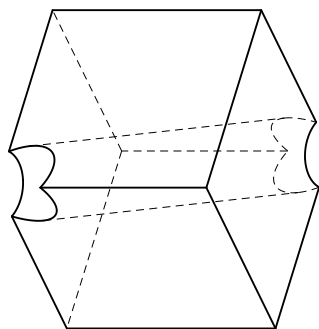

Cube with a diagonal hole

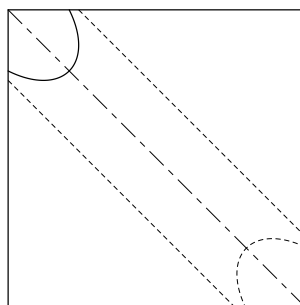


Front view, meaning projection on the **ZX** working plane

Example

11 PLANE PROJECTED PROPR-45 PROMIN+45 ROT+0 TURN MB MAX FMAX SYM-TABLE ROT


Comparison of projection and spatial angles

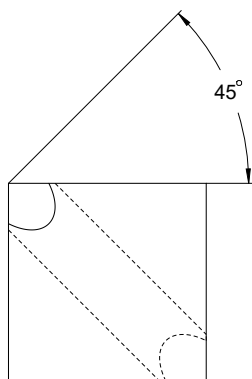

When imagining the workpiece to be transparent, the projection angles are easy to find. Both projection angles are 45° .



When defining the algebraic sign, ensure that the working plane is perpendicular to the center axis of the hole.

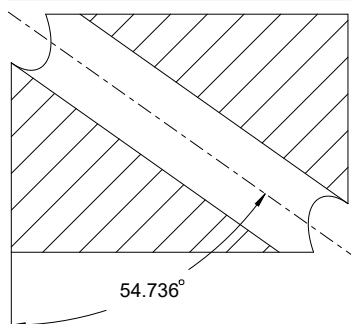

When defining the working plane by using spatial angles, the spatial diagonal must be considered.

The full section along the hole axis shows that the axis does not form an isosceles triangle with the lower and the left workpiece edge. This is why e. g. a spatial angle **SPA+45** produces an incorrect result.

Definition

Abbreviation	Definition
PROPR	Main plane
PROMIN	Minor plane
ROT	Angle of rotation

PLANE EULER


Application

Use the **PLANE EULER** function to define the working plane by three Euler angles.


Description of function

Euler angles define a working plane as three rotations layered on top of one another, starting from the non-tilted workpiece coordinate system **W-CS**.


Use the third Euler angle to optionally align the tilted X axis.

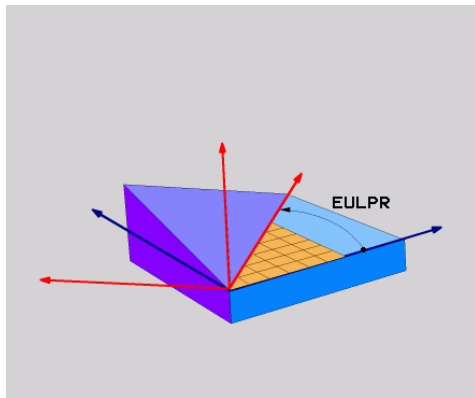

Euler angle **EULPR**

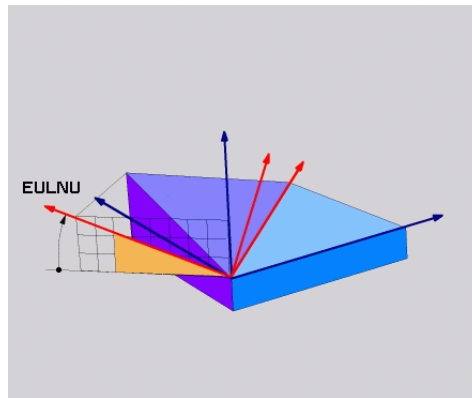

Euler angle **EULNU**

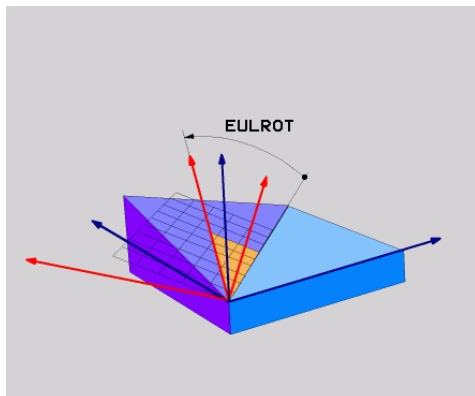

Euler angle **EULROT**

All three angles must be defined even if one or several angles equals 0.

At first, the rotations layered on top of one another happen around the non-tilted Z axis, then around the tilted X axis and finally around the tilted Z axis.



This view equals three **PLANE RELATIV** functions programmed one-by-one, first with **SPC**, then with **SPA** and finally with **SPC** again.

Further information: "PLANE RELATIV", Page 275

The same result can be achieved by a **PLANE SPATIAL** function with the spatial angles **SPC** and **SPA**, followed by a rotation, e. g. with the **TRANS ROTATION** function.

Further information: "PLANE SPATIAL", Page 255


Further information: "Rotations with TRANS ROTATION", Page 246

Application example

Example


11 PLANE EULER EULPR+0 EULNU45 EULROTO TURN MB MAX FMAX SYM- TABLE ROT

Initial state

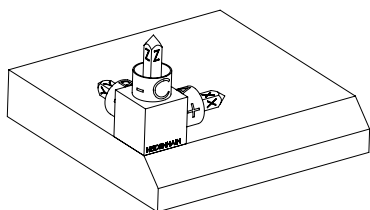

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

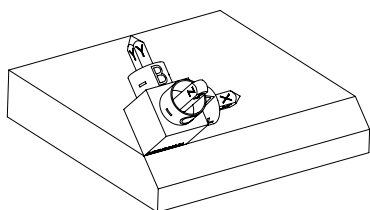

Using the defined Euler angle **EULNU**, the control orients the Z axis of the **WPL-CS** to be perpendicular with the chamfer surface. The rotation by the **EULNU** angle is around the non-tilted X axis.

The orientation of the tilted X axis equals the orientation of the non-tilted X axis.

The orientation of the tilted Y axis results automatically because all axes are perpendicular to one another.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced by using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following Euler angles:

- **EULPR+90, EULNU45** and **EULROTO** for the second chamfer
- **EULPR+180, EULNU45** and **EULROTO** for the third chamfer
- **EULPR+270, EULNU45** and **EULROTO** for the fourth chamfer

The values are referenced to the non-tilted workpiece coordinate system **W-CS**.


Remember that the workpiece datum must be shifted before each working plane definition.

Input

Example

```
11 PLANE EULER EULPR+0 EULNU45 EULROT0 TURN MB MAX FMAX SYM- TABLE ROT
```

The NC function includes the following syntax elements:

Syntax element	Meaning
PLANE EULER	Syntax initiator for the working plane definition by means of three Euler angles
EULPR	Rotation around the Z axis of the workpiece coordinate system W-CS Input: -180.000000...+180.000000
EULNU	Rotation around the X axis of the tilted working plane coordinate system WPL-CS Input: 0...180.000000
EULROT	Rotation around the Z axis of the tilted WPL-CS Input: 0...360.000000
MOVE, TURN or STAY	Type of rotary axis positioning <div data-bbox="486 1041 1209 1153">  Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined. </div>
SYM or SEQ	Select an unambiguous tilting solution Further information: "Rotary axis positioning", Page 284 Further information: "Tilting solution", Page 287 Optional syntax element
COORD ROT or TABLE ROT	Transformation type Further information: "Transformation types", Page 291 Optional syntax element

Definition

Abbreviation	Definition
EULPR	Precession angle
EULNU	Nutation angle
EULROT	Angle of rotation

PLANE VECTOR

Application

Use the **PLANE VECTOR** function to define the working plane by two vectors.


Related topics

- Output formats of NC programs


Further information: "Output formats of NC programs", Page 396

Description of function

Vectors define a working plane as two independent specifications of direction, starting from the non-tilted workpiece coordinate system **W-CS**.

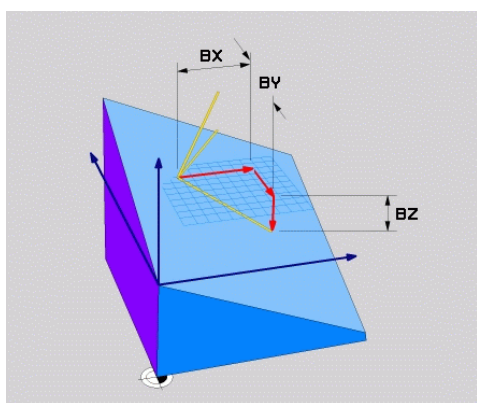

Base vector with components **BX**, **BY** and **BZ**

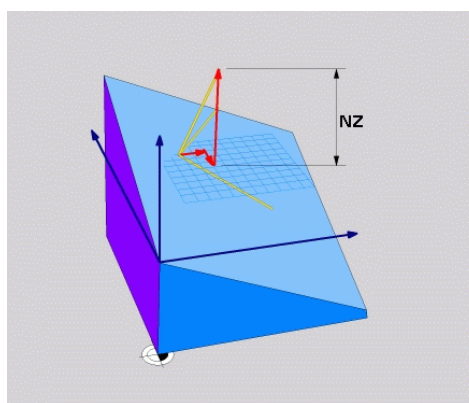

NZ component of the normalized vector

All six components must be defined even if one or several components equals 0.



There is no need to enter a normalized vector. The drawing dimensions or any values which will not alter the ratio between the components can be used.

Further information: "Application example", Page 269


The base vector with components **BX**, **BY** and **BZ** defines the direction of the tilted X axis. The normal vector with components **NX**, **NY** and **NZ** defines the direction of the tilted Z axis and therefore indirectly the working plane. The normal vector is perpendicular to the tilted working plane.

Application example

Example


11 PLANE VECTOR BX+1 BY+0 BZ+0 NX+0 NY-1 NZ+1 TURN MB MAX FMAX SYM-TABLE ROT

Initial state

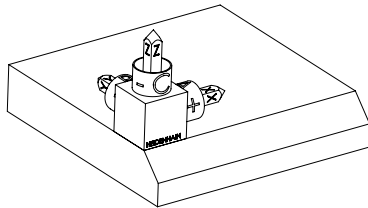

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

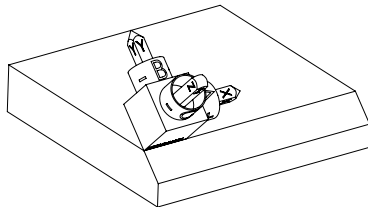

Using the defined normal vector with the components **NX+0**, **NY-1** and **NZ+1**, the control orients the Z axis of the working plane coordinate system **WPL-CS** to be perpendicular with the chamfer surface.

The alignment of the tilted X axis equals the orientation of the non-tilted X axis due to component **BX+1**.

The orientation of the tilted Y axis results automatically because all axes are perpendicular to one another.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following vector components:

- **BX+0**, **BY+1** and **BZ+0** as well as **NX+1**, **NY+0** and **NZ+1** for the second chamfer
- **BX-1**, **BY+0** and **BZ+0** as well as **NX+0**, **NY+1** and **NZ+1** for the third chamfer
- **BX+0**, **BY-1** and **BZ+0** as well as **NX-1**, **NY+0** and **NZ+1** for the fourth chamfer


The values are referenced to the non-tilted workpiece coordinate system **W-CS**.

Remember that the workpiece datum must be shifted before each working plane definition.

Input

11 PLANE VECTOR BX+1 BY+0 BZ+0 NX+0 NY-1 NZ+1 TURN MB MAX FMAX SYM-
TABLE ROT

The NC function includes the following syntax elements:

Syntax element	Meaning
PLANE VECTOR	Syntax initiator for the working plane definition by means of two vectors
BX, BY and BZ	Components of base vector, referenced to the workpiece coordinate system W-CS , for orienting the tilted X axis Input: -99.9999999...+99.9999999
NX, NY and NZ	Components of the normal vector, referenced to the W-CS , for orienting the tilted Z axis Input: -99.9999999...+99.9999999
MOVE, TURN or STAY	Type of rotary axis positioning <div data-bbox="478 936 1211 1070" style="border: 1px solid black; padding: 5px; margin-top: 10px;">  Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined. </div>
SYM or SEQ	Select an unambiguous tilting solution Further information: "Tilting solution", Page 287 Optional syntax element
COORD ROT or TABLE ROT	Transformation type Further information: "Transformation types", Page 291 Optional syntax element

Notes

- If the components of the normal vector contain very small values, e. g. 0 or 0.0000001, the control cannot determine the working plane slope. In such cases, the control cancels machining with an error message. This behavior cannot be configured.
- The control calculates standardized vectors from the values you enter.

Notes about non-perpendicular vectors

To ensure that the definition of the working plane is unambiguous, the vectors must be programmed perpendicular to each other.

The machine manufacturer uses the optional machine parameter **autoCorrectVector** (no. 201207) to define the behavior of the control with non-perpendicular vectors.

As an alternative to an error message, the control can either correct or replace the non-perpendicular base vector. This correction (or replacement) does not affect the normal vector.

The correction behavior of the control if the base vector is not perpendicular:

- The control projects the base vector along the normal vector onto the working plane defined by the normal vector.

Correction behavior of the control if the base vector is not perpendicular and too short, parallel or antiparallel to the normal vector:

- If the normal vector contains the value 0 in the **NX** component, the base vector corresponds to the original X axis.
- If the normal vector contains the value 0 in the **NY** component, the base vector corresponds to the original Y axis.

Definition

Abbreviation	Definition
B e. g. in BX	Base vector
N e. g. in NX	Normal vector

PLANE POINTS**Application**

Use the **PLANE POINTS** function to define the working plane by three points.


Related topics

- Aligning the plane with touch probe cycle **431 MEASURE PLANE**


Further information: User's Manual for Measuring Cycles for Workpieces and Tools

Description of function


Points define a working plane by using their coordinates in the non-tilted workpiece coordinate system **W-CS**.

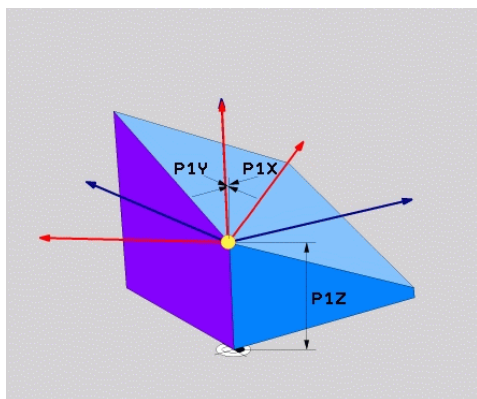

First point with coordinates **P1X**, **P1Y** and **P1Z**

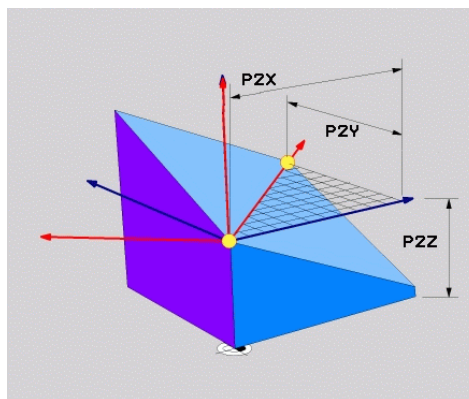

Second point with coordinates **P2X**, **P2Y** and **P2Z**

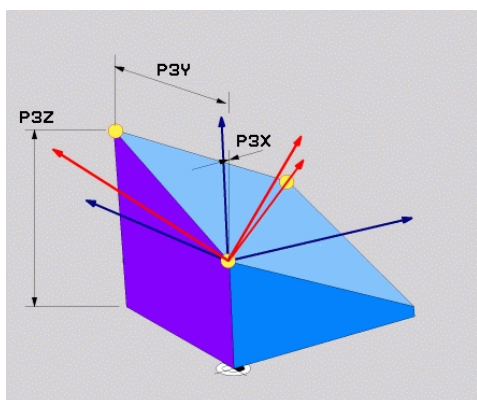

Third point with coordinates **P3X**, **P3Y** and **P3Z**

All nine coordinates must be defined even if one or several coordinates equals 0.

The first point with coordinates **P1X**, **P1Y** and **P1Z** defines the first point of the tilted X axis.



You can imagine that the first point defines the origin of the tilted X axis and therefore the point serving for orientation of the working plane coordinate system **WPL-CS**.


Ensure that the definition of the first point will not shift the workpiece datum. If the coordinates of the first point are to be programmed with the value 0, the workpiece datum may have to be shifted to that position before.

The second point with coordinates **P2X**, **P2Y** and **P2Z** defines the second point of the tilted X axis and consequently its orientation.



The orientation of the tilted Y axis in the defined working plane results automatically because both axes are perpendicular to one another.

The third point with coordinates **P3X**, **P3Y** and **P3Z** defines the slope of the tilted working plane.

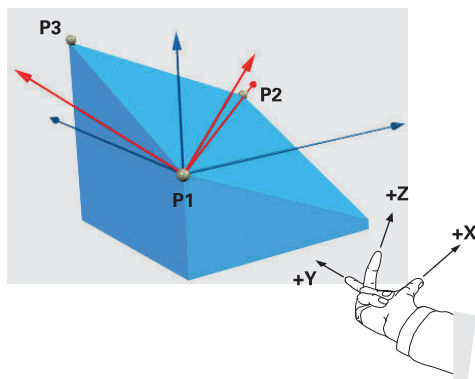

To direct the positive tool axis direction away from the workpiece, the following conditions apply to the position of the three points:


- Point 2 is to the right of point 1
- Point 3 is above the connecting lines between points 1 and 2

Application example

Example


11 PLANE POINTS P1X+0 P1Y+0 P1Z+0 P2X+1 P2Y+0 P2Z+0 P3X+0 P3Y+1 P3Z+1
TURN MB MAX FMAX SYM- TABLE ROT

Initial state

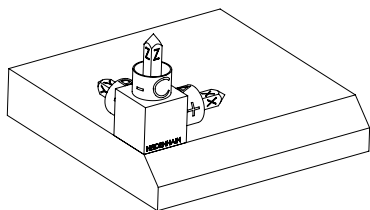

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

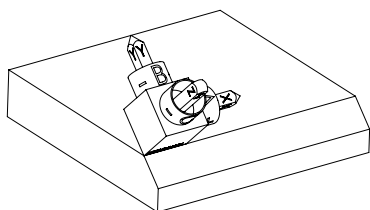

Using the first two points **P1** and **P2**, the control orients the X axis of the **WPL-CS**.

The orientation of the tilted X axis equals the orientation of the non-tilted X axis.

P3 defines the slope of the tilted working plane.

The orientations of the tilted Y and Z axes result automatically because all axes are perpendicular to one another.



The drawing dimensions or any values which will not alter the ratio between the entered values can be used.

In the example, **P2X** may also be defined by the workpiece width **+100**. **P3Y** and **P3Z** can also be programmed by using the chamfer width **+10**.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following points:

- **P1X+0, P1Y+0, P1Z+0** as well as **P2X+0, P2Y+1, P2Z+0** and **P3X-1, P3Y+0, P3Z+1** for the second chamfer
- **P1X+0, P1Y+0, P1Z+0** as well as **P2X-1, P2Y+0, P2Z+0** and **P3X+0, P3Y-1, P3Z+1** for the third chamfer
- **P1X+0, P1Y+0, P1Z+0** as well as **P2X+0, P2Y-1, P2Z+0** and **P3X+1, P3Y+0, P3Z+1** for the fourth chamfer


The values are referenced to the non-tilted workpiece coordinate system **W-CS**.

Remember that the workpiece datum must be shifted before each working plane definition.

Input

11 PLANE POINTS P1X+0 P1Y+0 P1Z+0 P2X+1 P2Y+0 P2Z+0 P3X+0 P3Y+1 P3Z+1
TURN MB MAX FMAX SYM- TABLE ROT

The NC function includes the following syntax elements:

Syntax element	Meaning
PLANE POINTS	Syntax initiator for the working plane definition by means of three points
P1X, P1Y and P1Z	Coordinates of the first point of the tilted X axis, referenced to the workpiece coordinate system W-CS Input: -999999999.999999...+999999999.999999
P2X, P2Y and P2Z	Coordinates of the second point, referenced to the W-CS for orienting the tilted X axis Input: -999999999.999999...+999999999.999999
P3X, P3Y and P3Z	Coordinates of the third point, referenced to the W-CS for inclining the tilted working plane Input: -999999999.999999...+999999999.999999
MOVE, TURN or STAY	Type of rotary axis positioning <div data-bbox="486 1064 1209 1182" style="border: 1px solid black; padding: 5px; margin-top: 10px;">  Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined. </div> <p>Further information: "Rotary axis positioning", Page 284</p>
SYM or SEQ	Select an unambiguous tilting solution Further information: "Tilting solution", Page 287 Optional syntax element
COORD ROT or TABLE ROT	Transformation type Further information: "Transformation types", Page 291 Optional syntax element

Definition

Abbreviation	Definition
P e. g. in P1X	Point

PLANE RELATIV**Application**

Use the **PLANE RELATIV** function to define the working plane by just one spatial angle.

The defined angle always takes effect with reference to the input coordinate system **I-CS**.

Further information: "Reference systems", Page 222

Description of function


A relative spatial angle defines a working plane as a rotation in the active reference system.

When the working plane is not tilted, the defined spatial angle is referenced to the non-tilted workpiece coordinate system **W-CS**.

When the working plane is tilted, the defined spatial angle is referenced to the working plane coordinate system **WPL-CS**.



PLANE RELATIV allows e. g. programming a chamfer on a tilted workpiece surface by tilting the working plane further by the chamfer angle.

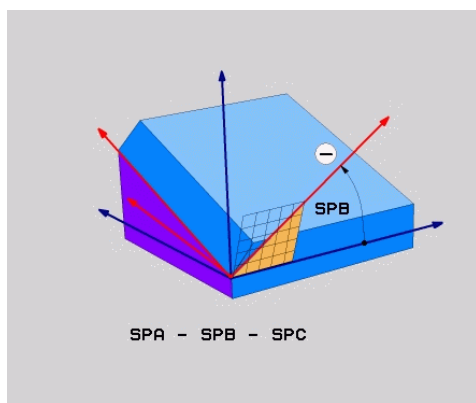

Additive spatial angle **SPB**

Each **PLANE RELATIV** function defines one spatial angle exclusively. However, it is possible to program any number of **PLANE RELATIV** functions in a row.


If you want to return the working plane that was active before the **PLANE RELATIV** function, define another **PLANE RELATIV** function with the same angle, but with the opposite algebraic sign.

Application example

Example


11 PLANE RELATIV SPA+45 TURN MB MAX FMAX SYM- TABLE ROT

Initial state

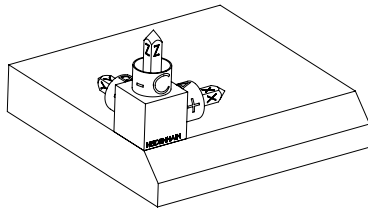

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

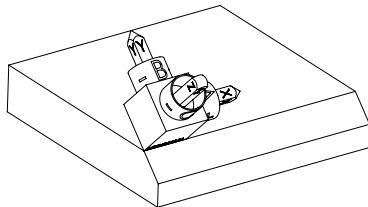

Using the spatial angle **SPA+45**, the control orients the Z axis of the **WPL-CS** to be perpendicular with the chamfer surface. The rotation by the **SPA** angle is around the non-tilted X axis. The orientation of the tilted X axis equals the orientation of the non-tilted X axis. The orientation of the tilted Y axis results automatically because all axes are perpendicular to one another.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following spatial angles:

- First PLANE RELATIVE function with **SPC+90** and another relative tilting with **SPA+45** for the second chamfer
- First PLANE RELATIVE function with **SPC+180** and another relative tilting with **SPA+45** for the third chamfer
- First PLANE RELATIVE function with **SPC+270** and another relative tilting with **SPA+45** for the fourth chamfer

The values are referenced to the non-tilted workpiece coordinate system **W-CS**.

Remember that the workpiece datum must be shifted before each working plane definition.



When shifting the workpiece datum further in a tilted working plane, incremental values must be defined.


Further information: "Note", Page 279

Input

11 PLANE RELATIV SPA+45 TURN MB MAX FMAX SYM- TABLE ROT

The NC function includes the following syntax elements:

Syntax element	Meaning
PLANE RELATIV	Syntax initiator for the working plane definition by means of one relative spatial angle
SPA, SPB or SPC	Rotation around the X, Y or Z axis of the workpiece coordinate system W-CS Input: -360.0000000...+360.0000000 <div>i When the working plane is tilted, the rotation is effective around the X, Y or Z axis in the working plane coordinate system WPL-CS</div>
MOVE, TURN or STAY	Type of rotary axis positioning <div>i Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined.</div> Further information: "Rotary axis positioning", Page 284
SYM or SEQ	Select an unambiguous tilting solution Further information: "Tilting solution", Page 287 Optional syntax element
COORD ROT or TABLE ROT	Transformation type Further information: "Transformation types", Page 291 Optional syntax element

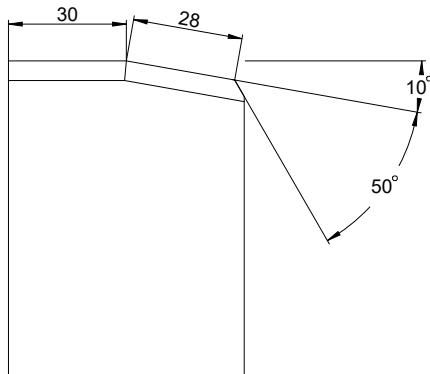Note**Incremental datum shift using a chamfer as example**

50° chamfer on a tilted workpiece surface

Example

```
11 TRANS DATUM AXIS X+30
```

```
12 PLANE RELATIV SPB+10 TURN MB MAX FMAX SYM- TABLE ROT
```

```
13 TRANS DATUM AXIS IX+28
```

```
14 PLANE RELATIV SPB+50 TURN MB MAX FMAX SYM- TABLE ROT
```

This procedure offers the advantage of being able to program directly with the drawing dimensions.

Definition

Abbreviation	Definition
SP e. g. in SPA	Spatial

PLANE RESET**Application**

Use the **PLANE RESET** function to reset all tilt angles and deactivate tilting of the working plane.

Description of function

The **PLANE RESET** function always executes two partial tasks:

- Reset all tilt angles, regardless of the selected tilt function or the type of angle
- Deactivate tilting of the working plane



No other tilting function will carry out this partial task!
Even when programming all angles with the value 0 in any tilting function, tilting of the working plane remains active.

The optional rotary axis positioning allows tilting the rotary axes back to the home position as the third partial task.


Further information: "Rotary axis positioning", Page 284

Input

11 PLANE RESET TURN MB MAX FMAX

The NC function includes the following syntax elements:

Syntax element	Meaning
PLANE RESET	Syntax initiator for resetting all tilting angles and for deactivating an active tilting function
MOVE, TURN or STAY	Type of rotary axis positioning


 Depending on the selection, the optional syntax elements **MB**, **DIST** and **F**, **F AUTO** or **FMAX** can be defined.

Further information: "Rotary axis positioning", Page 284

Note

Before every program run, ensure that no undesired coordinate transformations are effective. When needed, tilting of the working plane can also be deactivated manually in the **3-D rotation** window.

Further information: User's Manual for Setup and Program Run

 The status display allows checking the desired status of the tilting situation.


Further information: "Status display", Page 252

PLANE AXIAL

Application

Use the **PLANE AXIAL** function to define the working plane with anywhere from one to three absolute or incremental axis angles.

An axis angle can be programmed for each rotary axis available on the machine.

 Due to the option of defining only one axis angle, **PLANE AXIAL** can also be used on machines with only one rotary axis.

Please note that NC programs with axis angles always depend on the kinematics and therefore depend on the machine in question!

Related topics

- Programming independently of kinematics, using spatial angles


Further information: "PLANE SPATIAL", Page 255

Description of function

Axis angles define both the orientation of the working plane as well as the nominal coordinates of the rotary axes.

The axis angles must correspond to the axes present on the machine. If you try to program axis angles for rotary axes that do not exist on the machine, the control will generate an error message.

As the axis angles depend on the kinematics, a distinction must be made between the head and the table axes as far as the algebraic signs are concerned.

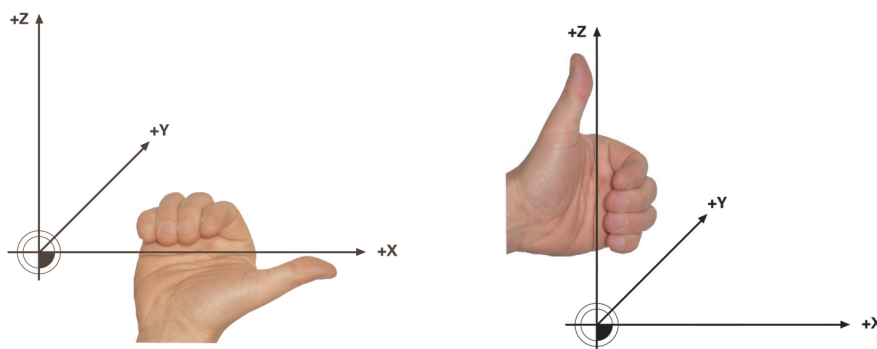

Extended right-hand rule for head rotary axes

Extended left-hand rule for table rotary axes

The thumb of the hand in question points in the positive direction of the axis around which the rotation occurs. If you curl your fingers, the curled fingers point in the positive direction of rotation.

Bear in mind that when working with rotary axes layered on top of one another, the positioning of the first rotary axis will also modify the position of the second rotary axis.


Application example

The example below applies to a machine with AC table kinematics whose two rotary axes are perpendicular and layered on top of one another.

Example


11 PLANE AXIAL A+45 TURN MB MAX FMAX

Initial state

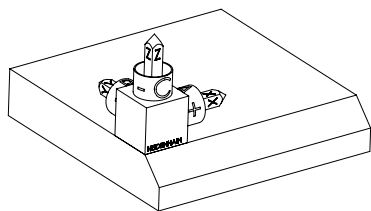

The initial state shows the position and orientation of the working plane coordinate system **WPL-CS** while still non-tilted. The workpiece datum which in the example was shifted to the top chamfer edge defines the position. The active workpiece datum also defines the position around which the control orients or rotates the **WPL-CS**.

Orientation of the tool axis

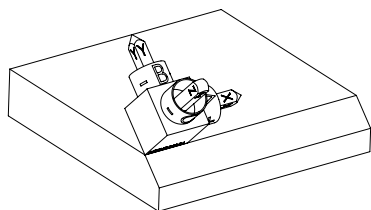


Using the defined axis angle **A**, the control orients the Z axis of the **WPL-CS** to be perpendicular with the chamfer surface. The rotation by angle **A** is around the non-tilted X axis.



To position the tool perpendicular to the chamfer surface, table rotary axis A must tilt to the rear.

In accordance with the extended left-hand rule for table axes, the algebraic sign of the A axis value must be positive.

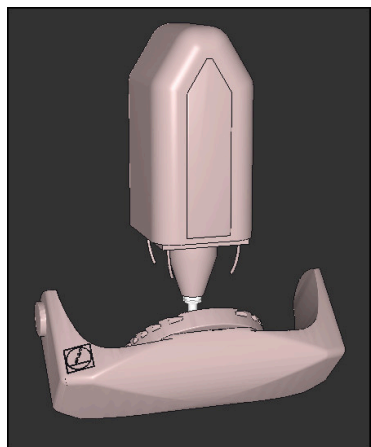

The orientation of the tilted X axis equals the orientation of the non-tilted X axis.

The orientation of the tilted Y axis results automatically because all axes are perpendicular to one another.



When programming the machining of the chamfer within a subprogram, an all-round chamfer can be produced using four working plane definitions.

If the example defines the working plane of the first chamfer, the remaining chamfers can be programmed using the following axis angles:

- **A+45** and **C+90** for the second chamfer
- **A+45** and **C+180** for the third chamfer
- **A+45** and **C+270** for the fourth chamfer


The values are referenced to the non-tilted workpiece coordinate system **W-CS**.

Remember that the workpiece datum must be shifted before each working plane definition.


Input

11 PLANE AXIAL A+45 TURN MB MAX FMAX


The NC function includes the following syntax elements:

Syntax element	Meaning
PLANE AXIAL	Syntax initiator for the working plane definition using one to three axis angle
A	When an A axis is available, nominal position of the A rotary axis Input: -99999999.9999999...+99999999.9999999 Optional syntax element
B	When a B axis is available, nominal position of the B rotary axis Input: -99999999.9999999...+99999999.9999999 Optional syntax element
C	When a C axis is available, nominal position of the C rotary axis Input: -99999999.9999999...+99999999.9999999 Optional syntax element
MOVE, TURN or STAY	Type of rotary axis positioning <div>  Depending on the selection, the optional syntax elements MB, DIST and F, F AUTO or FMAX can be defined. </div>

Further information: "Rotary axis positioning", Page 284

 The **SYM** or **SEQ** entries as well as **COORD ROT** or **TABLE ROT** are possible, but are not effective in conjunction with **PLANE AXIAL**.

Notes

 Refer to your machine manual.
If your machine allows spatial angle definitions, you can continue your programming with **PLANE RELATIV** after **PLANE AXIAL**.

- The axis angles of the **PLANE AXIAL** function are modally effective. If you program an incremental axis angle, the control will add this value to the currently effective axis angle. If you program two different rotary axes in two successive **PLANE AXIAL** functions, the new working plane is derived from the two defined axis angles.
- The **PLANE AXIAL** function does not take basic rotation into account.
- When used in conjunction with **PLANE AXIAL**, the programmed transformations mirroring, rotation and scaling do not affect the position of the rotation point nor the orientation of the rotary axes.
Further information: "Transformations in the workpiece coordinate system (W-CS)", Page 228
- Without the use of a CAM system, **PLANE AXIAL** is convenient only with rotary axes positioned at right angles.

Rotary axis positioning

Application


The type of rotary axis positioning defines how the control tilts the rotary axes to the calculated axis values.

The selection depends e. g. on the aspects below:

- Is the tool near the workpiece during tilting to position?
- Is the tool at a safe tilting position during tilting to position?
- May and can the rotary axes be positioned automatically?

Description of function

The control offers three types of rotary axis positioning from which one must be selected.

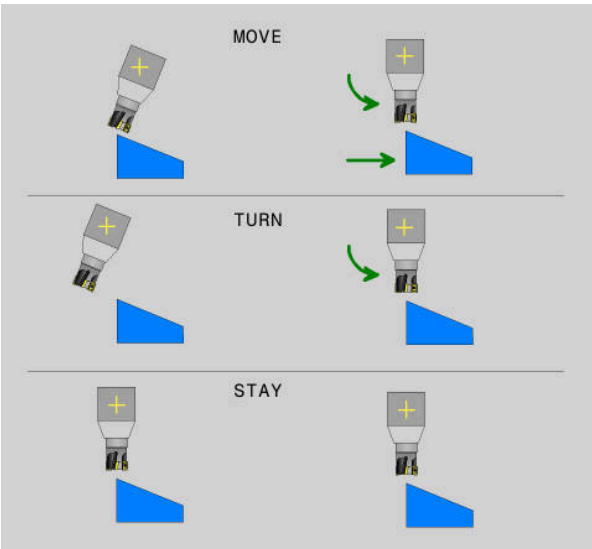

Type of rotary axis positioning	Meaning
MOVE	<p>If you perform tilting near the workpiece, then use this option.</p> <p>Further information: "Rotary axis positioning MOVE", Page 285</p>
TURN	<p>If the workpiece is so large that the range of traverse is not sufficient for the compensating movement of the linear axes, then use this option.</p> <p>Further information: "Rotary axis positioning TURN", Page 285</p>
STAY	<p>The control does not position any axes.</p> <p>Further information: "Rotary axis positioning STAY", Page 286</p>

Rotary axis positioning MOVE

The control positions the rotary axes and performs compensation movements in the linear principal axes.

The compensation movements ensure that the relative position between the tool and the workpiece will not change during the positioning process.

NOTICE

Danger of collision!

The center of rotation is in the tool axis. In the case of large tool diameters, the tool may plunge into the material during tilting. During the tilting movement, there is a risk of collision!

- Ensure sufficient distance between the tool and the workpiece


When **DIST** is not defined or when defining the value 0, the center of rotation and consequently the center of the compensation movements is in the tool tip.

When defining **DIST** with a value greater than 0, the center of rotation in the tool axis is shifted away from the tool tip by this value.



When wishing to tilt around a certain point on the workpiece, ensure the following:

- Prior to tilting to position, the tool is positioned directly above the desired point on the workpiece.
- The value defined in **DIST** matches exactly the clearance between the tool tip and the desired center of rotation.

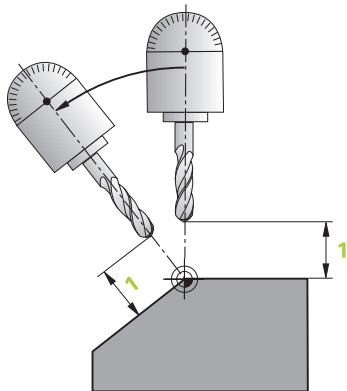

Rotary axis positioning TURN

The control positions only the rotary axes. The tool must be positioned after tilting to position.

Rotary axis positioning STAY

Both the rotary axes and the tool must be positioned after tilting to position.



Even with **STAY**, the control orients the working plane coordinate system **WPL-CS** automatically.

When selecting **STAY**, the rotary axes must be tilted to position in a separate positioning block after the **PLANE** function.

In the positioning block, use only the axis angles calculated by the control:

- **Q120** for the axis angle of the A axis
- **Q121** for the axis angle of the B axis
- **Q122** for the axis angle of the C axis

The variable avoids entry and calculating errors. In addition, no changes are required after changing the values within the **PLANE** functions.

Example

```
11 L A+Q120 C+Q122 FMAX
```

Input

MOVE

```
11 PLANE SPATIAL SPA+45 SPB+0 SPC+0 MOVE DISTO FMAX
```

Selecting **MOVE** allows defining the syntax elements below:

Syntax element	Meaning
DIST	Distance between center of rotation and the tool tip Input: 0...99999999.9999999 Optional syntax element
F, F AUTO or FMAX	Feed rate definition for automatic rotary axis positioning Optional syntax element

TURN

```
11 PLANE SPATIAL SPA+45 SPB+0 SPC+0 TURN MB MAX FMAX
```

Selecting **TURN** allows defining the syntax elements below:

Syntax element	Meaning
MB	Retraction in the current tool axis direction before positioning the rotary axis Values with an incremental effect can be entered or a retraction up to the traverse limit can be defined by selecting MAX . Input: 0...99999999.9999999 or MAX Optional syntax element
F, F AUTO or FMAX	Feed rate definition for automatic rotary axis positioning Optional syntax element

STAY

```
11 PLANE SPATIAL SPA+45 SPB+0 SPC+0 TURN MB MAX FMAX
```

Selecting **STAY** does not allow defining further syntax elements.

Note**NOTICE****Danger of collision!**

The control does not automatically check whether collisions can occur between the tool and the workpiece. Incorrect or no pre-positioning before tilting the tool into position can lead to a risk of collision during the tilting movement!

- ▶ Program a safe position before the tilting movement
- ▶ Carefully test the NC program or program section in the **Program run, single block** operating mode

Tilting solution**Application**

SYM (SEQ) allows selecting the desired option from several tilting solutions.




Unambiguous tilting solutions can be defined by using axis angles exclusively.

All other definition options can result in several tilting solutions, depending on the machine.


Description of function

The control offers two options from which one must be selected.

Option	Meaning
SYM	With SYM you select a tilting solution relative to the symmetry point of the master axis. Further information: "Tilting solution SYM", Page 288
SEQ	With SEQ you select a tilting solution relative to the basic position of the master axis. Further information: "Tilting solution SEQ", Page 289

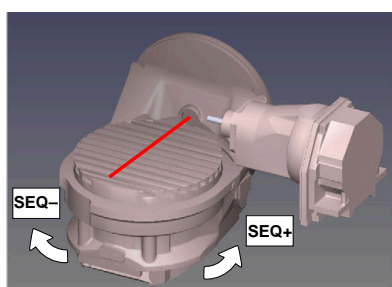

Reference for **SEQ**

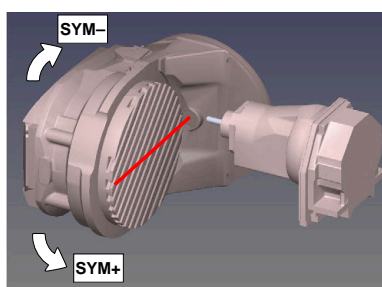

Reference for **SYM**

If the solution you have selected with **SYM** (**SEQ**) is not within the machine's range of traverse, then the control displays the **Entered angle not permitted** error message.

The entry of **SYM** or **SEQ** is optional.

If you do not define **SYM** (**SEQ**), then the control determines the solution as follows:

- 1 Check whether both possible solutions are within the traverse range of the rotary axes
- 2 Two possible solutions: Based on the current position of the rotary axes, choose the possible solution with the shortest path
- 3 One possible solution: Choose the only solution
- 4 No possible solution: Issue the error message **Entered angle not permitted**

Tilting solution SYM

With the **SYM** function, you select one of the possible solutions relative to the symmetry point of the master axis:

- **SYM+** positions the master axis in the positive half-space relative to the symmetry point
- **SYM-** positions the master axis in the negative half-space relative to the symmetry point

As opposed to **SEQ** **SYM** uses the symmetry point of the master axis as its reference. Every master axis has two symmetry positions, which are 180° apart from each other (sometimes only one symmetry position is in the traverse range).



To determine the symmetry point:

- ▶ Perform **PLANE SPATIAL** with any spatial angle and **SYM+**
- ▶ Save the axis angle of the master axis in a Q parameter (e.g., -80)
- ▶ Repeat the **PLANE SPATIAL** function with **SYM-**
- ▶ Save the axis angle of the master axis in a Q parameter (e.g., -100)
- ▶ Calculate the average value (e.g., -90)

The average value corresponds to the symmetry point.

Tilting solution SEQ

With the **SEQ** function, you select one of the possible solutions relative to the home position of the master axis:

- **SEQ+** positions the master axis in the positive tilting range relative to the home position
- **SEQ-** positions the master axis in the negative tilting range relative to the home position



SEQ assumes that the master axis is in its home position (0°). Relative to the tool, the master axis is the first rotary axis, or the last rotary axis relative to the table (depending on the machine configuration). If both possible solutions are in the positive or negative range, then the control automatically uses the closer solution (shorter path). If you need the second possible solution, then you must either pre-position the master axis (in the area of the second possible solution) before tilting the working plane, or work with **SYM**.

Examples

Machine with C rotary axis and A tilting table. Programmed function: PLANE SPATIAL SPA+0 SPB+45 SPC+0

Limit switch	Start position	SYM = SEQ	Resulting axis position
None	A+0, C+0	Not prog.	A+45, C+90
None	A+0, C+0	+	A+45, C+90
None	A+0, C+0	–	A–45, C–90
None	A+0, C–105	Not prog.	A–45, C–90
None	A+0, C–105	+	A+45, C+90
None	A+0, C–105	–	A–45, C–90
–90 < A < +10	A+0, C+0	Not prog.	A–45, C–90
–90 < A < +10	A+0, C+0	+	Error message
–90 < A < +10	A+0, C+0	–	A–45, C–90

Machine with B rotary axis and A tilting table (limit switches: A +180 and –100). Programmed function: PLANE SPATIAL SPA-45 SPB+0 SPC+0

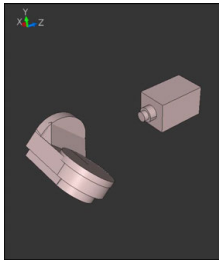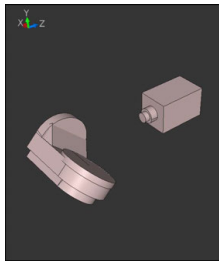SYM	SEQ	Resulting axis position	Kinematics view
+		A–45, B+0	
-		Error message	No solution in limited range
	+	Error message	No solution in limited range
	-	A–45, B+0	



The position of the symmetry point is contingent on the kinematics. If you change the kinematics (such as switching the head), then the position of the symmetry point changes as well.

Depending on the kinematics, the positive direction of rotation of **SYM** may not correspond to the positive direction of rotation of **SEQ**. Therefore, ascertain the position of the symmetry point and the direction of rotation of **SYM** on each machine before programming.

Transformation types

Application

COORD ROT and **TABLE ROT** influence the orientation of the working plane coordinate system **WPL-CS** through the axis position of a free rotary axis.




Any rotary axis becomes a free rotary axis with the following configuration:

- The rotary axis has no effect on the tool angle of inclination because the rotary axis and the tool axis are parallel in the tilting situation
- The rotary axis is the first rotary axis in the kinematic chain starting from the workpiece

The effect of the **COORD ROT** and **TABLE ROT** transformation types therefore depends on the programmed spatial angles and the machine kinematics.

Description of function

The control offers two options.

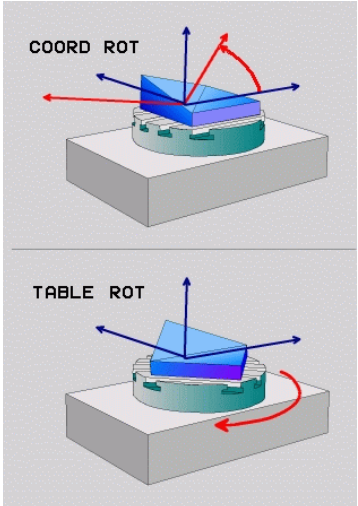

Option	Meaning
COORD ROT	<ul style="list-style-type: none"> > The control positions the free rotary axis to 0 > The control orients the working plane coordinate system in accordance with the programmed spatial angle
TABLE ROT	<p>TABLE ROT with:</p> <ul style="list-style-type: none"> ■ SPA and SPB equal to 0 ■ SPC equal or unequal to 0 > The control orients the free rotary axis in accordance with the programmed spatial angle > The control orients the working plane coordinate system in accordance with the basic coordinate system <p>TABLE ROT with:</p> <ul style="list-style-type: none"> ■ At least SPA or SPB unequal to 0 ■ SPC equal or unequal to 0 > The control does not position the free rotary axis. The position prior to tilting the working plane is maintained > Since the workpiece was not positioned, the control orients the working plane coordinate system in accordance with the programmed spatial angle

If no free rotary axis arises in a tilting situation, then the **COORD ROT** and **TABLE ROT** transformation types have no effect.


The entry of **COORD ROT** or **TABLE ROT** is optional.

If no transformation type was selected, then the control uses the **COORD ROT** transformation type for the **PLANE** functions


Example

The following example shows the effect of the **TABLE ROT** transformation type in conjunction with a free rotary axis.


11 L B+45 R0 FMAX	; Pre-position the rotary axis
12 PLANE SPATIAL SPA-90 SPB+20 SPC +0 TURN F5000 TABLE ROT	; Tilt the working plane

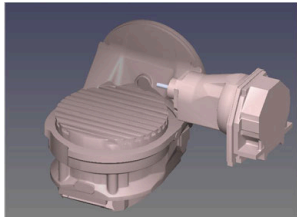

Origin

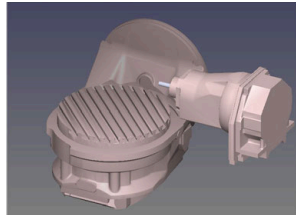

A = 0, B = 45

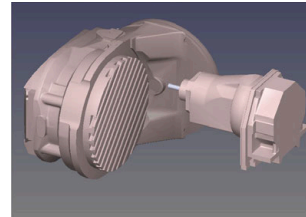

A = -90, B = 45

- > The control positions the B axis to the axis angle B+45
- > With the programmed tilting situation with SPA-90, the B axis becomes the free rotary axis
- > The control does not position the free rotary axis. The position of the B axis prior to the tilting of the working plane is maintained
- > Since the workpiece was not also positioned, the control orients the working plane coordinate system in accordance with the programmed spatial angle SPB +20

Notes

- For the positioning behavior with the **COORD ROT** and **TABLE ROT** transformation types, it makes no difference whether the free rotary axis is a table axis or a head axis.
- The resulting axis position of the free rotary axis depends on an active basic rotation, among other factors.
- The orientation of the working plane coordinate system also depends on a programmed rotation; for example, by means of Cycle **10 ROTATION**.

10.6 Inclined machining (option 9)**Application**

When pre-positioning the tool during machining, workpiece positions that are difficult to reach can be machined without collisions.


Related topics

- Compensating the tool angle of inclination with **FUNCTION TCPM** (option 9)
Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295
- Compensating the tool angle of inclination with **M128** (option 9)
Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432
- Tilting the working plane (option 8)
Further information: "Tilting the working plane (option 8)", Page 249
- Presets on the tool
Further information: "Presets on the tool", Page 154
- Reference systems
Further information: "Reference systems", Page 222

Requirements

- Machine with rotary axes
- Kinematics description
 To calculate the tilting angles, the control requires a kinematics description prepared by the machine manufacturer.
- Advanced Functions Set 2 (software option 9)

Description of function

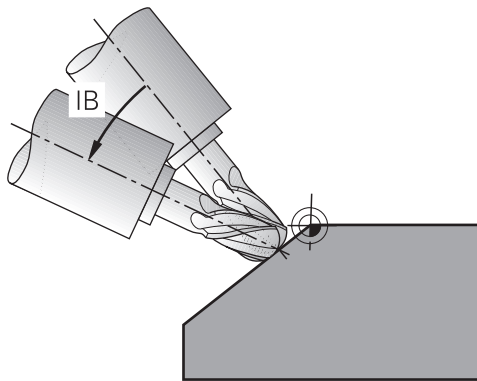

The **FUNCTION TCPM** function allows executing inclined machining. In this process, one working plane may be tilted.

Further information: "Tilting the working plane (option 8)", Page 249

Inclined machining can be implemented using the following functions:

- Incremental traverse of rotary axis
Further information: "Inclined machining with incremental process", Page 294
- Normal vectors
Further information: "Inclined machining using normal vectors", Page 295

Inclined machining with incremental process

Inclined machining can be implemented by changing the inclination angle in addition to the normal linear movement while function **FUNCTION TCPM** or **M128** is active, e. g. **L X100 Y100 IB-17 F1000 G01 G91 X100 Y100 IB-17 F1000**. In this process, the relative position of the tool's center of rotation remains the same while inclining the tool.

Example

* - ...	
12 L Z+50 R0 FMAX	; Position at clearance height
13 PLANE SPATIAL SPA+0 SPB-45 SPC +0 MOVE DIST50 F1000	; Define and activate the PLANE function
14 FUNCTION TCPM F TCP AXIS POS PATHCTRL AXIS	; Activate TCPM
15 L IB-17 F1000	; Pre-position the tool
* - ...	

Inclined machining using normal vectors

In case of inclined machining using normal vectors, the tool angle of inclination is achieved by means of straight lines **LN**.

To execute inclined machining with normal vectors, function **FUNCTION TCPM** or miscellaneous function **M128** must be activated.

Example

* - ...	
12 L Z+50 R0 FMAX	; Position at clearance height
13 PLANE SPATIAL SPA+0 SPB+45 SPC +0 MOVE DIST50 F1000	; Tilt the working plane
14 FUNCTION TCPM F TCP AXIS POS PATHCTRL AXIS	; Activate TCPM
15 LN X+31.737 Y+21,954 Z+33,165 NX+0,3 NY+0 NZ+0,9539 F1000 M3	; Incline the tool with the normal vector
* - ...	

10.7 Compensating the tool angle of inclination with FUNCTION TCPM (option 9)

Application

The **FUNCTION TCPM** function allows you to influence the positioning behavior of the control. When activating **FUNCTION TCPM**, the control compensates any changed tool angles of inclination by means of compensating movements of the linear axes.

FUNCTION TCPM allows e. g. changing the tool angle of inclination for inclined machining while the position of the tool location point relative to the contour remains the same.



Instead of **M128**, HEIDENHAIN recommends using the more powerful function **FUNCTION TCPM**.

Related topics


- Compensating the tool angle of inclination with **M128**
Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432
- Tilting the working plane
Further information: "Tilting the working plane (option 8)", Page 249
- Presets on the tool
Further information: "Presets on the tool", Page 154
- Reference systems
Further information: "Reference systems", Page 222

Requirements

- Machine with rotary axes
- Kinematics description
 To calculate the tilting angles, the control requires a kinematics description prepared by the machine manufacturer.
- Advanced Functions Set 2 (software option 9)

Description of function

FUNCTION TCPM is an improvement on the **M128** function which allows defining the behavior of the control while during the positioning of rotary axes.

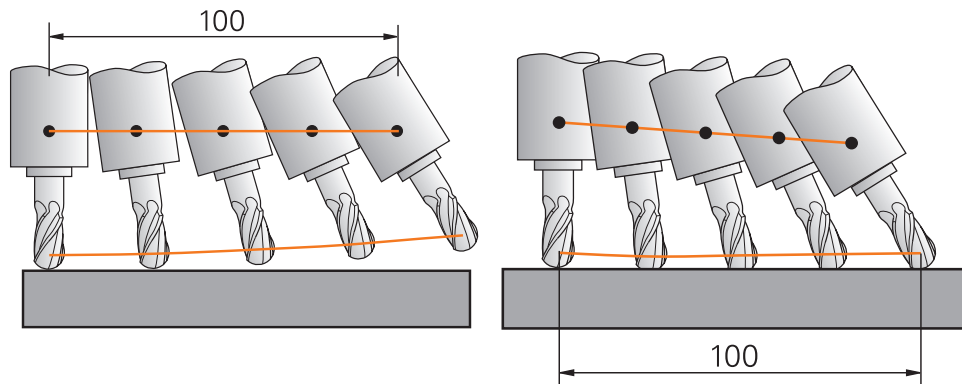

Behavior without **TCPM**

Behavior with **TCPM**

When **FUNCTION TCPM** is active, the control shows the **TCPM** icon in the position display.

Further information: User's Manual for Setup and Program Run

The **FUNCTION RESET TCPM** function resets the **FUNCTION TCPM** function.

Input

FUNCTION TCPM

10 FUNCTION TCPM F TCP AXIS POS PATHCTRL AXIS REFPNT CENTER-CENTER F1000

The NC function contains the following syntax elements:

Syntax element	Meaning
FUNCTION TCPM	Syntax initiator for compensating tool angles of inclination
F TCP or F CONT	Interpretation of the programmed feed rate Further information: "Interpretation of the programmed feed rate ", Page 297
AXIS POS or AXIS SPAT	Interpretation of programmed rotary axis coordinates Further information: "Interpretation of the programmed rotary axis coordinates", Page 298
PATHC-TRL AXIS or PATHCTRL VECTOR	Interpolation of tool angle of inclination Further information: "Interpolation of tool angle of inclination between start and end positions", Page 299
REFPNT TIP-TIP , REFPNT TIP-CENTER or REFPNT CENTER-CENTER	Selection of tool location point and tool rotation point Further information: "Selection of tool location point and tool rotation point", Page 300 Optional syntax element
F	Maximum feed rate for compensating movements in the linear axes for movements with a rotary-axis component Further information: "Limiting the linear-axis feed rate", Page 301 Optional syntax element

FUNCTION RESET TCPM

10 FUNCTION RESET TCPM

The NC function contains the following syntax elements:

Syntax element	Meaning
FUNCTION RESET TCPM	Syntax initiator for resetting of FUNCTION TCPM



Interpretation of the programmed feed rate

The control offers the following options for interpreting the feed rate:

Selection	Function
F TCP	When selecting F TCP , the control interprets the programmed feed rate as the relative speed between the tool location point and the workpiece.
F CONT	When selecting F CONT , the control interprets the programmed feed rate as contouring feed rate. In this process, the control transfers the contouring feed rate to the respective axes of the active NC block.



Interpretation of the programmed rotary axis coordinates

The control offers the options below for interpreting the tool angle of inclination between the start and end position:

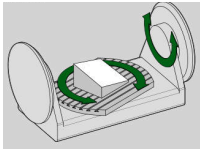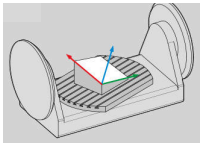Selection	Function
 <p>AXIS POS</p>	<p>When selecting AXIS POS, the control interprets the programmed rotary axis coordinates as axis angle. The control positions the rotary axes on the position defined in the NC program.</p> <p>The AXIS POS selection is primarily suitable in conjunction with perpendicularly arranged rotary axes. AXIS POS can only be used with different machine kinematics, e. g. 45° swivel heads if the programmed rotary axis coordinates define the desired working plane alignment correctly, e. g. using a CAM system.</p>
 <p>AXIS SPAT</p>	<p>If AXIS SPAT is selected, the control interprets the programmed rotary axis coordinates as spatial angles.</p> <p>The control preferably implements the spatial angles as orientation of the coordinate system and tilts only required axes.</p> <p>Select AXIS SPAT to allow using NC programs regardless of kinematics.</p> <p>Selecting AXIS SPAT allows defining spatial angles that are given with respect to the input coordinate system I-CS. The defined angles have the effect of incremental spatial angles. In the first traverse block after the FUNCTION TCPM function with AXIS SPAT, always program SPA, SPB and SPC, even with spatial angles of 0°.</p> <p>Further information: "Input coordinate system I-CS", Page 232</p>

Interpolation of tool angle of inclination between start and end positions

The control offers the options below for interpolating the tool angle of inclination between the programmed start and end positions:

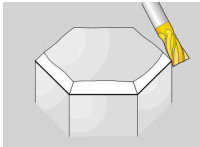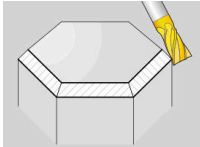Selection	Function
 <p>PATHCTRL AXIS</p>	<p>When selecting PATHCTRL AXIS, the control interpolates linearly between the start and end point.</p> <p>Use PATHCTRL AXIS with NC programs with small changes of the tool angle of inclination per NC block. In this case, the angle TA in Cycle 32 can be large.</p> <p>Further information: User's Manual for Machining Cycles</p> <p>PATHCTRL AXIS can be used both for face milling and also for peripheral milling.</p> <p>Further information: "3D tool compensation during face milling (option 9)", Page 321</p> <p>Further information: "3D tool compensation during peripheral milling (option 9)", Page 326</p>
 <p>PATHCTRL VECTOR</p>	<p>If PATHCTRL VECTOR is selected, the tool orientation within an NC block always lies in the plane that is defined by the start orientation and end orientation.</p> <p>With PATHCTRL VECTOR the control generate a plane surface even if there are large changes in the tool inclination angle.</p> <p>Use PATHCTRL VECTOR for peripheral milling if there are large changes in the tool inclination angle per NC block.</p>

In both cases, the control moves the programmed tool location point on a straight line between the start position and end position.



To obtain continuous movement, define Cycle **32** with a **tolerance for rotary axes**.

Further information: User's Manual for Machining Cycles

Selection of tool location point and tool rotation point

The control offers the options below for defining the tool location point and the tool rotation point:

Selection	Function
REFPNT TIP-TIP	When selecting REFPNT TIP-TIP , the tool location point and the tool rotation point are located at the tool tip.
REFPNT TIP-CENTER	<p>When selecting REFPNT TIP-CENTER, the tool location point is located at the tool tip. The tool rotation point is located at the tool center point.</p> <p>The option REFPNT TIP-CENTER is optimized for turning tools (option 50). When the control positions the rotary axes, the tool rotation point remains at the same position. This allows you to machine e. g. complex contours by simultaneous turning.</p> <p>Further information: "Theoretical and virtual tool tip", Page 310</p>
REFPNT CENTER-CENTER	<p>When selecting REFPNT CENTER-CENTER, the tool location point and the tool rotation point are located at the tool center point.</p> <p>Selecting REFPNT CENTER-CENTER allows executing CAM-generated NC programs which are referenced to the tool center point and still calibrate the tool relative to its tip.</p>



This allows the control to monitor the entire tool length for collisions while machining is in progress.

Previously, this functionality could only be achieved by shortening the tool with **DL** and without the control monitoring the remaining tool length.


Further information: "Tool data within variables", Page 306

If you use **REFPNT CENTER-CENTER** to program pocket milling cycles, the control generates an error message.

Further information: User's Manual for Machining Cycles

Further information: "Presets on the tool", Page 154

The reference point is optional. If you do not enter anything, the control uses **REFPNT TIP-TIP**.

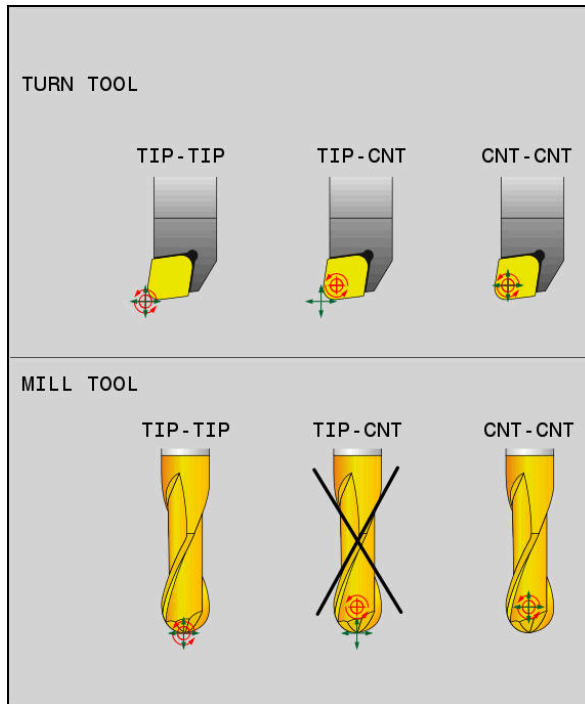

Selection options of tool preset and tool rotation point

Limiting the linear-axis feed rate

The optional input of **F** allows you to limit the feed rate of linear axes for motions with a rotary-axis component.

Thus, you can avoid fast compensation movements, e.g. in case of retraction movement at rapid traverse.



Make sure to select a value for the linear axis feed-rate limit that is not too small because large feed-rate variations may occur at the tool location point. Feed-rate variations impair the surface quality.

If **FUNCTION TCPM** is active, the feed-rate limit will only be effective for motions with a rotary-axis component, not for entirely linear motions.

The linear axis feed-rate limit remains in effect until you program a new value or reset **FUNCTION TCPM**.

Notes

NOTICE

Danger of collision!

Rotary axes with Hirth coupling must move out of the coupling to enable tilting. There is a danger of collision while the axis moves out of the coupling and during the tilting operation.

- ▶ Retract the tool before changing the position of the tilting axis

- Before positioning axes with **M91** or **M92**, and before a **TOOL CALL** block, reset the **FUNCTION TCPM** function.
- The following cycles can be used with active **FUNCTION TCPM**:
 - Cycle **32 TOLERANCE**
 - Cycle **800 ADJUST XZ SYSTEM** (option 50)
 - Cycle **882 SIMULTANEOUS ROUGHING FOR TURNING** (option 158)
 - Cycle **883 TURNING SIMULTANEOUS FINISHING** (option 158)
 - Cycle **444 PROBING IN 3-D**
- Use only ball-nose cutters for face milling in order to avoid contour damage. In combination with other tool shapes, check if the NC program contains any possible contour damage, using the **Simulation** workspace.

Further information: "Notes", Page 436

11

Compensations

11.1 Tool compensation for tool length and radius

Application

Delta values allow implementing tool compensation of the tool length and the tool radius. Delta values influence the calculated and therefore the active tool dimensions.

The tool length delta value **DL** is effective in the tool axis. The tool radius delta value **DR** is effective exclusively for radius-compensated traverses with the path functions and cycles.

Further information: "Path Functions", Page 167

Related topics

- Tool radius compensation

Further information: "Tool radius compensation", Page 306

- Tool compensation with compensation tables

Further information: "Tool compensation with compensation tables", Page 312

Description of function

The control distinguishes between two types of delta values:


- Delta values within the tool table serve for permanent tool compensation that is required e. g. due to wear.

These delta values can be determined e. g. by using a tool touch probe. The control automatically enters the delta values in the tool management.

Further information: User's Manual for Setup and Program Run

- Delta values within a tool call serve for a tool compensation that is effective exclusively in the current NC program, e. g. a workpiece oversize.

Further information: "Tool call by TOOL CALL", Page 159

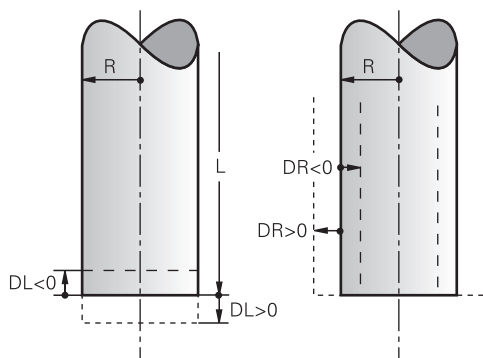

Delta values represent deviations from the length and radius of a tool.

A positive delta value enlarges the current tool length or the tool radius. The tool then cuts less material during machining, e. g. for a workpiece oversize.

A negative delta value reduces the current tool length or the tool radius. The tool then cuts more material during machining.

For programming delta values in an NC program, define the value within a tool call or by using a compensation table.

Further information: "Tool call by TOOL CALL", Page 159

Further information: "Tool compensation with compensation tables", Page 312

Delta values within a tool call can also be defined by using variables.

Further information: "Tool data within variables", Page 306

Tool length compensation

The control takes the tool length compensation into account as soon as a tool is called. The control performs tool length compensation only on tools of length $L > 0$.

In tool length compensation, the control takes delta values from the tool table and the NC program into account.

Active tool length = $L + DL_{TAB} + DL_{Prog}$

- L:** Tool length **L** from the tool table
- DL_{TAB} :** Tool length delta value **DL** from the tool table
- DL_{Prog} :** Tool length delta value **DL** from the tool call or the compensation table
- The most recently programmed value takes effect.
- Further information:** "Tool call by TOOL CALL", Page 159
- Further information:** "Tool compensation with compensation tables", Page 312

NOTICE

Danger of collision!

The control uses the defined tool length from the tool table for compensating the tool length. Incorrect tool lengths will result in an incorrect tool length compensation. The control does not perform tool length compensation or a collision check for tools with a length of **0** and after **TOOL CALL 0**. Danger of collision during subsequent tool positioning movements!

- ▶ Always define the actual tool length of a tool (not just the difference)
- ▶ Use **TOOL CALL 0** only to empty the spindle

Tool radius compensation

The control takes the tool radius compensation into account in the following cases:

- In case of active radius compensation **RR** or **RL**
Further information: "Tool radius compensation", Page 306
- Within machining cycles
Further information: User's Manual for Machining Cycles
- In case of straight lines **LN** with surface normal vectors
Further information: "Straight line LN", Page 318

In tool radius compensation, the control takes the delta values from the tool table and the NC program into account.

Active tool radius = $R + DR_{TAB} + DR_{Prog}$

- R:** Tool radius **R** from the tool table
Further information: User's Manual for Setup and Program Run
- DR_{TAB} :** Tool radius delta value **DR** from the tool table
Further information: User's Manual for Setup and Program Run
- DR_{Prog} :** Tool radius delta value **DR** from the tool call or the compensation table
- The most recently programmed value takes effect.
- Further information:** "Tool call by TOOL CALL", Page 159
- Further information:** "Tool compensation with compensation tables", Page 312

Tool data within variables

When executing a tool call, the control calculates all tool-specific values and saves them within variables.

Further information: "Preassigned Q parameters", Page 459

Active tool length and tool radius:

Q parameters	Function
Q108	ACTIVE TOOL RADIUS
Q114	ACTIVE TOOL LENGTH

After the control has saved the current values within variables, the variables can be used in the NC program.

Application example

Use Q parameter **Q108 ACTIVE TOOL RADIUS** and the tool length delta values to shift the tool location point of a ball-nose cutter to the ball center.

```
11 TOOL CALL "BALL_MILL_D4" Z S10000
```

```
12 TOOL CALL DL-Q108
```

This allows the control to monitor the complete tool for collisions and the dimensions used in the NC program can still be programmed with reference to the ball center.

Notes

- The control shows delta values from the tool management graphically in the simulation. For delta values from the NC program or from compensation tables, the control only changes the position of the tool in the simulation.

Further information: "Simulation of tools", Page 566

- The machine manufacturer uses the optional machine parameter **prog-ToolCalIDL** (no. 124501) to define whether the control will consider delta values from a tool call in the **Positions** workspace.

Further information: "Tool call", Page 159

Further information: User's Manual for Setup and Program Run

- The control takes up to six axes including the rotary axes into account in the tool compensation.

11.2 Tool radius compensation

Application

When tool radius compensation is active, the control will no longer reference the positions in the NC program to the tool center point, but to the cutting edge.

Use tool radius compensation to program drawing dimensions without having to consider the tool radius. This lets you use a tool with deviating dimensions without having to modify the program after a tool has broken.

Related topics

- Presets on the tool

Further information: "Presets on the tool", Page 154

Requirements

- Defined tool data in the tool management

Further information: User's Manual for Setup and Program Run

Description of function

The control takes the active tool radius into account during tool radius compensation. The active tool radius results from the tool radius **R** and the delta values **DR** from the tool management and the **NC program**.

Active tool radius = $R + DR_{TAB} + DR_{Prog}$


Further information: "Tool compensation for tool length and radius", Page 304

Paraxial traverses can be compensated as follows:

- **R+**: lengthens a paraxial traverse by the amount of the tool radius
- **R-**: shortens a paraxial traverse by the amount of the tool radius

An NC block with path functions can contain the following types of tool radius compensation:


- **RL**: tool radius compensation, on the left of the contour
- **RR**: tool radius compensation, on the right of the contour
- **R0**: resets an active tool radius compensation, positioning with the tool center point

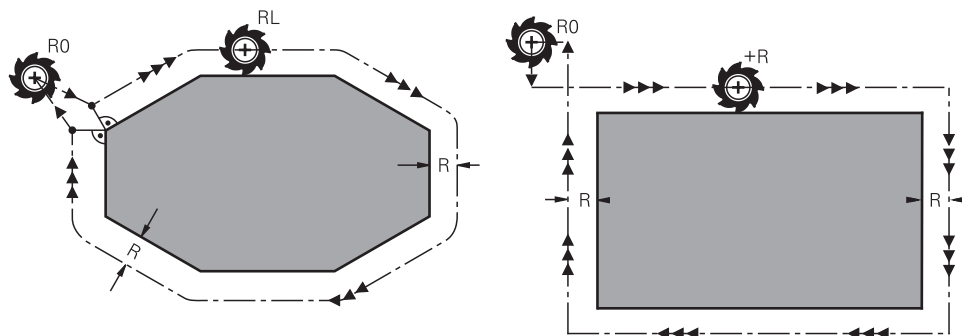

Radius-compensated traverse with path functions

Radius-compensated traverse with paraxial movements

The tool center moves along the contour at a distance equal to the radius. **Right** or **left** are to be understood as based on the direction of tool movement along the workpiece contour.

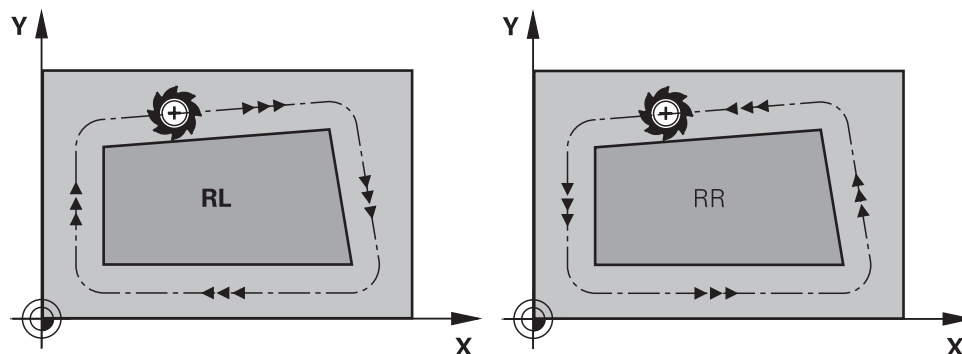

RL: The tool moves on the left of the contour

RR: The tool moves on the right of the contour

Effect

Tool radius compensation is effective starting from the NC block in which tool radius compensation is programmed. Tool radius compensation is effective modally and at the end of the block.



Program tool radius compensation only once, allowing e. g. changes to be implemented quicker.

The control resets tool radius compensation in the following cases:

- Positioning block with **R0**
- **DEP** function for departing from the contour
- Selection of a new NC program

Notes

NOTICE

Danger of collision!

The control needs safe positions for contour approach and departure. These positions must enable the control to perform compensating movements when radius compensation is activated and deactivated. Incorrect positions can lead to contour damage. Danger of collision during machining!

- ▶ Program safe approach and departure positions at a sufficient distance from the contour
- ▶ Consider the tool radius
- ▶ Consider the approach strategy

- When tool radius compensation is active, the control displays an icon in the **Positions** workspace.
Further information: User's Manual for Setup and Program Run
- Between two NC blocks with different radius compensations **RR** and **RL** you must program at least one traversing block in the working plane without radius compensation (that is, with **R0**).
- The control takes up to six axes including the rotary axes into account in the tool compensation.

Notes in connection with the machining of corners

- Outside corners:
If you program radius compensation, the control moves the tool around outside corners on a transitional arc. If necessary, the control reduces the feed rate at outside corners to reduce machine stress, for example at very great changes of direction
- Inside corners:
The control calculates the intersection of the tool center paths at inside corners under radius compensation. From this point it then starts the next contour element. This prevents damage to the workpiece at the inside corners. The permissible tool radius, therefore, is limited by the geometry of the programmed contour.

11.3 Tooth radius compensation for turning tools (option 50)

Application

The tip of a lathe tool has a certain radius (**RS**). When machining tapers, chamfers and radii, this results in distortions on the contour because the programmed traverse paths refer to the theoretical tool tip S. TRC prevents the resulting deviations.

Related topics

- Tool data of turning tools
- Radius compensation with **RR** and **RL** in milling mode

Further information: User's Manual for Setup and Program Run

Requirement


- Combined milling/turning (software option 50)
- Required tool data defined for the tool type

Further information: User's Manual for Setup and Program Run

Description of function


The control checks the cutting geometry with the point angle **P-ANGLE** and the setting angle **T-ANGLE**. Contour elements in the cycle are processed by the control only as far as this is possible with the specific tool.

In the turning cycles the control automatically carries out tool radius compensation. In specific traversing blocks and within programmed contours, activate TRC with **RL** or **RR**.

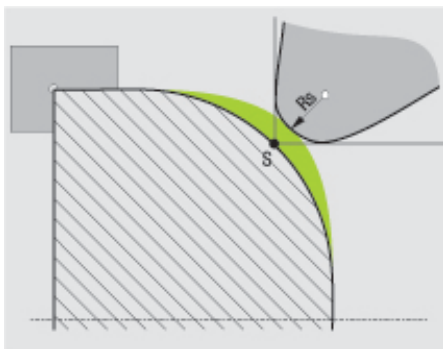


Offset between the tooth radius **RS** and the theoretical tool tip S.

Theoretical and virtual tool tip

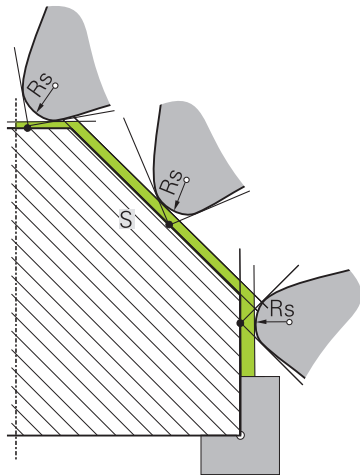

Inclined surface with theoretical tool tip

The theoretical tool tip is effective in the tool coordinate system. When the tool is inclined, the position of the tool tip rotates with the tool.

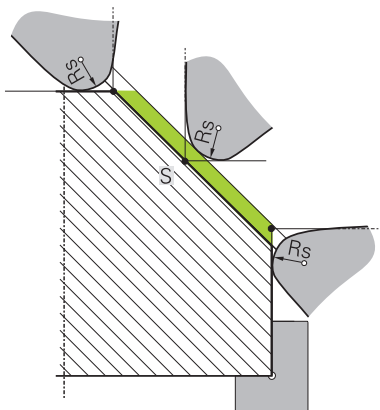

Inclined surface with virtual tool tip

Use **FUNCTION TCPM** with the selection **REFPNT TIP-CENTER** to activate the virtual tool tip. Correct tool data are the prerequisite for calculating the virtual tool tip.


Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

The virtual tool tip is effective in the workpiece coordinate system. When the tool is inclined, the virtual tool tip remains unchanged as long as the tool orientation **TO** is the same. The control automatically switches the status display **TO** and thus also the virtual tool tip if the tool leaves the angle range valid for **TO 1**, for example.

The virtual tool tip enables you to perform inclined paraxial longitudinal and transverse machining operations with high contour accuracy even without radius compensation.

Further information: "Simultaneous turning", Page 130

Notes

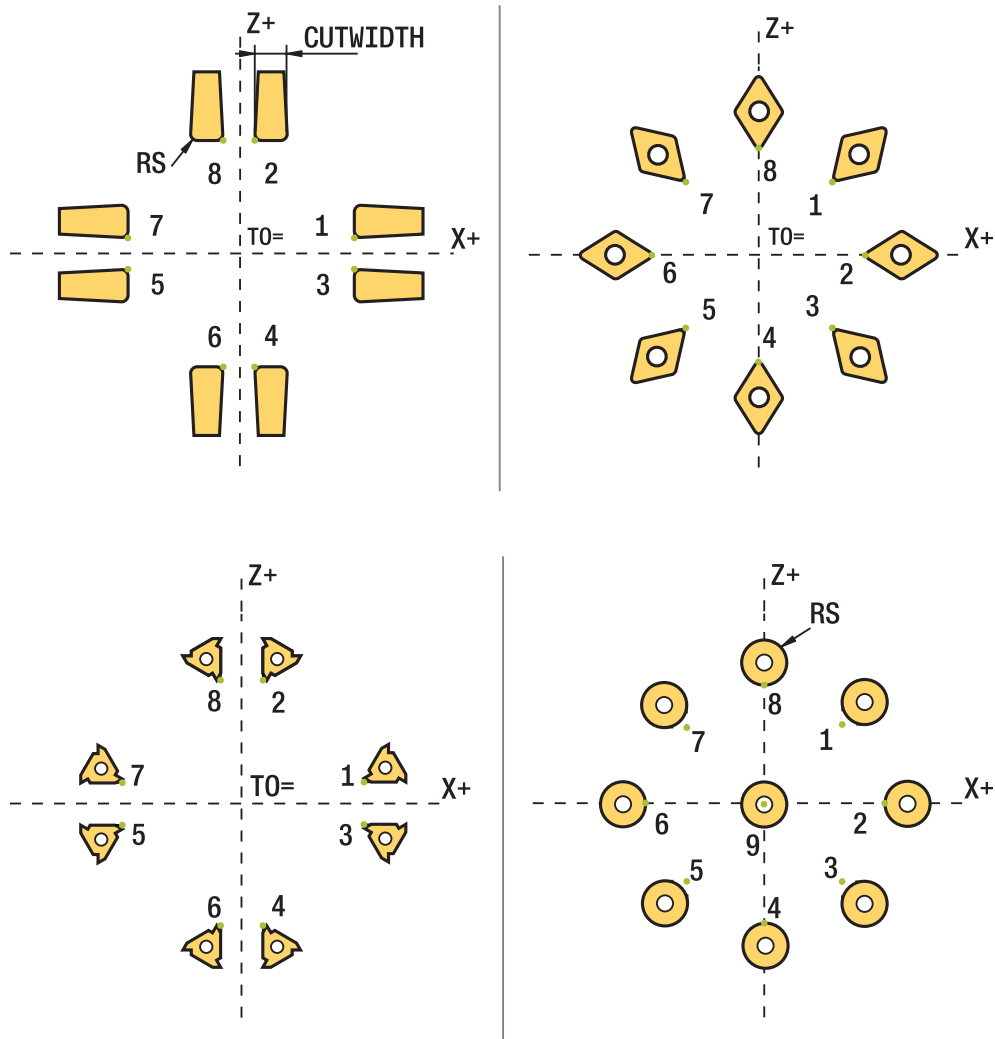

- The direction of the radius compensation is not clear when the tool-tip position (**TO=2, 4, 6, 8**) is neutral. In this case, TRC is only possible within fixed machining cycles.
- Tool tip radius compensation is also possible during inclined machining.
Active miscellaneous functions limit the possibilities here:
 - With **M128** tool-tip radius compensation is possible only in combination with machining cycles
 - **M144** or **FUNCTION TCPM** with **REFPNT TIP-CENTER** also allows tool-tip radius compensation with all positioning blocks, e.g. with **RL/RR**
- The control displays a warning when residual material is left behind due to the angle of the secondary cutting edges. You can suppress the warning with the machine parameter **suppressResMatlWar** (no. 201010).

11.4 Tool compensation with compensation tables

Application

With the compensation table, you can save compensations in the tool coordinate system (T-CS) or in the working plane coordinate system (WPL-CS). The saved compensations can be called during the NC program for compensating the tool.

The compensation tables offer the following benefits:

- Values can be changed without adapting the NC program
- Values can be changed during NC program run

Via the file name extension, you can determine in which coordinate system the control will perform the compensation.

The control provides the following compensation tables:

- tco (tool correction): Compensation in the tool coordinate system (**T-CS**)
- wco (workpiece correction): Compensation in the working plane coordinate system (**WPL-CS**)

Further information: "Reference systems", Page 222

Related topics

- Contents of the compensation tables
Further information: "Compensation table *.tco", Page 615
Further information: "Compensation table *.wco", Page 617
- Editing compensation tables during program run
Further information: User's Manual for Setup and Program Run

Description of function

In order to compensate tools by using the compensation tables, the steps below are needed:

- Creating a compensation table
Further information: "Creating a compensation table", Page 618
- Activating the compensation table in the NC program
Further information: "Selecting a compensation table with SEL CORR-TABLE", Page 314
- As an alternative, activating the compensation table manually for the program run
Further information: "Activating the compensation tables manually", Page 313
- Activating a compensation value
Further information: "Activating a compensation value with FUNCTION CORRDATA", Page 314

The compensation table values can be edited within the NC program.

Further information: "Accessing table values ", Page 599

The values in the compensation tables can be edited even while the program is running.

Further information: User's Manual for Setup and Program Run

Tool compensation in the tool coordinate system T-CS:

The compensation table ***.tco** defines compensation values for the tool in tool coordinate system **T-CS**.

Further information: "Tool coordinate system T-CS", Page 234

The compensations have the following effects:

- In the case of milling cutters, as an alternative to the delta values in the **TOOL CALL**

Further information: "Tool call by TOOL CALL", Page 159

- In the case of turning tools, as an alternative to **FUNCTION TURNDATA CORR-TCS** (option 50)

Further information: "Compensating turning tools with FUNCTION TURNDATA CORR (option 50)", Page 315

- In the case of grinding tools, as compensation for **LO** and **R-OVR** (option 156)

Further information: User's Manual for Setup and Program Run

Tool compensation in the working plane coordinate system WPL-CS:

The values from the compensation tables with the ***.wco** file name extension are applied as shifts in the working plane coordinate system (**WPL-CS**).

Further information: "Working plane coordinate system WPL-CS", Page 230

The ***.wco** compensation tables are used mainly for turning (option 50).

The compensations have the following effects:

- For turning operations, as an alternative to **FUNCTION TURNDATA CORR-WPL** (option 50)
- An X shift affects the radius

The following options are available for a shift in the WPL-CS:

- **FUNCTION TURNDATA CORR-WPL**
- **FUNCTION CORRDATA WPL**
- Shifting with the turning-tool table
 - Optional **WPL-DX-DIAM** column
 - Optional **WPL-DZ** column



The shifts programmed with **FUNCTION TURNDATA CORR-WPL** and **FUNCTION CORRDATA WPL** are alternative programming options for the same shift.

A shift in the working plane coordinate system (**WPL-CS**) defined by the turning-tool table is added to the **FUNCTION TURNDATA CORR-WPL** and **FUNCTION CORRDATA WPL** functions.

Activating the compensation tables manually

The compensation tables can be activated manually for the **Program Run** operating mode.

In the **Program Run** operating mode, the **Program settings** window contains the **Tables** area. In this area, a datum table and both compensation tables can be selected in one selection window for running the program.

When activating a table, the control will highlight this table with the status **M**.

11.4.1 Selecting a compensation table with SEL CORR-TABLE

Application

If you are using compensation tables, then use the function **SEL CORR-TABLE** to activate the desired compensation table from within the NC program.

Related topics

- Activating the compensation values in the table
Further information: "Activating a compensation value with FUNCTION CORRDATA", Page 314
- Contents of the compensation tables
Further information: "Compensation table *.tco", Page 615
Further information: "Compensation table *.wco", Page 617

Description of function

For the NC program, both a table ***.tco** and a table ***.wco** can be selected.

Input

11 SEL CORR-TABLE TCS "TNC:\table \corr.tco"	; Select compensation table corr.tco
---	---

The NC function includes the following syntax elements:

Syntax element	Meaning
SEL CORR-TABLE	Syntax initiator for selecting a compensation table
TCS or WPL	Compensation in the tool coordinate system T-CS or in the working plane coordinate system WPL-CS
" " or QS	Path of table Fixed or variable name Selection by means of a selection window

11.4.2 Activating a compensation value with FUNCTION CORRDATA

Application

The **FUNCTION CORRDATA** function allows activating a row of the compensation table for the active tool.

Related topics

- Selecting a compensation table
Further information: "Selecting a compensation table with SEL CORR-TABLE", Page 314
- Contents of the compensation tables
Further information: "Compensation table *.tco", Page 615
Further information: "Compensation table *.wco", Page 617

Description of function

The activated compensation values are effective up to the next tool change or until the end of the NC program.

If you change a value, then this change does not become active until the compensation is called again.

Input**11 FUNCTION CORRDATA TCS #1**; Activate row 1 of compensation table
***.tco**

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION CORRDATA	Syntax initiator for activating a compensation value
TCS, WPL or RESET	Compensation in the tool coordinate system T-CS or in the working plane coordinate system WPL-CS or reset compensation
#, " " or QS	Desired table row Fixed or variable number or name Selection by means of a selection window Only when TCS or WPL are selected
TCS or WPL	Reset the compensation in T-CS or in WPL-CS Only if RESET has been selected

11.5 Compensating turning tools with FUNCTION TURNDATA CORR (option 50)

Application

With **FUNCTION TURNDATA CORR** you can define additional compensation values for the active tool. In the **TURNDATA CORR FUNCTION** you can enter delta values for tool lengths in the X direction **DXL** and in the Z direction **DZL**. The compensation values have an additive effect on the compensation values from the turning tool table.

The compensation can be defined in the tool coordinate system **T-CS** or in the working plane coordinate system **WPL-CS**.

Further information: "Reference systems", Page 222

Related topics

- Delta values in the turning tool table
Further information: User's Manual for Setup and Program Run
- Tool compensation with compensation tables
Further information: "Tool compensation with compensation tables", Page 312

Requirement

- Combined milling/turning (software option 50)
- Required tool data defined for the tool type
Further information: User's Manual for Setup and Program Run

Description of function

The coordinate system in which the compensation is effective can be defined:

- **FUNCTION TURNDATA CORR-TCS:** The tool compensation is effective in the tool coordinate system
- **FUNCTION TURNDATA CORR-WPL:** The tool compensation is effective in the workpiece coordinate system

With **FUNCTION TURNDATA CORR-TCS** you can define a cutter radius oversize **DRS**. This enables you to program an equidistant contour oversize. **DCW** allows you to compensate the recessing width of a recessing tool.

Tool compensation **FUNCTION TURNDATA CORR-TCS** is always effective in the tool coordinate system, even during inclined machining.

FUNCTION TURNDATA CORR is always effective for the active tool. A renewed **TOOL CALL** deactivates compensation again. When you exit the NC program (e.g. with PGM MGT), the control automatically resets the compensation values.

Input

11 FUNCTION TURNDATA CORR-TCS:Z/X
DZL:0.1 DXL:0.05 DCW:0.1

; Tool compensation in Z direction,
X direction and for the width of the
recessing tool

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION TURNDATA CORR	Syntax initiator for tool compensation of a turning tool
CORR-TCS:Z/X or CORR-WPL:Z/X	Tool compensation in the tool coordinate system T-CS or in the working plane coordinate system WPL-CS
DZL:	Delta value for the tool length in Z direction Optional syntax element
DXL:	Delta value for the tool length in X direction Optional syntax element
DCW:	Delta value for the recessing tool width Only if CORR-TCS:Z/X was selected Optional syntax element
DRS:	Delta value for the cutter radius Only if CORR-TCS:Z/X was selected Optional syntax element

Note

During interpolation turning the functions **FUNCTION TURNDATA CORR** and **FUNCTION TURNDATA CORR-TCS** do not have any effect.

If you want to compensate a turning tool in Cycle **292 CONTOUR.TURNG.INTRP.**, compensation needs to be performed in the cycle or in the tool table.

Further information: User's Manual for Machining Cycles

11.6 3D tool compensation (option 9)

11.6.1 Fundamentals

The control allows 3D tool compensation in CAM-generated NC programs with surface-normal vectors.

Further information: "Straight line LN", Page 318


The control displaces the tool in the direction of the surface normals by the total of the delta values from tool management, tool call and compensation tables.

Further information: "Tools for 3D tool compensation", Page 319


3D tool compensation can be used e. g. in the cases below:

- Compensation for re-worked tools for compensating small differences between the programmed and the actual tool dimensions
- Compensation for substitute tools with deviating diameters for compensating even larger differences between the programmed and the actual tool dimensions
- Generating a constant workpiece oversize which may serve e. g. as a finishing allowance

3D tool compensation saves time since there is no need to recalculate and output from the CAM system.

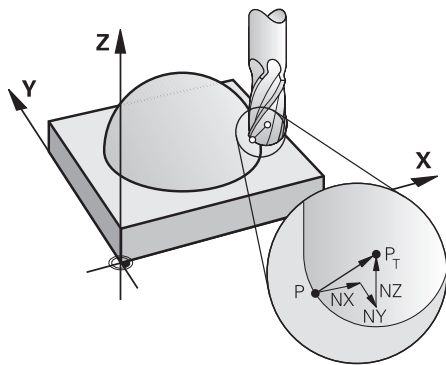

For an optional tool angle of inclination, the NC blocks must include an additional tool vector with the components TX, TY and TZ.

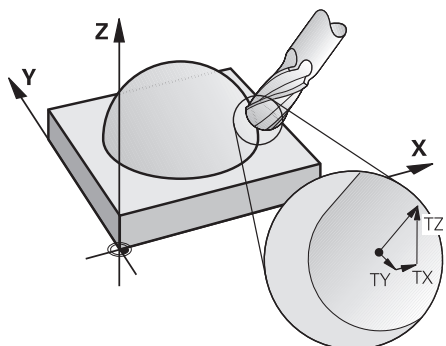

Note the differences between face milling and peripheral milling.

Further information: "3D tool compensation during face milling (option 9)", Page 321

Further information: "3D tool compensation during peripheral milling (option 9)", Page 326

11.6.2 Straight line LN

Application

Straight lines **LN** are a prerequisite for 3D compensation. Within straight lines **LN**, a surface normal vector defines the direction of the 3D tool compensation. An optional tool vector defines the tool angle of inclination.

Related topics

- Fundamentals of 3D compensation

Further information: "Fundamentals", Page 317

Requirements

- Advanced Functions Set 2 (software option 9)
- NC program created with a CAM system

Straight lines **LN** cannot be programmed directly on the control, but require a CAM system.

Further information: "CAM-generated NC programs", Page 395

Description of function

As with a straight line **L**, a straight line **LN** is used to define the target point coordinates.

Further information: "Straight line L", Page 175

In addition, the straight lines **LN** contain a surface normal vector as well as an optional tool vector.

Input

```
LN X+31.737 Y+21.954 Z+33.165 NX+0.2637581 NY+0.0078922 NZ-0.8764339 TX
+0.0078922 TY-0.8764339 TZ+0.2590319 F1000 M128
```

The NC function includes the following syntax elements:

Syntax element	Meaning
LN	Syntax initiator for straight line with vectors
X, Y, Z	Coordinates of the straight-line end point
NX, NY, NZ	Components of the surface normal vector
TX, TY, TZ	Components of the tool vector Optional syntax element
R0, RL or RR	Tool radius compensation Further information: "Tool radius compensation", Page 306 Optional syntax element
F, FMAX, FZ, FU or F AUTO	Feed rate Further information: User's Manual for Setup and Program Run Optional syntax element
M	Additional function Optional syntax element

Notes

- In the NC syntax, the order must be X,Y, Z for the position and NX, NY, NZ as well as TX, TY, TZ for the vectors.
- The NC syntax of LN blocks must always indicate all of the coordinates and all of the surface-normal vectors, even if the values have not changed from the previous NC block.
- Calculate the vectors as exactly as possible and specify them with at least 7 decimal places in order to avoid drastic feed rate decreases during machining.
- The CAM-generated NC program must contain normalized vectors.
- The 3D tool compensation using surface normal vectors is effective for the coordinate data specified for the main axes X, Y, Z.

Definition

Normalized vector

A normalized vector is a mathematical quantity possessing a magnitude of 1 and a direction. The direction is defined by the components X, Y and Z.

11.6.3 Tools for 3D tool compensation

Application

3D tool compensation can be used with the following tool shapes: end mill, toroid cutter and ball-nose cutter.

Related topics

- Compensation in tool management
Further information: "Tool compensation for tool length and radius", Page 304
- Compensation in tool call
Further information: "Tool call by TOOL CALL", Page 159
- Compensation with compensation tables
Further information: "Tool compensation with compensation tables", Page 312

Description of function

The tool shapes can be distinguished by columns **R** and **R2** of the tool management:


- End mill: **R2** = 0
- Toroid cutter: **R2** > 0
- Ball-nose cutter: **R2** = **R**

Further information: User's Manual for Setup and Program Run

The delta values **DL**, **DR** and **DR2** are used to adapt the tool management values to the actual tool.

The control then compensates for the tool position by the sum of the delta values from the tool table and the programmed tool compensation (tool call or compensation table).

The surface normal vector of straight lines **LN** defines the direction in which the control compensates the tool. The surface normal vector always points to the tool radius 2 center CR2.

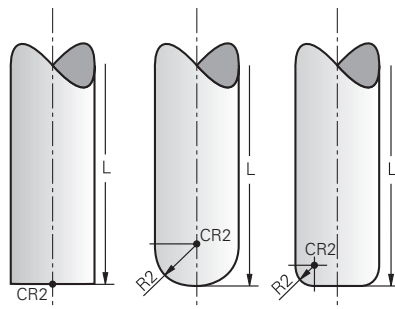

Position of CR2 with the individual tool shapes

Further information: "Presets on the tool", Page 154

Notes

- The tools are defined in the tool management. The overall tool length equals the distance between the tool carrier reference point and the tool tip. The control monitors the complete tool for collisions only by using the overall length.

When defining a ball-nose cutter by the overall length and outputting an NC program to the ball center, the control must take the difference into account. When calling the tool in the NC program, define the sphere radius as a negative delta value in **DL** and thus shift the tool location point to the tool center point.

- If you load a tool with oversize (positive delta value), the control generates an error message. You can suppress the error message with the **M107** function.

Further information: "Permitting positive tool oversizes with M107 (option 9)", Page 449


Use the simulation to ensure that no contours are damaged by the tool oversize.

11.6.4 3D tool compensation during face milling (option 9)

Application

Face milling is a machining operation carried out with the front face of the tool.

The control displaces the tool in the direction of the surface normals by the total of the delta values from tool management, tool call and compensation tables.

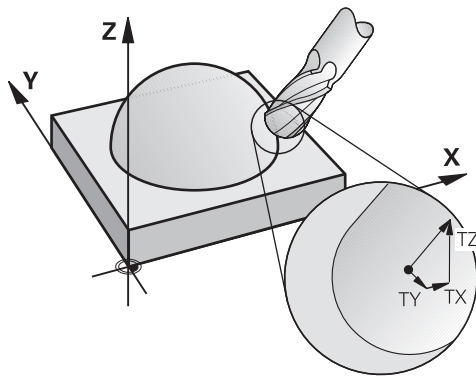

Requirements

- Advanced Functions Set 2 (software option 9)
- Machine with automatically positionable rotary axes
- Output of surface normal vectors from the CAM system

Further information: "Straight line LN", Page 318

- NC program with **M128** or **FUNCTION TCPM**

Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

Description of function

The variants below are possible with face milling:

- **LN** block without tool orientation, **M128** or **FUNCTION TCPM** is active: Tool perpendicular to the workpiece contour
- **LN** block with tool orientation **T**, **M128** or **FUNCTION TCPM** is active: Tool keeps the set tool orientation
- **LN** block without **M128** or **FUNCTION TCPM**: The control ignores the direction vector **T** even if it is defined

Example

11 L X+36.0084 Y+6.177 Z-1.9209 R0	; No compensation is possible
12 LN X+36.0084 Y+6.177 Z-1.9209 NX-0.4658107 NY+0 NZ+0.8848844 R0	; Compensation perpendicular to the contour is possible
13 LN X+36.0084 Y+6.177 Z-1.9209 NX-0.4658107 NY+0 NZ+0.8848844 TX +0.0000000 TY+0.6558846 TZ+0.7548612 R0 M128	; Compensation is possible, DL is effective along the T vector and DR2 along the N vector
14 LN X+36.0084 Y+6.177 Z-1.9209 NX-0.4658107 NY+0 NZ+0.8848844 R0 M128	; Compensation perpendicular to the contour is possible

Notes


NOTICE

Danger of collision!

The rotary axes of a machine may have limited ranges of traverse, e. g. between -90° and $+10^\circ$ for the B head axis. Changing the tilt angle to a value of more than $+10^\circ$ may result in a 180° rotation of the table axis. There is a danger of collision during the tilting movement!

- ▶ Program a safe tool position before the tilting movement, if necessary.
- ▶ Carefully test the NC program or program section in the **Single Block** mode

- If no tool orientation was defined in the **LN** block and **TCPM** is active, the control maintains the tool perpendicular to the workpiece contour.

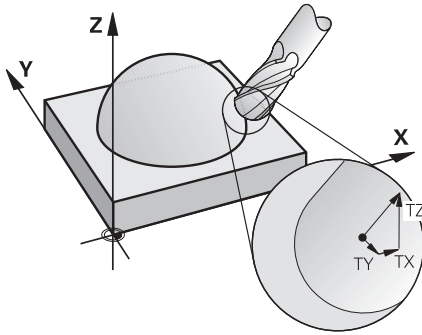


- If a tool orientation **T** has been defined in the **LN** block and M128 (or **FUNCTION TCPM**) is active at the same time, then the control will position the rotary axes automatically in such a way that the tool can reach the specified tool orientation. If you have not activated **M128** (or **TCPM FUNCTION**), then the control ignores the direction vector **T**, even if it is defined in the **LN** block.
- The control is not able to automatically position the rotary axes on all machines.
- The control generally uses the defined **delta values** for 3D tool compensation. The entire tool radius **R + DR** is only taken into account if you have activated the **FUNCTION PROG PATH IS CONTOUR** function.

Further information: "3D tool compensation with the entire tool radius with FUNCTION PROG PATH (option 9)", Page 328

Examples

Compensate re-worked ball-nose cutter CAM output at tool tip

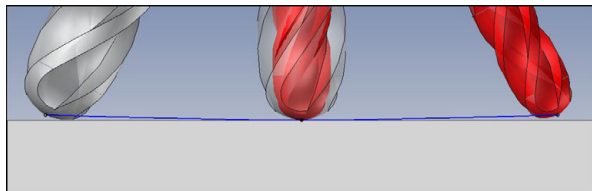

Use a re-worked Ø 5.8 mm ball-nose cutter instead of Ø 6 mm.

The NC program has the following structure:


- CAM output for Ø 6 mm ball-nose cutter
- NC points output on the tool tip
- Vector program with surface normal vectors

Proposed solution:

- Tool measurement on tool tip
- Enter the tool compensation into the tool table:
 - **R** and **R2** the theoretical tool data as from the CAM system
 - **DR** and **DR2** the difference between the nominal value and actual value

	R	R2	DL	DR	DR2
CAM	+3	+3			
Tool table	+3	+3	+0	-0.1	-0.1

Compensate re-worked ball-nose cutter
CAM output at the center of the ball

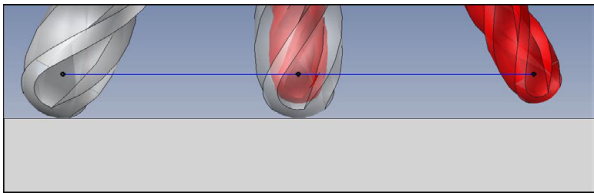

Use a re-worked Ø 5.8 mm ball-nose cutter instead of Ø 6 mm.

The NC program has the following structure:

- CAM output for Ø 6 mm ball-nose cutter
- NC points output on the center of the sphere
- Vector program with surface normal vectors

Suggested solution:


- Tool measurement on tool tip
- TCPM function **REFPNT CNT-CNT**
- Enter the tool compensation into the tool table:
 - **R** and **R2** the theoretical tool data as from the CAM system
 - **DR** and **DR2** the difference between the nominal value and actual value

	R	R2	DL	DR	DR2
CAM	+3	+3			
Tool table	+3	+3	+0	-0.1	-0.1

i

With TCPM **REFPNT CNT-CNT** the tool compensation values are identical for the outputs on the tool tip or center of the sphere.

Create workpiece oversize
CAM output at tool tip

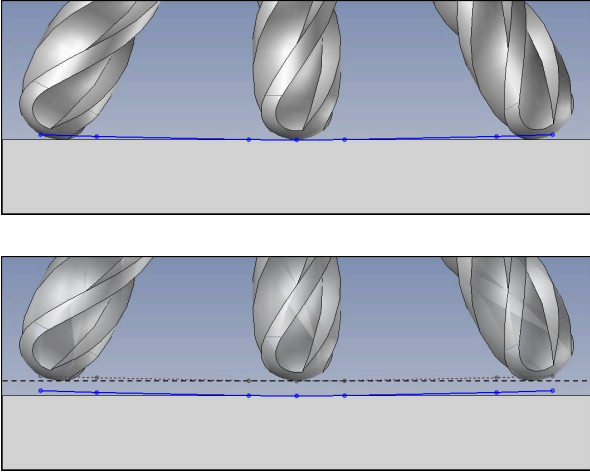

Use a Ø 6 mm ball-nose cutter for achieving an even oversize of 0.2 mm on the contour.

The NC program has the following structure:


- CAM output for Ø 6 mm ball-nose cutter
- NC points output on the tool tip
- Vector program with surface normal vectors and tool vectors

Proposed solution:

- Tool measurement on tool tip
- Enter the tool compensation into the TOOL CALL block:
 - **DL**, **DR** and **DR2** the desired oversize
- Suppress the error message with **M107**

	R	R2	DL	DR	DR2
CAM	+3	+3			
Tool table	+3	+3	+0	+0	+0
TOOL CALL			+0.2	+0.2	+0.2

**Create workpiece oversize
CAM output at the center of the sphere**

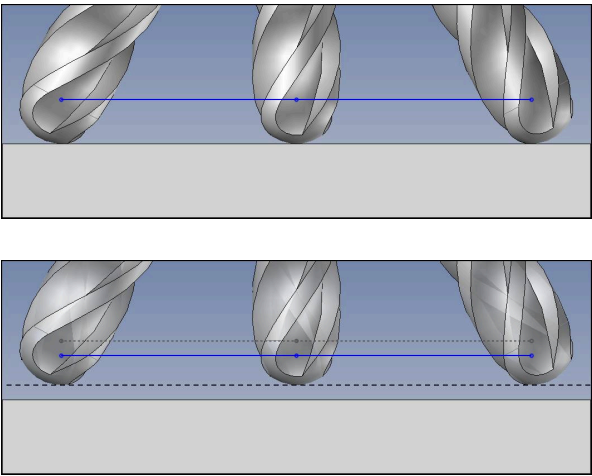

Use a Ø 6 mm ball-nose cutter for achieving an even oversize of 0.2 mm on the contour.

The NC program has the following structure:

- CAM output for Ø 6 mm ball-nose cutter
- NC points output on the center of the sphere
- TCPM function **REFPNT CNT-CNT**
- Vector program with surface normal vectors and tool vectors

Proposed solution:

- Tool measurement on tool tip
- Enter the tool compensation into the TOOL CALL block:
 - **DL**, **DR** and **DR2** the desired oversize
- Suppress the error message with **M107**


	R	R2	DL	DR	DR2
CAM	+3	+3			
Tool table	+3	+3	+0	+0	+0
TOOL CALL			+0.2	+0.2	+0.2

11.6.5 3D tool compensation during peripheral milling (option 9)

Application

Peripheral milling is a machining operation carried out with the lateral surface of the tool.

The control offsets the tool perpendicular to the direction of movement and perpendicular to the tool direction by the total of the delta values from the tool management, the tool call and the compensation tables.

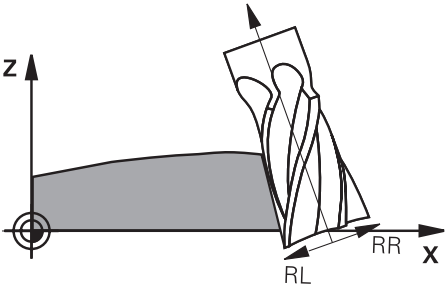

Requirements

- Advanced Functions Set 2 (software option 9)
- Machine with automatically positionable rotary axes
- Output of surface normal vectors from the CAM system
Further information: "Straight line LN", Page 318
- NC program with spatial angles
- NC program with **M128** or **FUNCTION TCPM**
Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432
Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295
- NC program with tool radius compensation **RL** or **RR**
Further information: "Tool radius compensation", Page 306

Description of function

The variants below are possible with peripheral milling:

- **L** block with programmed rotary axes, **M128** or **FUNCTION TCPM** is active, define compensation direction with radius compensation **RL** or **RR**
- **LN** block with tool orientation **T** perpendicular to the N vector, **M128** or **FUNCTION TCPM** is active
- **LN** block with tool orientation **T** without N vector, **M128** or **FUNCTION TCPM** is active

Example

11 L X+48.4074 Y+102.4717 Z-7.1088 C-267.9784 B-20.0115 RL M128	; Compensation is possible, compensation direction RL
12 LN X+60.6593 Y+102.4690 Z-7.1012 NX0.0000 NY0.9397 NZ0.3420 TX-0.0807 TY-0.3409 TZ0.9366 R0 M128	; Compensation is possible
13 LN X+60.6593 Y+102.4690 Z-7.1012 TX-0.0807 TY-0.3409 TZ0.9366 M128	; Compensation is possible

Notes

NOTICE

Danger of collision!


The rotary axes of a machine may have limited ranges of traverse, e. g. between -90° and +10° for the B head axis. Changing the tilt angle to a value of more than +10° may result in a 180° rotation of the table axis. There is a danger of collision during the tilting movement!

- ▶ Program a safe tool position before the tilting movement, if necessary.
- ▶ Carefully test the NC program or program section in the **Single Block** mode

- The control is not able to automatically position the rotary axes on all machines.
- The control generally uses the defined **delta values** for 3D tool compensation. The entire tool radius **R + DR** is only taken into account if you have activated the **FUNCTION PROG PATH IS CONTOUR** function.
Further information: "3D tool compensation with the entire tool radius with FUNCTION PROG PATH (option 9)", Page 328

Example

Compensate re-worked end mill CAM output at tool center

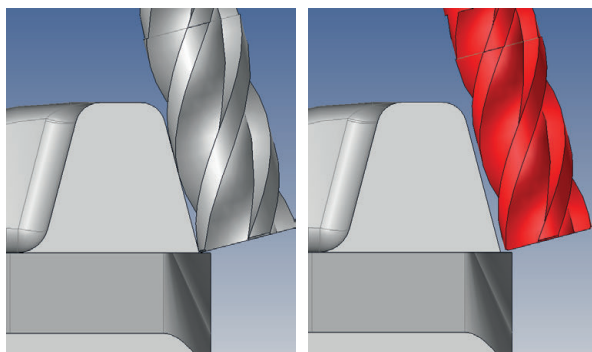

You use a re-worked \varnothing 11.8 mm end mill instead of \varnothing 12 mm.
The NC program has the following structure:

- CAM output for \varnothing 12 mm end mill
 - NC points output on the tool center
 - Vector program with surface normal vectors and tool vectors
- Alternative:

- Klartext program with active tool radius compensation **RL/RR**

Proposed solution:

- Tool measurement on tool tip
- Suppress the error message with **M107**
- Enter the tool compensation into the tool table:
 - **R** and **R2** the theoretical tool data as from the CAM system
 - **DR** and **DL** the difference between the nominal value and the actual value

	R	R2	DL	DR	DR2
CAM	+6	+0			
Tool table	+6	+0	+0	-0.1	+0

11.6.6 3D tool compensation with the entire tool radius with FUNCTION PROG PATH (option 9)

Application

The **FUNCTION PROG PATH** function defines whether the control references the 3D radius compensation only to the delta values as in the past or to the entire tool radius.

Related topics

- Fundamentals of 3D compensation
Further information: "Fundamentals", Page 317
- Tools for 3D compensation
Further information: "Tools for 3D tool compensation", Page 319

Requirements

- Advanced Functions Set 2 (software option 9)
- NC program created with a CAM system
Straight lines **LN** cannot be programmed directly on the control, but require a CAM system.

Further information: "CAM-generated NC programs", Page 395

Description of function

If you activate **FUNCTION PROG PATH**, the programmed coordinates exactly correspond to the contour coordinates.

The control takes the full tool radius **R + DR** and the full corner radius **R2 + DR2** into account for 3D radius compensation.

With **FUNCTION PROG PATH OFF**, you deactivate this special interpretation.

The control only uses the delta values **DR** and **DR2** for 3D radius compensation.

If you activate **FUNCTION PROG PATH**, the interpretation of the programmed path as the contour is effective for 3D compensation movements until you deactivate the function.

Input

11 FUNCTION PROG PATH IS CONTOUR

; Use the entire tool radius for 3D compensation.

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION PROG PATH	Syntax initiator for interpreting the programmed path
IS CONTOUR or OFF	Use the entire tool radius or only the delta values for 3D compensation

11.7 3D radius compensation depending on the tool contact angle (option 92)


Application

Due to the production process, the effective spherical radius of a ball cutter deviates from the ideal form. The maximum form inaccuracy is defined by the tool manufacturer. Common deviations lie between 0.005 mm and 0.01 mm.

The form inaccuracy can be saved in the form of a compensation value table. This table contains angle values and the deviation from the nominal radius **R2** measured on the respective angle value.

The **3D-ToolComp** software option (option 92) enables the control to compensate the value defined in the compensation value table depending on the actual contact point of the tool.

3D calibration of the touch probe can also be carried out with the **3D-ToolComp** software option. During this process the deviations determined during touch probe calibration are saved to the compensation value table.

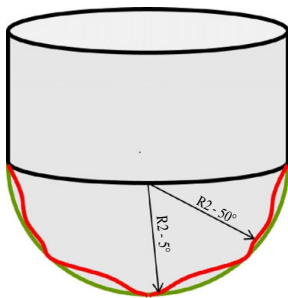

Related topics


- Compensation value table *.3DTC
Further information: "*.3DTC compensation table ", Page 618
- Touch probe 3D calibration
Further information: User's Manual for Setup and Program Run
- 3D probing with a touch probe
Further information: User's Manual for Measuring Cycles for Workpieces and Tools
- 3D compensation with CAM-generated NC programs with surface-normal vectors
Further information: "3D tool compensation (option 9)", Page 317

Requirements

- Advanced Functions Set 2 (software option 9)
- 3D-ToolComp (software option 92)
- Output of surface normal vectors from the CAM system
- Tool properly defined in the tool management:
 - Value 0 in column **DR2**
 - Name of associated compensation value table in column **DR2TABLE**

Further information: User's Manual for Setup and Program Run


Description of function

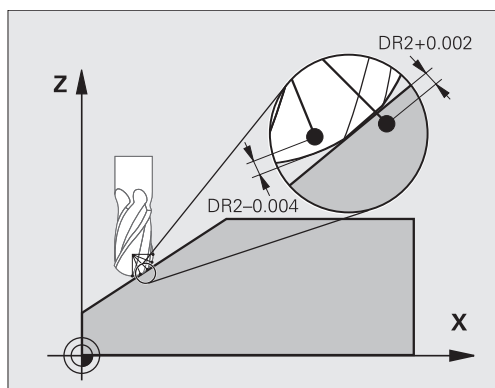

If you are executing an NC program with surface-normal vectors and have assigned a compensation value table (DR2TABLE column) to the active tool in the tool table (TOOL.T), the control uses the values from the compensation value table instead of the compensation value DR2 from TOOL.T.

In doing so, the control takes the compensation value from the compensation value table defined for the current contact point of the tool with workpiece into account. If the contact point is between two compensation points, the control interpolates the compensation value linearly between the two closest angles.

Angle value	Compensation value
40°	0.03 mm (measured)
50°	-0.02 mm (measured)
45° (contact point)	+0.005 mm (interpolated)

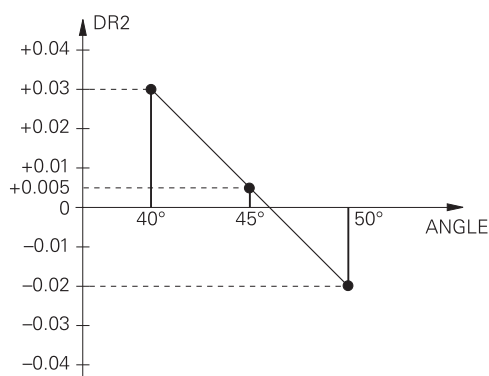

Notes

- If the control cannot interpolate a compensation value, it displays an error message.
- **M107** (suppress error message for positive compensation values) is not required, even if positive compensation values are determined.
- The control uses either DR2 from TOOL.T or a compensation value from the compensation value table. Additional offsets, such as a surface oversize, can be defined via DR2 in the NC program (compensation table **.tco** or **TOOL CALL** block).

12

Files

12.1 File management

12.1.1 Basic information

Application

In the file management, the control displays drives, folders, and files. You can, for example, create or delete folders or files and can also connect drives.

The file management includes the **Files** operating mode and the **Open File** workspace.

Related topics










- Data backup
- Connecting network drives

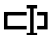

Further information: User's Manual for Setup and Program Run

Description of function


Icons and buttons

The file management contains the following icons and buttons:

Icon, button, or shortcut	Meaning
	Rename
 CTRL+C	Copy
 CTRL+X	Cut
	Delete
	Favorite
	Eject USB device
	Write-protection is active Only in the Files operating mode
	Write-protection is not active Only in the Files operating mode
New folder	Create new folder
New file	Create new file
<div style="border: 1px solid black; padding: 10px;"> <p> You create a new table in the Tables operating mode.</p> <p>Further information: "Tables operating mode", Page 592</p> </div>	
File functions	The control opens the context menu. Further information: "Context menu", Page 548 Only in the Files operating mode

Icon, button, or shortcut	Meaning
Mark CTRL+BLANK	The control marks the file and opens the action bar. Only in the Files operating mode
 CTRL+Z	Undo an action
 CTRL+Y	Redo an action
Open	The control opens the file in the appropriate operating mode or application.
Select in Program Run	The control opens the file in the Program Run operating mode. Only in the Files operating mode
Additional functions	<p>The control opens a selection menu with the following functions:</p> <ul style="list-style-type: none"> ■ Update TAB / PGM Adapt the format and content of files from the iTNC 530 Further information: "Adapting an iTNC 530 file", Page 344 ■ Mount network share Further information: User's Manual for Setup and Program Run <p>Only in the Files operating mode</p>

Screen elements of the file management

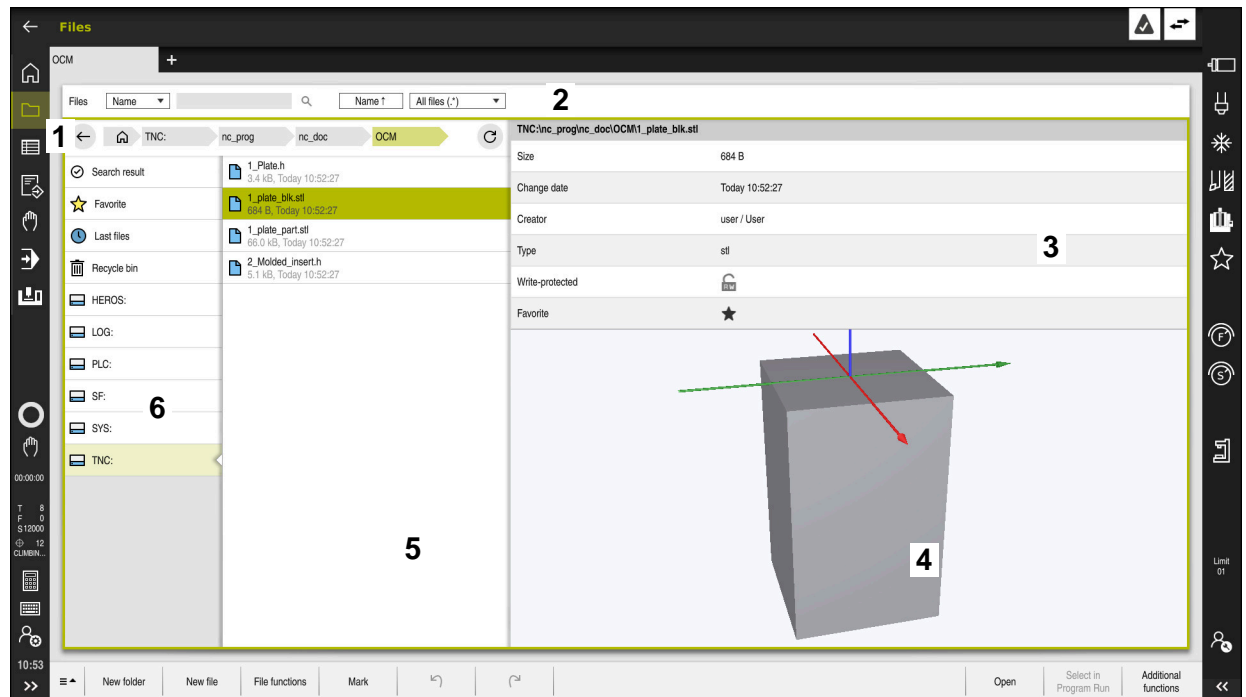

Files operating mode

- 1 Navigation path
In the navigation path the control shows the position of the current folder in the folder structure. Use the individual elements of the navigation path to move to a higher folder level.
- 2 Title bar
 - Full-text search
Further information: "Full-text search in the title bar", Page 337
 - Sorting
Further information: "Sorting in the title bar", Page 337
 - Filtering
Further information: "Filtering in the title bar", Page 337
- 3 Information area
Further information: "Information area", Page 337
- 4 Preview area
In the preview area the control shows a preview of the selected file; for example an excerpt from an NC program.
- 5 Content column
In the content column the control shows all folders and files of the current drive, folder, or other source.
The control displays the following status for a file, if applicable:
 - **M**: the file is active in the **Program Run** operating mode
 - **S**: the file is active in the **Simulation** workspace
 - **E**: the file is active in the **Editor** operating mode
- 6 Navigation column
Further information: "Navigation column", Page 338

Full-text search in the title bar

Use the full-text search to look for any strings in the names or contents of files. The control searches through the active level and any lower levels of the selected drive or folder.

Use the selection menu to choose whether the control searches the names or contents of the files.

You can use the ***** character as a placeholder. This placeholder can stand for any characters or even an entire word. You can also use the placeholder to search for specific file types (e.g., ***.pdf**).

Sorting in the title bar

You can sort folders and files in ascending or descending order according to the following criteria:

- **Name**
- **Type**
- **Size**
- **Change date**

If you sort by name or type, the control lists the files alphabetically.

Filtering in the title bar

You can filter the folders and files using the following standard filters:

- **NC programs (.H, .I)**
- **Klartext file (.H)**
- **ISO file (.I)**
- **Text file (.TXT)**
- **All files (*.*)**

If you want to filter for a different file type, you can use the placeholder character in the full-text search.

Further information: "Full-text search in the title bar", Page 337

Information area

In the information area the control shows the path of the file or folder.

Further information: "Path", Page 338

Depending on which element is selected, the control displays the following additional information:

- **Size**
- **Change date**
- **Creator**
- **Type**

You can select the following functions in the information area:

- Activate and deactivate write-protection
- Add or remove favorites

Navigation column

The navigation column offers the following possibilities for navigation:

- **Search result**

The control displays the results of the full-text search. If there was no search, or if nothing was found, then this area is empty.

- **Favorite**

The control displays all folders and files that you have marked as favorites.

- **Last files**

The control displays the 15 most recently opened files.

- **Recycle bin**

The control moves deleted folders and files to the recycle bin. You can use the context menu to restore these files or empty the recycle bin.

Further information: "Context menu", Page 548

- **Drives (e.g., TNC:)**

The control displays internal and external drives (e.g., a USB device).

Permitted characters

You can use the following characters for the names of drives, folders, and files:

A B C D E F G H I J K L M N O P Q R S T U V W X Y Z a b c d e f g h i j k l m n o p q r s t
u v w x y z 0 1 2 3 4 5 6 7 8 9 _ -

Only use characters that are shown here; otherwise problems might occur (for example, during data transmission).

The following characters have specific functions, and must therefore not be used in a name:

Symbol	Function
.	Separates the file name from the file type
\ /	Separates between drive, folder, and file in the path
:	Separates the drive names

Name

When you create a file, you first define its name. The file name is followed by the file name extension, consisting of a period and the file type.

Path

The maximum permitted path length is 255 characters. The path length consists of the drive characters, the folder name, and the file name, including the file name extension.

Absolute path

An absolute path specifies the exact position of a file. The path begins with the drive and then goes through the folder structure in sequence all the way to the file (e.g., **TNC:\nc_prog\mdh.h**). If the file being called has been moved, then a new absolute path must be entered.

Relative path

A relative path specifies the position of a file in relation to the file that is calling it. The path goes through the folder structure in sequence all the way to the file, starting from the file that is calling it (e.g., **demo\reset.H**). If a file has been moved, then a new relative path must be entered.

File types

You can use uppercase or lowercase letters to define the file type.

HEIDENHAIN-specific file types

The control can open the following HEIDENHAIN-specific file types:

File type	Application
H	NC program written in HEIDENHAIN Klartext Further information: "Contents of an NC program", Page 102
I	NC program with ISO commands
HC	Contour definition in the smarT.NC format of the iTNC 530
HU	Main program in the smarT.NC format of the iTNC 530
3DTC	Table with 3D tool compensations that depend on the contact angle Further information: "3D radius compensation depending on the tool contact angle (option 92)", Page 330
D	Table with workpiece datums Further information: "Datum table", Page 605
DEP	Automatically generated table with data that depend on the NC program (e.g., the tool usage file) Further information: User's Manual for Setup and Program Run
P	Table for pallet-oriented machining Further information: "Job list workspace", Page 578
PNT	Table with machining positions (e.g., for the machining of irregular point patterns) Further information: "Point table", Page 603
PR	Table with workpiece presets Further information: User's Manual for Setup and Program Run
TAB	Freely definable table (e.g., for protocol files or as WMAT and TMAT tables for automatic calculation of cutting data) Further information: "Freely definable tables", Page 602 Further information: "Cutting data calculator", Page 553
TCH	Table with the assignment of the tool magazine Further information: User's Manual for Setup and Program Run
T	Table with tools for all technologies Further information: User's Manual for Setup and Program Run
TP	Table with touch probes Further information: User's Manual for Setup and Program Run
TRN	Table with turning tools Further information: User's Manual for Setup and Program Run

File type	Application
GRD	Table with grinding tools Further information: User's Manual for Setup and Program Run
DRS	Table with dressing tools Further information: User's Manual for Setup and Program Run
TNCDRW	Contour description as a 2D drawing Further information: "Graphical Programming", Page 515
M3D	Format for tool carriers or collision objects (option 40), for example Further information: "Options for fixture files", Page 359
TNCBCK	File for data backup and restoration Further information: User's Manual for Setup and Program Run

The control opens these file types with an internal application or with a HEROS tool.

Standardized file types

The control can open the following standardized file types:

File type	Application
CSV	Text file for saving or exchanging simple structured data Further information: User's Manual for Setup and Program Run
XLSX (XLS)	File type for various spreadsheet programs (e.g., Microsoft Excel)
STL	3D model created with triangular facets (e.g., fixtures) Further information: "Exporting a simulated workpiece as STL file", Page 567
DXF	2D CAD files
IGS/IGES STP/STEP	3D CAD files Further information: User's Manual for Setup and Program Run
CHM	Help files in compiled or compressed format
CFG	Configuration files of the control Further information: "Options for fixture files", Page 359 Further information: User's Manual for Setup and Program Run
CFT	3D data of a parameterizable tool-carrier template Further information: User's Manual for Setup and Program Run
CFX	3D data of a geometrically determined tool carrier Further information: User's Manual for Setup and Program Run
HTM/HTML	Text file with structured content of a website that can be opened in a browser (e.g., the integrated product help) Further information: "User's Manual as integrated product help: TNCguide", Page 34
XML	Text file with hierarchically-structured data
PDF	Document format that visually reproduces the original file identically, regardless of the source application
BAK	Data- backup file Further information: User's Manual for Setup and Program Run
INI	Initialization file (e.g., can contain program settings)
A	Text file (e.g., for defining the screen output format with FN16)
TXT	Text file (e.g., for saving the results of measurement cycles with FN16)
SVG	Picture format for vector graphics
BMP	Picture formats for pixel graphics
GIF	By default, the control uses the PNG format for screenshots
JPG/JPEG PNG	Further information: User's Manual for Setup and Program Run

File type	Application
OGG	Container file format for the OGA, OGV, and OGX media types
ZIP	Container file format that collects multiple compressed files.

The control opens some of these file types with the HEROS tools.

Further information: User's Manual for Setup and Program Run

Notes

- The control has 189 GB of disk space. The maximum size of any file is limited to 2 GB.
- The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). These characters can cause problems when inputting or reading data in conjunction with SQL commands.

Further information: "Table access with SQL statements", Page 495

- If the cursor is within the content column, you can start inputting through the keyboard. The control opens a separate input field and automatically searches for the entered string. If it finds a file or folder with that string, then the control moves the cursor to it.
- If you exit an NC program by pressing the **END BLK** key, the control opens the **Add** tab. The cursor is on the NC program that was just closed.
If you press the **END BLK** key again, the control opens the NC program again with the cursor on the last selected line. With large files, this behavior can cause a delay.
If you press the **ENT** key, the control always opens an NC program with the cursor on line 0.
- The control creates dependency files with the ***.dep** extension for the tool-usage file e. g. in order to perform a tool usage test.
In the machine parameter **dependentFiles** (no. 122101) the machine manufacturer defines whether the control displays dependency files.
- In the machine parameter **createBackup** (no. 105401) the machine manufacturer defines whether the control creates a backup file when saving an NC program. Please note that these backup files will take up disk space.

Hints about file functions

If you select a file or folder and swipe to the right, the control displays the following file functions:

- Rename
- Copy
- Cut
- Delete
- Mark as favorite

You can also select these file functions from the context menu.

Further information: "Context menu", Page 548

Hints about copied files

- If you copy a file and then paste it to the same folder, the control adds the suffix **_Copy** to the file name.
- If you paste a file to another folder and that folder contains a file with the same name, the control opens the **Insert file** window. The control displays the path of the two files and offers the following options:
 - Replace existing file
 - Skip copied file
 - Add suffix to file name



You can also apply the selected option to all such cases.

12.1.2 Open File workspace**Application**

The **Open File** workspace allows e. g. selecting and creating files.

Functionality

The **Open File** workspace can be opened by the icons below, depending on the active operating mode:

Icon	Function
	Add in the Tables and Editor operating modes
	Open File in the Program Run operating mode

The functions below can be executed in the **Open File** workspace in the respective operating modes:

Function	Tables operating mode	Editor operating mode	Program Run operating mode
New folder	✓	✓	–
New file	✓	✓	–
Open	✓	✓	✓

12.1.3 Quick selection workspace

Application

In the **Quick selection** workspace you open an existing table or create a file, e. g. an NC program.

Description of function

The **Quick selection** workspace can be opened with the **Add** function in the **Tables** and **Editor** operating modes.

Further information: "Icons on the control's user interface", Page 71

In the **Tables** operating mode the tables below can be opened:

- **Tool management**
- **Pocket table**
- **Presets**
- **Touch probes**
- **Datums**
- **T usage order**
- **Tooling list**

Use the **Create new table** button to create various tables on the control.

In the **Editor** operating mode the files below can be created:

- **New program**
- **New contour**
- **New job list**

12.1.4 Adapting an iTNC 530 file

Application

In order to use a file created on the iTNC 530 on the **TNC7** as well, the control must adapt the file's format and content. The **Update TAB / PGM** function does this job.

Description of function

Importing an NC program

The control uses the **Update TAB / PGM** function to remove umlauts and checks if the NC block **END PGM** exists. The NC program would be incomplete without this NC block.

Importing a tool table

The following characters are permitted in the **NAME** column of the tool table:

\$ % & , - . 0 1 2 3 4 5 6 7 8 9 @ A B C D E F G H I J K L M N O P Q R S T U V W X Y Z

–

The control converts a comma into a dot with the **Update TAB / PGM** function.

The control adopts all supported tool types and assigns the **Undefined** type to all unknown tool types.

Further information: User's Manual for Setup and Program Run

Adapting a file

Prepare a backup of the original file before adapting

To adapt the format and the content of an iTNC 530 file:



- ▶ Select the **Files** operating mode
- ▶ Select the desired file
- ▶ Select **Additional functions**
- The control displays a selection menu.
- ▶ Select **Update TAB / PGM**
- The control adapts the file format and content.

Additional
functions



The control saves the changes and overwrites the original file.

- ▶ Check the content after adapting

Notes

- The machine manufacturer uses import and update rules to define which adaptations the control is to execute, e. g. removal of umlauts.
- The machine manufacturer uses the optional machine parameter **import-FromExternal** (no. 102909) to define for each file type if automatic adaptation is carried out upon copying to the control.

12.1.5 USB devices

Application

A USB device allows transmitting data and saving data externally.

Requirement

- USB 2.0 or 3.0
- USB device with supported file system
The control supports USB devices with the following file systems:
 - FAT
 - VFAT
 - exFAT
 - ISO9660



The control does not support USB devices with other file systems, such as NTFS.

- A ready data interface

Further information: User's Manual for Setup and Program Run

Description of function

The control displays a USB device as a drive in the navigation column of the **Files** operating mode or of the **Open File** workspace.

The control automatically detects USB devices. If you connect a USB device with a file system that is not supported, the control generates an error message.

Before executing an NC program saved on the USB device, the file must be transferred to the control hard disk.

 
When transmitting large files, the control displays the data transmission progress at the bottom of the navigation and content column.

Removing a USB device

To remove a USB device:



- ▶ Select **Eject**
- The control opens a pop-up window and asks whether you want to eject the USB device.



- ▶ Press **OK**
- The control shows the message **The USB device can be removed now.**

Notes

NOTICE

Caution: Danger due to manipulated data!

If you execute NC programs directly from a network drive or a USB device, you have no control over whether the NC program has been changed or manipulated. In addition, the network speed can slow down the execution of the NC program. Undesirable machine movements or collisions may result.

- ▶ Copy the NC program and all called files to the **TNC:** drive

NOTICE

Caution: Data may be lost!

Always remove a connected USB device properly, otherwise data may be damaged or deleted!

- ▶ Use the USB port for transfer and backup only; do not use it for editing and executing NC programs
- ▶ Use the icon to remove USB devices when data transfer is complete

- If an error message is displayed when connecting a USB device, check the setting in the **SELinux** security software.

Further information: User's Manual for Setup and Program Run

- If the control displays an error message when using a USB hub, ignore and acknowledge the message with the **CE** key.

- Prepare a backup of the files on the control at regular intervals.

Further information: User's Manual for Setup and Program Run

12.2 Programmable file functions

Application

Programmable file functions enable management of files from within the NC program. Files can be opened, copied, relocated and deleted. This allows e. g. opening the drawing of a component during the measuring process with a touch probe cycle.

Description of function

Opening a file with OPEN FILE

The **OPEN FILE** function allows you to open a file from within an NC program.

If you define **OPEN FILE**, the control continues the dialog and you can program a **STOP**.

Using this function, the control can open all file types that you can open manually.

Further information: "File types", Page 339

The control opens the file in the HEROS tool last used for this file type. If you have never opened a file of a certain file type and multiple HEROS tools are available, the control will interrupt program run and open the **Application?** window. In the **Application?** window, you can select the HEROS tool the control should use to open the file. The control saves this selection.

Multiple HEROS tools are available for opening the following file types:

- CFG
- SVG
- BMP
- GIF
- JPG/JPEG
- PNG



In order to avoid program run interruptions or having to select an alternative HEROS tool, open a file of the corresponding file type once in the file manager. If the files of a certain file type can be opened in multiple HEROS tools, you can use the file manager to select the HEROS tool to be used for opening files of this file type.

Further information: "File management", Page 334

This function is effective in the **Simulation** workspace, the **MDI** application, and the **Program Run** operating mode.

Input

```
11 OPEN FILE "FILE1.PDF" STOP
```

The NC function includes the following syntax elements:

Syntax element	Meaning
OPEN FILE	Start of syntax for the OPEN FILE function
" "	Path of the file to be opened
STOP	Interrupts the program run or simulation Optional syntax element

Copying, relocating and deleting files with FUNCTION FILE

The control offers the functions below for copying, moving and deleting files from an NC program:

NC function	Description
FUNCTION FILE COPY	This function copies a file into a target file. The control substitutes the content of the target file. This function requires specifying the path to both files.
FUNCTION FILE MOVE	This function moves a file to a target file. The control substitutes the content of the target file and deletes the file to be moved. This function requires specifying the path to both files.
FUNCTION FILE DELETE	This function deletes the selected file. This function requires specifying the path to the file to be deleted.

These functions are effective in the **MDI** application and in the **Program Run** operating mode.

Input

11 FUNCTION FILE COPY "FILE1.PDF" TO "FILE2.PDF" ; Copy the file from the NC program

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION FILE COPY	Syntax initiator for the Open file function
" "	Path of the file to be copied
" "	Path of the file to be substituted

11 FUNCTION FILE MOVE "FILE1.PDF" TO "FILE2.PDF" ; Move the file from the NC program

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION FILE MOVE	Syntax initiator for the Move file function
" "	Path of the file to be relocated
" "	Path of the file to be substituted

11 FUNCTION FILE DELETE "FILE1.PDF" ; Delete the file from the NC program

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION FILE DELETE	Syntax initiator for the Delete file function
" "	Path of the file to be deleted

Notes

NOTICE

Caution: Data may be lost!

When deleting a file with the **FUNCTION FILE DELETE** function, the control will not put this file into the recycle bin. The control deletes the file once and for all!

- Use this function only with files that are no longer needed

- There are various ways to select files:
 - Enter the file path
 - Select the file in a select window
 - Define the file path or name of the subprogram in a QS parameter
If the called file is located in the same directory as the calling file, you may also enter just the file name.
- When applying file functions relating to the calling NC program in a called NC program, the control will display an error message.
- When intending to copy or move a non-existent file, the control displays an error message.
- If the file to be deleted does not exist, the control does not display an error message.


13

Collision Monitoring

13.1 Dynamic Collision Monitoring (DCM, option 40)

Application

Dynamic Collision Monitoring (DCM, dynamic collision monitoring) can be used for collision monitoring of machine components defined by the machine manufacturer. When the collision objects come closer to each other than a defined minimum distance, the control stops and displays an error message. This procedure reduces the risk of collision.

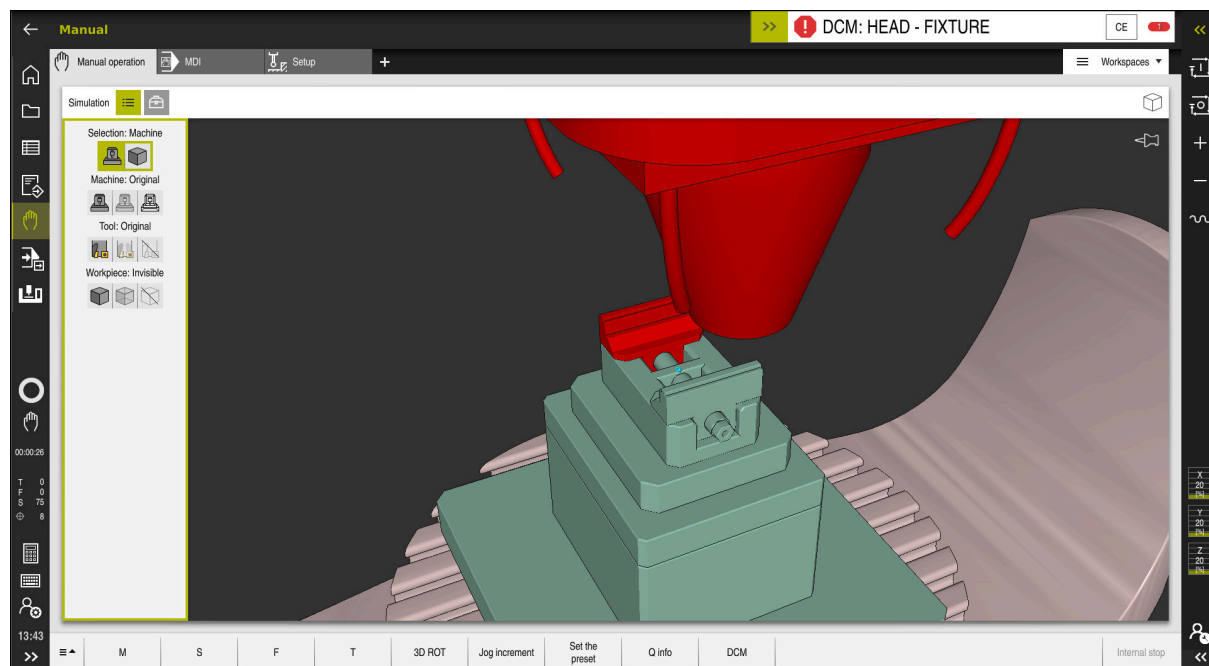

Dynamic Collision Monitoring (DCM) including collision warning

Requirements

- Dynamic Collision Monitoring (DCM, software option 40)
- Control prepared by the machine manufacturer
The machine manufacturer must define a kinematics model of the machine, insertion point for fixtures and the safety distance between collision objects.
Further information: "Fixture monitoring (option 40)", Page 358
- Tools with a positive radius **R** and length **L**.
Further information: User's Manual for Setup and Program Run
- The values in the tool management equal the actual tool dimensions
Further information: User's Manual for Setup and Program Run


Description of function



Refer to your machine manual.

The machine manufacturer adapts the Dynamic Collision Monitoring (DCM) to the control.

The machine manufacturer can define machine components and minimum distances that are to be monitored by the control during all machine movements. If two collision objects come closer to each other than a defined minimum distance, the control generates an error message and terminates the movement.

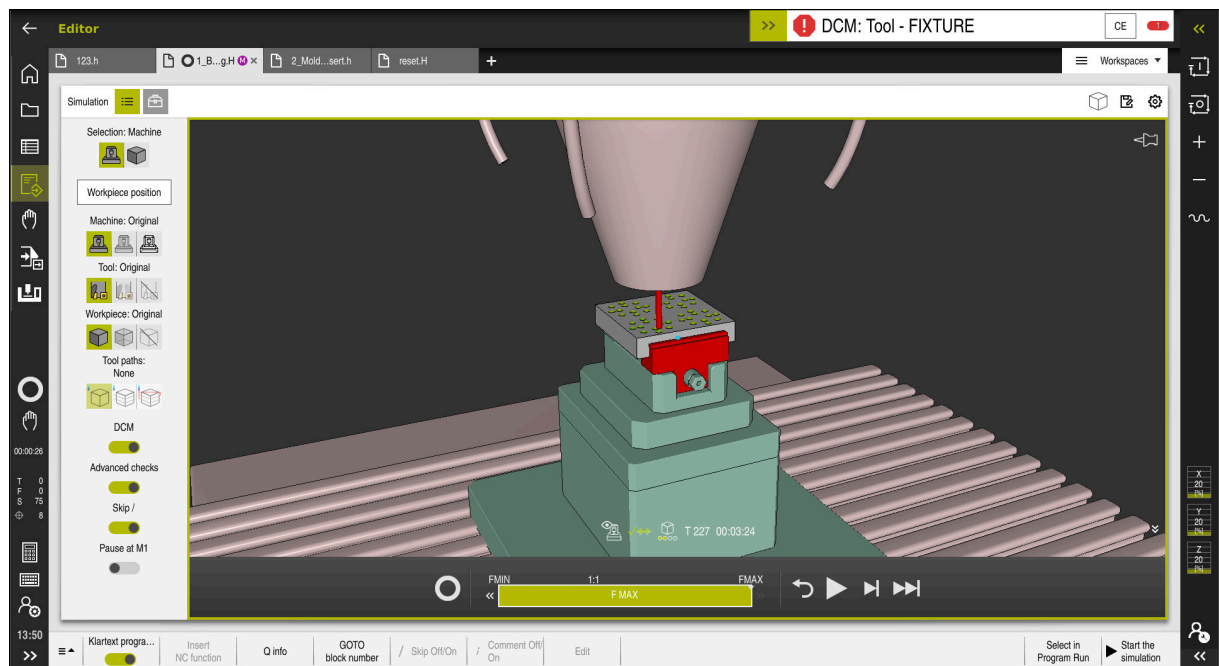

Dynamic Collision Monitoring (DCM) in the **Simulation** workspace

NOTICE

Danger of collision!

If Dynamic Collision Monitoring (DCM) is inactive, the control will not perform any automatic collision checking. This means that movements that might cause collisions will not be prevented. There is a danger of collision during all movements!

- ▶ Make sure to activate DCM whenever possible
- ▶ Make sure to always re-activate DCM immediately after a temporary deactivation
- ▶ Carefully test your NC program or program section in the **Single Block** mode while DCM is deactivated

The control displays the collision objects graphically in the following operating modes:

- **Editor** operating mode
- **Manual** operating mode
- **Program Run** operating mode

The control also monitors the tools, as defined in tool management, for collision.

NOTICE**Danger of collision!**

Even if Dynamic Collision Monitoring (DCM) is active, the control does not automatically monitor the workpiece for collisions, neither with the tool nor with other machine components. There is a risk of collision during machining!

- ▶ Enable the **Advanced checks** switch for simulations
- ▶ Check the machining sequence using a simulation
- ▶ Carefully test your NC program or program section in the **Single Block** mode

Further information: "Advanced checks in the simulation", Page 361

Dynamic Collision Monitoring (DCM) in the Manual and Program Run operating modes

Dynamic Collision Monitoring (DCM) is activated separately for the **Manual** and **Program Run** operating modes, using the **DCM** button.

Further information: User's Manual for Setup and Program Run

In the **Manual** and **Program Run** operating modes, the control stops the movement if two collision objects approach each other by less than a minimum distance. In this case, the control displays an error message naming the two objects causing collision.



Refer to your machine manual.

The machine manufacturer can define the minimum distance between two collision-monitored objects.

Before the collision warning, the control dynamically reduces the feed rate of movements. This ensures that the axes stop in good time before a collision occurs. When the collision warning is triggered, the control displays the colliding objects in red in the **Simulation** workspace.



When a collision warning has been issued, machine movements via the axis direction keys or the handwheel are only possible if they increase the distance between the collision objects.

With active collision monitoring and a simultaneous collision warning, no movements are permitted that reduce the distance or leave it unchanged.

Dynamic Collision Monitoring (DCM) in the Editor operating mode

Dynamic Collision Monitoring (DCM) is activated for simulation in the **Simulation** workspace.

Further information: "Activating Dynamic Collision Monitoring (DCM) for the simulation", Page 356

In the **Editor** operating mode, an NC program can be collision-monitored even prior to execution. In case of collision, the control stops the simulation and displays an error message naming the two objects causing collision.

HEIDENHAIN recommends the use of Dynamic Collision Monitoring (DCM) in the **Editor** operating mode only in addition to DCM in the **Manual** and **Program Run** operating modes.



The enhanced collision monitoring shows collisions between the workpiece and tools or tool holders.

Further information: "Advanced checks in the simulation", Page 361

To obtain a simulation result that is similar to the program run, the following aspects must match:

- Workpiece preset
- Basic rotation
- Offsets of each axis
- Tilting condition
- Active kinematic model

The active workpiece preset for the simulation must be selected. The active workpiece preset from the preset table can be adopted into the simulation.

Further information: "Visualization options column", Page 559

In a simulation, the following aspects may differ from the actual machine or may not be available at all:

- The simulated tool change position may differ from the tool change position in the machine.
- Changes in the kinematics may have a delayed effect in the simulation.
- PLC positioning movements are not displayed in the simulation.
- Global program settings (GPS, option 44) are not available
- Handwheel superimposition is not available
- Editing of job lists is not available
- Traverse range limits from the **Settings** application are not available.

13.1.1 Activating Dynamic Collision Monitoring (DCM) for the simulation

Dynamic Collision Monitoring (DCM) can be activated for the simulation only in the **Editor** operating mode.

To activate DCM for the simulation:



- ▶ Select the **Editor** operating mode
- ▶ Select **Workspaces**
- ▶ Select **Simulation**
- ▶ The control opens the **Simulation** workspace.




- ▶ Select the **Visualization options** column
- ▶ Activate the **DCM** switch
- ▶ The control activates DCM in the **Editor** operating mode.



The control displays the status of Dynamic Collision Monitoring (DCM) in the **Simulation** workspace

Further information: "Icons in the Simulation workspace", Page 558

13.1.2 Activating the graphic display of the collision objects

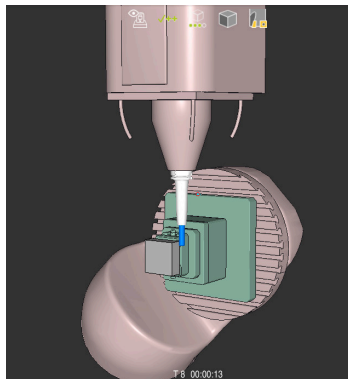

Simulation in the **Machine** mode

To activate the graphic display of the collision objects:



- ▶ Select an operating mode, e. g. **Manual**
- ▶ Select **Workspaces**
- ▶ Select the **Simulation** workspace
- ▶ The control opens the **Simulation** workspace.



- ▶ Select the **Visualization options** column
- ▶ Select the **Machine** mode
- ▶ The control displays a graphic representation of the machine and the workpiece.

Changing the representation

To change the graphic display of the collision objects:

- ▶ Activate the graphic display of the collision objects



- ▶ Select the **Visualization options** column



- ▶ Change the graphic display of the collision objects, e. g. **Original**

13.1.3 FUNCTION DCM: Deactivating and activating Dynamic Collision Monitoring (DCM) in NC programs

Application

Some machining steps are by design performed close to a collision object. If you want to exclude some machining steps from Dynamic Collision Monitoring (DCM), you can deactivate DCM for them in your NC program. This means that it is possible to monitor individual parts of an NC program for collision.

Requirement

This function can only be used if Dynamic Collision Monitoring (DCM) is active for the **Program Run** operating mode. Otherwise, the function has no effect and you cannot activate DCM from within the NC program.

Description of function

NOTICE

Danger of collision!

If Dynamic Collision Monitoring (DCM) is inactive, the control will not perform any automatic collision checking. This means that movements that might cause collisions will not be prevented. There is a danger of collision during all movements!

- ▶ Make sure to activate DCM whenever possible
- ▶ Make sure to always re-activate DCM immediately after a temporary deactivation
- ▶ Carefully test your NC program or program section in the **Single Block** mode while DCM is deactivated

FUNCTION DCM is only effective within the NC program.

It is for example possible to deactivate Dynamic Collision Monitoring (DCM) in the following situations in your NC program:

- To reduce the distance between two objects monitored for collision
- To prevent stops during program runs

The following NC functions are available:

- **FUNCTION DCM OFF** deactivates collision monitoring until the end of the NC program or the call of the **FUNCTION DCM ON** function.
- **FUNCTION DCM ON** revokes the **FUNCTION DCM OFF** function and reactivates collision monitoring.

Programming the FUNCTION DCM function

To program the **FUNCTION DCM** function:

Insert
NC function

- ▶ Select **Insert NC function**
- The control opens the **Insert NC function** window.
- ▶ Select **FUNCTION DCM**
- ▶ Select the **OFF** or **ON** syntax element

Notes

- Dynamic Collision Monitoring (DCM) helps you reduce the risk of collision. However, the control cannot consider all possible constellations during operation.
- The control can protect only those machine components from collision that your machine manufacturer has defined correctly with regard to dimensions, orientation, and position.
- The control takes the **DL** and **DR** delta values from the tool management into account. Delta values from the **TOOL CALL** block or a compensation table are not taken into account.
- For certain tools, e. g. face-milling cutters, the radius that would cause a collision can be greater than the value defined in the tool management.
- When a touch probe cycle starts, the control no longer monitors the stylus length and ball-tip diameter, so you can still probe collision objects.

13.2 Fixture monitoring (option 40)

13.2.1 Fundamentals

Application

The Fixture Monitoring function allows you to map setup situations and monitor them for collisions.

Related topics

- Dynamic Collision Monitoring (DCM, option 40)
Further information: "Dynamic Collision Monitoring (DCM, option 40)",
 Page 352
- Integrating an STL file as workpiece blank
Further information: "STL file as workpiece blank with BLK FORM FILE",
 Page 149

Requirements

- Dynamic Collision Monitoring (DCM, software option 40)
- Kinematics description
 The machine manufacturer creates the kinematics description
- Insertion point defined
 Using the insertion point, the machine manufacturer defines the preset for positioning the fixtures. The insertion point is often located at the end of the kinematic chain, e. g. at the center of a rotary table. For information about the position of the insertion point, please refer to your machine manual.
- Fixtures of suitable format:
 - STL file
 - 20,000 triangles maximum
 - Triangular mesh forms a closed shell
 - CFG file
 - M3D file

Description of function

To use fixture monitoring, the steps below are needed:

- Creating a fixture or loading into the control

Further information: "Options for fixture files", Page 359

- Fixture placement


- **Set up fixtures** function in the **Setup** application (option 140)

Further information: User's Manual for Setup and Program Run

- Manual fixture placement

- When changing fixtures, load or remove the fixture in the NC program

Further information: "Loading and removing fixtures using the FIXTURE function (option 40)", Page 360

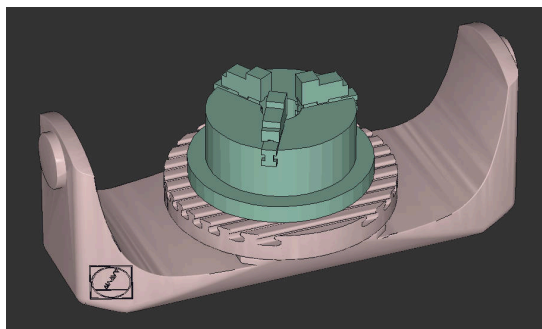

Three-jaw chuck loaded as fixture

Options for fixture files

For the integration of fixtures with the **Set up fixtures** function, only STL files can be used.

You can use the **3D mesh** function (option 152) to create STL files from other file types and adapt STL files to the requirements of your control.

Further information: User's Manual for Setup and Program Run

Alternatively, CFG and M3D files can be set up manually.

Fixtures from STL files

STL files allow you to map both individual components and entire assemblies as an immobile fixture. The STL format is useful, in particular, for integrated fixture systems and recurring setups.

If an STL file does not meet the requirements of the control, then the control issues an error message.

With CAD Model Optimizer (software option 152), you can adapt STL files that do not meet the requirements and then use them as fixtures.

Further information: User's Manual for Setup and Program Run

Fixtures from M3D files

M3D is a file type designed by HEIDENHAIN. The paid M3D Converter software from HEIDENHAIN allows you to create M3D files from STL or STEP files.

In order to use an M3D file as a fixture, you need to use the M3D Converter software to create and check the file.

Fixtures from CFG files

CFG files are configuration files. You can integrate the STL and M3D files available in a CFG file. This enables you to map complex setups.

The **Set up fixtures** function can be used to create a CFG file for the fixture, using the measured value.

In CFG files, you can correct the orientation of the fixture files to be effective on the control. **KinematicsDesign** can be used to create and edit CFG files on the control.

Further information: User's Manual for Setup and Program Run

Notes

NOTICE

Danger of collision!

The setup situation defined for fixture monitoring must match the actual machine status. Otherwise, there is a risk of collision.

- ▶ Measure the position of the fixture in your machine
- ▶ Use the measured values for positioning the fixture
- ▶ Test the NC programs in the Simulation

- When using a CAM system, use a postprocessor to output the fixture situation.
- Note the orientation of the coordinate system in the CAD system. Use the CAD system to adapt the orientation of the coordinate system to the desired orientation of the fixture in the machine.
- You can choose any orientation of the fixture model in the CAD system, and therefore the orientation does not always match the orientation of the fixture in the machine.
- Define the coordinate origin in the CAD system such that the fixture can be directly attached to the point of insertion of the kinematics.
- Create a central directory for your fixtures (e.g., **TNC:\system\Fixture**).
- HEIDENHAIN recommends storing variants of recurring setup situations suitable for standard workpiece sizes in the control (e.g., vise with different jaw opening widths).

By storing multiple fixtures, you can choose the appropriate fixture for your machining operation without needing to configure it.

- Example files for setups used in everyday manufacturing are provided in the NC database of the Klartext Portal:

<https://www.klartext-portal.com/en/tips/nc-solutions>

13.2.2 Loading and removing fixtures using the FIXTURE function (option 40)

Application

The **FIXTURE** function allows loading and removing saved fixtures from within the NC program.

In the **Editor** operating mode and in the **MDI** application, different fixtures can be loaded independently of one another.

Further information: "Fixture monitoring (option 40)", Page 358

Requirements

- Dynamic Collision Monitoring (DCM, software option 40)
- A measured fixture file exists

Description of function

The selected setup situation is checked for collisions during simulation or machining.

The **FIXTURE SELECT** function selects a fixture by means of a pop-up window. The search filter in the window may have to be changed to **All files (*.*)**.

The **FIXTURE RESET** function removes the fixture.

Input

11 FIXTURE SELECT "TNC:\system \Fixture\JAW_CHUCK.STL"	; Load the fixture as an STL file
--	-----------------------------------

The NC function includes the following syntax elements:

Syntax element	Meaning
FIXTURE	Syntax initiator for fixtures
SELECT or RESET	Select or remove fixture
File or QS	Fixture path as a fixed or variable name Only if SELECT has been selected

13.3 Advanced checks in the simulation

Application

The **Advanced checks** function allows checking in the **Simulation** workspace if collisions occur between the workpiece and the tool or tool carrier.

Related topics

- Collision monitoring of machine component by Dynamic Collision Monitoring (DCM, option 40)

Further information: "Dynamic Collision Monitoring (DCM, option 40)",
Page 352

Description of function


The **Advanced checks** function can be used only in the **Editor** operating mode.

The **Advanced checks** function can be activated by a switch in the **Visualization options** column.

Further information: "Visualization options column", Page 559

If the **Advanced checks** function is active, the control generates a warning in the cases below:

- Material removal at rapid traverse
The control displays material removal at rapid traverse in red in the simulation.
- Collisions between the tool and the workpiece
- Collisions between the tool holder and the workpiece
The control also considers inactive steps of a stepped tool.

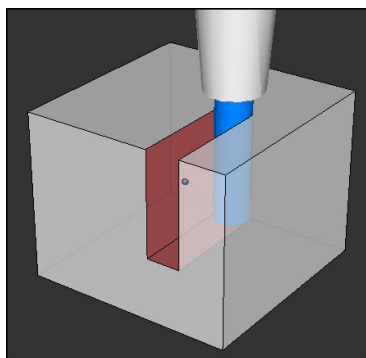

Material removal at rapid traverse

Notes

- The **Advanced checks** function helps reduce the danger of collision. However, the control cannot consider all possible constellations during operation.
- The **Advanced checks** function in the simulation uses the information from the workpiece blank definition for workpiece monitoring. The control can monitor only the active workpiece blank, even if several workpieces are clamped in the machine!

Further information: "Defining a workpiece blank with BLK FORM", Page 144

13.4 Automatic tool liftoff with FUNCTION LIFTOFF

Application

The tool retracts from the contour by up to 2 mm. The control calculates the lift off direction based on the input in the **FUNCTION LIFTOFF** block.

The **LIFTOFF** function is effective in the following situations:

- In case of an NC stop triggered by you
- In case of an NC stop triggered by the software, e. g. if an error has occurred in the drive system.
- In case of a power interruption

Related topics

- Automatic liftoff with **M148**

Further information: "Automatically lifting off upon an NC stop or a power failure with M148", Page 444

- Liftoff in the tool axis with **M140**

Further information: "Retracting in the tool axis with M140", Page 439

Requirements

- Function enabled by the machine manufacturer
In machine parameter **on** (no. 201401), the machine manufacturer defines whether automatic lift-off is active.
- **LIFTOFF** activated for the tool
You must define the value **Y** in the **LIFTOFF** column of the tool management.

Description of function

You can program the LIFTOFF function in the following ways:

- **FUNCTION LIFTOFF TCS X Y Z:** Lift-off in the tool coordinate system (**T-CS**) with the vector resulting from **X**, **Y** and **Z**
- **FUNCTION LIFTOFF ANGLE TCS SPB:** Lift-off in the tool coordinate system (**T-CS**) with a defined spatial angle
This makes sense for turning (option 50)
- **FUNCTION LIFTOFF AUTO:** Liftoff in automatically determined direction
- **FUNCTION LIFTOFF RESET:** NC function reset

Further information: "Tool coordinate system T-CS", Page 234

The control automatically resets the **FUNCTION LIFTOFF** function at the end of a program.

FUNCTION LIFTOFF in turning mode (option 50)**NOTICE****Caution: Danger to the tool and workpiece!**

Undesired movements of the axes can occur if you use the **FUNCTION LIFTOFF ANGLE TCS** function in turning mode. The behavior of the control depends on the kinematics description and Cycle **800 (Q498 = 1)**.

- ▶ Carefully test the NC program or program section in **Program run, single block** operating mode.
- ▶ If necessary, change the algebraic sign of the defined angle

If parameter **Q498** has been set to 1, the control will reverse the tool for machining.

In conjunction with the **LIFTOFF** function, the control behaves as follows:

- If the tool spindle has been defined as an axis, the **LIFTOFF** direction will be reversed.
- If the tool spindle has been defined as a kinematic transformation, the **LIFTOFF** direction will not be reversed.

Further information: User's Manual for Machining Cycles

Input

11 FUNCTION LIFTOFF TCS X+0 Y+0.5 Z +0.5	; Lift off with the defined vector upon NC stop or power failure
12 FUNCTION LIFTOFF ANGLE TCS SPB +20	; Lift off with spatial angle SPB +20 upon NC stop or power failure

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION LIFTOFF	Syntax initiator for a automatic liftoff
TCS, ANGLE, AUTO or RESET	Define the liftoff direction as a vector, define it as a spatial angle, have it calculated automatically, or reset liftoff
X, Y, Z	Vector components in the tool coordinate system T-CS Only if TCS has been selected
SPB	Spatial angle in T-CS Only if ANGLE has been selected When entering 0, the control lifts off in the direction of the active tool axis.

Notes

- The control uses the **M149** function to deactivate the **FUNCTION LIFTOFF** function without resetting the lift-off direction. If you program **M148**, the control will activate the automatic lift-off of the tool in the lift-off direction defined by the **FUNCTION LIFTOFF** function.
- In case of an emergency stop, the control will not lift off the tool.
- The lift-off movement will not be monitored by Dynamic Collision Monitoring (DCM, option 40)
Further information: "Dynamic Collision Monitoring (DCM, option 40)", Page 352
- In machine parameter **distance** (no. 201402), the machine manufacturer defines the maximum lift-off height.

14

Control Functions

14.1 Adaptive Feed Control (AFC, option 45)

14.1.1 Fundamentals

Application

Adaptive Feed Control (AFC) saves time when processing NC programs and reduces wear on the machine. The control regulates the contouring feed rate during program run depending on the spindle power. In addition, the control responds to overloading of the spindle.

Related topics

- Tables related to AFC

Further information: User's Manual for Setup and Program Run

Requirements

- Adaptive Feed Control (AFC, software option 45)
- Approved by the machine manufacturer

The machine manufacturer uses the optional machine parameter **Enable** (no. 120001) to define whether you can use AFC.

Description of function

To regulate the feed rate during program run with AFC:

- Define basic settings for AFC in the **AFC.tab** table
Further information: User's Manual for Setup and Program Run
- Define settings for AFC for each tool in the tool management
Further information: User's Manual for Setup and Program Run
- Define AFC in the NC program
Further information: "NC functions for AFC (option 45)", Page 368
- Define AFC in the **Program Run** operating mode with the **AFC** switch.
Further information: "AFC switch in Program Run operating mode", Page 370
- Prior to automatic control, determine the reference spindle power with a teach-in cut
Further information: User's Manual for Setup and Program Run

If AFC is active in the teach-in cut or in control mode, the control displays an icon in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

Detailed information about the function is provided by the control on the **AFC** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

Benefits of AFC

Adaptive feed control (AFC) has the following advantages:

- Optimization of machining time
By controlling the feed rate, the control tries to maintain the previously recorded maximum spindle power or the reference power specified in the tool table (**AFC-LOAD** column) during the entire machining time. It shortens the machining time by increasing the feed rate in machining zones with little material removal.
- Tool monitoring
If the spindle power exceeds the taught-in or specified maximum value, the control reduces the feed until the reference spindle power is reached. If the minimum feed rate is exceeded, the control executes a shutdown response. AFC can also use the spindle power to monitor the tool for wear and breakage without changing the feed rate.
Further information: User's Manual for Setup and Program Run
- Protection of the machine's mechanical elements
Timely feed rate reduction and shutdown responses help to avoid machine overload.

Tables related to AFC

The control offers the following tables in conjunction with AFC:

- **AFC.tab**
In the **AFC.TAB** table, you can enter the feed rate control settings to be used by the control. This table must be saved in the **TNC:\table** directory.
Further information: User's Manual for Setup and Program Run
- ***.H.AFC.DEP**
With a teach-in cut, the control at first copies the basic settings for each machining step, as defined in the AFC.TAB table, to a file called **<name>.H.AFC.DEP**. **<name>** is the name of the NC program for which you have recorded the teach-in cut. In addition, the control measures the maximum spindle power consumed during the teach-in cut and saves this value to the table.
Further information: User's Manual for Setup and Program Run
- ***.H.AFC2.DEP**
During a teach-in cut, the control stores information for each machining step in the **<name>.H.AFC2.DEP** file. The **<name>** corresponds to the name of the NC program for which you perform the teach-in cut.
In control mode, the control updates the data in this table and performs evaluations.

You can open and, if necessary, edit the tables for AFC during program run. The control offers only the tables for the active NC program.

Further information: User's Manual for Setup and Program Run

Notes

NOTICE

Caution: Danger to the tool and workpiece!

As soon as Adaptive Feed Control (AFC) is deactivated, the control immediately switches back to the programmed machining feed rate. If AFC decreased the feed rate, e.g. due to wear, before it was deactivated, the control accelerates the feed rate up to the programmed value. This behavior applies regardless of how the function is deactivated. This feed acceleration may result in damage to the tool and/or the workpiece!

- ▶ If the feed rate falling below the **FMIN** value is imminent, stop the machining operation without deactivating AFC
 - ▶ Define the overload reaction for cases in which the feed rate falls below the **FMIN** value
- If Adaptive Feed Control is active in **Control** mode, the control executes a shutdown response independent of the programmed overload reaction.
 - If, with the reference spindle load, the minimum feed factor is fallen below The control executes the shutdown response from the **OVLD** column of the **AFC.tab** table.

Further information: User's Manual for Setup and Program Run
 - If the programmed feed rate falls below the 30 % threshold The control executes an NC stop.
 - Adaptive feed control is not intended for tools with diameters less than 5 mm. If the rated power consumption of the spindle is very high, the limit diameter of the tool may be larger.
 - Do not work with adaptive feed control in operations in which the feed rate and spindle speed must be adapted to each other, such as tapping.
 - In NC blocks containing **FMAX**, the adaptive feed control is **not active**.
 - With the machine parameter **dependentFiles** (no. 122101), the machine manufacturer defines whether the control displays dependency files in the file management.

14.1.2 Activating and deactivating AFC

NC functions for AFC (option 45)

Application

Adaptive Feed Control (AFC) is activated and deactivated from the NC program.

Requirements

- Adaptive Feed Control (AFC, software option 45)
- Control settings defined in the **AFC.tab** table

Further information: User's Manual for Setup and Program Run
- Desired control setting defined for all tools

Further information: User's Manual for Setup and Program Run
- **AFC** switch active

Further information: "AFC switch in Program Run operating mode", Page 370

Description of function

The control provides several functions that enable you to start and stop AFC:

- **FUNCTION AFC CTRL:** The **AFC CTRL** function activates feedback control mode starting with this NC block, even if the learning phase has not been completed yet.
- **FUNCTION AFC CUT BEGIN TIME1 DIST2 LOAD3:** The control starts a sequence of cuts with active **AFC**. The changeover from the teach-in cut to feedback control mode begins as soon as the reference power has been determined in the teach-in phase, or once one of the **TIME**, **DIST** or **LOAD** conditions has been met.
- **FUNCTION AFC CUT END:** The **AFC CUT END** function deactivates the AFC control.

Input

FUNCTION AFC CTRL

11 FUNCTION AFC CTRL	; Start AFC in control mode
-----------------------------	-----------------------------

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION AFC CTRL	Syntax initiator for the start of control mode

FUNCTION AFC CUT

11 FUNCTION AFC CUT BEGIN TIME10 DIST20 LOAD80	; Start AFC machining step, limit the duration of the teach-in phase
---	--

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION AFC CUT	Syntax initiator for an AFC machining step
BEGIN or END	Start or end machining step
TIME	End teach-in phase after the defined time in seconds Optional syntax element Only if BEGIN has been selected
DIST	End teach-in phase after the defined distance in mm Optional syntax element Only if BEGIN has been selected
LOAD	Enter the reference load of the spindle directly, max. 100% Optional syntax element Only if BEGIN has been selected

Notes

NOTICE

Caution: Danger to the tool and workpiece!

If you activate the **FUNCTION MODE TURN** machining mode, the control will clear the current **OVLD** values. This means that you need to program the machining mode before the tool call! If the programming sequence is not correct, no tool monitoring will take place, which might result in damage to the tool or workpiece!

- ▶ Program the **FUNCTION MODE TURN** machining mode before the tool call

- The **TIME**, **DIST** and **LOAD** defaults are modally effective. They can be reset by entering **0**.
- Execute the function **AFC CUT BEGIN** only after the starting rotational speed has been reached. If this is not the case, then the control issues an error message, and the AFC cut is not started.
- You can define a feedback-control reference power with the **AFC LOAD** tool table column and the **LOAD** input in the NC program. You can activate the **AFC LOAD** value via the tool call and the **LOAD** value with the **FUNCTION AFC CUT BEGIN** function.

If you program both values, the control will use the value programmed in the NC program!

AFC switch in Program Run operating mode

Application

The **AFC** switch allows you to activate or deactivate Adaptive Feed Control (AFC) in the **Program Run** operating mode.

Related topics

- Activating AFC in the NC program
Further information: "NC functions for AFC (option 45)", Page 368

Requirements

- Adaptive Feed Control (AFC, software option 45)
- Approved by the machine manufacturer
 The machine manufacturer uses the optional machine parameter **Enable** (no. 120001) to define whether you can use AFC.

Description of function

The **AFC** switch must be activated for the NC functions to have an effect for AFC.

If you do not specifically deactivate AFC using the switch, AFC remains active. The control remembers the setting of the switch even if the control is restarted.

If the **AFC** switch is active, the control displays an icon in the **Positions** workspace. In addition to the current setting of the feed rate potentiometer, the control shows the controlled feed value as a percentage (%).

Further information: User's Manual for Setup and Program Run

Notes**NOTICE****Caution: Danger to the tool and workpiece!**

As soon as the AFC function is deactivated, the control immediately switches back to the programmed machining feed rate. If AFC decreased the feed rate (e.g. due to wear) before it was deactivated, the control accelerates the feed rate up to the programmed value. This applies regardless of how the function is deactivated (e.g. feed rate potentiometer). This acceleration may result in damages to the tool or the workpiece!

- ▶ If it is imminent that the feed rate falls below the **FMIN** value, stop the machining operation (instead of deactivating the **AFC** function)
 - ▶ Define the overload reaction for cases in which the feed rate falls below the **FMIN** value
- If Adaptive Feed Control is active in **Control** mode, the control internally sets the spindle override to 100 %. This means that you can no longer change the spindle speed.
 - If Adaptive Feed Control is active in **Control** mode, the control takes over the value from the feed rate override function.
 - Increasing the feed rate override has no influence on the control.
 - If you reduce the feed override with the potentiometer by more than 10% in relation to the position at the start of the program, the control switches AFC off.
You can reactivate control with the **AFC** switch.
 - Potentiometer values of up to 50% always have an effect, even with active control.
 - Mid-program startup is allowed during active feed control. The control takes the cutting number of the startup block in account.

14.2 Functions for controlling program run**14.2.1 Overview**

The control provides the following NC functions for program control:

Syntax	Function	Further information
FUNCTION S-PULSE	Program pulsing spindle speed	Page 372
FUNCTION DWELL	Program singular dwell time	Page 373
FUNCTION FEED DWELL	Program cyclic dwell time	Page 373

14.2.2 Pulsing spindle speed with FUNCTION S-PULSE

Application

Using the **S-PULSE FUNCTION** you can program a pulsing spindle speed, e.g. to avoid natural oscillations of the machine when operating at a constant spindle speed.

Description of function

With the **P-TIME** input value you define the duration of an oscillation (oscillation period), and with the **SCALE** input value the spindle speed change in percent. The spindle speed changes in a sinusoidal form around the target value.

Use **FROM-SPEED** and **TO-SPEED** to define the upper and lower spindle speed limits of a spindle speed range in which the pulsing spindle speed is effective. Both input values are optional. If you do not define a parameter, the function applies to the entire speed range.

Use the **FUNCTION S-PULSE RESET** to reset the pulsing spindle speed.

When a pulsing spindle speed is active, the control shows a corresponding icon in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

Input

**11 FUNCTION S-PULSE P-TIME10 SCALE5
FROM-SPEED4800 TO-SPEED5200**

; Spindle speed variation of 5 % around the nominal value within 10 seconds (with limit values)

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION S-PULSE	Start of syntax for pulsing spindle speed
P-TIME or RESET	Define the duration of an oscillation in seconds, or reset the pulsing spindle speed
SCALE	Spindle speed change in % Only if P-TIME has been selected
FROM-SPEED	Lower speed limit from which the pulsing spindle speed will be effective Only if P-TIME has been selected Optional syntax element
TO-SPEED	Upper speed limit up to which the pulsing spindle speed will be effective Only if P-TIME has been selected Optional syntax element

Note

The control never exceeds a programmed speed limit. The spindle speed is maintained until the sinusoidal curve of the **S-PULSE FUNCTION** falls below the maximum speed once more.

14.2.3 Programmed dwell time with FUNCTION DWELL

Application

The **FUNCTION DWELL** function enables you to program a dwell time in seconds or define the number of spindle revolutions for dwelling.

Related topics

- Cycle **9 DWELL TIME**

Further information: User's Manual for Machining Cycles

- Program recurring dwell time

Further information: "Cyclic dwell time with FUNCTION FEED DWELL", Page 373

Description of function

The defined dwell time from **FUNCTION DWELL** is effective in both milling and turning operations.

Input

11 FUNCTION DWELL TIME10	; Dwell time for 10 seconds
12 FUNCTION DWELL REV5.8	; Dwell time for 5.8 spindle revolutions

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION DWELL	Syntax initiator for singular dwell time
TIME or REV	Duration of dwell time in seconds or spindle revolutions

14.2.4 Cyclic dwell time with FUNCTION FEED DWELL

Application

The **FUNCTION FEED DWELL** function can be used to program a cyclic dwell time in seconds, e.g. to force chip breaking in a turning cycle.

Related topics

- Program a one-time dwell time

Further information: "Programmed dwell time with FUNCTION DWELL", Page 373

Description of function

The defined dwell time from **FUNCTION FEED DWELL** is effective in both milling and turning operations.

The **FUNCTION FEED DWELL** function is not effective with rapid traverse movements and probing motion.

Use **FUNCTION FEED DWELL RESET** to reset the recurring dwell time.

The control automatically resets the **FUNCTION FEED DWELL** function at the end of a program.

Program **FUNCTION FEED DWELL** immediately prior to the operation you wish to run with chip breaking. Reset the dwell time immediately following the machining with chip breaking.

Input

11 FUNCTION FEED DWELL D-TIME0.5 F-TIME5

; Activate cyclic dwell time: Machine for 5 seconds, hold for 0.5 seconds

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION FEED DWELL	Syntax initiator for cyclic dwell time
D-TIME or RESET	Define dwell time duration in seconds or reset recurring dwell time
F-TIME	Duration of machining time until the next dwell time in seconds Only if D-TIME is selected

Notes

NOTICE

Caution: Danger to the tool and workpiece!

When the **FUNCTION FEED DWELL** function is active, the control will repeatedly interrupt the feed movement. While the feed movement is interrupted, the tool remains at its current position, and the spindle continues to turn. During thread cutting, this behavior will cause the workpiece to become scrap. There is also a risk of tool breakage during execution!

- Deactivate the **FUNCTION FEED DWELL** function before cutting threads

- You can also reset the dwell time by entering **D-TIME 0**.

15

Monitoring

15.1 Component Monitoring with MONITORING HEATMAP (option 155)

Application

The **MONITORING HEATMAP** function allows you to start and stop the workpiece representation in a component heatmap from within the NC program.

The control monitors the selected component and shows the result in a heatmap on the workpiece.



If the process monitoring (option 168) in the simulation displays a process heat map, the control does not display a component heat map.

Further information: "Process Monitoring (option 168)", Page 378

Related topics

- **MON** tab in the **Status** workspace
Further information: User's Manual for Setup and Program Run
- Cycle **238 MEASURE MACHINE STATUS** (option 155)
Further information: User's Manual for Machining Cycles
- Color the workpiece as a heat map in the simulation
Further information: "Workpiece options column", Page 561
- **Process Monitoring** (option 168) with **SECTION MONITORING**
Further information: "Process Monitoring (option 168)", Page 378

Requirements


- Component Monitoring (software option 155)
- Components to be monitored are defined
In the optional machine parameter **CfgMonComponent** (no. 130900), the machine manufacturer defines the machine components to be monitored as well as the warning and error thresholds.

Description of function

A component heatmap is similar to the image from an infrared camera.

- Green: component works under conditions defined as safe
- Yellow: component works under warning zone conditions
- Red: Overload condition

The control shows these statuses on the workpiece in the simulation and can overwrite the statuses upon subsequent operations.

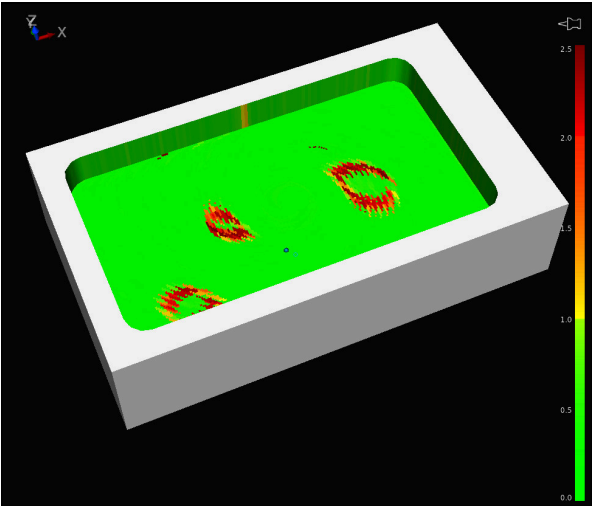

Representation of the component heat map in the simulation with missing pre-machining

Only one component at a time can be monitored with the heatmap. If you start the heatmap several times in a row, monitoring of the previous component is stopped.

Input

11 MONITORING HEATMAP START FOR "Spindle"	; Activate monitoring of the Spindle component and display it as a heat map
--	--

The NC function includes the following syntax elements:

Syntax element	Meaning
MONITORING HEATMAP	Syntax initiator for component monitoring
START FOR or STOP	Start or stop component monitoring
" " or QS	Fixed or variable name of the component to be monitored Only if START FOR is selected

Note

The control cannot display changes in the statuses directly in the simulation, as it must process the incoming signals, e.g. in the event of a tool breakage. The control shows the change with a slight time delay.

15.2 Process Monitoring (option 168)


15.2.1 Fundamentals

The control uses process monitoring to detect disturbances in the machining process, e.g.:

- Tool breakage
- Incorrect or missing workpiece pre-machining
- Changed position or size of the workpiece blank
- Wrong material, e.g. aluminum instead of steel

Process monitoring allows you to monitor the machining process during program run using monitoring tasks. The monitoring task compares the signal curve of the current execution of an NC program with one or more reference machining operations. The monitoring task uses these reference machining operations to determine an upper and lower limit. If the current machining operation is outside the limits for a defined hold time, the monitoring task responds with a defined reaction. If, for example, the spindle current drops due to a tool breakage, the monitoring task stops the NC program.

Further information: User's Manual for Setup and Program Run

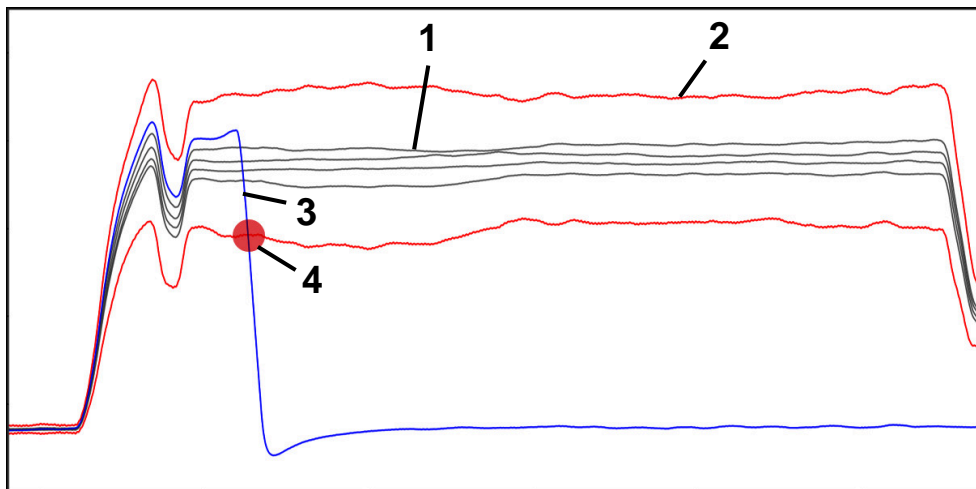

Drop in spindle current due to tool breakage

- | | | |
|---|---|--|
| 1 | — | References |
| 2 | — | Limits consisting of tunnel width and, if necessary, expansion |
| 3 | — | Current machining operation |
| 4 | ● | Process fault, e.g. due to tool breakage |

If you are using process monitoring, the following steps are required:

- Defining monitoring sections in the NC program
Further information: "Defining monitoring sections with MONITORING SECTION (option 168)", Page 379
- Slowly running-in the NC program in Single Block mode before activating process monitoring
Further information: User's Manual for Setup and Program Run
- Activating process monitoring
Further information: User's Manual for Setup and Program Run
- If necessary, configuring settings for the monitoring tasks
 - Selecting a strategy template
Further information: User's Manual for Setup and Program Run
 - Adding or removing monitoring tasks
Further information: User's Manual for Setup and Program Run
 - Defining settings and responses within the monitoring tasks
Further information: User's Manual for Setup and Program Run
 - Displaying monitoring task in the simulation as a process heat map
Further information: "Workpiece options column", Page 561
Further information: User's Manual for Setup and Program Run
- Running the NC program in Full Sequence
Further information: User's Manual for Setup and Program Run
- Selecting the required references as necessary for the monitoring tasks
Further information: User's Manual for Setup and Program Run

Related topics

- **Component monitoring** (option 155) with **MONITORING HEATMAP**
Further information: "Component Monitoring with MONITORING HEATMAP (option 155)", Page 376

15.2.2 Defining monitoring sections with MONITORING SECTION (option 168)

Application

With the **MONITORING SECTION** function, you divide the NC program into monitoring sections for process monitoring.

Related topics

- **Process Monitoring** workspace
Further information: User's Manual for Setup and Program Run

Requirement

- Process Monitoring (software option 168)

Description of function

MONITORING SECTION START is used to define the start of a new monitoring section and **MONITORING SECTION STOP**, to define the end of the monitoring section.

You must not nest monitoring sections.

If you do not define a **MONITORING SECTION STOP**, the control still interprets a new monitoring section for the following functions:

- For a new **MONITORING SECTION START**

- For a physical **TOOL CALL**

The control only interprets a new monitoring section for a tool call when a tool change takes place.

Further information: "Tool call by TOOL CALL", Page 159

Do not program the following functions within a monitoring section:

- Calling of a subprogram with **LBL CALL**

Except when the calling subprogram is also programmed within the monitoring section

- Calling of an NC program with **PGM CALL**

- Calling of an NC program with cycle **12 PGM CALL**

You can define monitoring sections within called subprograms or NC programs.

Input

11 MONITORING SECTION START AS
"finish contour"

; Start of the monitoring section including additional naming

The NC function includes the following syntax elements:

Syntax element	Meaning
MONITORING SECTION	Syntax initiator for the monitoring section of process monitoring
START or STOP	Start or end of the monitoring section
AS	Additional designation Optional syntax element Only when START is selected

Notes

- The control shows the start and end of the monitoring section in the structure.

Further information: "Settings in the Program workspace", Page 109

- End the monitoring section before the end of the program with **MONITORING SECTION STOP**.

If you do not define an end for the monitoring section, the control ends the monitoring section with **END PGM**.

16

**Multiple-Axis
Machining**

16.1 Working with the parallel axes U, V and W

16.1.1 Fundamentals

In addition to the principal axes X, Y and Z, the parallel axes U, V and W are available. A parallel axis is, for example, a quill for holes so that smaller masses are moved on large machines.

Further information: "Programmable axes", Page 98

The control provides the following functions for machining with the parallel axes U, V and W:

- **FUNCTION PARAXCOMP:** Define behavior when positioning parallel axes
Further information: "Defining behavior when positioning parallel axes with FUNCTION PARAXCOMP", Page 382
- **FUNCTION PARAXMODE:** Select three linear axes for machining
Further information: "Select three linear axes for machining with FUNCTION PARAXMODE", Page 384

If the machine manufacturer has already enabled the parallel axis in the configuration, the control takes this axis into account in the calculations, without you having to program **PARAXCOMP**. This means that the control continuously takes the parallel axis into account in the calculations and you can therefore also probe a workpiece with any position of the W axis, for example.

In this case, the control displays an icon in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

Please note that **PARAXCOMP OFF** does not deactivate the parallel axis in this case, but the control reactivates the standard configuration. The control deactivates automatic calculation only if you include the axis in the NC block, e.g. **PARAXCOMP OFF W**.

After the control has booted, the configuration defined by the machine manufacturer is in effect.

Requirements

- Machine with parallel axes
- Parallel axis functions activated by the machine manufacturer
 The machine manufacturer uses the optional machine parameter **parAxComp** (no. 300205) to define whether the parallel axis function is switched on by default.

16.1.2 Defining behavior when positioning parallel axes with FUNCTION PARAXCOMP

Application

The **FUNCTION PARAXCOMP** function is used to define whether the control takes parallel axes into account in the traversing movements with the associated main axis.

Description of function

If the **FUNCTION PARAXCOMP** function is active, the control displays an icon in the **Positions** workspace. The icon for **FUNCTION PARAXMODE** may cover an active icon for **FUNCTION PARAXCOMP**.

Further information: User's Manual for Setup and Program Run

FUNCTION PARAXCOMP DISPLAY

Use the **PARAXCOMP DISPLAY** function to activate the display function for parallel axis movements. The control includes movements of the parallel axis in the position display of the associated main axis (sum display). Therefore, the position display of the main axis always displays the relative distance from the tool to the workpiece, regardless of whether you move the main axis or the parallel axis.

FUNCTION PARAXCOMP MOVE

The control uses the **PARAXCOMP MOVE** function to compensate for movements of a parallel axis by performing compensation movements in the associated principal axis.

For example, if a parallel-axis movement is performed in the negative W-axis direction, the principal axis Z is moved simultaneously in the positive direction by the same value. The relative distance from the tool to the workpiece remains the same. Application in gantry-type milling machines: Retract the spindle sleeve to move the cross beam down simultaneously.

FUNCTION PARAXCOMP OFF

Use the **PARAXCOMP OFF** function to switch off the **PARAXCOMP DISPLAY** and **PARAXCOMP MOVE** parallel axis functions.

The following actions cause the control to reset the **PARAXCOMP** parallel-axis function:

- Selection of NC program
- **PARAXCOMP OFF**

When **FUNCTION PARAXCOMP** is not active, the control does not display the corresponding icon and the additional information after the axis designations.

Input**11 FUNCTION PARAXCOMP MOVE W**

; Compensate for movements of the W axis by means of a compensating movement in the Z axis

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION PARAXCOMP	Syntax initiator for the behavior when positioning parallel axes
DISPLAY, MOVE or OFF	Calculate the values of the parallel axis with the main axis, compensate for or do not take into account movements with the main axis
X, Y, Z, U, V or W	Affected axis Optional syntax element

Note

The **PARAXCOMP MOVE** function can be used only in connection with straight-line blocks (**L**).

16.1.3 Select three linear axes for machining with FUNCTION PARAXMODE

Application

Use the **PARAXMODE** function to define the axes the control is to use for machining. You program all traverse movements and contour descriptions in the principal axes X, Y and Z, independent of your machine.

Requirement

- Parallel axis is calculated

If your machine manufacturer has not yet activated the **PARAXCOMP** function as default, you must activate **PARAXCOMP** before you can work with **PARAXMODE**.

Further information: "Defining behavior when positioning parallel axes with FUNCTION PARAXCOMP", Page 382

Description of function

If the **PARAXMODE** function is active, the control uses the axes defined in the function to execute the programmed traverse movements. If the control is to move the principal axis deselected by **PARAXMODE**, you can identify this axis by additionally entering the character **&**. The **&** character then refers to the principal axis.

Further information: "Moving the principal axis and the parallel axis", Page 385

Define 3 axes in the **PARAXMODE** function (e.g. **FUNCTION PARAXMODE X Y W**) to be used by the control for programmed traverse movements.

If the **FUNCTION PARAXMODE** function is active, the control displays an icon in the **Positions** workspace. The icon for **FUNCTION PARAXMODE** may cover an active icon for **FUNCTION PARAXCOMP**.

Further information: User's Manual for Setup and Program Run

FUNCTION PARAXMODE OFF

Use the **PARAXCOMP OFF** function to switch off the parallel-axis function. The control then uses the principal axes defined by the machine manufacturer.

The control resets the **PARAXMODE ON** parallel-axis function via the following functions:

- Selection of NC program
- End of program
- **M2** and **M30**
- **PARAXMODE OFF**

Input

11 FUNCTION PARAX MODE X Y W

; Execute programmed traversing movements with axes **X**, **Y** and **W**.

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION PARAX MODE	Syntax initiator for axis selection for machining
OFF	Deactivate the parallel axis function Optional syntax element
X, Y, Z, U, V or W	Three axes for machining Only for FUNCTION PARAX MODE

Moving the principal axis and the parallel axis

If the **PARAXMODE** function is active, you can traverse the deselected main axis with the **&** character within the straight line **L**.

Further information: "Straight line L", Page 175

To traverse a deselected main axis:



- ▶ Select **L**
- ▶ Define coordinates
- ▶ Select deselected main axis, e.g. **&Z**
- ▶ Enter a value
- ▶ Define the radius compensation, if necessary
- ▶ Define the feed rate, if necessary
- ▶ Define a miscellaneous function, if necessary
- ▶ Confirm your input

Notes

- You must deactivate the parallel-axis functions before switching the machine kinematics.
- You can deactivate the programming of parallel axes with the machine parameter **noParaxMode** (no. 105413).
- In order for the control to offset the principal axis deselected with **PARAXMODE**, switch the **PARAXCOMP** function on for this axis.
- Additional positioning of a principal axis with the **&** command is done in the REF system. If you have set the position display to display ACTUAL values, this movement will not be shown. If necessary, switch the position display to REF values.

Further information: User's Manual for Setup and Program Run

- Your machine manufacturer will define the calculation of possible offset values (X_OFFS, Y_OFFS and Z_OFFS from the preset table) for the axes positioned with the **&** operator in the **presetToAlignAxis** machine parameter (no. 300203).

16.1.4 Parallel axes in conjunction with machining cycles

You can also use most machining cycles of the control with parallel axes.

Further information: User's Manual for Machining Cycles

You cannot use the following cycles with parallel axes:

- Cycle **285 DEFINE GEAR** (option 157)
- Cycle **286 GEAR HOBGING** (option 157)
- Cycle **287 GEAR SKIVING** (option 157)
- Touch probe cycles

16.1.5 Example

Drilling is carried out with the W axis in the following NC program:

0 BEGIN PGM PAR MM	
1 BLK FORM 0.1 Z X+0 Y+0 Z-20	
2 BLK FORM 0.2 X+100 Y+100 Z+0	
3 TOOL CALL 5 Z S2222	; Call the tool in the tool axis Z
4 L Z+100 R0 FMAX M3	; Position the main axis
5 CYCL DEF 200 DRILLING	
Q200=+2 ;SET-UP CLEARANCE	
Q201=-20 ;DEPTH	
Q206=+150 ;FEED RATE FOR PLNGNG	
Q202=+5 ;PLUNGING DEPTH	
Q210=+0 ;DWELL TIME AT TOP	
Q203=+0 ;SURFACE COORDINATE	
Q204=+50 ;2ND SET-UP CLEARANCE	
Q211=+0 ;DWELL TIME AT DEPTH	
Q395=+0 ;DEPTH REFERENCE	
6 FUNCTION PARAXCOMP DISPLAY Z	; Activate display compensation
7 FUNCTION PARAXMODE X Y W	; Positive axis selection
8 L X+50 Y+50 R0 FMAX M99	; The parallel axis W executes the infeed
9 FUNCTION PARAXMODE OFF	; Restore the standard configuration
10 L M30	
11 END PGM PAR MM	

16.2 Using the facing head with FACING HEAD POS (option 50)

Application

With a facing slide, also called boring head, you can perform almost all turning operations with fewer different tools. The slide position of the facing slide in the X direction can be programmed. On the facing slide you mount, for example, a longitudinal turning tool that you call with a TOOL CALL block.

Related topics

- Machining with parallel axes **U**, **V** and **W**

Further information: "Working with the parallel axes U, V and W", Page 382

Requirements

- Combined milling/turning (software option 50)
- Control prepared by the machine manufacturer
The machine manufacturer must take the facing head into account in the kinematics.
- Kinematics with facing head activated
Further information: "Switching the operating mode with FUNCTION MODE", Page 122
- Workpiece datum in the working plane is at the center of the rotationally symmetrical contour
With a facing head, the workpiece datum must not be in the center of the rotary table, because the tool spindle rotates.
Further information: "Datum shift with TRANS DATUM", Page 242

Description of function



Refer to your machine manual.

The machine manufacturer can provide his own cycles for working with a facing slide. The standard functional range is described below.

The facing head is defined as a turning tool.

Further information: User's Manual for Setup and Program Run

Please note for tool calls:

- **TOOL CALL** block without tool axis
- Cutting speed and spindle speed with **TURNDATA SPIN**
- Switch the spindle on with **M3** or **M4**

Machining also works with a tilted working plane and on workpieces that are not rotationally symmetric.

If you move with the facing head without the **FACING HEAD POS** function, you must program the motions of the facing head with the U axis, e.g. in the **Manual operation** application. If the **FACING HEAD POS** function is active, program the facing head with the X axis.

When you activate the facing head, the control automatically positions itself at the workpiece datum in **X** and **Y**. To avoid collisions, you can define a safe height using the **HEIGHT** syntax element.

The facing head is deactivated with the **FUNCTION FACING HEAD** function.

Input

Activating the facing head

11 FACING HEAD POS HEIGHT+100 FMAX ; Activate facing head and move with rapid traverse to safe height **Z+100**

The NC function includes the following syntax elements:

Syntax element	Meaning
FACING HEAD POS	Activate the syntax initiator for the facing head
HEIGHT	Safe height in the tool axis Optional syntax element
F or FMAX	Approach safe height with defined feed rate or rapid traverse Optional syntax element
M	Additional function Optional syntax element

Deactivating the facing head

11 FUNCTION FACING HEAD OFF ; Deactivate facing head

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION FACING HEAD OFF	Deactivate the syntax initiator for the facing head

Notes

NOTICE**Caution: Danger to the tool and workpiece!**

For a facing slide to be used, a kinematic model prepared by the machine manufacturer must be selected by means of the function **FUNCTION MODE TURN**. In this kinematic model, the control implements the programmed X-axis movements of the facing slide as U-axis movements when the **FACING HEAD** function is active. When the **FACING HEAD** function is not active and in **Manual operation** mode, this automated implementation does not take place. As a result, **X** axis movements (programmed or axis key) will be performed in the X axis. In this case, the facing slide must be moved with the U axis. There is a risk of collision during retraction or manual movements!

- ▶ Position facing slide at home position with active **FACING HEAD POS** function
- ▶ Retract facing slide with active **FACING HEAD POS** function
- ▶ In **Manual operation** mode, move the facing slide with the **U** axis key
- ▶ Because the **Tilt the working plane** function is possible, pay attention to the 3D ROT status

- To set a spindle speed limitation you can use the **NMAX** value from the tool table as well as **SMAX** value from **FUNCTION TURNDATA SPIN**.
- The following constraints apply to the use of a facing slide:
 - Miscellaneous functions **M91** and **M92** cannot be used
 - Retraction with **M140** is not possible
 - **TCPM** or **M128** are not possible (option 9)
 - **DCM** collision monitoring cannot be used (option 40)
 - Cycles **800**, **801**, and **880** cannot be used
- If you are using the facing slide in the tilted working plane, please note the following:
 - The control calculates the tilted working plane as in milling mode. The **COORD ROT** and **TABLE ROT** functions, as well as **SYM (SEQ)**, refer to the XY plane.
Further information: "Tilting solution", Page 287
 - HEIDENHAIN recommends using the **TURN** positioning behavior. The **MOVE** positioning behavior is not the best option in combination with the facing slide.
Further information: "Rotary axis positioning", Page 284

16.3 Machining with polar kinematics with FUNCTION POLARKIN

Application

In a polar kinematic model, the path contours of the working plane are performed by one linear axis and one rotary axis instead of by two linear principal axes. The working plane is defined by the linear principal axis and the rotary axis while the working space is defined by these two axes and the infeed axis.

On milling machines, various linear principal axes can be replaced with suitable rotary axes. For example on large machines, polar kinematics enable you to machine much larger surfaces than with only the principal axes.

On turning and grinding machines that have only two linear principal axes, polar kinematics enable milling operations to be performed on the front face.

Requirements

- Machine with at least one rotary axis


The polar rotary axis must be installed onto the table side so that it is opposite the selected linear axes and must be configured as a modulo axis. Thus, the linear axes must not be positioned between the rotary axis and the table. The maximum range of traverse of the rotary axis is limited by the software limit switches if necessary.

- **PARAXCOMP DISPLAY** function programmed with at least the main axes **X**, **Y** and **Z**.

HEIDENHAIN recommends defining all of the available axes within the **PARAXCOMP DISPLAY** function.

Further information: "Defining behavior when positioning parallel axes with FUNCTION PARAXCOMP", Page 382

Description of function

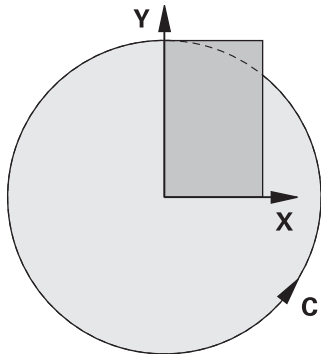


When the polar kinematics are active, the control displays an icon in the **Positions** workspace. This icon covers the icon for the **PARAXCOMP DISPLAY** function.

Use the **POLARKIN AXES** function to activate the polar kinematics. The axis data define the radial axis, the infeed axis, and the polar axis. The **MODE** data influence the positioning behavior, whereas the **POLE** data define the machining at the pole. The pole is the center of rotation of the rotary axis in this case.

Notes on the axes to be selected:

- The first linear axis must be radial to the rotary axis.
- The second linear axis defines the infeed axis and must be parallel to the rotary axis.
- The rotary axis defines the polar axis and is defined last.
- Any available modulo axis that is installed onto the table side so that it is opposite the selected linear axes can be used as the rotary axis.
- The two selected linear axes thus span an area within which the rotary axis also lies.

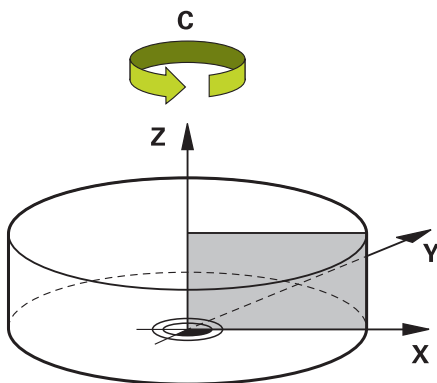

The following scenarios lead to deactivation of the polar kinematics:

- Execution of the **POLARKIN OFF** function
- Selection of an NC program
- Reaching the end of the NC program
- Abortion of the NC program
- Selecting a kinematic model
- Restarting the control

MODE options

The control provides the following options for positioning behavior:

MODE options:

Syntax	Function
POS	Seen from the center of rotation, the control performs machining in the positive direction of the radial axis. The radial axis must be prepositioned correspondingly.
NEG	Seen from the center of rotation, the control performs machining in the negative direction of the radial axis. The radial axis must be prepositioned correspondingly.
KEEP	The control remains with the radial axis on that side of the center of rotation on which the axis is positioned when the function is activated. If the radial axis is on the center of rotation upon switch-on, POS applies.
ANG	The control remains with the radial axis on that side of the center of rotation on which the axis is positioned when the function is activated. If you set POLE to ALLOWED , positioning through the pole is possible. The pole side is changed and a 180-degree rotation of the rotary axis is prevented.

POLE options

The control provides the following options for machining at the pole:

POLE options:

Syntax	Function
ALLOWED	The control permits machining operations at the pole
SKIPPED	The control prevents machining operations at the pole



The disabled area corresponds to a circular surface with a radius of 0.001 mm (1 µm) around the pole.

Input

11 FUNCTION POLARKIN AXES X Z C
MODE: KEEP POLE: ALLOWED

; Activate polar kinematics with axes **X**,
Z and **C**.

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION POLARKIN	Syntax initiator for polar kinematics
AXES or OFF	Activate or deactivate polar kinematics
X, Y, Z, U, V, A, B, C	Selection of two linear axes and one rotary axis Only when AXES is selected Other possibilities might be available, depending on the machine.
MODE:	Selection of the positioning behavior Further information: "MODE options", Page 392 Only when AXES is selected
POLE:	Selection of machining in the pole Further information: "POLE options", Page 392 Only when AXES is selected

Notes

- The principal axes X, Y, and Z as well as the possible parallel axes U, V, and W can be used as radial axes or infeed axes.
- Position the linear axis that will not be included in the polar kinematics to the coordinate of the pole, before the **POLARKIN** function. Otherwise, a non-machinable area with a radius that corresponds to at least the value of the deselected linear axis would result.
- Avoid performing machining operations at the pole or near the pole, because fluctuations in feed rate may occur in this area. For this reason, ideally use the following **POLE** option: **SKIPPED**.
- The machine manufacturer uses the optional machine parameter **kindOfPref** (no. 202301) to define the behavior of the control when the tool center point path passes through the polar axis.
- Polar kinematics cannot be combined with the following functions:
 - Traverse motions with **M91**
Further information: "Traversing in the machine coordinate system M-CS with M91", Page 416
 - Tilting the working plane (option 8)
 - **FUNCTION TCPM** or **M128** (option 9)
- Note that the traversing range of the axes may be limited.
Further information: "Notes on software limit switches for modulo axes", Page 405
Further information: User's Manual for Setup and Program Run

16.3.1 Example: SL cycles in the polar kinematics


0 BEGIN PGM POLARKIN_SL MM	
1 BLK FORM 0.1 Z X-100 Y-100 Z-30	
2 BLK FORM 0.2 X+100 Y+100 Z+0	
3 TOOL CALL 2 Z S2000 F750	
4 FUNCTION PARAXCOMP DISPLAY X Y Z	; Activate PARAXCOMP DISPLAY
5 L X+0 Y+0.0011 Z+10 A+0 C+0 FMAX M3	; Pre-position outside the disabled pole area
6 POLARKIN AXES Y Z C MODE:KEEP POLE:SKIPPED	; Activate POLARKIN
* - ...	; Datum shift in polar kinematics
9 TRANS DATUM AXIS X+50 Y+50 Z+0	
10 CYCL DEF 7.3 Z+0	
11 CYCL DEF 14.0 CONTOUR	
12 CYCL DEF 14.1 CONTOUR LABEL2	
13 CYCL DEF 20 CONTOUR DATA	
Q1=-10 ;MILLING DEPTH	
Q2=+1 ;TOOL PATH OVERLAP	
Q3=+0 ;ALLOWANCE FOR SIDE	
Q4=+0 ;ALLOWANCE FOR FLOOR	
Q5=+0 ;SURFACE COORDINATE	
Q6=+2 ;SET-UP CLEARANCE	
Q7=+50 ;CLEARANCE HEIGHT	
Q8=+0 ;ROUNDING RADIUS	
Q9=+1 ;ROTATIONAL DIRECTION	
14 CYCL DEF 22 ROUGH-OUT	
Q10=-5 ;PLUNGING DEPTH	
Q11=+150 ;FEED RATE FOR PLNGNG	
Q12=+500 ;FEED RATE F. ROUGHNG	
Q18=+0 ;COARSE ROUGHING TOOL	
Q19=+0 ;FEED RATE FOR RECIP.	
Q208=+99999 ;RETRACTION FEED RATE	
Q401=+100 ;FEED RATE FACTOR	
Q404=+0 ;FINE ROUGH STRATEGY	
15 M99	
16 CYCL DEF 7.0 DATUM SHIFT	
17 CYCL DEF 7.1 X+0	
18 CYCL DEF 7.2 Y+0	
19 CYCL DEF 7.3 Z+0	
20 POLARKIN OFF	; Deactivate POLARKIN
21 FUNCTION PARAXCOMP OFF X Y Z	; Deactivate PARAXCOMP DISPLAY
22 L X+0 Y+0 Z+10 A+0 C+0 FMAX	
23 L M30	
24 LBL 2	

25 L X-20 Y-20 RR	
26 L X+0 Y+20	
27 L X+20 Y-20	
28 L X-20 Y-20	
29 LBL 0	
30 END PGM POLARKIN_SL MM	

16.4 CAM-generated NC programs

Application

CAM-generated NC programs are created externally of the control using CAM systems. In combination with 5-axis simultaneous machining and free-form surfaces, CAM systems provide a convenient solution, which in some cases may be the only solution possible.

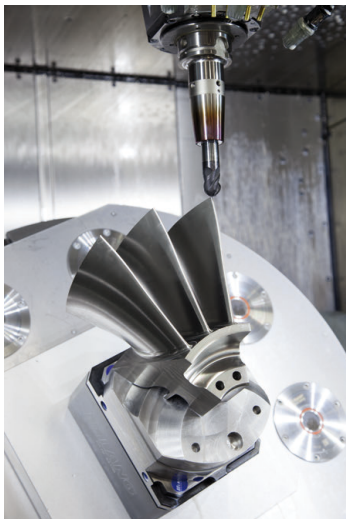


For CAM-generated NC programs to be able to use the full performance potential of the control and to provide you with such options as intervention and correction, certain requirements must be met.

CAM-generated NC programs must meet the same requirements as manually created NC programs. In addition, other requirements arise from the process chain.

Further information: "Process steps", Page 400

The process chain specifies the path from a design to the finished workpiece.

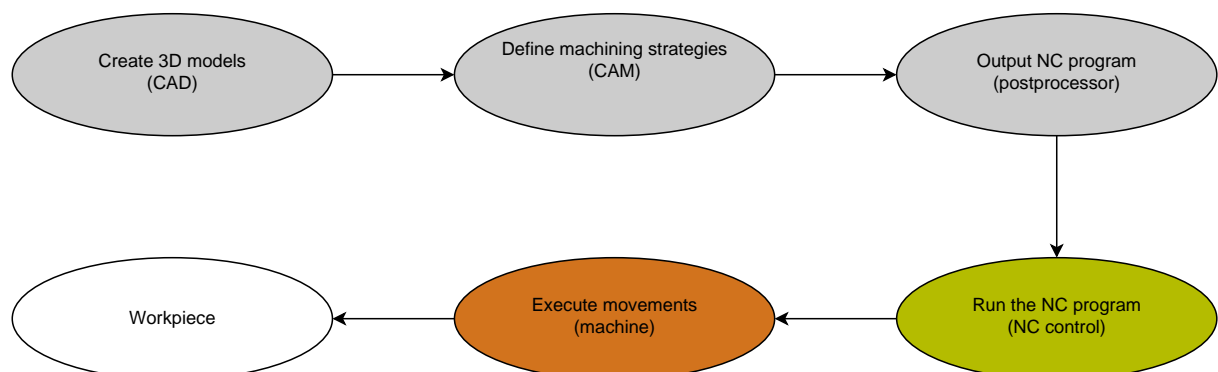

Related topics

- Using 3D data directly at the control
Further information: User's Manual for Setup and Program Run
- Programming graphically
Further information: "Graphical Programming", Page 515

16.4.1 Output formats of NC programs**Output in HEIDENHAIN Klartext format**

If you output the NC program in Klartext, you have the following options:

- 3-axis output
- Output with up to five axes, without **M128** or **FUNCTION TCPM**
- Output with up to five axes, with **M128** or **FUNCTION TCPM**



Requirements for 5-axis machining:

- Machine with rotary axes
- Advanced Functions Set 1 (option 8)
- Advanced Functions Set 2 (option 9) for **M128** or **FUNCTION TCPM**

If the machine kinematics and exact tool data are available to the CAM system, you can output 5-axis NC programs without **M128** or **FUNCTION TCPM**. The programmed feed rate is calculated for all axis components per NC block, which can result in different cutting speeds.

An NC program with **M128** or **FUNCTION TCPM** is machine-neutral and more flexible, since the control takes over the kinematics calculation and uses the tool data from the tool management. The programmed feed rate acts on the tool location point.


Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

Further information: "Presets on the tool", Page 154

Examples

11 L X+88 Y+23.5375 Z-8.3 R0 F5000	; 3-axis
11 L X+88 Y+23.5375 Z-8.3 A+1.5 C+45 R0 F5000	; 5-axis without M128
11 L X+88 Y+23.5375 Z-8.3 A+1.5 C+45 R0 F5000 M128	; 5-axis with M128

Output with vectors

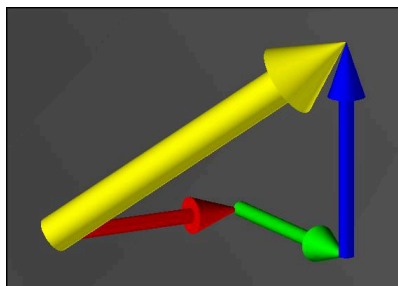

From the point of view of physics and geometry, a vector is a directed variable that describes a direction and a length.

When outputting with vectors, the control requires at least one normalized vector that specifies the direction of the surface normals or the tool position. Optionally, the NC block contains both vectors.

A normalized vector is a vector with the value 1. The vector amount corresponds to the root of the sum of the squares of its components.

$$\sqrt{NX^2 + NY^2 + NZ^2} = 1$$



Prerequisites:

- Machine with rotary axes
- Advanced Functions Set 1 (option 8)
- Advanced Functions Set 2 (option 9)



You can only use the output with vectors in milling mode.

Further information: "Switching the operating mode with FUNCTION MODE", Page 122



Vector output with the direction of the surface normals is required for using 3D tool radius compensation depending on the tool's contact angle (option 92).

Further information: "3D radius compensation depending on the tool contact angle (option 92)", Page 330

Examples


```
11 LN X0.499 Y-3.112 Z-17.105
   NX0.2196165 NY-0.1369522
   NZ0.9659258
```

; 3-axis with surface normal vector, without tool orientation

```
11 LN X0.499 Y-3.112 Z-17.105
   NX0.2196165 NY-0.1369522
   NZ0.9659258 TX+0,0078922 TY-
   0,8764339 TZ+0,2590319 M128
```

; 5-axis with M128, surface normal vector and tool orientation

Structure of an NC block with vectors

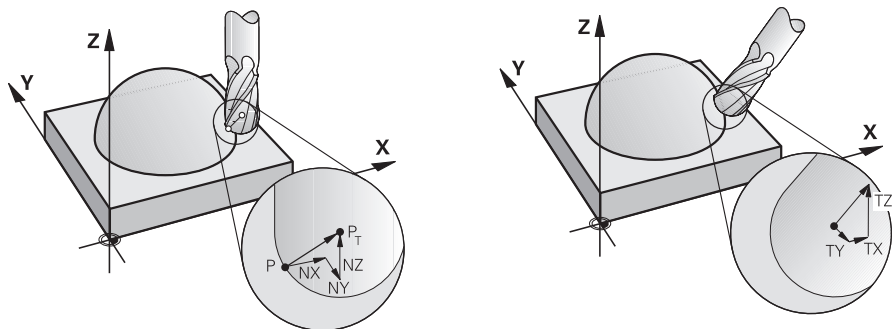

Surface normal vector perpendicular to the contour Tool direction vector


Example

11 LN X+0.499 Y-3.112 Z-17.105 NX0 NY0 NZ1 TX+0,0078922 TY- 0,8764339 TZ+0,2590319	; Straight line LN with surface normal vector and tool orientation
---	--

Syntax element	Meaning
LN	Straight line LN with surface normal vector
X Y Z	Target coordinates
NX NY NZ	Components of the surface normal vector
TX TY TZ	Components of the tool direction vector

16.4.2 Types of machining according to number of axes

3-axis machining

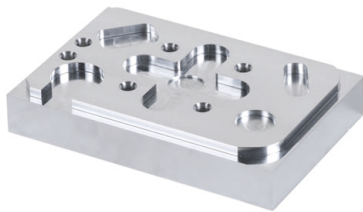

If only the linear axes **X**, **Y** and **Z** are required for machining a workpiece, 3-axis machining takes place.

3+2-axis machining



If tilting of the working plane is required for machining a workpiece, 3+2-axis machining takes place.



Prerequisites:

- Machine with rotary axes
- Advanced Functions Set 1 (option 8)

Inclined machining



For inclined machining, also referred to as inclined-tool machining, the tool is positioned at a user-defined angle to the working plane. The orientation of the working plane coordinate system **WPL-CS** is not changed, but only the position of the rotary axes and therefore the tool position. The control is able to compensate the offset that is created in the linear axes.

Inclined machining is used in conjunction with undercuts and short tool clamping lengths.



Prerequisites:

- Machine with rotary axes
- Advanced Functions Set 1 (option 8)
- Advanced Functions Set 2 (option 9)

5-axis machining



In 5-axis machining, also referred to as 5-axis simultaneous machining, the machine moves five axes at the same time. For free-form surfaces, this means that the tool can always be oriented perfectly with respect to the workpiece surface.



Prerequisites:

- Machine with rotary axes
- Advanced Functions Set 1 (option 8)
- Advanced Functions Set 2 (option 9)

5-axis machining is not possible with the export version of the control.

16.4.3 Process steps

CAD

Application

Using CAD systems, designers create the 3D models of the required workpieces. Incorrect CAD data has a negative impact on the entire process chain, including the quality of the workpiece.

Notes

- In 3D models, avoid open or overlapping faces and unnecessary points. If possible, use the check functions of the CAD system.
- Design or save the 3D models based on the center of tolerance and not the nominal dimensions.



Support manufacturing with additional files:

- Provide 3D models in STL format. The control-internal simulation can use the CAD data as blank and finished parts, for example. Additional models of tool and workholding equipment are important in conjunction with collision testing (option 40).
- Provide drawings with the dimensions to be checked. The file type of the drawings is not important in this respect, since the control can also open files such as PDFs, and therefore supports paperless production.

Definition

Abbreviation	Definition
CAD (computer-aided design)	Computer-aided design

CAM and postprocessor

Application


Using machining strategies within the CAM systems, CAM programmers create machine-independent and control-independent NC programs based on the CAD data.

With the aid of the postprocessor, the NC programs are ultimately output specific to machine and control.

Notes on the CAD data

- Avoid quality losses due to unsuitable transfer formats. Integrated CAM systems with manufacturer-specific interfaces work in some cases without loss.
- Take advantage of the available accuracy of the CAD data obtained. A geometry or model error of less than 1 μm is recommended for finishing large radii.

Notes on chord error and Cycle 32 TOLERANCE

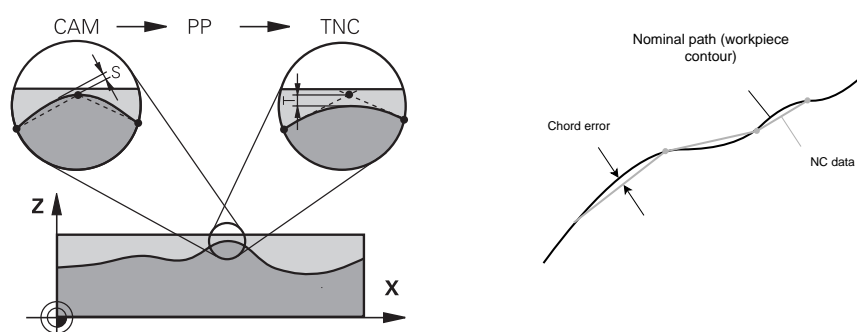

- In roughing, the focus is on the processing speed.
The sum of the chord error and the tolerance **T** in Cycle **32 TOLERANCE** must be smaller than the contour allowance, otherwise contour violations may occur.

Chord error in CAM system	0.004 mm to 0.015 mm
---------------------------	----------------------

Tolerance T in Cycle 32 TOLERANCE	0.05 mm to 0.3 mm
---	-------------------

- When finishing with the aim of high accuracy, the values must provide the required data density.

Chord error in CAM system	0.001 mm to 0.004 mm
---------------------------	----------------------

Tolerance T in Cycle 32 TOLERANCE	0.002 mm to 0.006 mm
---	----------------------

- When finishing with the aim of a high surface quality, the values must allow smoothing of the contour.


Chord error in CAM system	0.001 mm to 0.005 mm
---------------------------	----------------------

Tolerance T in Cycle 32 TOLERANCE	0.010 mm to 0.020 mm
---	----------------------


Further information: User's Manual for Machining Cycles

Notes on control-optimized NC output

- Prevent rounding errors by outputting axis positions with at least four decimal places. For optical components and workpieces with large radii (small curves), at least five decimal places are recommended. The output of surface normal vectors (for straight lines **LN**) requires at least seven decimal places.
- You can prevent the cumulation of tolerances by outputting absolute instead of incremental coordinate values for successive positioning blocks.
- If possible, output positioning blocks as arcs. The control calculates circles more accurately internally.
- Avoid repetitions of identical positions, feed specifications and additional functions, e.g. **M3**.
- Output Cycle **32 TOLERANCE** again only when changing settings.
- Make sure that corners (curvature transitions) are precisely defined by an NC block.
- The feed rate fluctuates strongly if the tool path is output with strong changes in direction. If possible, round the tool paths.

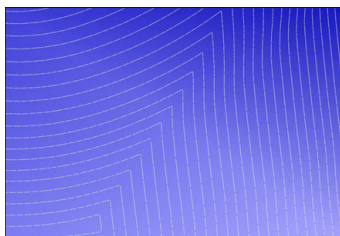

Tool paths with strong changes in direction at transitions

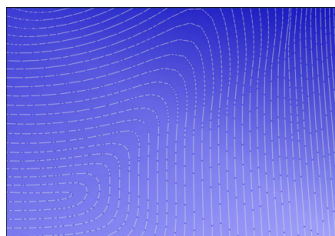

Tool paths with rounded transitions

- Do not use intermediate or interpolation points for straight paths. These points are generated, for example, by a constant point output.
- Prevent patterns on the workpiece surface by avoiding exactly synchronous point distribution on surfaces with even curvature.
- Use suitable point distances for the workpiece and the machining step. Possible starting values are between 0.25 mm and 0.5 mm. Values greater than 2.5 mm are not recommended, even with high machining feed rates.
- Prevent mispositioning by outputting the **PLANE** functions (option 8) with **MOVE** or **TURN** without separate positioning blocks. If you output **STAY** and position the rotary axes separately, use variables **Q120** to **Q122** instead of fixed axis values.

Further information: "Tilting the working plane with PLANE functions (option 8)", Page 250

- Prevent strong feed breaks at the tool location point by avoiding an unfavorable relationship between linear and rotary axis motion. A significant change in the tool adjustment angle with a slight change in the position of the tool is a problem, for example. Take into account the different speeds of the axes involved.
- If the machine moves five axes simultaneously, the kinematic errors of the axes may multiply. Use as few axes as possible simultaneously.
- Avoid unnecessary feed rate limits that you can define within **M128** or the **FUNCTION TCPM** (option 9) function for compensation movements.

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

- Take into account the machine-specific behavior of rotary axes.

Further information: "Notes on software limit switches for modulo axes", Page 405

Notes on tools

- A ball-nose cutter, a CAM output to the tool center point and a high rotational axis tolerance **TA** (1° to 3°) in cycle **32 TOLERANCE** enable uniform feed paths.
- Ball-nose or toroidal milling cutter and a CAM output relative to the tool tip require low rotational axis tolerances **TA** (approx. 0.1°) in Cycle **32 TOLERANCE**. Contour violations are more likely to occur at higher values. The extent of the contour violations depends on factors such as the tool position, the tool radius and the depth of engagement.

Further information: "Presets on the tool", Page 154

Notes for user-friendly NC outputs

- Facilitate the easy adaptation of NC programs by using the machining and touch probe cycles of the control.
- Facilitate both the adaptation options and the overview by defining feed rates centrally using variables. It is preferable to use freely usable variables, e.g. **QL** parameters.

Further information: "Variables: Q, QL, QR and QS parameters", Page 454

- Provide a better overview by structuring the NC programs. Use e.g. subprograms within the NC programs. If possible, divide larger projects into multiple separate NC programs.

Further information: "Programming Techniques", Page 209

- Support correction options by outputting contours with tool radius correction.

Further information: User's Manual for Setup and Program Run

- Use structure items to enable fast navigation within the NC programs.

Further information: "Structuring of NC programs", Page 541

- Use comments to communicate important information about the NC program.

Further information: "Adding comments", Page 540

NC control and machine**Application**

The control uses the points defined in the NC program to calculate the motions of each machine axis as well as the required velocity profiles. Control-internal filter functions then process and smooth the contour so that the control does not exceed the maximum permissible path deviation.

The motions and velocity profiles calculated are implemented as movements of the tool by the machine's drive system.

You can use various intervention and correction options to optimize machining.

Notes on the use of CAM-generated NC programs

- The simulation of machine and control-independent NC data within the CAM systems can deviate from the actual machining. Check the CAM-generated NC programs using the control-internal simulation.

Further information: "Simulation Workspace", Page 557

- Take into account the machine-specific behavior of rotary axes.

Further information: "Notes on software limit switches for modulo axes", Page 405

- Make sure that the required tools are available and that the remaining service life is sufficient.

Further information: User's Manual for Setup and Program Run

- If necessary, change the values in Cycle **32 TOLERANCE** depending on the chord error and the dynamic response of the machine.

Further information: User's Manual for Machining Cycles



Refer to your machine manual.

Some machine manufacturers provide an additional cycle for adapting the behavior of the machine to the respective machining operation (e.g. Cycle **332 Tuning**). Cycle **332** can be used to modify filter settings, acceleration settings and jerk settings.

- If the CAM-generated NC program contains normalized vectors, you can also correct tools three-dimensionally.

Further information: "Output formats of NC programs", Page 396

Further information: "3D radius compensation depending on the tool contact angle (option 92)", Page 330

- Software options enable further optimizations.

Further information: "Functions and function packages", Page 407

Further information: "Software options", Page 45

Notes on software limit switches for modulo axes



The following information on software limit switches for modulo axes also applies to traversing limits.

Further information: User's Manual for Setup and Program Run

The following general conditions apply to software limit switches for modulo axes:

- The lower limit is greater than -360° and less than $+360^\circ$.
- The upper limit is not negative and less than $+360^\circ$.
- The lower limit is not greater than the upper limit.
- The lower and upper limits are less than 360° apart.

If the general conditions are not met, the control cannot move the modulo axis and issues an error message.

If the target position or a position equivalent to it is within the permitted range, movement is permitted with active modulo limit switches. The direction of motion is determined automatically, as only one of the positions can be approached at any one time. Please note the following examples!

Equivalent positions differ by an offset of $n \times 360^\circ$ from the target position. The factor n corresponds to any integer.

Example

11 L C+0 R0 F5000	; Limit switches -80° and $+80^\circ$
12 L C+320	; Target position -40°

The control positions the modulo axis between the active limit switches to the position -40° , which is equivalent to 320° .

Example

11 L C-100 R0 F5000	; Limit switches -90° and $+90^\circ$
12 L IC+15	; Target position -85°

The control executes the traversing motion because the target position lies within the permitted range. The control positions the axis in the direction of the nearest limit switch.

Example

11 L C-100 R0 F5000	; Limit switches -90° and $+90^\circ$
12 L IC-15	; Error message

The control issues an error message because the target position is outside the permitted range.

Examples

11 L C+180 R0 F5000	; Limit switches -90° and $+90^\circ$
12 L C-360	; Target position 0° : Also applies for a multiple of 360° , e.g. 720°
11 L C+180 R0 F5000	; Limit switches -90° and $+90^\circ$
12 L C+360	; Target position 360° : Also applies for a multiple of 360° , e.g. 720°

If the axis is exactly in the middle of the prohibited area, the distance to both limit switches is identical. In this case, the control can move the axis in both directions.

If the positioning block results in two equivalent target positions in the permitted range, the control positions itself along the shorter path. If both equivalent target positions are 180° away, the control selects the direction of motion according to the programmed algebraic sign.

Definitions

Modulo axis

Modulo axes are axes whose encoder only returns values between 0° and 359.9999°. If an axis is used as a spindle, then the machine manufacturer must configure this axis as a modulo axis.

Rollover axis


Rollover axes are rotary axes that can perform several or any number of revolutions. The machine manufacturer must configure a rollover axis as a modulo axis.

Modulo counting method


The position display of a rotary axis with the modulo counting method is between 0° and 359.9999°. If the value exceeds 359.9999°, the display starts over at 0°.

16.4.4 Functions and function packages

ADP motion control

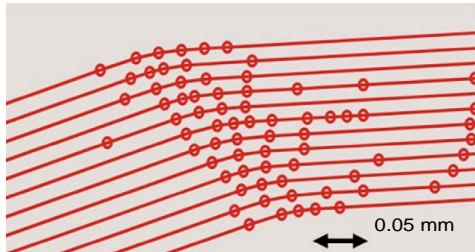

Distribution of points

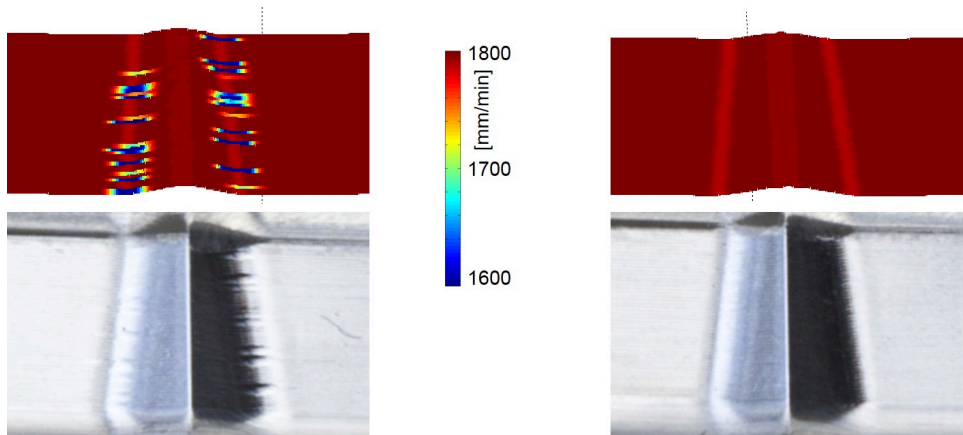

Comparison without and with ADP


CAM-generated NC programs with an insufficient resolution and variable point density in adjacent paths can lead to feed rate fluctuations and errors on the workpiece surface.

The Advanced Dynamic Prediction (ADP) function extends the prediction of the permissible maximum feed rate profile and optimizes the motion control of the axes involved during milling. This means that you can achieve a high surface quality with a short machining time and reduce the reworking effort.

The most important benefits of ADP at a glance:

- With bidirectional milling, the forward and reverse paths have symmetrical feed behavior.
- Tool paths adjacent to one another have uniform feed paths.
- Negative effects associated with typical problems of CAM-generated NC programs are compensated for or mitigated, e.g.:
 - Short stair-like steps
 - Rough chord tolerances
 - Strong rounded block end point coordinates
- Even under difficult conditions, the control precisely complies with the dynamic parameters.

Dynamic Efficiency

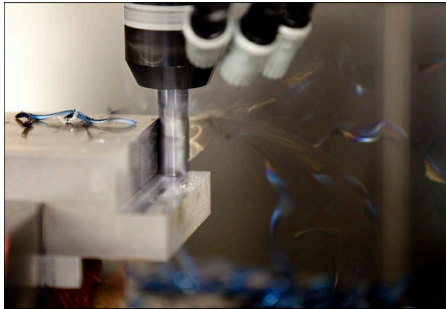

The Dynamic Efficiency package of functions enables you to increase process reliability in heavy machining and roughing in order to improve efficiency.

Dynamic Efficiency includes the following software features:

- Active Chatter Control (ACC, option 145)
- Adaptive Feed Control (AFC, option 45)
- Cycles for trochoidal milling (option 167)


Using Dynamic Efficiency offers the following advantages:

- ACC, AFC and trochoidal milling reduce machining time by increasing the material removal rate.
- AFC enables tool monitoring and thus increases process reliability.
- ACC and trochoidal milling extend the tool life.



You can find more information in the brochure titled **Options and Accessories**.

Dynamic Precision

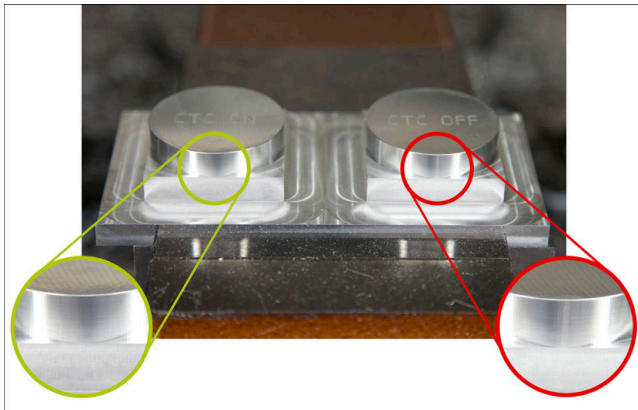

The Dynamic Precision package of functions enables you to machine quickly and accurately, and with high surface quality.

Dynamic Precision includes the following software functions:

- Cross Talk Compensation (CTC, option 141)
- Position Adaptive Control (PAC, option 142)
- Load Adaptive Control (LAC, option 143)
- Motion Adaptive Control (MAC, option 144)
- Active Vibration Damping (AVD, option 146)

The functions each provide decisive improvements. They can be combined and also mutually complement each other:

- CTC increases the accuracy in the acceleration phases.
- AVD enables better surfaces.
- CTC and AVD result in fast and accurate processing.
- PAC leads to increased contour constancy.
- LAC keeps accuracy constant, even with variable load.
- MAC reduces vibrations and increases the maximum acceleration for rapid traverse movements.



You can find more information in the brochure titled **Options and Accessories**.

17

**Miscellaneous
Functions**

17.1 Miscellaneous functions M and the STOP function

Application

Use miscellaneous functions to activate or deactivate functions of the control and to influence the behavior of the control.

Description of function

You can define up to four miscellaneous functions **M** at the end of an NC block or in a separate NC block. Once you confirm the entry of a miscellaneous function, the control continues with the dialog and you can define additional parameters, such as **M140 MB MAX**.

In the **Manual operation** application, use the **M** button to activate a miscellaneous function.

Further information: User's Manual for Setup and Program Run

Effects of the miscellaneous functions M

Miscellaneous functions **M** are in effect blockwise or modally. Miscellaneous functions take effect from their point of definition. Other functions or the end of the NC program reset modally effective miscellaneous functions.

Some miscellaneous functions take effect at the start of the NC block and others at the end, regardless of the sequence in which they were programmed.

If you program more than one miscellaneous function in an NC block, the execution sequence is as follows:

- Miscellaneous functions taking effect at the start of the block are executed before those taking effect at the end of the block.
- If more than one miscellaneous function takes effect at the start or end of the block, they are executed in the same sequence as programmed.

STOP function

The **STOP** function interrupts the program run or simulation, e.g., for tool inspection. You can also enter up to four miscellaneous functions **M** in a **STOP** block.

17.1.1 Programming the STOP function

To program the **STOP** function:

- STOP

- ▶ Select **STOP**
 - > The control creates a new NC block with the **STOP** function.

17.2 Overview of miscellaneous functions




Refer to your machine manual.

The machine manufacturer can influence the behavior of the miscellaneous functions described below.

M0 to M30 are standardized miscellaneous functions.

This table shows at what point the miscellaneous functions take effect:

- At the start of the block
- At the end of the block

Function	Effect	Further information
M0 Stop program run and the spindle, switch coolant supply off	■	
M1 Optionally stop the program run, optionally stop the spindle, optionally switch the coolant supply off Function depends on the machine manufacturer	■	
M2 Stop program run and the spindle, switch coolant supply off, return to beginning of the program, optionally reset the program information The functions depends on the setting by the machine manufacturer in the machine parameter resetAt (no. 100901)	■	
M3 Switch spindle on clockwise	□	
M4 Switch spindle on counterclockwise	□	
M5 Stop the spindle	■	
M6 Tool change; stop program run and spindle	■	
<div>  <p>Since this function depends on the machine manufacturer, HEIDENHAIN recommends using the TOOL CALL function for tool changes. Further information: "Tool call by TOOL CALL", Page 159</p> </div>		
M8 Switch coolant supply on	□	
M9 Switch coolant supply off	■	
M13 Switch spindle on clockwise, switch coolant supply on	□	
M14 Switch spindle on counterclockwise, switch coolant supply on	□	

Function	Effect	Further information
M30 Function is Identical to M2	■	
M89 Free miscellaneous function or Call cycle modally Function depends on the machine manufacturer	□ ■	See the User's Manual for Machining Cycles
M91 Traverse in the machine coordinate system M-CS	□	Page 416
M92 Traverse in the M92 coordinate system	□	Page 417
M94 Reduce the display for rotary axes to under 360°	□	Page 419
M97 Machine small contour steps	■	Page 420
M98 Machine open contours completely	■	Page 421
M99 Call a cycle once per block	■	See the User's Manual for Machining Cycles
M101 Automatically insert a replacement tool	□	Page 447
M102 Reset M101	■	
M103 Reduce feed rate for infeed movements	□	Page 422
M107 Permit positive tool oversizes	□	Page 449
M108 Check the radius of the replacement tool Reset M107	■	Page 451
M109 Adapt feed rate for circular paths	□	Page 423
M110 Reduce feed rate for inner radii	□	
M111 Reset M109 and M110	■	
M116 Interpret feed rate for rotary axes as mm/min	□	Page 425
M117 Reset M116	■	
M118 Activate handwheel superimpositioning	□	Page 426

Function	Effect	Further information
M120 Pre-calculate the radius-compensated contour (look ahead)	□	Page 428
M126 Shorter-path traverse of rotary axes	□	Page 431
M127 Reset M126	■	
M128 Automatically compensate for tool inclination (TCPM)	□	Page 432
M129 Reset M128	■	
M130 Traverse in the non-tilted input coordinate system I-CS	□	Page 418
M136 Interpret feed rate as mm/rev	□	Page 437
M137 Reset M136	■	
M138 Take rotary axes into account during machining operations	□	Page 438
M140 Retract in the tool axis	□	Page 439
M141 Suppress touch probe monitoring	□	Page 451
M143 Rescind basic rotations	□	Page 441
M144 Factor the tool offset into the calculations	□	Page 442
M145 Reset M144	■	
M148 Automatically lift off upon an NC stop or a power failure	□	Page 444
M149 Reset M148	■	
M197 Prevent rounding off of outside corners	■	Page 445

17.3 Miscellaneous functions for coordinate entries

17.3.1 Traversing in the machine coordinate system M-CS with M91

Application

You can use **M91** to program machine-based positions, such as for moving to safe positions. The coordinates of positioning blocks with **M91** are effective in the machine coordinate system **M-CS**.

Further information: "Machine coordinate system M-CS", Page 223

Description of function

Effect

M91 is in effect blockwise and takes effect at the start of the block.

Application example

11 LBL "SAFE"	
12 L Z+250 R0 FMAX M91	; Approach a safe position in the tool axis
13 L X-200 Y+200 R0 FMAX M91	; Approach a safe position in the plane
14 LBL 0	

Here **M91** is in a subprogram in which the control moves the tool to a safe position, by first moving in the tool axis and then in the plane.

Since the coordinates refer to the machine datum, the tool always moves to the same position. That way, regardless of the workpiece preset, the subprogram can be repeatedly called in the NC program, for example before tilting the rotary axes.

Without **M91** the control references the programmed coordinates to the workpiece preset.

Further information: "Presets in the machine", Page 99



The coordinates for a safe position depend on the machine.
The machine manufacturer defines the position of the machine datum.

Notes

- If you program incremental coordinates in an NC block with the miscellaneous function **M91**, then these coordinates are relative to the last position programmed with **M91**. For the first position programmed with **M91**, the incremental coordinates are relative to the current tool position.
- The control considers any active tool radius compensation when positioning with **M91**.
Further information: User's Manual for Setup and Program Run
- The control uses the tool carrier reference point when positioning in the tool axis.
Further information: "Presets in the machine", Page 99
- The following position displays refer to the machine coordinate system **M-CS** and show the values defined with **M91**:
 - **Nominal reference position (RFNOML)**
 - **Actual reference position (RFACTL)**
- In the **Editor** operating mode, use the **Workpiece position** window to apply the current workpiece preset for the simulation. In this constellation you can simulate traverse movements with **M91**.
Further information: "Visualization options column", Page 559
- In the machine parameter **refPosition** (no. 400403) the machine manufacturer defines the position of the machine datum.

17.3.2 Traversing in the M92 coordinate system with M92

Application

You can use **M92** to program machine-based positions, such as for moving to safe positions. The coordinates of positioning blocks with **M92** are relative to the **M92** datum and are effective in the **M92** coordinate system.

Further information: "Presets in the machine", Page 99

Description of function

Effect

M92 is in effect blockwise and takes effect at the start of the block.

Application example

11 LBL "SAFE"	
12 L Z+0 R0 FMAX M92	; Approach a safe position in the tool axis
13 L X+0 Y+0 R0 FMAX M92	; Approach a safe position in the plane
14 LBL 0	

Here **M92** is in a subprogram in which the tool moves to a safe position, by first moving in the tool axis and then in the plane.

Since the coordinates refer to the **M92** datum, the tool always moves to the same position. That way, regardless of the workpiece preset, the subprogram can be repeatedly called in the NC program, for example before tilting the rotary axes.

Without **M92** the control references the programmed coordinates to the workpiece preset.

Further information: "Presets in the machine", Page 99



The coordinates for a safe position depend on the machine.
The machine manufacturer defines the position of the **M92** datum.

Notes

- The control considers any active tool radius compensation when positioning with **M92**.
Further information: User's Manual for Setup and Program Run
- The control uses the tool carrier reference point when positioning in the tool axis.
Further information: "Presets in the machine", Page 99
- In the **Editor** operating mode, use the **Workpiece position** window to apply the current workpiece preset for the simulation. In this constellation you can simulate traverse movements with **M92**.
Further information: "Visualization options column", Page 559
- In the optional machine parameter **distFromMachDatum** (no. 300501) the machine manufacturer defines the position of the **M92** datum.

17.3.3 Traversing in the non-tilted input coordinate system I-CS with M130

Application

Coordinates of a straight line entered with **M130** are effective in the non-tilted input coordinate system **I-CS** despite a tilted working plane, such as for retraction.

Description of function

Effect

M130 is in effect blockwise for straight lines without radius compensation and takes effect at the start of the block.

Further information: "Straight line L", Page 175

Application example

```
11 L Z+20 R0 FMAX M130
```

```
; Retract in the tool axis
```

With **M130**, the control references the coordinates in this NC block to the non-tilted input coordinate system **I-CS** despite a tilted working plane. That way the control retracts the tool perpendicular to the top edge of the workpiece.

Without **M130** the control references the coordinates of the straight line to the tilted **I-CS**.

Further information: "Input coordinate system I-CS", Page 232

Notes

NOTICE

Danger of collision!

The miscellaneous function **M130** is effective only blockwise. The control executes the subsequent machining operations in the tilted working plane coordinate system **WPL-CS** again. Danger of collision during machining!

- Use the simulation to check the sequence and positions

If you combine **M130** with a cycle call, the control will interrupt machining with an error message.

Definition

Non-tilted input coordinate system I-CS

In a non-tilted input coordinate system **I-CS** the control ignores the tilting of the working plane, but does take into account the alignment of the workpiece's upper surface and all active transformations, such as a rotation.

17.4 Miscellaneous functions for path behavior

17.4.1 Reducing the display for rotary axes to under 360° with M94

Application

With **M94** the control reduces the display of the rotary axes to a range between 0° and 360°. Additionally, this limitation reduces the angle difference between the actual position and the new nominal position to less than 360°, which shortens traverse movements.

Related topics

- Values of the rotary axes in the position display

Further information: User's Manual for Setup and Program Run

Description of function

Effect

M94 is in effect blockwise and takes effect at the start of the block.

Application example

11 L IC+420	; Move the C axis
12 L C+180 M94	; Reduce the display value of the C axis and move the axis

Before machining, the control shows the value 0° in the position display of the C axis.

In the first NC block the C axis moves incrementally by 420°, for example in order to cut an adhesive slot.

The second NC block first reduces the display of the C axis from 420° to 60°. Then the control positions the C axis to the nominal position of 180°. The angle difference is now 120°.

Without **M94** the angle difference would be 240°.

Input

If you define **M94**, the control continues the dialog and prompts you for the affected rotary axis. If you do not enter an axis, the control reduces the position display for all rotary axes.

21 L M94	; Reduce the display values of all rotary axes
21 L M94 C	; Reduce the display value of the C axis

Notes

- **M94** only affects rollover axes whose actual position display permits values above 360°.
- In the machine parameter **isModulo** (no. 300102) the machine manufacturer defines whether the modulo counting method is used for a rollover axis.
- In the optional machine parameter **shortestDistance** (no. 300401) the machine manufacturer defines whether the control by default positions the rotary axis on the shortest traverse path.
- In the optional machine parameter **startPosToModulo** (no. 300402) the machine manufacturer defines whether the control reduces the actual position display to a range between 0° and 360° before each positioning.
- If traverse limits or software limit switches are active for a rotary axis then **M94** has no effect on this rotary axis.

Definitions

Modulo axis

Modulo axes are axes whose encoder only returns values between 0° and 359.9999°. If an axis is used as a spindle, then the machine manufacturer must configure this axis as a modulo axis.

Rollover axis

Rollover axes are rotary axes that can perform several or any number of revolutions. The machine manufacturer must configure a rollover axis as a modulo axis.

Modulo counting method

The position display of a rotary axis with the modulo counting method is between 0° and 359.9999°. If the value exceeds 359.9999°, the display starts over at 0°.

17.4.2 Machining small contour steps with M97

Application

With **M97** you can produce contour steps that are smaller than the tool radius. The control does not damage the contour and does not issue an error message.



Instead of **M97**, HEIDENHAIN recommends using the more powerful function **M120** (option 21).

After activating **M120** you can produce complete contours without error messages. **M120** also considers circular paths.

Related topics

- Pre-calculating a radius-compensated contour with **M120**



Further information: "Pre-calculating a radius-compensated contour with M120", Page 428

Description of function

Effect

M97 is in effect blockwise and takes effect at the end of the block.

Application example

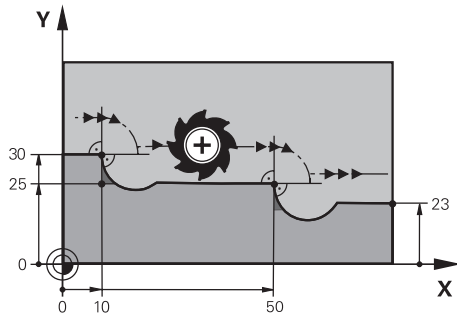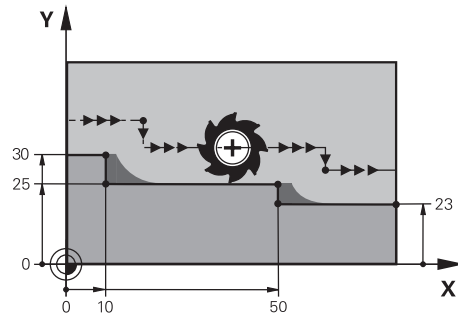Contour step without **M97**Contour step with **M97**

11 TOOL CALL 8 Z S5000	; Insert the tool with diameter 16
* - ...	
21 L X+0 Y+30 RL	
22 L X+10 M97	; Machine the contour step using the path intersection
23 L Y+25	
24 L X+50 M97	; Machine the contour step using the path intersection
25 L Y+23	
26 L X+100	

For radius-compensated contour steps, the control uses **M97** to determine a path intersection that is in the extension of the tool path. The control extends the tool path each time by the tool radius. This means that the smaller the counter step is and the larger the tool radius, the greater the contour extension is. The control moves the tool beyond the path intersection and thus avoids damage to the contour.

Without **M97** the tool would move on a transitional arc around the outside corners and damage the contour. At such locations the control interrupts machining with the **Tool radius too large** error message.

Notes

- Program **M97** only for outside corners.
- For further machining operations, please note that shifting the contour corner results in more residual material. You may then need to rework the contour step with a smaller tool.

17.4.3 Machining open contour corners with **M98**

Application



If the tool performs a machining operation on a radius-compensated contour, then residual material remains at the inside corners. With **M98** the control extends the tool path by the tool radius so that the tool completely machines an open contour and removes all residual material.

Description of function

Effect

M98 is in effect blockwise and takes effect at the end of the block.

Application example

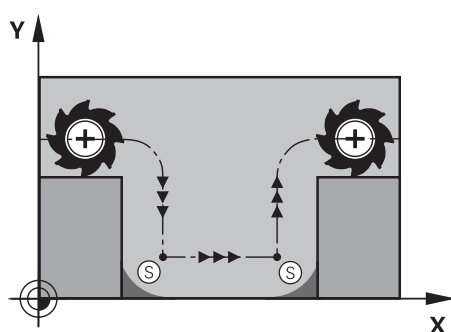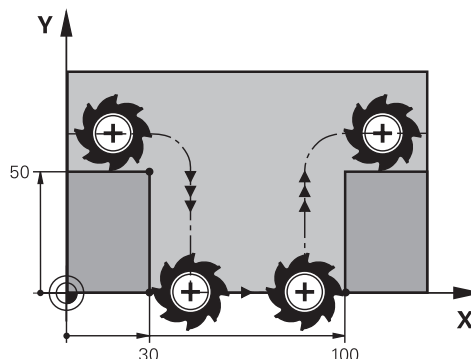Open contour without **M98**Open contour with **M98**

11 L X+0 Y+50 RL F1000	
12 L X+30	
13 L Y+0 M98	; Completely machine an open contour corner
14 L X+100	; The control maintains the position of the Y axis with M98
15 L Y+50	

The control moves the tool along the contour with radius compensation. With **M98** the control calculates the contour ahead of time and determines a new path intersection in the extension of tool path. The control moves the tool beyond this path intersection and completely machines the open contour.

In the next NC block the control maintains the position of the Y axis.

Without **M98** the control uses the programmed coordinates as limitation for the radius-compensated contour. The control calculates the path intersection so that the contour is not damaged and residual material remains.

17.4.4 Reducing the feed rate for infeed movements with M103

Application

With **M103** the control performs infeed movements at a lower feed rate, for example when plunging. You use a percent factor to define the feed-rate value.

Description of function

Effect

M103 is in effect for straight lines in the tool axis at the start of the block.

In order to reset **M103**, program **M103** without a defined factor.

Application example

11 L X+20 Y+20 F1000	; Move in the working plane
12 L Z-2.5 M103 F20	; Activate feed rate reduction and move at reduced feed rate
12 L X+30 Z-5	; Move at reduced feed rate

In the first NC block the control positions the tool in the working plane.

In NC block **12** the control activates **M103** with the percent factor 20 and then performs the infeed movement in the Z axis at a reduced feed rate of 200 mm/min.

Next, in NC block **13**, the control performs an infeed movement in the X and Z axes at a reduced feed rate of 825 mm/min. This higher feed rate results from the control moving the tool in the plane in addition to the infeed movement. The control calculates a cutting value between the feed rate in the plane and the infeed rate.

Without **M103** the infeed movement is performed at the programmed feed rate.

Input

If you define **M103**, the control continues the dialog and prompts you for the factor **F**.

Notes

- The infeed rate F_Z is calculated from the last programmed feed rate F_{Prog} and the percent factor **F**.

$$F_Z = F_{Prog} \times F$$

- **M103** is also effective with an active tilted working plane coordinate system **WPL-CS**. The feed rate reduction is then effective during infeed movements in the virtual tool axis **VT**.

17.4.5 Adapting the feed rate for circular paths with M109**Application**

With **M109** the control maintains a constant feed rate at the cutting edge for internal and external machining on circular paths, for example to produce a uniform milled surface during finishing.

Description of function**Effect**

M109 takes effect at the start of the block.

In order to reset **M109**, program **M111**.

Application example

11 L X+5 Y+25 RL F1000	; Approach first contour point at programmed feed rate
12 CR X+45 Y+25 R+20 DR- M109	; Activate feed rate adaptation, then perform the operation on the circular path at the increased feed rate

In the first NC block the control moves the tool at the programmed feed rate, which refers to the tool center-point path.

In NC block **12** the control activates **M109** and maintains a constant feed rate at the tool cutting edge when machining on circular paths. At the beginning of each block the control calculates the feed rate at the tool cutting edge for the respective NC block and adapts the programmed feed rate depending on the contour radius and tool radius. This means that the programmed feed rate is increased for external operations and reduced for internal operations.

The tool then cuts the external contour at an increased feed rate.

Without **M109** the tool cuts along the circular path at the programmed feed rate.

Notes

NOTICE

Caution: Danger to the tool and workpiece!

If the **M109** function is active, the control might significantly increase the feed rate when machining very small outside corners (acute angles). There is a risk of tool breakage or workpiece damage during machining.

- Do not use **M109** for machining very small outside corners (acute angles)

If you define **M109** before calling a machining cycle with a number greater than **200**, the adjusted feed rate is also effective for circular paths within these machining cycles.

17.4.6 Reducing the feed rate for internal radii with M110

Application

With **M110** the control maintains a constant feed rate at the cutting edge only for internal radii, as opposed to **M109**. This results in consistent cutting conditions affecting the tool, which is important, for example, in heavy-duty machining.

Description of function

Effect

M110 takes effect at the start of the block.

In order to reset **M110**, program **M111**.

Application example

11 L X+5 Y+25 RL F1000	; Approach first contour point at programmed feed rate
12 CR X+45 Y+25 R+20 DR+ M110	; Activate feed rate reduction, then perform the operation on the circular path at the reduced feed rate

In the first NC block the control moves the tool at the programmed feed rate, which refers to the tool center-point path.

In NC block **12** the control activates **M110** and maintains a constant feed rate at the tool cutting edge when machining on internal radii. At the beginning of each block the control calculates the feed rate at the tool cutting edge for the respective NC block and adapts the programmed feed rate depending on the contour radius and tool radius.

The tool then cuts the internal radius at a reduced feed rate.

Without **M110** the tool cuts along the internal radius at the programmed feed rate.

Note

If you define **M110** before calling a machining cycle with a number greater than **200**, the adjusted feed rate is also effective for circular paths within these machining cycles.

17.4.7 Interpreting the feed rate for rotary axes as mm/min with M116 (option 8)

Application

With **M116** the control interprets the feed rate for rotary axes as millimeters per minute.

Requirements

- Machine with rotary axes
- Kinematics description



Refer to your machine manual.

The machine manufacturer creates the kinematics description of the machine.

- Software option 8: Advanced Functions (set 1)

Description of function**Effect**

M116 is effective only in the working plane and takes effect at the start of the block. In order to reset **M116**, program **M117**.

Application example

11 L IC+30 F500 M116

; Move in the C axis in mm/min

With **M116** the control interprets the programmed feed rate of the C axis as mm/min, such as for cylinder surface machining.

In this case, the control calculates the feed for the block at the start of each NC block, taking the distance from the tool center point to the center of the rotary axis into account.

The feed rate does not change while the control is executing the NC block. This also applies for when the tool is moving towards the center of a rotary axis.

Without **M116** the control interprets the feed rate programmed for a rotary axis as degrees per minute.

Notes

- You can program **M116** for head and table rotary axes.
- The **M116** function also has an effect if the **Tilt working plane** function is active.
Further information: "Tilting the working plane (option 8)", Page 249
- It is not possible to combine **M116** with **M128** or **FUNCTION TCPM** (option 9). If you want to activate **M116** for an axis while **M128** or **FUNCTION TCPM** is active, then you must use **M138** to exclude this axis before machining.
Further information: "Taking rotary axes into account during machining operations with M138", Page 438
- Without **M128** or **FUNCTION TCPM** (option 9), **M116** can take effect for multiple rotary axes at the same time.

17.4.8 Activating handwheel superimpositioning with M118

Application

With **M118** the control activates handwheel superimpositioning. You can then perform manual corrections by handwheel during program run.

Related topics

- Handwheel superimpositioning with global program settings GPS (option 44)

Requirements

- Handwheel
- Software option 21: Advanced Functions (set 3)

Description of function

Effect

M118 takes effect at the start of the block.

In order to reset **M118**, program **M118** without entering any axes.



Canceling a program also resets handwheel superimpositioning.

Application example

11 L Z+0 R0 F500	; Move in the tool axis
12 L X+200 R0 F250 M118 Z1	; Move in the working plane with active handwheel superimpositioning of no more than ± 1 mm in the Z axis

In the first NC block the control positions the tool in the tool axis.

In NC block **12** the control activates handwheel superimpositioning at the start of the block with a maximum traverse range of ± 1 mm in the Z axis.

Then the control performs the traverse movement in the working plane. During this traverse movement you can use the handwheel for continuous motion of the tool in the Z axis by up to ± 1 mm. This way you can, for example, rework a workpiece that has been reclamped but that cannot be probed due to its free-form surface.

Input

If you define **M118**, the control continues the dialog and prompts you for the axes and the maximum permissible superimpositioning value. For linear axes you define the value in millimeters and for rotary axes in degrees.

21 L X+0 Y+38.5 RL F125 M118 X1 Y1	; Move in the working plane with active handwheel superimpositioning of no more than ± 1 mm in the X and Y axes
---	---

Notes



Refer to your machine manual.

Your machine manufacturer must have prepared the control for this function.

- By default **M118** is effective in the machine coordinate system **M-CS**.
If you activate the **handwheel superimpositioning** switch in the **GPS** (option 44) workspace, handwheel superimpositioning is effective in the last selected coordinate system.
Further information: User's Manual for Setup and Program Run
- On the **POS HR** tab of the **Status** workspace the control shows the active coordinate system in which handwheel superimpositioning is in effect, as well as the maximum possible traverse values of the respective axes.
Further information: User's Manual for Setup and Program Run
- The handwheel superimpositioning function with **M118** in combination with dynamic collision monitoring (DCM, option 40) is possible only at a standstill.
To be able to use **M118** without restrictions, you have to deactivate **DCM** (option 40) or activate a kinematics model without collision objects.
Further information: User's Manual for Setup and Program Run
- Handwheel superimpositioning is also effective in the **MDI** application.
Further information: User's Manual for Setup and Program Run
- If you want to use **M118** with clamped axes, you must unclamp them first.

Notes in conjunction with the virtual tool axis VT (option 44)

Refer to your machine manual.

Your machine manufacturer must have prepared the control for this function.

- On machines with head rotation axes, you can choose for inclined machining whether superimpositioning should be in effect in the Z axis or along the virtual tool axis **VT**.

Further information: User's Manual for Setup and Program Run

- In the machine parameter **selectAxes** (no. 126203) the machine manufacturer defines the assignment of axis keys on the handwheel.
When using an HR 5xx handwheel, you can assign the virtual axis to the orange **VI** axis key, if desired.

17.4.9 Pre-calculating a radius-compensated contour with M120**Application**

With **M120** the control pre-calculates a radius-compensated contour. This way the control can produce contours that are smaller than the tool radius without damaging the contour or issuing an error message.

Requirement

- Software option 21: Advanced Functions (set 3)



Description of function**Effect**

M120 takes effect at the start of the block and remains in effect beyond the milling cycles.

You can reset **M120** with the following functions:

- Radius compensation **R0**
- **M120 LA0**
- **M120** without **LA**
- **PGM CALL**
- Cycle **19 WORKING PLANE** or **PLANE** functions (option 8)

Application example

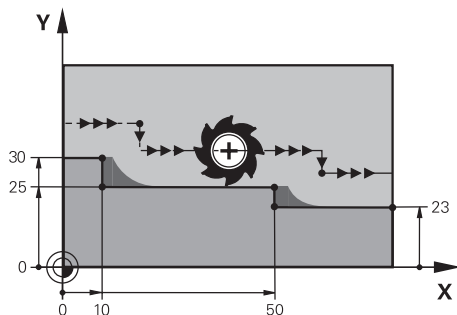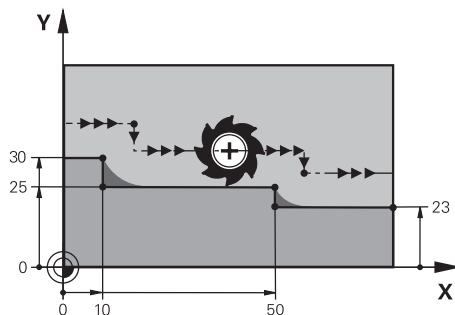Contour step with **M97**Contour step with **M120**

11 TOOL CALL 8 Z S5000	; Insert the tool with diameter 16
* - ...	
21 L X+0 Y+30 RL M120 LA2	; Activate contour pre-calculation and move in the working plane
22 L X+10	
23 L Y+25	
24 L X+50	
25 L Y+23	
26 L X+100	

With **M120 LA2** in NC block **21**, the control checks the radius-compensated contour for undercuts. In this example the control calculates the tool path starting from the current NC block for two NC blocks at a time. Then the control uses radius compensation while positioning the tool to the first contour point.

When machining the contour, the control extends the tool path in each case so that the tool does not damage the contour.

Without **M120** the tool would move on a transitional arc around the outside corners and damage the contour. At such locations the control interrupts machining with the **Tool radius too large** error message.

Input

If you define **M120**, the control continues the dialog and prompts you for the number of **LA** NC blocks to be calculated in advance (up to 99).

Notes

NOTICE


Danger of collision!

Define as low a number as possible of **LA** NC blocks to be pre-calculated. If the value defined is too large, the control might overlook parts of the contour!

- ▶ Use the Simulation mode to test the NC program before execution
- ▶ Verify the NC program by slowly executing it block by block

- For further machining operations, please note that residual material remains in the contour corners. You may then need to rework the contour step with a smaller tool.
- If you always program **M120** in the same NC block as the radius compensation you can achieve consistent and clearly structured programs.
- If you run the following functions while **M120** is active, then the control cancels program run and issues an error message:
 - Cycle **32 TOLERANCE**
 - **M128** (option 9)
 - **FUNCTION TCPM** (option 9)
 - Mid-program startup

Example

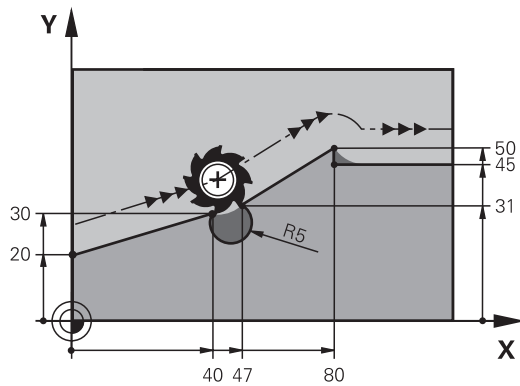

0 BEGIN PGM "M120" MM	
1 BLK FORM 0.1 Z X+0 Y+0 Z-10	
2 BLK FORM 0.2 X+110 Y+80 Z+0	; Workpiece blank definition
3 TOOL CALL 6 Z S1000 F1000	; Insert the tool with diameter 12
4 L X-5 Y+26 R0 FMAX M3	; Move in the working plane
5 L Z-5 R0 FMAX	; Infeed in the tool axis
6 L X+0 Y+20 RL F AUTO M120 LA5	; Activate contour pre-calculation and move to the first contour point
7 L X+40 Y+30	
8 CR X+47 Y+31 R-5 DR+	
9 L X+80 Y+50	
10 L X+80 Y+45	
11 L X+110 Y+45	; Move to the last contour point
12 L Z+100 R0 FMAX M120	; Retract the tool and reset M120
13 M30	; End of program
14 END PGM "M120" MM	

Definition

Abbreviation	Definition
LA (look ahead)	Number of look-ahead blocks

17.4.10 Shorter-path traversing of rotary axes with M126

Application

With **M126** the control moves a rotary axis on the shortest path of traverse to the programmed coordinates. This function is effective only for rotary axes whose position display is reduced to a value of less than 360°.

Description of function

Effect

M126 takes effect at the start of the block.

In order to reset **M126**, program **M127**.

Application example

11 L C+350	; Move in the C axis
12 L C+10 M126	; Shortest-path traverse in the C axis

In the first NC block the control positions the C axis to 350°.

In the second NC block the control activates **M126** and then positions the C axis with shortest-path traverse to 10°. The control uses the shortest traverse path and moves the C axis in the positive direction of rotation, beyond 360°. The traverse path is 20°.

Without **M126** the control does not move the rotary axis beyond 360°. The traverse path is then 340° in the negative direction of rotation.

Notes

- **M126** is not in effect with incremental traverse movements.
- The effect of **M126** depends on the configuration of the rotary axis.
- **M126** has an effect only on modulo axes.
In the machine parameter **isModulo** (no. 300102) the machine manufacturer defines whether a rotary axis is a modulo axis.
- In the optional machine parameter **shortestDistance** (no. 300401) the machine manufacturer defines whether the control by default positions the rotary axis on the shortest traverse path.
- In the optional machine parameter **startPosToModulo** (no. 300402) the machine manufacturer defines whether the control reduces the actual position display to a range between 0° and 360° before each positioning.

Definitions

Modulo axis

Modulo axes are axes whose encoder only returns values between 0° and 359.9999°. If an axis is used as a spindle, then the machine manufacturer must configure this axis as a modulo axis.

Rollover axis

Rollover axes are rotary axes that can perform several or any number of revolutions. The machine manufacturer must configure a rollover axis as a modulo axis.

Modulo counting method

The position display of a rotary axis with the modulo counting method is between 0° and 359.9999°. If the value exceeds 359.9999°, the display starts over at 0°.

17.4.11 Automatically compensating for tool inclination with M128 (option 9)

Application

If the position of a controlled rotary axis changes in the NC program, then the control uses **M128** during the tilting procedure to automatically compensate for the tool inclination with a compensating movement of the linear axes. That way the position of the tool tip relative to the workpiece surface remains unchanged (TCPM).



Instead of **M128**, HEIDENHAIN recommends using the more powerful function **FUNCTION TCPM**.

Related topics

- Compensating for tool offset with **FUNCTION TCPM**

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

Requirement

- Machine with rotary axes
- Kinematics description



Refer to your machine manual.

The machine manufacturer creates the kinematics description of the machine.

- Software option 9: Advanced Functions (set 2)

Description of function**Effect**

M128 takes effect at the start of the block.


You can reset **M128** with the following functions:

- **M129**
- **FUNCTION RESET TCPM**
- In the **Program Run** operating mode, select a different NC program



M128 is also in effect in the **Manual** operating mode and remains active even after a change in the operating mode.

Application example

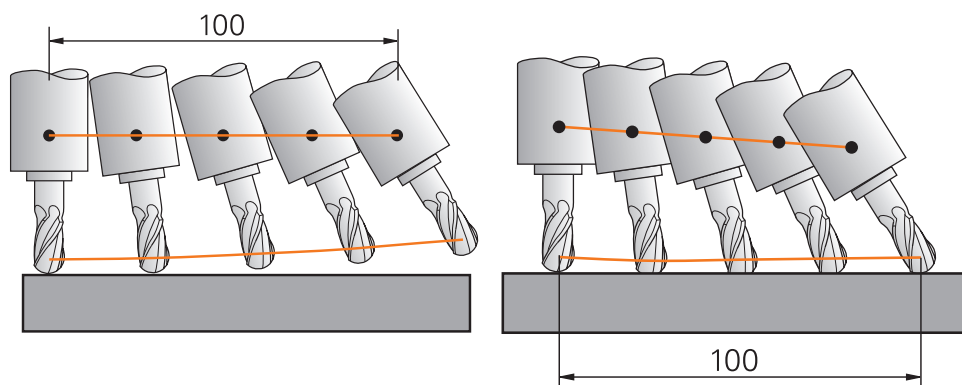

Behavior without **M128**

Behavior with **M128**

11 L X+100 B-30 F800 M128 F1000

; Move with automatic compensation of the motion in the rotary axis

In this NC block the control activates **M128** with the feed rate for the compensating movement. The control then simultaneously moves the tool in the X axis and in the B axis.

In order to keep the position of the tool tip constant relative to the workpiece while inclining the rotary axis, the control uses the linear axes to perform a continuous compensating movement. In this example the control performs the compensating movement in the Z axis.

Without **M128** an offset of the tool tip relative to the nominal position results as soon as the inclination angle of the tool changes. The control does not compensate for this offset. If you do not take this deviation into account in the NC program, the machining operation will not be performed correctly or a collision will occur.

Input

If you define **M128**, the control continues the dialog and prompts you for the feed rate **F**. The defined value limits the feed rate during the compensating movement.

Inclined machining with open-loop rotary axes

With open-loop rotary axes, also known as counter axes, you can also perform inclined machining in combination with **M128**.

For inclined machining operations with open-loop rotary axes, proceed as follows:

- ▶ Before activating **M128**, position the rotary axes manually
- ▶ Activate **M128**
- > The control reads the actual values of all existing rotary axes, calculates from this the new position of the tool location point, and updates the position display.
Further information: "Presets on the tool", Page 154
- > The control performs the necessary compensating movement with the next traverse movement.
- ▶ Execute the machining operation
- ▶ Reset **M128** at the program end with **M129**
- ▶ Return the rotary axes to their initial position



As long as **M128** is active, the control monitors the actual positions of the open-loop rotary axes. If the actual position deviates from the value that is defined by the machine manufacturer, then the control issues an error message and interrupts program run.

Notes

NOTICE**Danger of collision!**

Rotary axes with Hirth coupling must move out of the coupling to enable tilting. There is a danger of collision while the axis moves out of the coupling and during the tilting operation.

- ▶ Make sure to retract the tool before changing the position of the rotary axis

NOTICE**Danger of collision!**

For peripheral milling, if you define the tool inclination using **LN** straight lines with tool orientation **TX**, **TY**, and **TZ**, the control autonomously calculates the required positions of the rotary axes. This can result in unexpected movements.

- ▶ Use the Simulation mode to test the NC program before execution
- ▶ Verify the NC program by slowly executing it block by block

Further information: "3D tool compensation during peripheral milling (option 9)", Page 326

Further information: "Output with vectors", Page 397

- The feed rate for the compensating movement remains in effect until you program a new feed rate or rescind **M128**.
- If **M128** is active, the control shows the **TCPM** symbol in the **Positions** workspace.

Further information: User's Manual for Setup and Program Run

- You define the inclination angle of the tool by entering the axis positions of the rotary axes directly. This way the values refer to the machine coordinate system **M-CS**. For machines with head rotation axes the tool coordinate system **T-CS** changes. For machines with table rotary axes the workpiece coordinate system **W-CS** changes.

Further information: "Reference systems", Page 222

- If you run the following functions while **M128** is active, then the control cancels program run and issues an error message:
 - Cutting edge radius compensation **RR/RL** in turning operations (option 50)
 - **M91**
 - **M92**
 - **M144**
 - Calling a tool with **TOOL CALL**
 - Dynamic Collision Monitoring (DCM, option 40) and at the same time **M118**
- In the optional machine parameter **maxCompFeed** (no. 201303) the machine manufacturer defines the maximum speed of compensating movements.
- In the optional machine parameter **maxAngleTolerance** (no. 205303) the machine manufacturer defines the maximum angle tolerance.
- In the optional machine parameter **maxLinearTolerance** (no. 205305) the machine manufacturer defines the maximum linear axis tolerance.
- In the optional machine parameter **manualOversize** (no. 205304) the machine manufacturer defines a manual oversize for all collision objects.

Notes on tools

If you incline a tool while machining a contour, you must use a ball-nose cutter; otherwise the tool can damage the contour.

In order to avoid damaging a contour while machining it with a ball-nose cutter, note the following:

- With **M128** the control equates the tool rotation point with the tool location point. If the tool rotation point is at the tool tip, the tool will damage the contour if the tool is inclined. Therefore the tool location point must be at the tool center point.

Further information: "Presets on the tool", Page 154

- In order for the control to display the tool correctly in the simulation, you must define its actual length in the column **L** of the tool management.

When calling the tool in the NC program, define the sphere radius as a negative delta value in **DL** and thus shift the tool location point to the tool center point.

Further information: "Tool length compensation", Page 305

For Dynamic Collision Monitoring (DCM, option 40) it is also important that you define the tool's actual length in the tool management.

Further information: "Dynamic Collision Monitoring (DCM, option 40)", Page 352

- If the tool location point is at the tool center point you must modify the coordinates of the tool axis in the NC program by the value of the sphere radius.

In **FUNCTION TCPM** you can choose the tool location point and the tool rotation point separately from each other.

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

Definition

Abbreviation	Definition
TCPM (tool center point management)	Maintain the position of the tool location point Further information: "Presets on the tool", Page 154

17.4.12 Interpreting the feed rate as mm/rev with M136**Application**

With **M136** the control interprets the feed rate as millimeters per revolution. The feed rate depends on the spindle speed, for example in conjunction with the turning mode (option 50).

Further information: "Switching the operating mode with FUNCTION MODE", Page 122

Description of function**Effect**

M136 takes effect at the start of the block.

In order to reset **M136**, program **M137**.

Application example

11 LBL "TURN"	
12 FUNCTION MODE TURN	; Activate turning mode
13 M136	; Switch interpretation of the feed rate to mm/rev
14 LBL 0	

M136 is here located in a subprogram in which the control activates the turning mode (option 50).

With **M136** the control interprets the feed rate as millimeters per spindle revolution, which is necessary for the turning mode. The feed rate per revolution refers to the rotational speed of the workpiece spindle. The control thus moves the tool at the programmed feed rate for every rotation of the workpiece spindle.

Without **M136** the control interprets the feed rate as millimeters per minute.

Notes

- In NC programs based on inch units, **M136** is not allowed in combination with **FU** or **FZ**.
- The workpiece spindle is not permitted to be controlled when **M136** is active.
- **M136** is not possible in combination with an oriented spindle stop. The control cannot calculate the feed rate because the spindle does not rotate during an oriented spindle stop, such as when tapping.

17.4.13 Taking rotary axes into account during machining operations with M138

Application

With **M138** you define which rotary axes the control takes into account during the calculation and positioning of spatial angles. The control excludes any axes that were not defined. That way you can reduce the number of tilting possibilities and thus avoid error messages, for example on machines with three rotary axes.

M138 is in effect in combination with the following functions:

- **M128** (option 9)
Further information: "Automatically compensating for tool inclination with M128 (option 9)", Page 432
- **FUNCTION TCPM** (option 9)
Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295
- **PLANE** functions (option 8)
Further information: "Tilting the working plane with PLANE functions (option 8)", Page 250
- Cycle **19 WORKING PLANE** (option 8)
Further information: User's Manual for Machining Cycles

Description of function

Effect

M138 takes effect at the start of the block.

In order to reset **M138**, program **M138** without entering any rotary axes.

Application example

11 L Z+100 R0 FMAX M138 A C	; Define that axes A and C should be taken into account
12 PLANE SPATIAL SPA+0 SPB+90 SPC+0 MOVE FMAX	; Tilt spatial angle SPB by 90°

On a six-axis machine with **A**, **B**, and **C** rotary axes you must exclude one rotary axis for spatial angle operations; otherwise too many combinations are possible.

With **M138 A C** the control calculates the axis position when tilting with spatial angles only in the **A** and **C** axes. The **B** axis is excluded. Therefore, in NC block **12** the control positions the spatial angle **SPB+90** with the **A** and **C** axes.

Without **M138** there are too many possibilities for tilting. The control interrupts the machining process and issues an error message.

Input

If you define **M138**, the control continues the dialog and prompts you for the rotary axes to be taken into account.

11 L Z+100 R0 FMAX M138 C	; Define that the C axis should be taken into account
----------------------------------	--

Notes

- With **M138** the control excludes the rotary axes only during the calculation and positioning of spatial angles. A rotary axis that has been excluded with **M138** can nevertheless be moved in a positioning block. Please note that in this case the control does not execute any compensations.
- In the optional machine parameter **parAxComp** (no. 300205) the machine manufacturer defines whether the control includes the position of the excluded axis when calculating the kinematics.

17.4.14 Retracting in the tool axis with M140**Application**

With **M140** the control retracts the tool in the tool axis.

Description of function**Effect**

M140 is in effect blockwise and takes effect at the start of the block.

Application example

11 LBL "SAFE"	
12 M140 MB MAX	; Retract by the maximum distance in the tool axis
13 L X+350 Y+400 R0 FMAX M91	; Approach a safe position in the working plane
14 LBL 0	

Here **M140** is in a subprogram in which the control moves the tool to a safe position.

With **M140 MB MAX** the control retracts the tool by the maximum distance in the positive direction in the tool axis. The control stops the tool before reaching a limit switch or a collision object.

In the next NC block the control moves the tool to a safe position in the working plane.

Without **M140** the control does not execute a retraction.

Input

If you define **M140**, the control continues the dialog and prompts you for the retraction distance **MB**. You can program the retraction distance as a positive or negative incremental value. With **MB MAX** the control retracts the tool in the positive direction in the tool axis before reaching a limit switch or a collision object.

After **MB** you can define a feed rate for the retraction movement. If you do not define a feed rate, the control retracts the tool at rapid traverse.

21 L Y+38.5 F125 M140 MB+50 F750	; Retract tool at feed rate of 750 mm/min by 50 mm in the positive direction of the tool axis
21 L Y+38.5 F125 M140 MB MAX	; Retract tool at rapid traverse by the maximum distance in the positive direction in the tool axis

Notes

NOTICE

Danger of collision!

The machine manufacturer has various options for configuring the Dynamic Collision Monitoring (DCM, option 40) function. Depending on the machine, the control can continue with the NC program without an error message despite the detected collision. The control stops the tool at the last position without a collision and continues the NC program from this position. This configuration of DCM results in movements that are not defined in the program. **This behavior occurs no matter whether collision monitoring is active or inactive.** There is a danger of collision during these movements!

- ▶ Refer to your machine manual.
- ▶ Check the behavior at the machine.

NOTICE

Danger of collision!

If you use **M118** to modify the position of a rotary axis with the handwheel and then execute **M140**, the control ignores the superimposed values during the retraction movement. This results in unwanted and unpredictable movements, especially when using machines with head rotation axes. There is a danger of collision during these retraction movements!

- ▶ Do not combine **M118** with **M140** when using machines with head rotation axes.

- **M140** is also effective with a tilted working plane. For machines with head rotation axes the control moves the tool in the tool coordinate system **T-CS**.
Further information: "Tool coordinate system T-CS", Page 234
- With **M140 MB MAX** the control retracts the tool only in the positive direction in the tool axis.
- If you define a negative value for **MB**, the control retracts the tool in the negative direction in the tool axis.
- The control gleans the necessary information about the tool axis for **M140** from the tool call.
- In the optional machine parameter **moveBack** (no. 200903) the machine manufacturer defines the distance to a limit switch or a collision object upon a maximum retraction with **MB MAX**.

Definition

Abbreviation	Definition
MB (move back)	Tool axis retraction

17.4.15 Rescinding basic rotations with M143

Application

With **M143** the control resets a basic rotation as well as a 3D basic rotation, for example after machining a workpiece that needed alignment.

Description of function

Effect

M143 is in effect blockwise and takes effect at the start of the block.

Application example

11 M143	; Reset the basic rotation
----------------	----------------------------

In this NC block the control resets a basic rotation that had been defined in the NC program. In the active row of the preset table the control overwrites the values of the columns **SPA**, **SPB**, and **SPC** with the value **0**.

Without **M143** the basic rotation remains in effect until you manually reset the basic rotation or overwrite it with a new value.

Note

The function **M143** is not permitted with mid-program startup.

Further information: User's Manual for Setup and Program Run

17.4.16 Factoring the tool offset into the calculations with M144 (option 9)

Application

The control uses **M144** in subsequent traverse movements to compensate for tool offsets that result from inclined rotary axes.



Instead of **M144**, HEIDENHAIN recommends using the more powerful function **FUNCTION TCPM** (option 9).

Related topics

- Compensating for tool offset with **FUNCTION TCPM**

Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295

Requirement

- Software option 9: Advanced Functions (set 2)

Description of function

Effect

M144 takes effect at the start of the block.

In order to reset **M144**, program **M145**.

Application example

11 M144	; Activate tool compensation
12 L A-40 F500	; Position the A axis
13 L X+0 Y+0 R0 FMAX	; Position the X and Y axes

With **M144** the control takes the position of the rotary axes into account in the subsequent positioning blocks.

In NC block **12** the control positions the rotary axis **A**, resulting in an offset between the tool tip and the workpiece. The control compensates for this offset mathematically.

In the next NC block the control positions the **X** and **Y** axes. When **M144** is active, the control compensates for the position of the rotary axis **A** during this movement.

Without **M144** the control does not take the offset into account, and the machining operation is performed with this offset.

Notes



Refer to your machine manual.

When working with angle heads, keep in mind that the machine geometry is defined by the machine manufacturer in a kinematics description. If you use an angle head during machining, then you must select the correct kinematics description.

- You can use **M91** and **M92** for positioning even when **M144** is active.
Further information: "Miscellaneous functions for coordinate entries", Page 416
- The functions **M128** and **FUNCTION TCPM** are not permitted when **M144** is active. The control will issue an error message if you try to activate these functions.
- **M144** does not work in connection with **PLANE** functions. If both functions are active, then the **PLANE** function is in effect.
Further information: "Tilting the working plane with PLANE functions (option 8)", Page 250
With **M144** the control moves according to the workpiece coordinate system **W-CS**.

If you activate **PLANE** functions, the control moves according to the working plane coordinate system **WPL-CS**.

Further information: "Reference systems", Page 222

Notes In conjunction with the turning operation (option 50)

- If the inclined axis is a tilting table, the control orients the tool coordinate system **W-CS**.
If the inclined axis is a swivel head, the control does not orient the **W-CS**.
- After inclining the rotary axis, you may have to again pre-position the turning tool in the Y coordinate and orient the position of the tool tip with Cycle **800 ADJUST XZ SYSTEM**.

Further information: User's Manual for Machining Cycles

17.4.17 Automatically lifting off upon an NC stop or a power failure with M148

Application

With **M148** the control automatically retracts the tool from the workpiece in the following situations:

- Manually triggered NC stop
- NC stop triggered by the software, for example if an error has occurred in the drive system
- Power interruption



Instead of **M148**, HEIDENHAIN recommends using the more powerful function **FUNCTION LIFTOFF**.

Related topics

- Automatic retraction with **FUNCTION LIFTOFF**

Further information: "Automatic tool liftoff with FUNCTION LIFTOFF", Page 362

Requirement

- **LIFTOFF** column in the tool management

You must define the value **Y** in the **LIFTOFF** column of the tool management.

Further information: User's Manual for Setup and Program Run

Description of function

Effect

M148 takes effect at the start of the block.

You can reset **M148** with the following functions:

- **M149**
- **FUNCTION LIFTOFF RESET**

Application example

11 M148

; Activate automatic retraction

This NC block activates **M148**. If an NC stop is triggered during machining, the tool is retracted by up to 2 mm in the positive direction in the tool axis. This avoids possible damage due to the tool or workpiece.

Without **M148** the axes come to a stop upon an NC stop, meaning that the tool remains at the workpiece, which might result in surfaces blemishes on the workpiece.

Notes

- When lifting the tool off with **M148**, the control will not necessarily lift it off in the tool axis direction.
The control uses the **M149** function to deactivate the **FUNCTION LIFTOFF** function without resetting the lift-off direction. If you program **M148**, the control will activate the automatic lift-off of the tool in the lift-off direction defined by the **FUNCTION LIFTOFF** function.
- Please note that for some tools, such as side milling cutters, automatic retraction does not make sense.
- In machine parameter **on** (no. 201401), the machine manufacturer defines whether automatic lift-off is active.
- In machine parameter **distance** (no. 201402), the machine manufacturer defines the maximum lift-off height.

17.4.18 Preventing rounding off of outside corners with M197

Application


With **M197** the control extends a radius-compensated contour at the corner tangentially and inserts a smaller transition arc. That way you prevent the tool from rounding off the outside corner.

Description of function


Effect

M197 is in effect blockwise and only for radius-compensated outside corners.

Application example

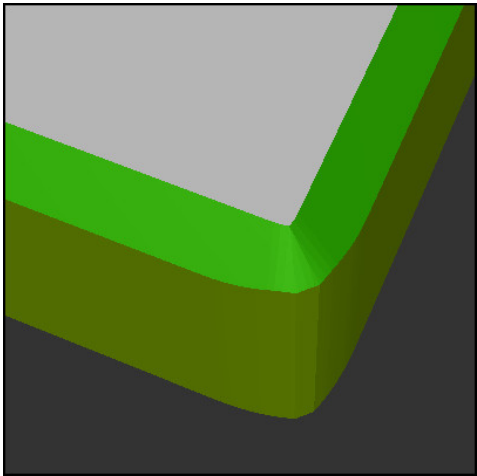

Contour without **M197**

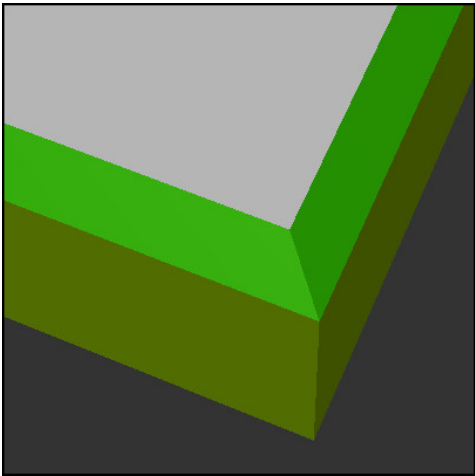

Contour with **M197**

* - ...	; Approach the contour
11 X+60 Y+10 M197 DL5	; Machine the first contour with a sharp edge
12 X+10 Y+60 M197 DL5	; Machine the second contour with a sharp edge
* - ...	; Machine the remaining contour

With **M197 DL5** the control extends the contour at the corner tangentially by up to 5 mm. In this example, the 5 mm exactly correspond to the tool radius, resulting in an outside corner with a sharp edge. The control uses the smaller transitional arc to nevertheless move along the traverse path gently.

Without **M197** and with active radius compensation the control inserts a tangential transitional arc at an outside corner, which leads to rounding off of the outside corner.

Input

If you define **M197**, the control continues the dialog and prompts you for the tangential extension **DL**. **DL** is the maximum length by which the control extends the outside corner.

Note

In order to produce corners with sharp edges, define the parameter **DL** with the same size as the tool radius. The smaller the value you enter for **DL**, the more the corner will be rounded off.

Definition

Abbreviation	Definition
DL	Maximum tangential extension

17.5 Miscellaneous functions for tools

17.5.1 Automatically inserting a replacement tool with M101

Application

With **M101** the control automatically inserts a replacement tool after a specified tool life has expired. The control then continues the machining operation with the replacement tool.

Requirements

- **RT** column in the tool management
You define the number or name of the replacement tool in the **RT** column.
- **TIME2** column in the tool management
In the **TIME2** column you define the tool life after which the control inserts the replacement tool.

Further information: User's Manual for Setup and Program Run



Use only tools with an identical radius as replacement tools. The control does not automatically check the radius of the tool.

If you want the control to check the radius, program **M108** after the tool change.

Further information: "Checking the radius of the replacement tool with M108", Page 451

Description of function

Effect

M101 takes effect at the start of the block.

In order to reset **M101**, program **M102**.

Application example



Refer to your machine manual.

The function of **M101** can vary depending on the individual machine tool.

11 TOOL CALL 5 Z S3000

; Tool call

12 M101

; Activate automatic tool change

The control exchanges the tools and activates **M101** in the next NC block. The **TIME2** column of the tool management contains the maximum age for the tool life at the time the tool is called. If, during machining, the current tool age in the column **CUR_TIME** exceeds this value, the control inserts the replacement tool at a suitable point in the NC program. This exchange takes place after no more than one minute, unless the control has not concluded the active NC block yet. A useful application of this function is for automated programs on unattended machines.

Input

If you define **M101**, the control continues the dialog and prompts you for **BT**. With **BT** you define the number of NC blocks by which the automatic tool change may be delayed (up to 100 blocks). The content of the NC blocks, such as the feed rate or distance moved, influences the time by which the tool change is delayed.

If you do not define **BT**, the control uses the value 1 or, if applicable, a default value defined by the machine manufacturer.

The value for **BT**, the tool life verification, and the calculation of the automatic tool change have an influence on the machining time.

11 M101 BT10

; Activate automatic tool change after no more than 10 NC blocks

Notes

NOTICE

Danger of collision!

During an automatic tool change with **M101**, the control always retracts the tool in the tool axis first. There is danger of collision when retracting tools for machining undercuts, such as side milling cutters or T-slot milling cutters!

- ▶ Use **M101** only for machining operations without undercuts
- ▶ Deactivate the tool change with **M102**

- If you want to reset the current age of a tool (e.g. after changing the indexable inserts), enter the value 0 in the **CUR_TIME** column of the tool management.
Further information: User's Manual for Setup and Program Run
- For indexed tools, the control does not apply any data from the main tool. You must define a replacement tool (with index, if necessary) in each table row in the tool management. If an indexed tool is worn and therefore disabled, this does not apply to all indices. This means, for example, that the main tool can still be used.
Further information: User's Manual for Setup and Program Run
- The higher the value of **BT**, the smaller will be the effect of an extended program duration through **M101**. Please note that this will delay the automatic tool change!
- The **M101** miscellaneous function is not available for turning tools and in turning mode (option 50).

Notes on tool change

- The control performs the automatic tool change at a suitable point in the NC program.
- The control cannot perform the automatic tool change at the following points in a program.
 - During a machining cycle
 - If radius compensation with **RR** or **RL** is active
 - Directly after an **APPR** approach function
 - Directly before a **DEP** departure function
 - Directly before and after a chamfer with **CHF** or a rounding with **RND**
 - During a macro
 - During a tool change
 - Directly after the NC functions **TOOL CALL** or **TOOL DEF**
- If the machine manufacturer does not define otherwise, the control moves the tool after the tool change as follows:
 - If the target position in the tool axis is below the current position, the tool axis is positioned last.
 - If the target position in the tool axis is above the current position, the tool axis is positioned first.

Notes on the input value BT

- To calculate a suitable initial value for **BT**, use the following formula:

$$BT = 10 \div t$$
 t: average machining time of an NC block in seconds
 Round the result up to an integer value. If the calculated result is greater than 100, use the maximum input value of 100.
- In the optional machine parameter **M101BlockTolerance** (no. 202206) the machine manufacturer defines the standard value for the number of NC blocks by which the automatic tool change may be delayed. This standard value applies if you do not define **BT**.

Definition

Abbreviation	Definition
BT (block tolerance)	Number of NC blocks by which a tool change may be delayed.

17.5.2 Permitting positive tool oversizes with M107 (option 9)**Application**

With **M107** (option 9) the control does not interrupt the machining process upon a positive delta value. The function is in effect with active 3D tool compensation and for **LN** straight lines.

Further information: "3D tool compensation (option 9)", Page 317

With **M107** you can, for example, use the same tool in a CAM program for pre-finishing with oversize and then later for final finishing without oversize.

Further information: "Output formats of NC programs", Page 396

Requirement

- Software option 9: Advanced Functions (set 2)


Description of function

Effect

M107 takes effect at the start of the block.

In order to reset **M107**, program **M108**.

Application example

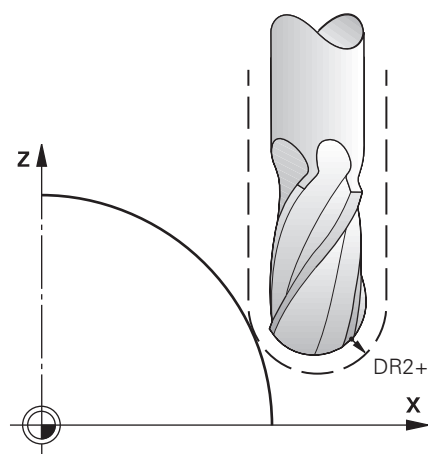

11 TOOL CALL 1 Z S5000 DR2:+0.3

; Insert a tool with a positive delta value

12 M107

; Permit positive delta values

The control exchanges the tools and activates **M107** in the next NC block. That way the control permits positive delta values and does not issue an error message, such as during pre-finishing.

Without **M107** the control issues an error message upon positive delta values.

Notes

- Before actual machining, check in the NC program to make sure that the positive delta values of the tool will not result in contour damages or collisions.
- With peripheral milling the control issues an error message in the following case:
 $DR_{Tab} + DR_{Prog} > 0$

Further information: "3D tool compensation during peripheral milling (option 9)",
Page 326

- With face milling the control issues an error message in the following cases:

- $DR_{Tab} + DR_{Prog} > 0$
- $R2 + DR2_{Tab} + DR2_{Prog} > R + DR_{Tab} + DR_{Prog}$
- $R2 + DR2_{Tab} + DR2_{Prog} > 0$
- $DR2_{Tab} + DR2_{Prog} > 0$

Further information: "3D tool compensation during face milling (option 9)",
Page 321

Definition

Abbreviation	Definition
R	Tool radius
R2	Corner radius
DR	Delta value of the tool radius
DR2	Delta value of the corner radius
TAB	Value refers to the tool management
PROG	Value refers to the NC program, meaning from the tool call or from compensation tables

17.5.3 Checking the radius of the replacement tool with M108

Application

If you program **M108** before inserting a replacement tool, the control checks the replacement tool for any radius deviations.

Further information: "Automatically inserting a replacement tool with M101",
Page 447

Description of function

Effect

M108 takes effect at the end of the block.

Application example

11 TOOL CALL 1 Z S5000	; Insert the tool
12 M101 M108	; Activate automatic tool change and radius checking

The control exchanges the tool and activates the automatic tool change and radius checking in the next NC block.

If the maximum tool age of the tool expires during machining, the control inserts the replacement tool. The control checks the tool radius of the replacement tool based on the **M108** miscellaneous function defined previously. If the radius of the replacement tool is greater than the radius of the tool being replaced, the control issues an error message.

Without **M108** the control will not check the radius of the replacement tool.

Note

M108 is also used to reset **M107** (option 9).

Further information: "Permitting positive tool oversizes with M107 (option 9)",
Page 449

17.5.4 Suppressing touch probe monitoring with M141

Application

In conjunction with the touch probe cycles **3 MEASURING** or **4 MEASURING IN 3-D**, if the stylus is deflected, you can retract the touch probe in a positioning block with **M141**.

Description of function

Effect

M141 is in effect blockwise for straight lines and takes effect at the start of the block.

Application example

11 TCH PROBE 3.0 MEASURING	
12 TCH PROBE 3.1 Q1	
13 TCH PROBE 3.2 Y ANGLE: +0	
14 TCH PROBE 3.3 ABST +10 F100	
15 TCH PROBE 3.4 ERRORMODE1	
16 L IX-20 R0 F500 M141	; Retract with M141

In cycle **3 MEASURING** the control probes the X axis of the workpiece. Since no retraction distance **MB** is defined in this cycle, the touch probe stands still after the deflection.

In NC block **16** the control retracts the touch probe against the probing direction by 20 mm. **M141** suppresses monitoring of the touch probe.

Without **M141** the control issues an error message as soon as you move the machine axes.

Further information: User's Manual for Measuring Cycles for Workpieces and Tools

Note

NOTICE

Danger of collision!

The miscellaneous function **M141** suppresses the corresponding error message if the stylus is deflected. The control does not perform an automatic collision check with the stylus. Based on these two types of behavior, you must check whether the touch probe can retract safely. There is a risk of collision if you choose the wrong direction for retraction.

- Carefully test the NC program or program section in the **Program run, single block** operating mode

18

**Variable
Programming**

18.1 Overview of variable programming

The control provides the following options for variable programming in the **Variables** folder of the **Insert NC function** window:

Function group	Further information
Basic arithmetic operations	Page 464
Trigonometric functions	Page 466
Circle calculation	Page 468
Jump commands	Page 469
Special functions	Page 470 Page 482
SQL commands	Page 495
String functions	Page 487
Counters	Page 494
Entering formulas directly	Page 484
Function for machining complex contours	See the User's Manual for Machining Cycles

18.2 Variables: Q, QL, QR and QS parameters

18.2.1 Basics


Application

You can use the Q, QL, QR and QS parameter variables of the control to perform calculations in an NC program, for example.

For instance, you can program the following syntax elements variably:

- Coordinate values
- Feed rates
- Spindle speeds
- Cycle data

Description of function

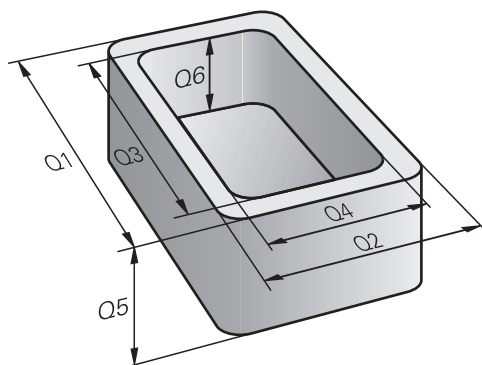


Q parameters are always identified with letters and numbers. The letters determine the type of Q parameter and the numbers the Q parameter range.

You can define which parameters the control displays on the **QPARA** tab of the **Status** workspace for each variable type.


Further information: User's Manual for Setup and Program Run

Variable types

The control provides the following variables for numerical values:

Q parameter type	Q parameter range	Meaning
Q parameters:		Parameters affect all NC programs in the control's memory
	0 to 99	Parameters for the user , if there are no overlaps with the HEIDENHAIN-SL cycles
		<div>  <p>These parameters have a local effect within macros and OEM cycles. This means that changes are not returned to the NC program. For this reason, use the Q parameter range 1200 to 1399 for OEM cycles!</p> </div>
	100 to 199	Parameters for special functions on the control that can be read by NC programs of the user or by cycles
	200 to 1199	Parameters primarily used for HEIDENHAIN cycles
	1200 to 1399	Parameters primarily used for OEM cycles
	1400 to 1999	Parameters for users
QL parameters:		Parameters only effective locally within an NC program
	0 to 499	Parameters for users
QR parameters:		Parameters are retained in all NC programs in the control's memory, including after a power interruption
	0 to 99	Parameters for users
	100 to 199	Parameters for HEIDENHAIN functions (e.g., cycles)
	200 to 499	Parameters for the machine manufacturer (e.g., cycles)

In addition, the control provides **QS** parameters for alphanumeric values, e.g. texts:

Q parameter type	Q parameter range	Meaning
QS parameters:		Parameters affect all NC programs in the control's memory
	0 to 99	Parameters for the user , where no overlaps with the HEIDENHAIN SL cycles are present
		<div>  <p>These parameters have a local effect within macros and OEM cycles. This means that changes are not returned to the NC program. For this reason, use the QS parameter range 200 to 499 for OEM cycles!</p> </div>
	100 to 199	Parameters for special functions on the control that can be read by NC programs of the user or by cycles
	200 to 1199	Parameters primarily used for HEIDENHAIN cycles
	1200 to 1399	Parameters primarily used for OEM cycles
	1400 to 1999	Parameters for users

Q parameter list window

In the **Q parameter list** window, you can see and edit the current values of all variables defined in the control.

	NO.	Value	Description
Q	0	0.00000000	
Q	1	0.00000000	MILLING DEPTH
Q	2	0.00000000	TOOL PATH OVERLAP
Q	3	0.00000000	ALLOWANCE FOR SIDE
Q	4	0.00000000	ALLOWANCE FOR FLOOR
Q	5	0.00000000	SURFACE COORDINATE
Q	6	0.00000000	SET-UP CLEARANCE
Q	7	0.00000000	CLEARANCE HEIGHT

Q parameter list window, showing the Q parameter values

In the left-hand panel, you can select the variable type to be displayed.

The control displays the following information:

- Variable type, e.g. Q parameter
- Number of the variable
- Value of variable
- Description in case of pre-assigned variables

If the field in the **Value** column is displayed with a white background, you can enter a value or edit the existing value.



While the control is executing an NC program, you cannot edit the variables using the **Q parameter list** window. Changes are only possible while a program run has been interrupted or aborted.

Further information: User's Manual for Setup and Program Run

This status is reached after an NC block has been executed, for example in the **Single Block** mode

The following Q and QS parameters cannot be edited in the **Q parameter list** window:

- Parameters with numbers in the range from 100 to 199, because there might be interferences with special functions in the control.
- Parameters with numbers in the range from 1200 to 1399, because there might be interferences with machine manufacturer-specific functions.

Further information: "Variable types", Page 456

You can select the **NR** or **Value** columns and then enter the desired string. The control will search the selected column for this string.

You can open the **Q parameter list** window in the following operating modes:

- **Editor**
- **Manual**
- **Program Run**

In the **Manual** and **Program Run** operating modes, the window can be opened with the **Q** key.

Notes

NOTICE

Danger of collision!

HEIDENHAIN cycles, machine manufacturer cycles and third-party functions use variables. You can also program variables within NC programs. If you do not use only the recommended variable ranges when using variables, this can lead to overlaps (interactions) and therefore to undesirable behavior. Danger of collision during machining!

- ▶ Only use variable ranges recommended by HEIDENHAIN
- ▶ Comply with the documentation from HEIDENHAIN, the machine manufacturer and third-party providers
- ▶ Check the machining sequence using the simulation

- You can enter fixed and variable values mixed in the NC program.
- You can assign a maximum of 255 characters to QS parameters.
- You can use the **Q** key to create an NC block to assign a value to a variable. If you press the key again, the control changes the variable type in the order **Q, QL, QR**. On the virtual keyboard, this procedure only works with the **Q** key in the NC functions area.

Further information: "Virtual keyboard of the control bar", Page 536

- Q parameters can be assigned numerical values between -999 999 999 and +999 999 999. The input range is limited to 16 digits, of which 9 may be before the decimal point. Internally the control calculates numbers up to a value of 10^{10} .
- You can reset Q parameters to the status **Undefined**. If a position is programmed with a Q parameter that is undefined, the control ignores this movement.

Further information: "Setting a variable to undefined", Page 466

- You must not use preassigned Q parameters (QS parameters) between **Q100** and **Q199** (**QS100** and **QS199**) as calculation parameters in the NC programs.

Further information: "Preassigned Q parameters", Page 459

- The control saves numerical values internally in a binary number format (standard IEEE 754). Due to the standardized format used, the control does not represent some decimal numbers with a binary number that is 100% exact (round-off error). If you use calculated variable contents for jump commands or positioning moves, you must take this into consideration.

Notes on QR parameters and backup

The control saves QR parameters within a backup.

If the machine manufacturer did not define a specific path, the control will save the **QR** parameter values in the following path: **SYS:\runtime\sys.cfg**. This partition will only be backed up in full backups.

Machine manufacturers can use the following optional machine parameters to specify the paths:

- **pathNcQR** (no. 131201)
- **pathSimQR** (no. 131202)

If the machine manufacturer used the optional machine parameters to specify a path on the TNC partition, you can perform a backup with the **NC/PLC Backup** functions without entering a code number.

Further information: User's Manual for Setup and Program Run

18.2.2 Preassigned Q parameters

The Q parameters **Q100** to **Q199** are assigned values by the control. The following types of information are assigned to the Q parameters:

- Values from the PLC
- Tool and spindle data
- Data on operating status
- Results of measurements from touch probe cycles etc.

The control saves the preassigned Q parameters **Q108** and **Q114** to **Q117** in the unit of measure used by the active NC program.

Values from the PLC: Q100 to Q107

The control assigns values from the PLC to parameters **Q100** to **Q107** in an NC program.

Active tool radius: Q108

The active value of the tool radius is assigned to **Q108**. **Q108** is calculated from:

- Tool radius **R** from the tool table
- Delta value **DR** from the tool table
- Delta value **DR** from the NC program (compensation table or tool call)



The control remembers the current tool radius even if the power is interrupted.

Tool axis: Q109

The value of the parameter **Q109** depends on the current tool axis:

Parameter	Tool axis
Q109 = -1	No tool axis defined
Q109 = 0	X axis
Q109 = 1	Y axis
Q109 = 2	Z axis
Q109 = 6	U axis
Q109 = 7	V axis
Q109 = 8	W axis

Spindle status: Q110

The value of **Q110** depends on the last defined additional function for the spindle:

Parameter	Additional function
Q110 = -1	No spindle status defined
Q110 = 0	M3: Spindle ON, clockwise
Q110 = 1	M4: Spindle ON, counterclockwise
Q110 = 2	M5 after M3
Q110 = 3	M5 after M4

Coolant on/off: Q111

Parameter	M function
Q111 = 1	M8: Coolant ON
Q111 = 0	M9: Coolant OFF

Overlap factor: Q112

The control assigns **Q112** to the overlap factor for pocket milling.

Unit of measurement for dimensions in the NC program: Q113

During nesting with **PGM CALL**, the value of the parameter **Q113** depends on the dimensional data of the NC program from which the other NC programs are called.

Parameter	Dimensional data of the main program
Q113 = 0	Metric system (mm)
Q113 = 1	Imperial system (inch)

Tool length: Q114

The current value for the tool length is assigned to **Q114**.



The control remembers the current tool length even if the power is interrupted.

Coordinates after probing during program run

The parameters **Q115** to **Q119** contain the coordinates of the spindle position at the instant of probing during programmed measurement with the 3D touch probe. The coordinates are referenced to the preset that is active in **Manual operation** mode.

The length of the stylus and the radius of the ball tip are not compensated in these coordinates.

Parameter	Coordinate axis
Q115	X axis
Q116	Y axis
Q117	Z axis
Q118	4th axis Machine-dependent
Q119	5th axis Machine-dependent

Deviation between actual and nominal value during automatic tool measurement; for example, with the TT 160

Parameter	Deviation of actual from nominal value
Q115	Tool length
Q116	Tool radius

Tilting the working plane with workpiece angles: Coordinates calculated by the control for rotary axes

Parameter	Coordinates
Q120	A axis
Q121	B axis
Q122	C axis

Measurement results from touch probe cycles

Further information: User's Manual for Measuring Cycles for Workpieces and Tools

Parameters	Measured actual values
Q150	Angle of a straight line
Q151	Center in main axis
Q152	Center in secondary axis
Q153	Diameter
Q154	Pocket length
Q155	Pocket width
Q156	Length of the axis selected in the cycle
Q157	Position of the centerline
Q158	Angle in the A axis
Q159	Angle in the B axis
Q160	Coordinate of the axis selected in the cycle

Parameters	Measured deviation
Q161	Center in main axis
Q162	Center in secondary axis
Q163	Diameter
Q164	Pocket length
Q165	Pocket width
Q166	Measured length
Q167	Position of the centerline

Parameters	Determined space angle
Q170	Rotation about the A axis
Q171	Rotation about the B axis
Q172	Rotation about the C axis

Parameters	Workpiece status
Q180	Good
Q181	Rework
Q182	Scrap

Parameters	Tool measurement with the BLUM laser
Q190	Reserved
Q191	Reserved
Q192	Reserved
Q193	Reserved

Parameters	Reserved for internal use
Q195	Marker for cycles

Parameters	Reserved for internal use
Q196	Marker for cycles
Q197	Marker for cycles (machining patterns)
Q198	Number of the last active measuring cycle
Parameter value	Status of tool measurement with TT
Q199 = 0.0	Tool is within the tolerance.
Q199 = 1.0	Tool is worn (LTOL/RTOL is exceeded)
Q199 = 2.0	Tool is broken (LBREAK/RBREAK is exceeded)
Parameters	Measured actual values
Q950	1st position in the main axis
Q951	1st position in the secondary axis
Q952	1st position in the tool axis
Q953	2nd position in the main axis
Q954	2nd position in the secondary axis
Q955	2nd position in the tool axis
Q956	3rd position in the main axis
Q957	3rd position in the secondary axis
Q958	3rd position in the tool axis
Q961	Spatial angle SPA in the WPL-CS
Q962	Spatial angle SPB in the WPL-CS
Q963	Spatial angle SPC in the WPL-CS
Q964	Angle of rotation in the I-CS
Q965	Angle of rotation in the coordinate system of the rotary table
Q966	First diameter
Q967	Second diameter
Parameters	Measured deviations
Q980	1st position in the main axis
Q981	1st position in the secondary axis
Q982	1st position in the tool axis
Q983	2nd position in the main axis
Q984	2nd position in the secondary axis
Q985	2nd position in the tool axis
Q986	3rd position in the main axis
Q987	3rd position in the secondary axis
Q988	3rd position in the tool axis
Q994	Angle in the I-CS
Q995	Angle in the coordinate system of the rotary table
Q996	First diameter

Parameters	Measured deviations
Q997	Second diameter

Parameter value	Workpiece status
Q183 = -1	Not defined
Q183 = 0	Pass
Q183 = 1	Rework
Q183 = 2	Scrap

18.2.3 Basic arithmetic folder

Application

In the **Basic arithmetic** folder of the **Insert NC function** window, the control offers the functions **FN 0** to **FN 5**.


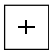
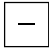
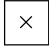


You can assign numeric values to variables using the **FN 0** function. You then use a variable instead of the fixed number in the NC program. You can also use pre-assigned variables, e.g. results from touch probe cycles. With the functions **FN 1** to **FN 5**, you can make calculations with the variable values within the NC program.

Related topics

- Preassigned variables
Further information: "Preassigned Q parameters", Page 459
- Programmable touch probe cycles
Further information: User's Manual for Machining Cycles
- Calculations with multiple calculation steps in an NC block
Further information: "Formulas in the NC program", Page 484

Description of function

The **Basic arithmetic** folder contains the following functions:

Icon	Function
	FN 0: ASSIGN e. g., FN 0: Q5 = +60 Directly assign value Reset Q parameter value
	FN 1: ADDITION e. g., FN 1: Q1 = -Q2 + -5 Calculate and assign the sum of two values
	FN 2: SUBTRACTION e. g. FN 2: Q1 = +10 - +5 Form and assign difference between two values
	FN 3: MULTIPLICATION e. g. FN 3: Q2 = +3 * +3 Form and assign the product of two values
	FN 4: DIVISION e.g., FN 4: Q4 = +8 DIV +Q2 Calculate and assign the quotient of two values Not permitted: Division by 0
	FN 5: SQUARE ROOT e.g., FN 5: Q20 = SQRT 4 Calculate and assign the square root of a value Not permitted: Square root of a negative value

To the left of the = sign, you define the variable to which you assign the value or result.


To the right of the = sign, you can use fixed or variable values.

The variables and numerical values in the equations can be entered with an algebraic sign.

Part families

For part families, you program the characteristic workpiece dimensions as variables, for example. To process the individual parts, assign a corresponding numerical value to each variable.

11 LBL "Z1"	
12 FN 0: Q1=30	; Assignment, Q1 contains the value 30
13 FN 0: Q2=10	; Assignment, Q2 contains the value 10
* - ...	
21 L X +Q1	; Corresponds to L X +30

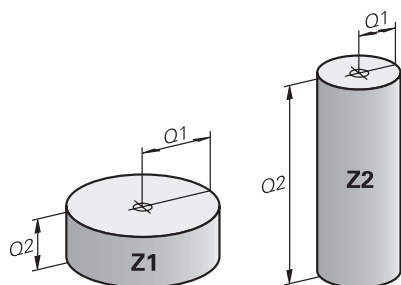Example: Cylinder with Q parameters

Cylinder radius:	$R = Q1$
Cylinder height:	$H = Q2$
Cylinder Z1:	$Q1 = +30$ $Q2 = +10$
Cylinder Z2:	$Q1 = +10$ $Q2 = +50$

Setting a variable to undefined

To set a variable to the **undefined** status:



- ▶ Select **Insert NC function**
- The control opens the **Insert NC function** window.
- ▶ Select **FN 0**
- ▶ Enter the number of the variable, e.g. **Q5**
- ▶ Select **SET UNDEFINED**
- ▶ Confirm your input
- The control sets the variable to the **undefined** status.

Notes

- The control distinguishes between undefined variables and variables with the value 0.
- You cannot divide by 0 (**FN 4**).
- You cannot extract a square root from a negative value (**FN 5**).





18.2.4 Trigonometric functions folder**Application**

In the **Trigonometric functions** folder of the **Insert NC function** window, the control provides the functions **FN 6** to **FN 8** and **FN 13**.


You can use these functions to calculate trigonometric functions for purposes such as programming variable triangular contours.

Description of function

The **Trigonometric functions** folder contains the following functions:

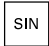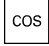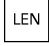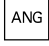Icon	Function
	FN 6: SINE e. g., FN 6: Q20 = SIN-Q5 Calculate and assign the sine of an angle in degrees (°)
	FN 7: COSINE e. g., FN 7: Q21 = COS-Q5 Calculate and assign the cosine of an angle in degrees (°)
	FN 8: ROOT SUM OF SQUARES e. g., FN 8: Q10 = +5 LEN +4 Calculate and assign length from two values
	FN 13: ANGLE e. g., FN 13: Q20 = +25 ANG-Q1 Calculate and assign an angle with the arc tangent of the opposite and adjacent sides of the triangle or with the sine and cosine of the angle ($0 < \text{angle} < 360^\circ$).

Definition

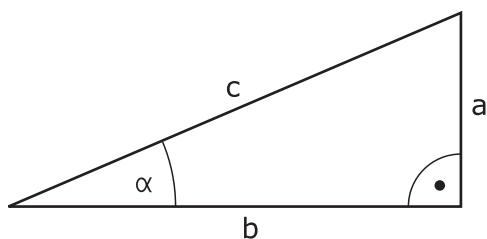

Side or trigonometric function	Meaning
a	Side opposite angle α
b	Third side
c	Side opposite right angle
Sine	$\sin \alpha = a / c$
Cosine	$\cos \alpha = b / c$
Tangent	$\tan \alpha = a / b = \sin \alpha / \cos \alpha$
Arc tangent	$\alpha = \arctan (a / b) = \arctan (\sin \alpha / \cos \alpha)$

Example

$$a = 25 \text{ mm}$$

$$b = 50 \text{ mm}$$

$$\alpha = \arctan (a / b) = \arctan 0.5 = 26.57^\circ$$

Furthermore:

$$a^2 + b^2 = c^2 \text{ (where } a^2 = a \times a \text{)}$$

$$c = \sqrt{(a^2 + b^2)}$$

18.2.5 Circle calculation folder


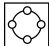
Application

In the **Circle calculation** folder of the **Insert NC function** window, the control provides the functions **FN 23** and **FN 24**.

These functions allow you to calculate the center of the circle and the radius of the circle from the coordinates of three or four circle points, for example the position and size of a partial circle.

Description of function

The **Circle calculation** folder contains the following functions:

Icon	Function
	FN 23: Determining the CIRCLE DATA from three points Example: FN 23: Q20 = CDATA Q30
	FN 24: Determining the CIRCLE DATA from four points Example: FN 24: Q20 = CDATA Q30

You save the coordinates in the working plane of the respective points in consecutive variables. You must save the coordinates of the main axis before the coordinates of the secondary axis, e.g. **X** before **Y** for tool axis **Z**.

Further information: "Designation of the axes on milling machines", Page 98

Circle calculation with three circle points

11 FN 23: Q20 = CDATA Q30

The coordinate pairs of three points on a circle must be saved in **Q30** and the five subsequent parameters—in this case, up to **Q35**.

The control then saves the circle center in the principal axis (X if spindle axis is Z) in parameter **Q20**, the circle center in the minor axis (Y if spindle axis is Z) in parameter **Q21**, and the circle radius in parameter **Q22**.

Circle calculation with four circle points

11 FN 24: Q20 = CDATA Q30

The coordinate pairs of four points on a circle must be saved in parameter **Q30** and the seven subsequent parameters—in this case, up to **Q37**.

The control then saves the circle center in the principal axis (X if spindle axis is Z) in parameter **Q20**, the circle center in the minor axis (Y if spindle axis is Z) in parameter **Q21**, and the circle radius in parameter **Q22**.

Note

Note that **FN 23** and **FN 24** automatically overwrite the resulting parameter and the two following parameters.

18.2.6 Jump commands folder

Application

In the **Jump commands** folder of the **Insert NC function** window, the control provides the functions **FN 9** to **FN 12** for jumps with if-then decisions.

In if-then decisions, the control compares a Q parameter with another Q parameter or a numerical value. If the condition is fulfilled, then the control continues the NC program at the label that is programmed after the condition.

If the condition is not fulfilled, the control continues with the next NC block.





Related topics

- Jumps without condition with **CALL LBL** label call

Further information: "Subprograms and program section repeats with the label LBL", Page 210

Description of function

The **Jump commands** folder contains the following functions for if-then decisions:

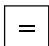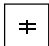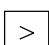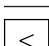Icon	Function
	<p>FN 9: IF EQUAL, JUMP e. g., FN 9: IF +Q1 EQU +Q3 GOTO LBL "UPCAN25" If both values or parameters are equal, jump to specified label</p> <hr/> <p>FN 9: IF UNDEFINED, JUMP e. g., FN 9: IF +Q1 IS UNDEFINED GOTO LBL "UPCAN25" If the specified parameter is undefined, then a jump is made to the specified label</p> <hr/> <p>FN 9: IF DEFINED, JUMP e. g., FN 9: IF +Q1 IS DEFINED GOTO LBL "UPCAN25" If the specified parameter is defined, then a jump is made to the specified label</p>
	<p>FN 10: IF UNEQUAL, JUMP e. g., FN 10: IF +10 NE -Q5 GOTO LBL 10 If both values or parameters are unequal, jump to specified label</p>
	<p>FN 11: IF GREATER, JUMP g. g., FN 11: IF+Q1 GT+10 GOTO LBL QS5 If the first value or parameter is greater than the second value or parameter, jump to specified label</p>
	<p>FN 12: IF LESS, JUMP e. g., FN 12: IF+Q5 LT+0 GOTO LBL "ANYNAME" If the first value or parameter is smaller than the second value or parameter, jump to specified label</p>

For the **IF** condition, you can enter fixed or variable numbers or text.

For the jump address **GOTO**, you can enter the following values:

- **LBL NAME**
- **LBL NUMBER**
- **QS**

Unconditional jump

Unconditional jumps are jumps whose condition is always fulfilled.

Example:

```
11 FN 9: IF+0 EQU+0 GOTO LBL1
```

You can use such jumps, for example, in a called NC program in which you work with subprograms. This way, you can ensure that the control does not execute the subprograms without a call, even without **M30** or **M2**.

Further information: "Subprograms", Page 212

Definitions

Abbreviation	Definition
IF	If
EQU (equal)	Equal to
NE (not equal)	Not equal to
GT (greater than)	Greater than
LT (less than)	Less than
GOTO (go to)	Go to
UNDEFINED	Undefined
DEFINED	Defined

18.2.7 Special functions for programming with variables

Output error messages with FN 14: ERROR

Application

With the **FN 14: ERROR** error function, you can output error messages under program control. The messages are predefined by the machine manufacturer or by HEIDENHAIN.

Related topics

- Error numbers pre-assigned by HEIDENHAIN
Further information: "Preassigned error numbers for FN 14: ERROR", Page 622
- Error messages in the notification menu
Further information: User's Manual for Setup and Program Run

Description of function

If, during a program run or during simulation, the control encounters the **FN 14: ERROR** function, it will interrupt the program run and display the defined message. You must then restart the NC program.

You define the error number for the desired error message.

The error numbers are grouped as follows:

Error number range	Standard dialog
0 ... 999	Machine-dependent dialog
1000 ... 1199	Internal error messages

Note

Note that depending on the type of control you have, not all error messages are present.

Outputting text formatted with FN 16: F-PRINT**Application**

With the function **FN 16: F-PRINT**, you can save Q parameter values and output formatted texts (e.g. in order to save measurement reports).

You can output the values as follows:

- Save them to a file on the control
- Display them on the screen in a pop-up window
- Save them to an external file
- Print them using a connected printer

Related topics

- Automatically generated measurement log for touch probe cycles
Further information: User's Manual for Setup and Program Run
- Print to a connected printer
Further information: User's Manual for Setup and Program Run

Description of function

To output Q-parameter values and texts:

- ▶ Create a text file that defines the output format and contents
 - ▶ In the NC program, use the function **FN 16: F-PRINT** in order to output the log
- If you output the values to a file, the maximum size of the output file will be 20 KB. Within the **FN 16** function, you specify the output file that contains the texts to be output.

The control displays the output file in the following cases:

- End of program **END PGM**
- Cancellation of program with the **NC STOP** key
- **M_CLOSE** command
Further information: "Keywords", Page 473

Source file for output format

You define the output format and the contents of the file in a source file ***.a**.

Formatting

You can define the formatting using the following commands:



Pay attention to capitalization.

Special characters	Function
"....."	Define output format for texts and variables between the quotation marks
%F	Format for Q parameters, QL, and QR: <ul style="list-style-type: none"> ■ Define %: format ■ F: Floating (decimal number), format for Q, QL, QR
9.3	Format for Q parameters, QL, and QR: <ul style="list-style-type: none"> ■ Total of 9 characters, including decimal separator ■ Of these, 3 are decimal places
%S	Format for text variable QS
%RS	Format for text variable QS Assumes the subsequent without any changes or formatting
%D or %I	Format for integer
,	Separation character between output format and parameter
;	End of block character
*	Beginning of a comment line Comments are not shown in the log
%"	Output quotation marks
%%	Output percent sign
\\	Output backslash
\n	Output line break
+	Q parameter value, right-aligned
-	Q parameter value, left-aligned

Keywords

You can include the following information in the file:

Keyword	Function
CALL_PATH	Gives the path for the NC program where you will find the FN 16 function. Example: "Measuring program: %S",CALL_PATH;
M_CLOSE	Closes the file to which you are writing with FN 16. Example: M_CLOSE;
M_APPEND	Upon renewed output, appends the log to the existing log. Example: M_APPEND;
M_APPEND_MAX	Upon renewed output, appends the log to the existing log until the maximum specified file size in kilobytes is exceeded. Example: M_APPEND_MAX20;
M_TRUNCATE	Overwrites the log upon renewed output. Example: M_TRUNCATE;
M_EMPTY_HIDE	Prevents empty lines from being inserted into the log if QS parameters are not defined or empty. Example: M_EMPTY_HIDE;
M_EMPTY_SHOW	Inserts empty lines into the log if QS parameters are not defined. Resets M_EMPTY_HIDE. Example: M_EMPTY_SHOW;
L_ENGLISH	Outputs the text only for English conversational language
L_GERMAN	Outputs the text only for German conversational language
L_CZECH	Outputs text only for Czech conversational language
L_FRENCH	Outputs text only for French conversational language
L_ITALIAN	Outputs text only for Italian conversational language
L_SPANISH	Outputs text only for Spanish conversational language
L_PORTUGUE	Outputs text only for Portuguese conversational language
L_SWEDISH	Outputs text only for Swedish conversational language
L_DANISH	Outputs text only for Danish conversational language
L_FINNISH	Outputs text only for Finnish conversational language
L_DUTCH	Outputs text only for Dutch conversational language
L_POLISH	Outputs text only for Polish conversational language
L_HUNGARIA	Outputs text only for Hungarian conversational language
L_CHINESE	Outputs text only for Chinese conversational language
L_CHINESE_TRAD	Outputs text only for Chinese (traditional) conversational language
L_SLOVENIAN	Outputs text only for Slovenian conversational language
L_NORWEGIAN	Outputs text only for Norwegian conversational language

Keyword	Function
L_ROMANIAN	Outputs text only for Romanian conversational language
L_SLOVAK	Outputs text only for Slovakian conversational language
L_TURKISH	Outputs text only for Turkish conversational language
L_ALL	Display text independently of the conversational language
HOUR	Number of hours from the real-time clock
MIN	Number of minutes from the real-time clock
SEC	Number of seconds from the real-time clock
DAY	Day from the real-time clock
MONTH	Month as a number from the real-time clock
STR_MONTH	Month as a string abbreviation from the real-time clock
YEAR2	Two-digit year from the real-time clock
YEAR4	Four-digit year from the real-time clock

Input

11 FN 16: F-PRINT TNC:\mask.a / TNC:\Prot1.txt ; Output file **Prot1.txt** with the source from **Mask.a**

The NC function includes the following syntax elements:

Syntax element	Meaning
FN 16: F-PRINT	Syntax initiator for outputting formatted texts
*.a	Path of the source file for the output format
/	Separator between the two paths
TNC:\Prot1.txt	Path under which the control saves the output file The file name extension of the log file determines the file type of the output (e.g., TXT, A, XLS, HTML).

You can enter the source file and the output file as Q parameters or as QS parameters. For this purpose you previously define the desired parameter in the NC program.

Enter Q parameters in the **FN 16** function with the following syntax so that the control can detect the Q parameters:

Input	Function
:'QS1'	Set QS parameters with preceding colon and between single quotation marks
:'QL3'.txt	Specify additional file name extension for the target file if required

Output options

Screen output

You can use the **FN 16: F-PRINT** function to display messages in a pop-up window on the control screen. This makes it easy to display explanatory texts in such a way that the user cannot continue without reacting to them. The length and position of these texts can be defined freely in the NC program. It is also possible to display the contents of variables by defining the text file accordingly.

In order to display the message on the control screen, enter **SCREEN:** as the output path.

Example

```
11 FN 16: F-PRINT TNC:\MASKE\MASKE1.A / SCREEN:
```



If you want to replace the content of the pop-up window for multiple screen outputs in the NC program, define the **M_CLOSE** or **M_TRUNCATE** keywords.

You can close the pop-up window in the following ways:

- By pressing the **CE** key
- By defining the **SCLR:** output path

Save output externally of the control

With the **FN 16** function you can also store log files externally.

To do so you must enter the target path in the **FN 16** function.

Example

```
96 FN 16: F-PRINT TNC:\MSK\MSK1.A / PC325:\LOG\PRO1.TXT
```

If you output the same file more than once in the NC program, the control appends the current output to the end of the contents already output within the target file.

Print output file

You can also use the function **FN 16: F-PRINT** to print the output files on a connected printer.

Further information: User's Manual for Setup and Program Run

The control will only print the log file if the source file for the output format ends with the **M_CLOSE** keyword.

To ensure that the messages will be sent to the default printer, you must enter **Printer:** and a file name as the target (output path).

If you do not use the default printer, enter the path to the respective printer, e.g., **Printer:\PR0739** and a file name.

The control will save the file using the defined file name and the defined path. The file name will not be printed.

The control saves the file only until printing is complete.

Example

```
11 FN 16: F-PRINT TNC:\MASKE\MASKE1.A / PRINTER:\PRINT1
```

Notes

- Use the optional machine parameters **fn16DefaultPath** (no. 102202) and **fn16DefaultPathSim** (no. 102203) to define a path under which the control saves the output files.
- If you only define the file name as the destination path of the output file, the control saves the output file in the folder of the NC program.
- If you define a path both in the machine parameters and in the **FN 16** function, the path in the **FN 16** function has priority.
- If the called file is located in the same directory as the file you are calling it from, you can also enter just the file name without the path. If you select the file using the selection menu, the control automatically proceeds in this manner.
- With the **%RS** function in the source file, the control accepts the following content unformatted. This allows you to output a path specification with QS parameters, for example.
- For text output, you can use the UTF-8 character set.

Example

Example of a text file that outputs a log file of variable length:

"MEASURING LOG";

"%S",QS1;

M_EMPTY_HIDE;

"%S",QS2;

"%S",QS3;

M_EMPTY_SHOW;

"%S",QS4;

M_CLOSE;


Example of an NC program that defines only **QS3**:

```
95 Q1 = 100
```

```
96 QS3 = "Pos 1: " || TOCHAR( DAT+Q1 )
```

```
97 FN 16: F-PRINT TNC:\fn16.a / SCREEN:
```

Example of a screen output with two empty lines resulting from **QS1** and **QS4**:

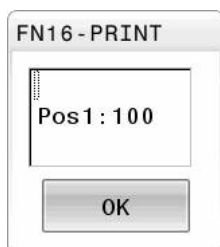

Read system data with FN 18: SYSREAD

Application

The **FN 18: SYSREAD** function can be used to read system data and store this data in variables.

Related topics

- List of the system data of the control
Further information: "List of FN functions", Page 628
- Read system data using QS parameters
Further information: "Read system data with SYSSTR", Page 489

Description of function

The control always outputs system data in the metric system with **FN 18: SYSREAD**, regardless of the unit of the NC program.

Input

**11 FN 18: SYSREAD Q25 = ID210 NR4
IDX3**

; Save the active dimension factor of the Z
axis in **Q25**

The NC function includes the following syntax elements:

Syntax element	Meaning
FN18: SYSREAD	Read the syntax initiator for system data
Q/QL/QR or QS	Variable in which the control stores the information
ID	Group number of the system datum
NR	System data number Optional syntax element
IDX	Index Optional syntax element
.	Sub-index for system data for tools Optional syntax element

Note

As an alternative, you can use **TABDATA READ** to read out data from the active tool table. In this case, the control will automatically convert the table values to the unit of measure used in the NC program.

Further information: "Reading table values with TABDATA READ", Page 600

Transfer values to PLC with FN 19: PLC**Application**

The **FN 19: PLC** function transfers up to two numerical values or Q parameters to the PLC.

Description of function**NOTICE****Danger of collision!**

Changes to the PLC can result in undesired behavior and serious errors (e.g., inoperability of the control). For this reason, access to the PLC is protected by password. This function provides HEIDENHAIN as well as your machine manufacturer and suppliers with the ability to communicate with the PLC from an NC program. It is not recommended for the machine operator or NC programmer to use this function. There is risk of collision during the execution of the function and during the subsequent machining!

- ▶ Only use the function in consultation with HEIDENHAIN, the machine manufacturer, or the supplier.
- ▶ Comply with the documentation from HEIDENHAIN, the machine manufacturer, and suppliers.

Synchronizing NC and PLC with FN 20: WAIT FOR

Application

With the **FN 20: WAIT FOR** function you can synchronize the NC and PLC during a program run. The NC stops machining until the condition that you have programmed in the **FN 20: WAIT FOR** block is fulfilled.

Description of function

NOTICE

Danger of collision!

Changes to the PLC can result in undesired behavior and serious errors (e.g., inoperability of the control). For this reason, access to the PLC is protected by password. This function provides HEIDENHAIN as well as your machine manufacturer and suppliers with the ability to communicate with the PLC from an NC program. It is not recommended for the machine operator or NC programmer to use this function. There is risk of collision during the execution of the function and during the subsequent machining!

- ▶ Only use the function in consultation with HEIDENHAIN, the machine manufacturer, or the supplier.
- ▶ Comply with the documentation from HEIDENHAIN, the machine manufacturer, and suppliers.

SYNC is used whenever you read, for example, system data via **FN 18: SYSREAD** that require synchronization with real time. The control stops the look-ahead calculation and executes the following NC block only when the NC program has actually reached that NC block.

Application example

```
32 FN 20: WAIT FOR SYNC
```

```
33 FN 18: SYSREAD Q1 = ID270 NR1 IDX1
```

In this example, you stop the internal pre-calculation of the control in order to determine the current position of the X axis.

Transferring values to PLC with FN 29: PLC

Application

The **FN 29: PLC** function transfers up to eight numerical values or Q parameters to the PLC.

Description of function**NOTICE****Danger of collision!**

Changes to the PLC can result in undesired behavior and serious errors (e.g., inoperability of the control). For this reason, access to the PLC is protected by password. This function provides HEIDENHAIN as well as your machine manufacturer and suppliers with the ability to communicate with the PLC from an NC program. It is not recommended for the machine operator or NC programmer to use this function. There is risk of collision during the execution of the function and during the subsequent machining!

- ▶ Only use the function in consultation with HEIDENHAIN, the machine manufacturer, or the supplier.
- ▶ Comply with the documentation from HEIDENHAIN, the machine manufacturer, and suppliers.

Creating your own cycles with FN 37: EXPORT**Application**

You need the **FN 37: EXPORT** function if you want to create your own cycles and integrate them in the control.

Description of function**NOTICE****Danger of collision!**

Changes to the PLC can result in undesired behavior and serious errors (e.g., inoperability of the control). For this reason, access to the PLC is protected by password. This function provides HEIDENHAIN as well as your machine manufacturer and suppliers with the ability to communicate with the PLC from an NC program. It is not recommended for the machine operator or NC programmer to use this function. There is risk of collision during the execution of the function and during the subsequent machining!

- ▶ Only use the function in consultation with HEIDENHAIN, the machine manufacturer, or the supplier.
- ▶ Comply with the documentation from HEIDENHAIN, the machine manufacturer, and suppliers.

Sending information from the NC program with FN 38: SEND**Application**

The function **FN 38: SEND** enables you to retrieve texts and Q parameter values from the NC program and write them to the log or send them to an external application, e.g. StateMonitor.

Description of function

Data is transferred via a TCP/IP connection.



For more detailed information, consult the RemoTools SDK manual.

Input

**11 FN 38: SEND /"Q-Parameter Q1: %f
Q23: %f" / +Q1 / +Q23**

; Write values from **Q1** and **Q23** to the logbook

The NC function includes the following syntax elements:

Syntax element	Meaning
FN 18: SEND	Send syntax initiator for information
/	Output text as fixed or variable text with up to max. seven placeholders for the values of the variables, e.g. %f Further information: "Source file for output format", Page 471
/	Content of the max. seven placeholders in the output text as fixed or variable numbers Optional syntax element

Notes

- Placeholders are case-sensitive, so make sure to enter them correctly.
- To obtain % in the output text, enter %% at the desired position.

Example

Send information to StateMonitor.

With function **FN 38**, you can enter job data, among others. This requires a job that has been created in StateMonitor and an assignment to the machine tool being used.



Job management with JobTerminal (option 4) is possible with StateMonitor version 1.2 or higher.

Requirements:

- Job number 1234
- Working step 1

11 FN 38: SEND /"JOB:1234_STEP:1_CREATE"	; Create job
12 FN 38: SEND /"JOB:1234_STEP:1_CREATE_ITEMNAME: HOLDER_ITEMID:123_TARGETQ:20"	; Alternatively: Create job with part name, part number and target quantity
13 FN 38: SEND /"JOB:1234_STEP:1_START"	; Start job
14 FN 38: SEND /"JOB:1234_STEP:1_PREPARATION"	; Start preparation
15 FN 38: SEND /"JOB:1234_STEP:1_PRODUCTION"	; Production
16 FN 38: SEND /"JOB:1234_STEP:1_STOP"	; Stop job
17 FN 38: SEND /"JOB:1234_STEP:1_FINISH"	; Finish job

In addition, the workpiece quantities for the job can be reported.

With the **OK**, **S**, and **R** placeholders, you can specify whether the quantity of reported workpieces has been machined correctly or not.

The **A** and **I** placeholders allow you to define how StateMonitor interprets the response. If absolute values are transferred, then StateMonitor overwrites the previously valid values. In the case of incremental values, StateMonitor increments the quantity.

11 FN 38: SEND /"JOB:1234_STEP:1_OK_A:23"	; Actual quantity (OK) absolute
12 FN 38: SEND /"JOB:1234_STEP:1_OK_I:1"	; Actual quantity (OK) incremental
13 FN 38: SEND /"JOB:1234_STEP:1_S_A:12"	; Scrap (S) absolute
14 FN 38: SEND /"JOB:1234_STEP:1_S_I:1"	; Scrap (S) incremental
15 FN 38: SEND /"JOB:1234_STEP:1_R_A:15"	; Rework (R) absolute
16 FN 38: SEND /"JOB:1234_STEP:1_R_I:1"	; Rework (R) incremental

18.2.8 Functions for freely definable tables

Opening a freely definable table with FN 26: TABOPEN

Application

With the function **FN 26: TABOPEN** you open a freely definable table to be written to with **FN 27** or to be read from with **FN 28**.

Related topics

- Content and creation of freely definable tables
Further information: "Freely definable tables", Page 602
- Access to table values with low computing power
Further information: "Table access with SQL statements", Page 495

Description of function

Enter the path of the freely definable table. The file name must end with ***.tab**.

Note

Only one table can be opened in an NC program at any one time. A new NC block with **FN 26: TABOPEN** automatically closes the last opened table.

Writing to a freely definable table with FN 27: TABWRITE

Application

With the **FN 27: TABWRITE** function you write to the table that you previously opened with **FN 26: TABOPEN**.

Related topics

- Content and creation of freely definable tables
Further information: "Freely definable tables", Page 602
- Opening a freely definable table
Further information: "Opening a freely definable table with FN 26: TABOPEN", Page 482

Description of function

You can define multiple column names in a **TABWRITE** block. The column names must be written between quotation marks and separated by a comma. You define in Q parameters the value that the control is to write to the respective column.

Use QS parameters if you want to write to a text field (such as column type **UPTTEXT**). Use Q, QL, or QR parameters to write to numerical fields.

Notes

- The control only executes the **FN 27: TABWRITE** function in the **Program Run** operating mode.
The **FN 18 ID992 NR16** function allows you to query the operating mode in which the NC program is running.
- If you write to more than one column in an NC block, you must save the values under successive Q parameter numbers.
- The control displays an error message if you try to write to a table cell that is locked or does not exist.

Example

You wish to write to the columns "Radius", "Depth", and "D" in line 5 of the presently opened table. The values to be written in the table are saved in the Q parameters **Q5**, **Q6**, and **Q7**.

11 Q5 = 3,75	; Define the value for the Radius column
12 Q6 = -5	; Define the value for the Depth column
13 Q7 = 7,5	; Define the value for the D column
14 FN 27: TABWRITE 5/"Radius,Depth,D" = Q5	; Write defined values to the table

Reading a freely definable table with FN 28: TABREAD**Application**

With the **FN 28: TABREAD** function you read from the table previously opened with **FN 26: TABOPEN**.

Related topics

- Content and creation of freely definable tables
Further information: "Freely definable tables", Page 602
- Opening a freely definable table
Further information: "Opening a freely definable table with FN 26: TABOPEN", Page 482
- Writing a freely definable table
Further information: "Writing to a freely definable table with FN 27: TABWRITE", Page 482

Description of function

You can define, i.e. read, multiple column names in a **TABREAD** block. The column names must be written between quotation marks and separated by a comma. In the **FN 28** block you can define the Q parameter number in which the control is to write the value that is first read.

Use QS parameters if you want to read a text field. Use Q, QL, or QR parameters to read from numerical fields.

Note

If you wish to read from more than one column in an NC block, the control will save the values under successive Q parameters of the same type, such as **QL1**, **QL2**, and **QL3**.

Example

You wish to read the values of the columns **X**, **Y**, and **D** from line 6 of the presently opened table. Save the first value in the Q parameter **Q10**, the second in **Q11**, and the third value in **Q12**.

From the same row, save the column **DOC** in **QS1**.

11 FN 28: TABREAD Q10 = 6/"X,Y,D"	; Read numeric values from columns X , Y and D
12 FN 28: TABREAD QS1 = 6/"DOC"	; Read the alphanumeric value from the DOC column

18.2.9 Formulas in the NC program

Application

You can use the **Formula Q/QL/QR** function to define multiple arithmetic operations in one NC block.

Related topics

- String formula for strings
Further information: "String functions", Page 487
- Define a calculation in the NC block
Further information: "Basic arithmetic folder", Page 464

Description of function

As the first entry, you define the variable to which you assign the result.

To the right of the = sign, you define the arithmetic operations.

If you define the functions **Formula Q/QL/QR** or **String Formula QS**, you can open a keyboard for formula input with all available calculation steps in the action bar or form. The virtual keyboard also contains a formula input mode.

Further information: "Virtual keyboard of the control bar", Page 536

Rules for formulas

Sequence for the evaluation of arithmetic operations

If you enter a mathematical formula that contains more than one mathematical operation, the control always evaluates the individual operations in a defined sequence. A familiar example of this is the rule that multiplication/division takes place before addition/subtraction (higher-level operations are performed first).

The control adheres to the following rules of priority for the evaluation of mathematical formulas:

Priority	Designation	Arithmetic operator
1	Resolve parentheses	()
2	Note the sign, calculate the function	Minus sign, SIN , COS , LN etc.
3	Powers	^
4	Multiplication and division	*, /
5	Addition and subtraction	+, -

Sequence of operations with the same priority

The control generally calculates operations with the same priority from the left to the right.

$$2 + 3 - 2 = (2 + 3) - 2 = 3$$


Exception: Concatenated powers are evaluated from right to left.

$$2^3 \cdot 2 = 2^9 = 512$$

Arithmetic operations

The formula input keyboard includes the following shortcut functions:

Syntax	Linking function	Priority
+	Addition e.g. $Q10 = Q1 + Q5$	Addition/subtraction calculation
-	Subtraction e.g. $Q25 = Q7 - Q108$	Addition/subtraction calculation
*	Multiplication e.g. $Q12 = 5 * Q5$	Multiplication/division calculation
/	Division e.g. $Q25 = Q1 / Q2$	Multiplication/division calculation
(Opening parenthesis e.g. $Q12 = Q1 * (Q2 + Q3)$	Expression in parentheses
)	Closing parenthesis e.g. $Q12 = Q1 * (Q2 + Q3)$	Expression in parentheses
SQ	Square of a value e.g. $Q15 = SQ 5$	Function
SQRT	Square root e.g. $Q22 = SQRT 25$	Function
SIN	Sine of an angle e.g. $Q44 = SIN 45$	Function
COS	Cosine of an angle e.g. $Q45 = COS 45$	Function
TAN	Tangent of an angle e.g. $Q46 = TAN 45$	Function
ASIN	Arc sine Inverse of the sine. Determines the angle from the ratio of the side opposite the angle and the hypotenuse e.g. $Q10 = ASIN (Q40 / Q20)$	Function
ACOS	Arc cosine Inverse of the cosine. Determines the angle from the ratio of the side adjacent to the angle and the hypotenuse e.g. $Q11 = ACOS Q40$	Function
ATAN	Arc tangent Inverse of the tangent. Determines the angle from the ratio of the opposite side to the adjacent side e.g. $Q12 = ATAN Q50$	Function
^	Raising values to a power e.g. $Q15 = 3 ^ 3$	Power

Syntax	Linking function	Priority
PI	Pi constant $\pi = 3.14159$ e.g. Q15 = PI	
LN	Natural logarithm (LN) of a number Base = e = 2.7183 e.g. Q15 = LN Q11	Function
LOG	Logarithm of a number Base = 10 e.g. Q33 = LOG Q22	Function
EXP	Exponential function (e^n) Base = e = 2.7183 e.g. Q1 = EXP Q12	Function
NEG	Negate values Multiply by -1 e.g. Q2 = NEG Q1	Function
INT	Truncate decimal places Form an integer e.g. Q3 = INT Q42	Function
<div>  The INT function does not round off—it simply truncates the decimal places. </div>		
ABS	Absolute value of a number e.g. Q4 = ABS Q22	Function
FRAC	Truncate places before the decimal point Form a fraction e.g. Q5 = FRAC Q23	Function
SGN	Check algebraic sign of a number e.g. Q12 = SGN Q50 If Q50 = 0 , then SGN Q50 = 0 If Q50 < 0 , then SGN Q50 = -1 If Q50 > 0 , then SGN Q50 = 1	Function
%	Calculate the modulo value (division remainder) e. g., Q12 = 400 % 360 Result: Q12 = 40	Function

You can also define shortcut functions for strings.

Example

Multiplication and division before addition and subtraction

```
11 Q1 = 5 * 3 + 2 * 10 ; Result = 35
```

- 1st calculation: $5 * 3 = 15$
- 2nd calculation: $2 * 10 = 20$
- 3rd calculation: $15 + 20 = 35$

Power before addition and subtraction

```
11 Q2 = SQ 10 - 3^3 ; Result = 73
```

- 1st calculation: 10 squared = 100
- 2nd calculation: 3 to the power of 3 = 27
- 3rd calculation: 100 – 27 = 73

Function before power

```
11 Q4 = SIN 30 ^ 2 ; Result = 0.25
```

- 1st calculation: Calculate sine of 30 = 0.5
- 2nd calculation: 0.5 squared = 0.25

Brackets before function

```
11 Q5 = SIN ( 50 - 20 ) ; = 0.5
```

- 1st calculation: Resolve parentheses: 50 - 20 = 30
- 2nd calculation: Calculate sine of 30 = 0.5

18.3 String functions

Application

With QS parameters, you can define and further process texts, e.g. to create variable logs with **FN 16: F-PRINT**.

Related topics

- Ranges of variables
Further information: "Variable types", Page 456

Description of function

You can assign a maximum of 255 characters to a QS parameter.

The following characters are allowed within QS parameters:

- Characters
- Numbers
- Special characters, for example ?
- Control characters, for example \ for paths
- Spaces


The individual string functions are programmed using the free syntax input.

Further information: "Editing NC functions", Page 117

You can further process or check the values of QS parameters with the functions

Formula Q/QL/QR and **String Formula QS**.

Syntax	Function	Higher-level NC function
DECLARE STRING	Assigning a value to QS parameter Further information: "Assigning text to a QS parameter", Page 491	
STRING FORMULA	Linking QS parameters Further information: "Linking QS parameters", Page 491	String formula QS

Syntax	Function	Higher-level NC function
TONUMB	Converting the alphanumeric value of a QS parameter to a numeric value and assign it to a variable Further information: "Converting variable text content to numeric values ", Page 492	Formula Q/QL/QR
TOCHAR	Converting the numeric value to an alphanumeric value and assign it to a QS parameter Further information: "Converting variable numeric values to text content", Page 492	String formula QS
SUBSTR	Copying a substring from a QS parameter Further information: "Copying a substring from a QS parameter", Page 492	String formula QS
SYSSTR	Read system data Further information: "Read system data with SYSSTR", Page 489	String formula QS
INSTR	Checking if the content of one QS parameter is contained in another QS parameter. Further information: "Searching for a substring within the content of a QS parameter", Page 492	Formula Q/QL/QR
STRLEN	Determining the text length of the value of a QS parameter Further information: "Determining the total number of characters in a QS parameter", Page 492 <div>  If the selected string parameter is not defined the control returns the result -1. </div>	Formula Q/QL/QR
STRCOMP	Compare alphabetic priority Further information: "Comparing the alphabetical order of two QS parameter contents", Page 493	Formula Q/QL/QR
CFGREAD	Read out machine parameter Further information: "Accepting the contents of a machine parameter", Page 493	<ul style="list-style-type: none"> ■ String formula QS ■ Formula Q/QL/QR

Read system data with SYSSTR

With the function **SYSSTR** you can read system data and store them in string parameters. You select the system data through a group number (ID) and a number.

Entering IDX and DAT is not required.

You can read the following system data:

Group name, ID no.	Number	Meaning
Program information, 10010	1	Path of the current main program or pallet program
	2	Path of the NC program shown in the block display
	3	Path of the cycle selected with CYCL DEF 12 PGM CALL
	10	Path of the NC program selected with SEL PGM
Channel data, 10025	1	Channel name
Values programmed in the tool call, 10060	1	Tool name
Kinematics, 10290	10	Kinematics programmed in the last FUNCTION MODE block
Current system time, 10321	1 to 16, 20	<ul style="list-style-type: none"> ■ 1: DD.MM.YYYY hh:mm:ss ■ 2 and 16: DD.MM.YYYY hh:mm ■ 3: DD.MM.YY hh:mm ■ 4: YYYY-MM-DD hh:mm:ss ■ 5 and 6: YYYY-MM-DD hh:mm ■ 7: YY-MM-DD hh:mm ■ 8 and 9: DD.MM.YYYY ■ 10: D.MM.YY ■ 11: YYYY-MM-DD ■ 12: YY-MM-DD ■ 13 and 14: hh:mm:ss ■ 15: hh:mm ■ 20: XX <p>"XX" stands for the two-digit number of the current calendar week that—in accordance with ISO 8601 —is characterized by the following:</p> <ul style="list-style-type: none"> ■ It comprises seven days ■ It begins with Monday ■ It is numbered sequentially ■ The first calendar week (week 01) is the week with the first Thursday of the Gregorian year.
Touch-probe data, 10350	50	Probe type of the active touch probe TS
	70	Probe type of the active touch probe TT
	73	Key name of the active touch probe TT from MP activeTT

Group name, ID no.	Number	Meaning
Data for pallet machining, 10510	1	Name of the pallet being machined
	2	Path of the selected pallet table
NC software version, 10630	10	Version identifier of the NC software version
Information for unbalance cycle, 10855	1	Path of the unbalance calibration table belonging to the active kinematics
Tool data, 10950	1	Tool name
	2	DOC entry of the tool
	3	AFC control setting
	4	Tool-carrier kinematics





Read machine parameters with CFGREAD

With the **CFGREAD** function, you can read out machine parameters of the control as numerical values or as strings. The read-out values are always output in metric units of measure.

To read a machine parameter, you must determine the following contents in the configuration editor:

- Parameter name
- Parameter object
- If present, group name and index

Further information: "Accepting the contents of a machine parameter", Page 493

Symbol	Type	Meaning	Example
	Key	Group name of the machine parameter (if available)	CH_NC
	Entity	Parameter object (name begins with Cfg...)	CfgGeoCycle
	Attribute	Name of the machine parameter	displaySpindleErr
	Index	List index of a machine parameter (if available)	[0]



If you are in the configuration editor for the user parameters, you can change the display of the existing parameters. In the default setting, the parameters are displayed with short, explanatory texts.

Each time you want to interrogate a machine parameter with the **CFGREAD** function, you must first define a QS parameter with attribute, entity and key.

The following parameters are read in the CFGREAD function's dialog:

- **KEY_QS**: Group name (key) of the machine parameter
- **TAG_QS**: Object name (entity) of the machine parameter
- **ATR_QS**: Name (attribute) of the machine parameter
- **IDX**: Index of the machine parameter

18.3.1 Assigning text to a QS parameter

Before you can use and further process texts, you must assign the characters to QS parameters. Use the **DECLARE STRING** command to do so.

To assign a text to a QS parameter:



- ▶ Select **Insert NC function**
- The control opens the **Insert NC function** window.
- ▶ Select **DECLARE STRING**
- ▶ Define QS parameters for the result, e.g. **QS10**
- ▶ Select **Name**
- ▶ Enter the desired text
- ▶ End NC block
- ▶ Execute NC block
- The control assigns the entered text to the QS parameter.

In this example, a text is assigned to the QS parameter **QS10**.

```
37 DECLARE STRING QS10 = "workpiece"
```

18.3.2 Linking QS parameters

You can use the concatenation operator **||** to link the characters of multiple QS parameters. This allows you to combine fixed and variable text elements.

To connect the values of multiple QS parameters:



- ▶ Select **Insert NC function**
- The control opens the **Insert NC function** window.
- ▶ Select **String formula QS**
- ▶ Define QS parameters for the result
- ▶ Open keyboard for formula input
- ▶ Select concatenation operator **||**
- ▶ To the left of the concatenation operator icon, define the number of the QS parameter with the first substring
- ▶ To the right of the concatenation operator icon, define the number of the QS parameter with the second substring
- ▶ End NC block
- ▶ Confirm your input
- After execution, the control saves the substrings in succession as a value in the target parameter.

In this example, **QS10** should contain the complete text of **QS12**, **QS13**, and **QS14**.

```
37 QS10 = QS12 || QS13 || QS14
```

Parameter contents:

- **QS12: Workpiece**
- **QS13: Status:**
- **QS14: Scrap**
- **QS10: Workpiece Status: Scrap**

18.3.3 Converting variable text content to numeric values

The **TONUMB** function allows you to store numeric characters of a QS parameter as the value of a variable. The value to be converted can only consist of numbers. The stored value can be used, for example, to perform calculations.

In this example, the QS parameter **QS11** is converted to the numerical parameter **Q82**.

```
37 Q82 = TONUMB ( SRC_QS11 )
```

18.3.4 Converting variable numeric values to text content

You can use the **TOCHAR** function to save the contents of a variable to a QS parameter. You can link the saved content with other QS parameters, for example.

In this example, the content of the numeric parameter **Q50** is transferred to the string parameter **QS11**.

```
37 QS11 = TOCHAR ( DAT+Q50 DECIMALS3 )
```

18.3.5 Copying a substring from a QS parameter

The **SUBSTR** function allows you to save a definable range from one QS parameter to another QS parameter. For example, you can use this function to extract the file name from an absolute file path.

In this example, the syntax element **BEG2** is used to read a four-character substring from the third character, since counting starts from zero and **LEN4** is commanded.

```
37 QS13 = SUBSTR ( SRC_QS10 BEG2 LEN4 )
```

18.3.6 Searching for a substring within the content of a QS parameter

You can use the **INSTR** function to check whether a specific substring is within a QS parameter. This allows you to check, for example, whether the concatenation of multiple QS parameters has worked. Two QS parameters are required for the check. The control searches the first QS parameter for the content of the second QS parameter.

If the control cannot find the substring to be searched for, the control saves the total number of characters to the result parameter.

If the substring to be searched for appears multiple times, then the control returns the first place at which it finds the substring.

In this example, **QS10** is searched for in the text stored in **QS13**. The search starts from the third character. When counting the characters, start with zero.

```
37 Q50 = INSTR ( SRC_QS10 SEA_QS13 BEG2 )
```

18.3.7 Determining the total number of characters in a QS parameter

The **STRLEN** function returns the length of the text stored in a selectable QS parameter. You can use this function to determine the length of a file path, for example.

In this example, the length of **QS15** is determined.

```
37 Q52 = STRLEN ( SRC_QS15 )
```


18.3.8 Comparing the alphabetical order of two QS parameter contents

The **STRCOMP** function allows you to compare the alphabetical order of the contents of two QS parameters. For example, you can use this function to check whether a QS parameter contains uppercase or lowercase letters. The control first searches all uppercase letters alphabetically and then all lowercase letters alphabetically.

The control returns the following results:

- **0**: The compared QS parameters are identical
- **-1**: The first QS parameter **precedes** the second QS parameter alphabetically
- **+1**: The first QS parameter **follows** the second QS parameter alphabetically

This example compares the alphabetical order of **QS12** and **QS14**.

```
37 Q52 = STRCOMP ( SRC_QS12 SEA_QS14 )
```

18.3.9 Accepting the contents of a machine parameter

You can use the NC function **CFGREAD** to transfer the content of a machine parameter to a QS parameter.

Depending on the content of the machine parameter, you can use the **CFGREAD** function to copy text content to QS parameters or numeric values to Q, QL or QR parameters.

In this example, the axis designation of the fourth axis is loaded as a QS parameter.

Specified settings in the machine parameters:

- DisplaySettings
- CfgDisplayData
 - axisDisplayOrder
 - [0] to [5]

Example

14 QS11 = ""	; Assign QS parameter for the key
15 QS12 = "CfgDisplaydata"	; Assign QS parameter for the entity
16 QS13 = "axisDisplay"	; Assign QS parameter for the parameter name
17 QS1 = CFGREAD(KEY_QS11 TAG_QS12 ATR_QS13 IDX3)	; Read out machine parameter(s)

Note

When you use the **STRING FORMULA** function, the result of the performed arithmetic operation is always a string. When you use the **FORMULA** function, the result of the performed arithmetic operation is always a numeric value.

Definition

String

In computer science, a string is a defined sequence of alphanumeric characters, i.e. texts. The control uses QS parameters to process strings.

18.4 Defining counters with FUNCTION COUNT

Application

The **FUNCTION COUNT** function allows you to control a simple counter from within the NC program. For example, this function allows you to count the number of manufactured workpieces.

Description of function

The count is retained even after a restart of the control.

The control only takes the **FUNCTION COUNT** function into account in the **Program Run** operating mode.

The control shows the current counter value and the defined target number on the **PGM** tab of the **Status** workspace.

Further information: User's Manual for Setup and Program Run

Input

11 FUNCTION COUNT TARGET5	; Set the target value of the counter to 5
----------------------------------	--

The NC function includes the following syntax elements:

Syntax element	Meaning
FUNCTION COUNT	Syntax initiator for the counter
INC, RESET, ADD, SET, TARGET or REPEAT	Define counting function Further information: "Counting functions", Page 494

Counting functions

The **FUNCTION COUNT** function provides the following possibilities:

Syntax	Function
INC	Increase count by 1
RESET	Reset counter
ADD	Increment the counter by the desired value Input: 0...9999
SET	Set the counter to the desired value Input: 0...9999
TARGET	Set the nominal count (target value) to the desired value Input: 0...9999
REPEAT	Repeat the NC program from the defined label if the target value has not yet been reached. Fixed or variable number or name

Notes

NOTICE

Caution: Data may be lost!

Only one counter can be managed by the control. If you execute an NC program that resets the counter, any counter progress of another NC program will be deleted.

- ▶ Please check prior to machining whether a counter is active.

- The machine manufacturer uses the optional machine parameter **CfgNcCounter** (no. 129100) to define whether you can edit the counter.
- You can use Cycle **225** to engrave the current counter value into the workpiece.

Further information: User's Manual for Machining Cycles

18.4.1 Example

11 FUNCTION COUNT RESET	; Reset counter value
12 FUNCTION COUNT TARGET10	; Set target number of machining operations
13 LBL 11	; Jump label
* - ...	; Machining operation
21 FUNCTION COUNT INC	; Increase counter value
22 FUNCTION COUNT REPEAT LBL 11	; Repeat machining operation if the target number has not been reached
23 M30	
24 END PGM	

18.5 Table access with SQL statements

18.5.1 Fundamentals

Application

If you would like to access numerical or alphanumerical content in a table or manipulate the table (e.g., rename columns or rows), then use the available SQL commands.

The syntax of the SQL commands available on the control is strongly influenced by the SQL programming language but does not conform with it entirely. In addition, the control does not support the full scope of the SQL language.

Related topics

- Opening, reading and writing to freely definable tables

Further information: "Functions for freely definable tables", Page 482

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

In the NC software, table accesses occur through an SQL server. This server is controlled via the available SQL commands. The SQL commands can be defined directly in an NC program.

The server is based on a transaction model. A **transaction** consists of multiple steps that are executed together, thereby ensuring that the table entries are processed in an orderly and well-defined manner.

The SQL commands take effect in the **Program Run** operating mode and the **MDI** application.

Example of transaction:

- Assign Q parameters to table columns for read or write access using **SQL BIND**
- Select data using **SQL EXECUTE** with the instruction **SELECT**
- Read, change, or add data using **SQL FETCH**, **SQL UPDATE**, or **SQL INSERT**
- Confirm or discard interaction using **SQL COMMIT** or **SQL ROLLBACK**
- Approve bindings between table columns and Q parameters using **SQL BIND**



You must conclude all transactions that have been started—even exclusively reading accesses. Concluding the transaction is the only way to ensure that changes and additions are transferred, that locks are removed, and that used resources are released.

The **result set** contains a subset of a table file. It results from a **SELECT** query performed on the table.

The **result set** is created when a query is executed in the SQL server, thereby occupying resources there.

This query has the same effect as applying a filter to the table, so that only part of the data records become visible. To perform this query, the table file must be read at this point.

The SQL server assigns a **handle** to the **result set**, which enables you to identify the result set for reading or editing data and completing the transaction. The **handle** is the result of the query, which is visible in the NC program. The value 0 indicates an **invalid handle**, i.e. it was not possible to create a **result set** for that query. If no rows are found that satisfy the specified condition, an empty **result set** is created and assigned a valid **handle**.

Overview of SQL commands

The control provides the following SQL commands:

Syntax	Function	Further information
SQL BIND	SQL BIND creates or disconnects a binding between table columns and Q or QS parameters	Page 497
SQL SELECT	SQL SELECT reads out a single value from a table and does not open any transaction	Page 499
SQL EXECUTE	SQL EXECUTE opens a transaction for selected table columns and table rows or enables the use of other SQL instructions (miscellaneous functions).	Page 501
SQL FETCH	SQL FETCH transfers the values to the bound Q parameters	Page 505
SQL ROLLBACK	SQL ROLLBACK discards all changes and concludes the transaction	Page 506
SQL COMMIT	SQL COMMIT saves all changes and concludes the transaction	Page 508
SQL UPDATE	SQL UPDATE expands the transaction to include the change of an existing row	Page 509
SQL INSERT	SQL INSERT creates a new table row	Page 511

Notes

NOTICE

Danger of collision!

Read and write accesses performed with the help of SQL commands always occur in metric units, regardless of the unit of measure selected for the table or the NC program.

If, for example, you save a length from a table to a Q parameter, then the value is thereafter always in metric units. If this value is then used for the purpose of positioning in an inch program (**L X+Q1800**), then an incorrect position will result.

- In inch programs, convert the read value prior to use

- HEIDENHAIN recommends that you use SQL functions instead of **FN 26**, **FN 27**, or **FN 28** in order to achieve maximum HDR hard-disk speeds for table applications and to reduce the amount of computing power used.

18.5.2 Binding a variable to a table column with SQL BIND

Application


SQL BIND links a Q parameter to a table column. The SQL commands **FETCH**, **UPDATE**, and **INSERT** evaluate this binding (assignment) during data transfer between the **result set** and the NC program.

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

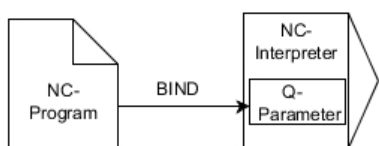

Program any number of bindings with **SQL BIND...**, before using the **FETCH**, **UPDATE**, or **INSERT** commands.

An **SQL BIND** command without a table name or column name cancels the binding. At the latest, the binding is terminated at the end of the NC program or subprogram.

Input

11 SQL BIND Q881

"Tab_example.Position_Nr"

; Bind **Q881** to the "Position_No" column of the "Tab_Example" table

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL BIND	Syntax initiator for the BIND SQL command
Q/QL/QR, QS or Q REF	Variable to be bound
" " or QS	Table name and table column, separated by . or QS parameter with definition

Notes

- Enter the path of the table or a synonym as the table name.
Further information: "Executing SQL statements with SQL EXECUTE", Page 501
- During the read and write operations, the control considers only those columns that you have specified by means of the **SELECT** command. If you specify columns without a binding in the **SELECT** command, then the control interrupts the read or write operation with an error message.

18.5.3 Reading out a table value with SQL SELECT

Application


SQL SELECT reads a single value from a table and saves the result in the defined Q parameter.

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

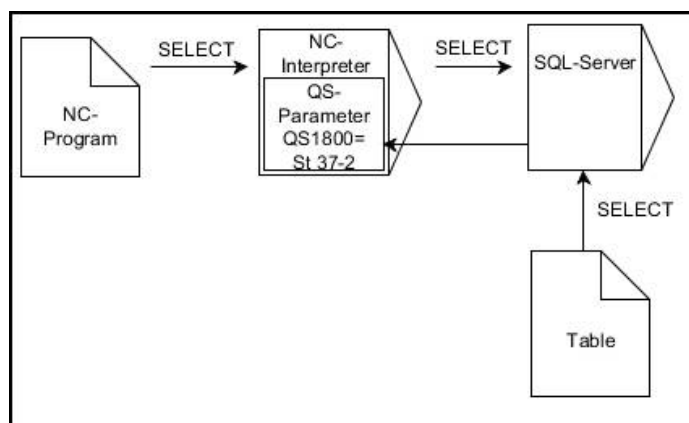

Black arrows and associated syntax show internal processes of **SQL SELECT**

With **SQL SELECT**, there is neither a transaction nor a binding between the table column and Q parameter. The control does not consider any bindings that may exist to the specified column. The control copies the read value only into the parameter specified for the result.

Input

```
11 SQL SELECT Q5 "SELECT Mess_X
FROM Tab_Example WHERE
Position_NR==3"
```

; Save the value of the "Position_No" column of the "Tab_Example" table in **Q5**

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL BIND	Syntax initiator for the SELECT SQL command
Q/QL/QR, QS or Q REF	Variable in which the control stores the result
" " or QS	SQL statement or QS parameter with the definition containing: <ul style="list-style-type: none"> ■ SELECT: Table column of the value to be transferred ■ FROM: Synonym or absolute path of the table (path in single quotation marks) ■ WHERE: Column designation, condition, and comparison value (Q parameter after : in single quotation marks)

Notes

- You can select multiple values or multiple columns using the SQL command **SQL EXECUTE** and the **SELECT** statement.
- For the instructions within the SQL command, you can likewise use single or combined QS parameters.

Further information: "Linking QS parameters", Page 491

- If you check the content of a QS parameter in the additional status indicator (**QPARA** tab), then you will see only the first 30 characters and therefore not the entire content.

Further information: User's Manual for Setup and Program Run

Example

The result of the following NC programs is identical.

0 BEGIN PGM SQL_READ_WMAT MM	
1 SQL Q1800 "CREATE SYNONYM my_table FOR 'TNC:\table \WMAT.TAB'"	; Create synonym
2 SQL BIND QS1800 "my_table.WMAT"	; Bind QS parameters
3 SQL QL1 "SELECT WMAT FROM my_table WHERE NR==3"	; Define search
* - ...	
* - ...	
3 SQL SELECT QS1800 "SELECT WMAT FROM my_table WHERE NR==3"	; Read and save value
* - ...	
* - ...	
3 DECLARE STRING QS1 = "SELECT "	
4 DECLARE STRING QS2 = "WMAT "	
5 DECLARE STRING QS3 = "FROM "	
6 DECLARE STRING QS4 = "my_table "	
7 DECLARE STRING QS5 = "WHERE "	
8 DECLARE STRING QS6 = "NR==3"	
9 QS7 = QS1 QS2 QS3 QS4 QS5 QS6	
10 SQL SELECT QL1 QS7	
* - ...	

18.5.4 Executing SQL statements with SQL EXECUTE

Application


SQL EXECUTE can be used in conjunction with various SQL instructions.

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

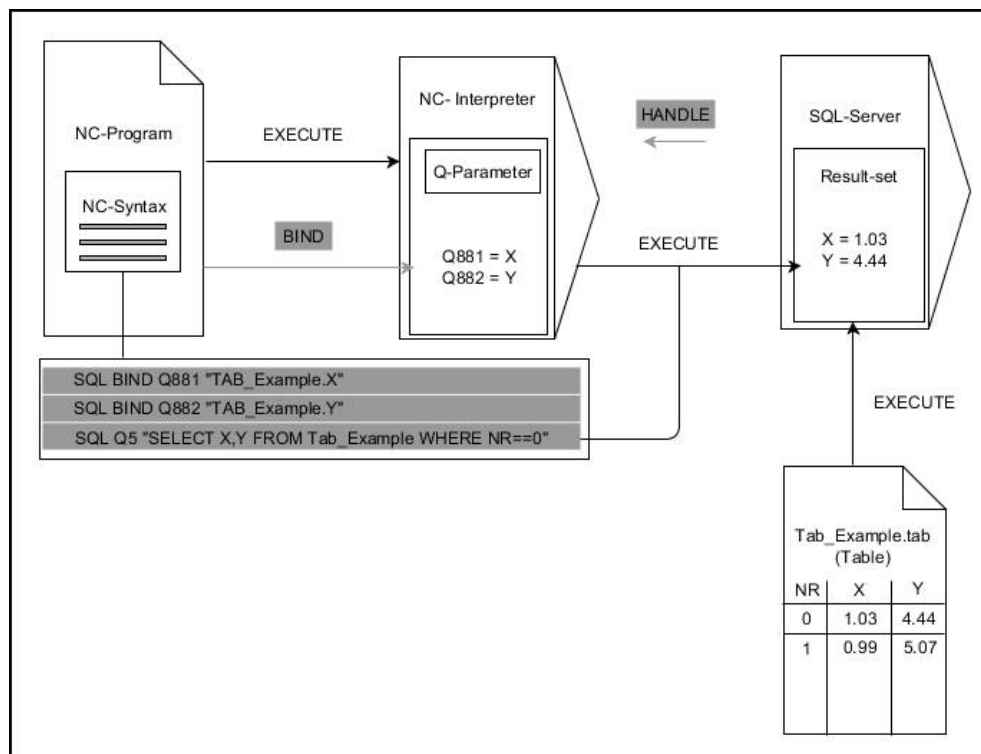

Black arrows and associated syntax indicate internal processes of **SQL EXECUTE**. The gray arrows and associated syntax do not directly belong to the **SQL EXECUTE** command.

The control provides the following SQL statements in the **SQL EXECUTE** command:

Instruction	Function
SELECT	Select data
CREATE SYNONYM	Create synonym (replace long path names with short names)
DROP SYNONYM	Delete synonym
CREATE TABLE	Generate a table
COPY TABLE	Copy table
RENAME TABLE	Rename table
DROP TABLE	Delete a table
INSERT	Insert table rows
UPDATE	Update table rows
DELETE	Delete table rows
ALTER TABLE	<ul style="list-style-type: none">■ Add table columns using ADD■ Delete table columns using DROP
RENAME COLUMN	Rename table columns

SQL EXECUTE with the SQL instruction SELECT

The SQL server places the data in the **result set** row-by-row. The rows are numbered in ascending order, starting with 0. The SQL commands **FETCH** and **UPDATE** use these row numbers (the **INDEX**).

SQL EXECUTE, in conjunction with the SQL instruction **SELECT**, selects the table values, transfers them to the **result set**, and always opens a transaction in the process. Unlike the SQL command **SQL SELECT**, the combination of **SQL EXECUTE** and the **SELECT** instruction allows multiple columns and rows to be selected at the same time.

In the function **SQL ... "SELECT...WHERE..."**, you can enter the search criteria. You thereby restrict the number of rows to be transferred. If you do not use this option, then all of the rows in the table are loaded.

In the function **SQL ... "SELECT...ORDER BY..."**, you can enter the ordering criterion. This entry consists of the column designation and the keyword **ASC** for ascending or **DESC** for descending order. If you do not use this option, then rows will be stored in a random order.

With the function **SQL ... "SELECT...FOR UPDATE"**, you can lock the selected rows for other applications. Other applications can continue to read these rows but are unable to change them. If you make changes to the table entries, then it is absolutely necessary to use this option.

Empty result set: If no rows meet the search criterion, then the SQL server returns a valid **HANDLE** without table entries.

Conditions for WHERE entries

Condition	Programming
Equals	= ==
Not equal to	!= <>
Less than	<
Less than or equal to	<=
Greater than	>
Greater than or equal to	>=
Empty	IS NULL
Not empty	IS NOT NULL

Linking multiple conditions:

Logical AND	AND
Logical OR	OR

Notes

- You can also define synonyms for tables that have not yet been generated.
- The sequence of the columns in the created file corresponds to the sequence within the **AS SELECT** instruction.
- For the instructions within the SQL command, you can likewise use single or combined QS parameters.

Further information: "Linking QS parameters", Page 491

- If you check the content of a QS parameter in the additional status indicator (**QPARA** tab), then you will see only the first 30 characters and therefore not the entire content.

Further information: User's Manual for Setup and Program Run

Example

Example: selection of table rows

11 SQL BIND Q881 "Tab_Example.Position_Nr"	
12 SQL BIND Q882 "Tab_Example.Measure_X"	
13 SQL BIND Q883 "Tab_Example.Measure_Y"	
14 SQL BIND Q884 "Tab_Example.Measure_Z"	
. . .	
20 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM Tab_Example"	

Example: Select table rows with the WHERE function

20 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM Tab_Example WHERE Position_Nr<20"	
---	--

Example: Select table rows with the WHERE function and Q parameter

20 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM Tab_Example WHERE Position_Nr==:'Q11'"	
---	--

Example: Define the table name with absolute path information

20 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM 'V:\table\Tab_Example' WHERE Position_Nr<20"	
0 BEGIN PGM SQL_CREATE_TAB MM	
1 SQL Q10 "CREATE SYNONYM NEW FOR 'TNC: \table\NewTab.TAB'"	Create synonym
2 SQL Q10 "CREATE TABLE NEW AS SELECT X,Y,Z FROM 'TNC:\prototype_for_NewTab.tab'"	Create table
3 END PGM SQL_CREATE_TAB MM	
0 BEGIN PGM SQL_CREATE_TABLE_QS MM	
1 DECLARE STRING QS1 = "CREATE TABLE "	
2 DECLARE STRING QS2 = "'TNC:\nc_prog\demo \Doku\NewTab.t' "	
3 DECLARE STRING QS3 = "AS SELECT "	
4 DECLARE STRING QS4 = "DL,R,DR,L "	
5 DECLARE STRING QS5 = "FROM "	
6 DECLARE STRING QS6 = "'TNC:\table\tool.t'"	
7 QS7 = QS1 QS2 QS3 QS4 QS5 QS6	
8 SQL Q1800 QS7	
9 END PGM SQL_CREATE_TABLE_QS MM	

18.5.5 Reading a line from a result set with SQL FETCH

Application

SQL FETCH reads a row from the **result set**. The values of the individual cells are stored by the control in the bound Q parameters. The transaction is defined through the **HANDLE** to be specified, and the row is defined by the **INDEX**.


SQL FETCH takes all of the columns into consideration that contain the **SELECT** instruction (SQL command **SQL EXECUTE**).

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

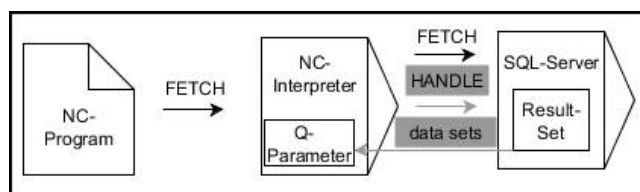

Black arrows and associated syntax indicate internal processes of **SQL FETCH**. The gray arrows and associated syntax do not directly belong to the **SQL FETCH** command.

The control shows in the defined variable whether the read operation was successful (0) or incorrect (1).

Input

```
11 SQL FETCH Q1 HANDLE Q5 INDEX 5 IGNORE UNBOUND UNDEFINE MISSING ; Read out result of transaction Q5 line 5
```

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL FETCH	Syntax initiator for the FETCH SQL command
Q/QL/QR or Q REF	Variable in which the control stores the result
HANDLE	Q parameter with identification of the transaction
INDEX	Row number within the result set as a number or variable If not specified, the control accesses line 0. Optional syntax element
IGNORE UNBOUND	For the machine manufacturer only Optional syntax element
UNDEFINE MISSING	For the machine manufacturer only Optional syntax element

Example

Transfer line number in the Q parameter

11	SQL BIND Q881 "Tab_Example.Position_Nr"
12	SQL BIND Q882 "Tab_Example.Measure_X"
13	SQL BIND Q883 "Tab_Example.Measure_Y"
14	SQL BIND Q884 "Tab_Example.Measure_Z"
* - ...	
21	SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM Tab_Example"
* - ...	
31	SQL FETCH Q1 HANDLE Q5 INDEX+Q2

18.5.6 Discarding changes to a transaction using SQL ROLLBACK

Application


SQL ROLLBACK discards all of the changes and additions of a transaction. The transaction is defined via the **HANDLE** to be specified.

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

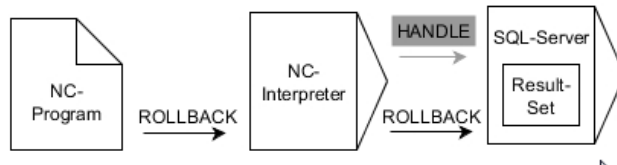

Black arrows and associated syntax indicate internal processes of **SQL ROLLBACK**. The gray arrows and associated syntax do not directly belong to the **SQL ROLLBACK** command.

The function of the SQL command **SQL ROLLBACK** depends on the **INDEX**:

- Without **INDEX**:
 - The control discards all changes and additions of the transaction
 - The control resets a lock set with **SELECT...FOR UPDATE**
 - The control completes the transaction (the **HANDLE** loses its validity)
- With **INDEX**:
 - Only the indexed row remains in the **result set** (the control removes all of the other rows)
 - The control discards any changes and additions that may have been made in the non-specified rows
 - The control locks only those rows indexed with **SELECT...FOR UPDATE** (the control resets all of the other locks)
 - The specified (indexed) row is then the new Row 0 of the **result set**
 - The control does **not** complete the transaction (the **HANDLE** keeps its validity)
 - The transaction must be completed manually with **SQL ROLLBACK** or **SQL COMMIT** at a later time

Input

11 SQL ROLLBACK Q1 HANDLE Q5 INDEX 5	; Delete all rows of transaction Q5 except row 5
--------------------------------------	--

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL ROLLBACK	Syntax initiator for the ROLLBACK SQL command
Q/QL/QR or Q REF	Variable in which the control stores the result
HANDLE	Q parameter with identification of the transaction
INDEX	Row number within the Result set as a number or variable that is retained If not specified, the control discards all changes and additions to the transaction Optional syntax element

Example

11 SQL BIND Q881 "Tab_Example.Position_Nr"
12 SQL BIND Q882 "Tab_Example.Measure_X"
13 SQL BIND Q883 "Tab_Example.Measure_Y"
14 SQL BIND Q884 "Tab_Example.Measure_Z"
* - ...
21 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM Tab_Example"
* - ...
31 SQL FETCH Q1 HANDLE Q5 INDEX+Q2
* - ...
41 SQL ROLLBACK Q1 HANDLE Q5

18.5.7 Completing a transaction with SQL COMMIT

Application


SQL COMMIT simultaneously transfers all of the rows that have been changed and added in a transaction back into the table. The transaction is defined via the **HANDLE** to be specified. In this context, a lock that has been set with **SELECT...FOR UPDATE** resets the control.

Requirements

- Code number 555343
 - Table exists
 - Appropriate table name
- The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

The assigned **HANDLE** (operation) loses its validity.

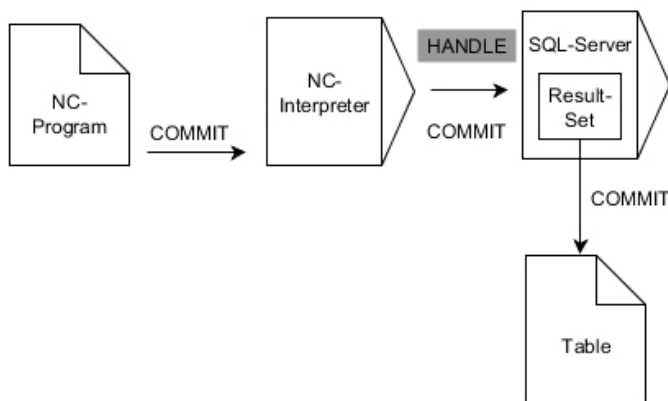

Black arrows and associated syntax indicate internal processes of **SQL COMMIT**.

The control shows in the defined variable whether the read operation was successful (0) or incorrect (1).

Input**11 SQL COMMIT Q1 HANDLE Q5**; Complete all rows of transaction **Q5** and update table

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL COMMIT	Syntax initiator for the COMMIT SQL command
Q/QL/QR or Q REF	Variable in which the control stores the result
HANDLE	Q parameter with identification of the transaction

Example**11 SQL BIND Q881 "Tab_Example.Position_Nr"****12 SQL BIND Q882 "Tab_Example.Measure_X"****13 SQL BIND Q883 "Tab_Example.Measure_Y"****14 SQL BIND Q884 "Tab_Example.Measure_Z"***** - ...****21 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM Tab_Example"***** - ...****31 SQL FETCH Q1 HANDLE Q5 INDEX+Q2***** - ...****41 SQL UPDATE Q1 HANDLE Q5 INDEX+Q2***** - ...****51 SQL COMMIT Q1 HANDLE Q5****18.5.8 Changing the row of a result set with SQL UPDATE****Application**


SQL UPDATE changes a row in the **result set**. The new values of the individual cells are copied by the control from the bound Q parameters. The transaction is defined through the **HANDLE** to be specified, and the row is defined by the **INDEX**. The control completely overwrites the already existing rows in the **result set**.

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

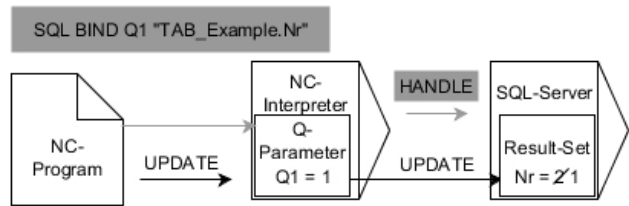

Black arrows and the associated syntax show internal **SQL UPDATE** processes. Gray arrows and the associated syntax are not directly associated with the **SQL UPDATE** command.

SQL UPDATE takes all of the columns into consideration that contain the **SELECT** instruction (SQL command **SQL EXECUTE**).

The control shows in the defined variable whether the read operation was successful (0) or incorrect (1).

Input

11 SQL UPDATE Q1 HANDLE Q5 index5 RESET UNBOUND	; Complete all rows of transaction Q5 and update table
--	--

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL UPDATE	Syntax initiator for the UPDATE SQL command
Q/QL/QR or Q REF	Variable in which the control stores the result
HANDLE	Q parameter with identification of the transaction
INDEX	Row number within the Result set as a number or variable If not specified, the control accesses line 0. Optional syntax element
RESET UNBOUND	For the machine manufacturer only Optional syntax element

Note

When writing to tables, the control checks the lengths of the string parameters. If the entries exceed the length of the columns to be described, then the control outputs an error message.

Example

Transfer line number in the Q parameter

```

11 SQL BIND Q881 "TAB_EXAMPLE.Position_Nr"
12 SQL BIND Q882 "TAB_EXAMPLE.Measure_X"
13 SQL BIND Q883 "TAB_EXAMPLE.Measure_Y"
14 SQL BIND Q884 "TAB_EXAMPLE.Measure_Z"
* - ...
21 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y,Measure_Z FROM
    TAB_EXAMPLE"
* - ...
31 SQL FETCH Q1 HANDLE Q5 INDEX+Q2

```

Program the row number directly

```

31 SQL UPDATE Q1 HANDLE Q5 INDEX5

```

18.5.9 Creating a new row in the result set with SQL INSERT

Application


SQL INSERT creates a new row in the **result set**. The values of the individual cells are copied by the control from the bound Q parameters. The transaction is defined via the **HANDLE** to be specified.

Requirements

- Code number 555343
- Table exists
- Appropriate table name

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Description of function

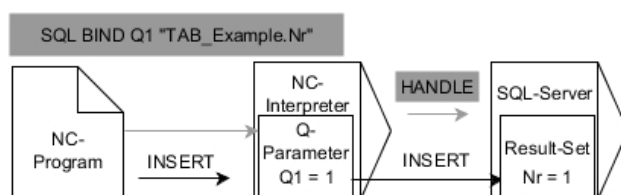

Black arrows and associated syntax indicate internal processes of **SQL INSERT**. The gray arrows and associated syntax do not directly belong to the **SQL INSERT** command.

SQL INSERT takes all of the columns into consideration that contain the **SELECT** instruction (SQL command **SQL EXECUTE**). Table columns without a corresponding **SELECT** instruction (not contained in the query result) are described by the control with default values.

The control shows in the defined variable whether the read operation was successful (0) or incorrect (1).

Input

```
11 SQL INSERT Q1 HANDLE Q5 ; Create a new row in transaction Q5
```

The NC function includes the following syntax elements:

Syntax element	Meaning
SQL INSERT	Syntax initiator for the INSERT SQL command
Q/QL/QR or Q REF	Variable in which the control stores the result
HANDLE	Q parameter with identification of the transaction

Note

When writing to tables, the control checks the lengths of the string parameters. If the entries exceed the length of the columns to be described, then the control outputs an error message.

Example

```
11 SQL BIND Q881 "Tab_Example.Position_Nr"
12 SQL BIND Q882 "Tab_Example.Measure_X"
13 SQL BIND Q883 "Tab_Example.Measure_Y"
14 SQL BIND Q884 "Tab_Example.Measure_Z"
* - ...
21 SQL Q5 "SELECT Position_Nr,Measure_X,Measure_Y, Measure_Z FROM
  Tab_Example"
* - ...
31SQL INSERT Q1 HANDLE Q5
```

18.5.10 Example

In the following example, the defined material is read from the table (**WMAT.TAB**) and is stored as a text in a QS parameter. The following example shows a possible application and the necessary program steps.



You can use the **FN 16** function, for example, in order to reuse QS parameters in your own log files.

Use synonym

0	BEGIN PGM SQL_READ_WMAT MM	
1	SQL Q1800 "CREATE SYNONYM my_table FOR 'TNC:\table-WMAT.TAB'"	; Create synonym
2	SQL BIND QS1800 "my_table.WMAT"	; Bind QS parameters
3	SQL QL1 "SELECT WMAT FROM my_table WHERE NR==3"	; Define search
4	SQL FETCH Q1900 HANDLE QL1	; Execute search
5	SQL ROLLBACK Q1900 HANDLE QL1	; Complete transaction
6	SQL BIND QS1800	; Remove parameter binding
7	SQL Q1 "DROP SYNONYM my_table"	; Delete synonym
8	END PGM SQL_READ_WMAT MM	

Step	Explanation
1 Create synonym	Assign a synonym to a path (replace long paths with short names) <ul style="list-style-type: none"> The path TNC:\table\WMAT.TAB is always placed in single quotes The selected synonym is my_table
2 Bind QS parameters	Bind a QS parameter to a table column <ul style="list-style-type: none"> QS1800 is freely available in NC programs The synonym replaces the entry of the complete path The defined column from the table is called WMAT
3 Define search	A search definition contains the entry of the transfer value <ul style="list-style-type: none"> The QL1 local parameter (freely selectable) serves to identify the transaction (multiple transactions are possible simultaneously) The synonym defines the table The WMAT entry defines the table column of the read operation The entries NR and ==3 define the table rows of the read operation Selected table columns and rows define the cells of the read operation
4 Execute search	The control performs the read operation <ul style="list-style-type: none"> SQL FETCH copies the values from the result set into the bound Q or QS parameter <ul style="list-style-type: none"> 0 successful read operation 1 faulty read operation The syntax HANDLE QL1 is the transaction designated by the parameter QL1 The parameter Q1900 is a return value for checking whether the data have been read
5 Complete transaction	The transaction is concluded and the used resources are released

Step	Explanation
6 Remove binding	The binding between table columns and QS parameters is removed (release of necessary resources)
7 Delete synonym	The synonym is deleted (release of necessary resources)



Synonyms are an alternative only to the required absolute paths. Relative path entries are not possible.

The following NC program shows the entry of an absolute path.

0 BEGIN PGM SQL_READ_WMAT_2 MM	
1 SQL BIND QS 1800 "'TNC:\table-\WMAT.TAB'.WMAT"	; Bind QS parameters
2 SQL QL1 "SELECT WMAT FROM 'TNC:-\table\WMAT.TAB' WHERE NR ==3"	; Define search
3 SQL FETCH Q1900 HANDLE QL1	; Execute search
4 SQL ROLLBACK Q1900 HANDLE QL1	; Complete transaction
5 SQL BIND QS 1800	; Remove parameter binding
6 END PGM SQL_READ_WMAT_2 MM	

19

**Graphical
Programming**

19.1 Fundamentals

Application


Graphical programming offers an alternative to conventional Klartext programming. You can create 2D sketches by drawing lines and arcs and generate a contour from this in Klartext. In addition, you can import existing contours from an NC program into the **Contour graphics** workspace and edit them graphically.

You can use graphical programming in isolation via a separate tab or in the form of the separate **Contour graphics** workspace. If you use graphical programming on its own tab, you cannot open any other workspaces of the **Editor** operating mode on this tab.

Description of function

The **Contour graphics** workspace is available in the **Editor** operating mode.

Screen layout

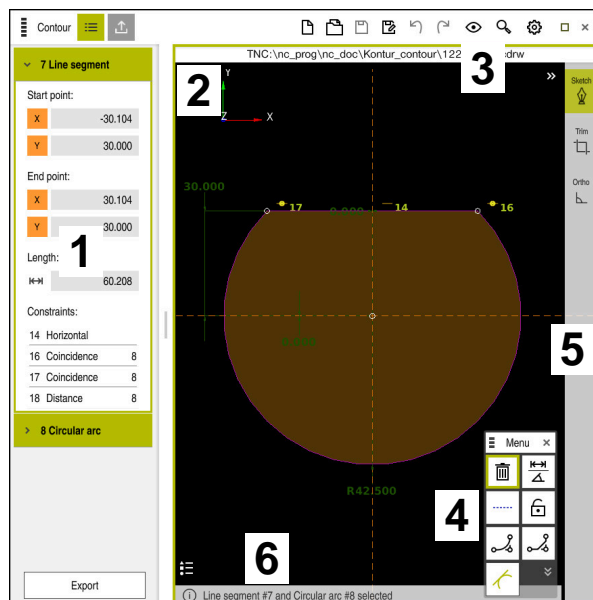

Screen layout of the **Contour graphics** workspace

The **Contour graphics** workspace contains the following areas:

- 1 Element information area
- 2 Drawing area
- 3 Title bar
- 4 Drawing functions
- 5 Toolbar
- 6 Information bar

Controls and gestures in graphical programming

In graphical programming, you can create a 2D sketch using various elements.

Further information: "First steps in graphical programming", Page 530






The following elements are available in graphical programming:

- Line segment
- Arc
- Construction point
- Construction line
- Construction circle
- Chamfer
- Rounding arc

Gestures

In addition to the gestures specifically available for graphical programming, you can also use various general gestures in graphical programming.

Further information: "Common gestures for the touchscreen", Page 65













Symbol	Gesture	Meaning
	Tap	Select a point or element
	Long press	Insert construction point
	Two-finger drag	Move the drawing view
	Draw straight elements	Insert Line segment element
	Draw circular elements	Insert Circular arc element

Icons of the title bar

The title bar of the **Contour graphics** workspace shows not only icons solely available for graphical programming but also general icons of the control interface.



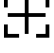



Further information: "Icons on the control's user interface", Page 71

The control shows the following icons in the title bar:

Icon or shortcut	Meaning
	File options
 CTRL+N	Discard contour
 CTRL+O	Open file
	View settings
	Show dimensions
	Show restrictions
	Show reference axes
	Preset views menu
	Include defined drawing area With this function, the control shows the defined size of the drawing area. You can define the size of the drawing area in the contour settings. Further information: "Contour settings window", Page 522
	Include selected element
	Include drawn elements in drawing area
	Open the Contour settings window Further information: "Contour settings window", Page 522









Possible colors








The control shows the elements in the following colors:



Icon	Meaning
	Element A drawn element that is not fully dimensioned is shown by the control in orange as a solid line.
	Construction element Drawn elements can be converted to construction elements. You can use construction elements to obtain additional points for creating your sketch. Construction elements are shown by the control in blue as a dashed line.
	Reference axis The reference axes shown form a Cartesian coordinate system. Dimensioning in the contour editor starts from the intersection of the reference axes. The intersection of the reference axes corresponds to the workpiece preset when exporting the contour data. The control shows reference axes in brown as a dashed line.
	Locked element You cannot adjust locked elements. If you want to edit a locked element, you must unlock it first. Locked elements are shown by the control in red as a solid line.
	Fully dimensioned element The control shows fully dimensioned elements in dark green. You cannot attach any additional constraints or dimensions to a fully dimensioned element, otherwise the element will be over-determined.
	Contour element The control shows the contour elements between the Start Point and End Point in the Export menu as green solid elements.

Icons in the drawing area

The control shows the following icons in the drawing area:

Icon or shortcut	Designation	Meaning
	Milling direction	The selected Milling direction determines whether the defined contour elements are output clockwise or counterclockwise.
	Delete	Deletes all selected elements
	Change the annotation	Switches the display between length and angle dimensions.
	Toggle construction element	This function converts an element into a construction element. Construction elements cannot also be output when exporting a contour.
	Lock element	If this icon is displayed, the selected element is locked against editing. Select the icon to unlock the element.
	Unlock element	If this icon is displayed, the selected element is not locked against editing. Select the icon to lock the element.
	Set the datum	This function moves the selected point to the origin of the coordinate system. All other drawn elements are also moved according to the given distances and dimensions. If necessary, the Set the datum function recalculates the existing restrictions.
	Corner rounding	Inserts a rounding arc
	Chamfer	Inserts a chamfer
	Coincidence	This function sets the Coincidence constraint for two marked points. When you use this function, the selected points of two elements are connected together. "Coincidence" is used here to refer to these points coinciding.
	Vertical	This function sets the Vertical restriction for the selected Line segment element. Vertical elements are automatically vertical.
	Horizontal	This function sets the Horizontal restriction for the selected Line segment element. Horizontal elements are automatically horizontal.
	Perpendicular	This function sets the Perpendicular restriction for two selected elements of the type Line segment . There is an angle of 90° between perpendicular elements.

Icon or shortcut	Designation	Meaning
	Parallel	<p>This function sets the Parallel restriction for two selected elements of the type Line segment.</p> <p>When you apply this function, the angle of two lines is aligned. First, the control checks whether there are restrictions, e.g. Horizontal.</p> <p>Behavior in the case of restrictions:</p> <ul style="list-style-type: none"> ■ If there is a restriction, the Line segment without restriction is aligned with the Line segment with restriction. ■ If both lines have restrictions, the function cannot be applied. The dimension is over-determined. ■ If there are no restrictions, the order of selection is decisive. The Line segment selected in the second instance is aligned with the Line segment first selected.
	Equal	<p>This function sets the Equal constraint for two marked elements. When you apply this function, the sizes of two elements are matched, e.g. in length or diameter of two elements. First, the control checks whether there are restrictions, e.g. a defined length.</p> <p>Behavior in the case of restrictions:</p> <ul style="list-style-type: none"> ■ If there is a restriction, the element without restriction is aligned with the element with restriction. ■ If both elements have corresponding restrictions, the function cannot be applied. The dimension is over-determined. ■ If there are no restrictions, the control generates the average value from the given Circular arc size values.
	Tangential	<p>This function sets the Tangential restriction for two marked elements of the type Line segment and Circular arc or Circular arc and Circular arc.</p> <p>When you use this function, both arcs and lines are moved. The affected elements come into contact at exactly one point after they are moved and form a tangential transition.</p>
	Symmetry	<p>This function sets the Symmetry restriction for a marked element of the type Line segment and two marked points of other construction elements.</p> <p>When you apply this function, the control positions the distance of the two points symmetrically to the selected line. If you subsequently change the distance of one of the points, the other point automatically adjusts to the change.</p>
	Point on element	<p>This function sets the Point on element restriction for a selected element and a point of another selected element.</p> <p>When you apply this function, the selected point is moved to the selected element.</p>
	Legend	Use this function to show or hide the legend explaining all the controls.
 CTRL+D	Sketch	<p>To prevent you from unintentionally drawing elements while moving the drawing, you can deactivate drawing mode. Drawing mode remains disabled until you activate it again.</p> <p>If you deactivate drawing mode, the control changes the button to green.</p>

Icon or shortcut	Designation	Meaning
 CTRL+T	Trim	If multiple elements overlap, you can use Trim mode to shorten elements to the next adjacent element. Trim mode remains active until you deactivate it again. If the function is active, the control changes the button to green.
	Ortho	With this function, you can only draw rectangular lines. The control does not allow oblique lines or arcs. If the function is active, the control changes the button to green.
CTRL+A	Select all	The Select All function allows you to mark all drawn elements at once.

Contour settings window

The **Contour settings** window contains the following areas:

- General information
- Sketching
- Export

General information area

The **General information** area contains the following settings:

Setting	Meaning
Plane	You select the plane in which you want to draw by selecting an axis combination. Available planes: <ul style="list-style-type: none"> ■ XY ■ ZX ■ YZ
Diameter programming	You use a switch to select whether drawn rotation contours in the XZ and YZ planes are interpreted as radius or diameter dimensions during export.
Sketching area width	Default width of the drawing area
Sketching area height	Default height of the drawing area
Decimal places	Number of decimal places for dimensioning

Sketching area

The **Sketching** area contains the following settings:

Setting	Meaning
Rounding radius	Default size for an inserted rounding radius
Chamfer length	Default size for an inserted chamfer
Snap circle size	Size of the snap circle when selecting the elements

Export area

The **Export** area contains the following settings:

Setting	Meaning
Type of circle	You select whether arcs are output as CC and C or CR .
Export as RND	You use a switch to select whether roundings drawn with the RND function are also exported as RND to the NC program.
CHF output	You use a switch to select whether chamfers drawn with the CHF function are also exported as CHF to the NC program.

19.1.1 Creating a new contour

To create a new contour:



- ▶ Select the **Editor** operating mode



- ▶ Select **Add**
- The control opens the **Quick selection** and the **Open File** workspaces.



- ▶ Select **New contour**
- The control opens the contour in a new tab.

19.1.2 Locking and unlocking elements

If you want to protect an element from editing, you can lock the element. A locked element cannot be edited. If you want to edit the locked element, you must first unlock the element.

To lock and unlock elements in graphical programming:

- ▶ Select the drawn element



- ▶ Select the **Lock element** function
- The control locks the element.
- The control displays the locked element in red.



- ▶ Select the **Unlock element** function
- The control unlocks the element.
- The control displays the unlocked element in yellow.

Notes

- Set the **Contour settings** before drawing.
Further information: "Contour settings window", Page 522
- Dimension each element immediately after drawing. If you do not dimension until the entire contour has been drawn, the contour may move unintentionally.
- You can assign restrictions to the drawn elements. To avoid unnecessarily complicating the design, work only with necessary restrictions.
Further information: "Icons in the drawing area", Page 520
- If you select elements of the contour, the control turns the elements in the menu bar green.

Definitions

File type	Definition
H	NC program in Klartext format
TNCDRW	HEIDENHAIN contour file

19.2 Importing contours into graphical programming

Application


With the **Contour graphics** workspace, you can not only create new contours, but also import contours from existing NC programs and, if necessary, edit them graphically.

Requirements

- Max. 200 NC blocks
- No cycles
- No approach and retraction movements
- No straight lines **LN** (option 9)
- No technology data, e.g. feed rates or additional functions
- No axis motions that are outside the specified plane, e.g. XY plane

If you try to import a prohibited NC block into graphical programming, the control will issue an error message.

Description of function

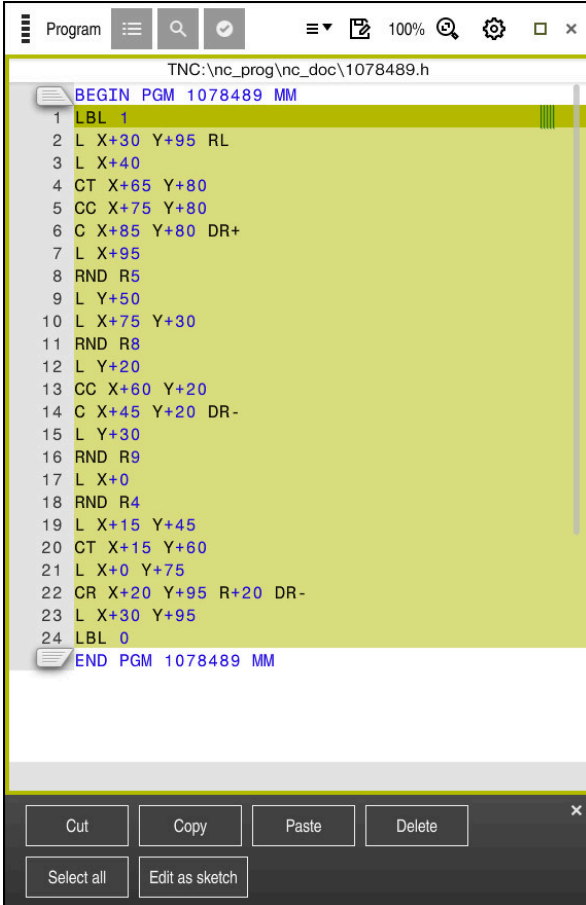

```

TNC:\nc_prog\nc_doc\1078489.h
BEGIN PGM 1078489 MM
1 LBL 1
2 L X+30 Y+95 RL
3 L X+40
4 CT X+65 Y+80
5 CC X+75 Y+80
6 C X+85 Y+80 DR+
7 L X+95
8 RND R5
9 L Y+50
10 L X+75 Y+30
11 RND R8
12 L Y+20
13 CC X+60 Y+20
14 C X+45 Y+20 DR-
15 L Y+30
16 RND R9
17 L X+0
18 RND R4
19 L X+15 Y+45
20 CT X+15 Y+60
21 L X+0 Y+75
22 CR X+20 Y+95 R+20 DR-
23 L X+30 Y+95
24 LBL 0
END PGM 1078489 MM

```


Contour to be imported from the NC program

In graphical programming, all contours consist exclusively of linear or circular elements with absolute Cartesian coordinates.

The control converts the following path functions when importing to the **Contour graphics** workspace:

- Circular contour **CT**
Further information: "Circular path CT", Page 181
- NC blocks with polar coordinates
Further information: "Polar coordinates", Page 168
- NC blocks with incremental inputs
Further information: "Incremental entries", Page 170
- Free contour programming **FK**

19.2.1 Importing contours

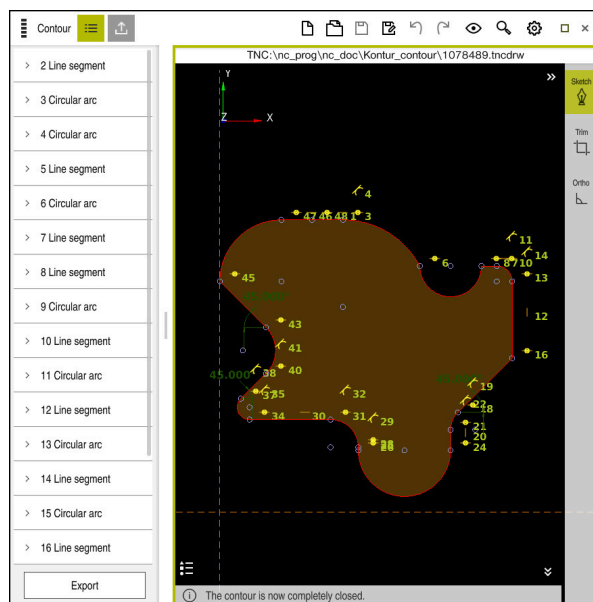

Imported contour

To import contours from NC programs:



- ▶ Select the **Editor** operating mode
- ▶ Open an existing NC program with a contour included
- ▶ Search for the contour in the NC program
- ▶ Hold the first NC block of the contour
- ▶ The control opens the context menu.
- ▶ Select **Mark**
- ▶ The control shows two marker arrows.
- ▶ Select the desired area with the marker arrows
- ▶ Select **Edit as sketch**
- ▶ The control opens the selected contour area in the **Contour graphics** workspace.

Notes

- In the **Contour settings** window, you can specify whether the dimensions of rotational contours in the XZ plane or YZ plane are interpreted as radius or diameter dimensions.

Further information: "Contour settings window", Page 522

- When you use the **Edit as sketch** function to import a contour into graphical programming, all elements are initially locked. Before you begin editing the elements, you must unlock the elements.

Further information: "Locking and unlocking elements", Page 523

- You can edit contours graphically and export them after importing.

Further information: "First steps in graphical programming", Page 530

Further information: "Exporting contours from graphical programming", Page 527

19.3 Exporting contours from graphical programming

Application

The **Export** column in the **Contour graphics** workspace allows you to export newly created or graphically edited contours.

Related topics

- Importing contours

Further information: "Importing contours into graphical programming", Page 524

- First steps in graphical programming

Further information: "First steps in graphical programming", Page 530

Description of function

The **Export** column provides the following functions:

- **Contour starting point**

Use this function to define the **Contour starting point** of the contour. You can either set the **Contour starting point** graphically or enter an axis value. If you enter an axis value, the control automatically determines the second axis value.

- **Contour end point**

Use this function to define the **Contour end point** of the contour. You can set the **Contour end point** in the same way as the **Contour starting point**.

- **Invert direction**

Use this function to change the programming direction of the contour.

- **Generate Klartext**

Use this function to export the contour as an NC program or subprogram. The control can only export certain path functions. All generated contours contain absolute Cartesian coordinates.

Further information: "Contour settings window", Page 522

The contour editor can generate the following path functions:

- Line **L**
- Circle center **CC**
- Circular contour **C**
- Circular contour **CR**
- Radius **RND**
- Chamfer **CHF**
- **Reset selection**

Use this function to deselect a contour.

The screenshot shows a 'Contour' settings window. At the top, there's a title bar with the word 'Contour' and a green icon. Below it, the 'Start point' section has 'X' and 'Y' input fields with values -33.753 and -25.826, and a 'Set graphically' button. The 'End point' section is identical. Below these are three buttons: 'Invert direction', 'Generate Klartext', and 'Reset selection'. At the very bottom is a 'Sketching' button.

Notes

- You can also use the **Contour starting point** and **Contour end point** functions to pick up parts of the drawn elements and generate a contour from them.
- You can save drawn contours with the file type ***.tncdrw** to the control.

19.4 First steps in graphical programming

19.4.1 Example task D1226664

<p>744 650 A4</p>			
<p>Text:</p>		<p>ID number</p>	
<p>Original drawing</p> <p>Scale: 1:1</p> <p>Format: A4</p>		<p>Change No. C000941-05</p> <p>Phase: Nicht-Serie</p>	
<p>RoHS</p>		<p>Werkstoff: 3.1645</p> <p>Material:</p>	
<p>Maße in mm / Dimensions in mm</p>		<p>Einzelteilzeichnung / Component Drawing</p>	
<p>Werkstückkanten nach ISO 13715</p> <p>Workpiece edges ISO 13715</p> <p> </p>		<p>Allgemeintoleranzen ISO 2768-mH $\leq 6\text{mm}$: ± 0.2</p> <p>General tolerances ISO 2768-mH $\leq 6\text{mm}$: ± 0.2</p>	
		<p>Tolerierung nach ISO 8015</p> <p>Tolerances as per ISO 8015</p>	
		<p>Oberflächenbehandlung:</p> <p>Surface treatment:</p>	
		<p>●blanke Flächen/Blank surfaces</p>	
<p>The reproduction, distribution and utilization of this document as well as the communication of its contents to others without express authorization is prohibited. Offenders will be held liable for the payment of damages. All rights reserved in the event of the grant of a patent, utility model or design. (ISO 16016)</p>			
<p>HEIDENHAIN</p> <p>DR. JOHANNES HEIDENHAIN GmbH</p> <p>83301 Traunreut, Germany</p>		<p>Created</p> <p>M-TS</p> <p>05.09.2017</p>	<p>Responsible</p> <p></p> <p></p>
		<p>Released</p> <p></p> <p></p>	<p>Version</p> <p></p>
		<p>Revision</p> <p></p>	<p>Sheet</p> <p></p>
		<p>Page</p> <p>1 of 1</p>	<p>D1226664-00 - A-01</p>
		<p>Document number</p>	

19.4.2 Drawing a sample contour

To draw the displayed contour:

- ▶ Create a new contour

Further information: "Creating a new contour", Page 523

- ▶ Configure **Contour settings**

i In the **Contour settings** window, you can define basic settings for drawing. For this example, you can use the standard settings.

Further information: "Contour settings window", Page 522




- ▶ Draw horizontal **Line segment**


- ▶ Select the end point of the drawn line
- ▶ The control shows the X and Y distance of the line to the center.




- ▶ Enter Y distance to center, e.g. **30**
- ▶ The control positions the line according to the condition set.
- ▶ Draw **Circular arc** from one end point of the line to the other end point
- ▶ The control displays the closed contour in yellow.
- ▶ Select the center point of the arc
- ▶ The control shows the center point coordinates of the arc in **X** and **Y**.
- ▶ Enter **0** for the X and Y center point coordinates of the arc
- ▶ The control moves the contour.
- ▶ Select drawn arc
- ▶ The control shows the current radius value of the arc.
- ▶ Enter radius **42.5**
- ▶ The control adjusts the radius of the arc.
- ▶ The contour is fully defined.

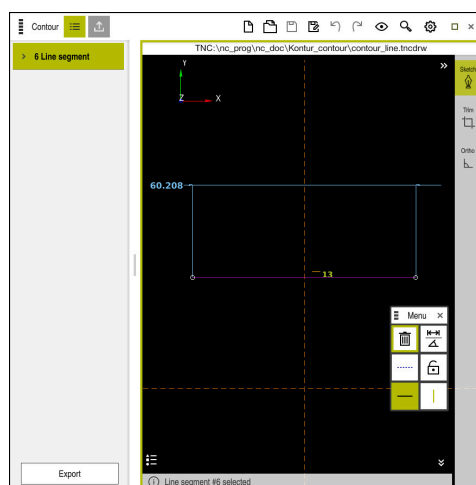

Line drawn

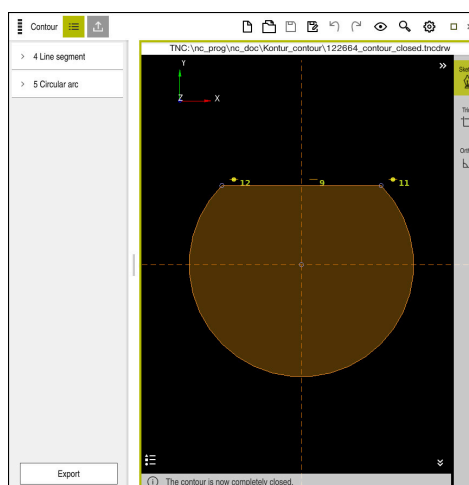

Closed contour

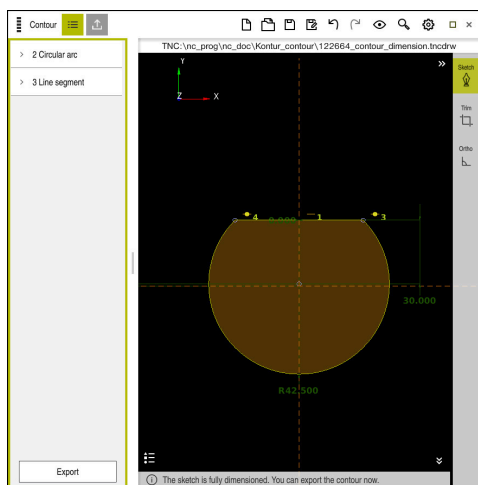

Dimensioned contour

19.4.3 Exporting a drawn contour

To export the drawn contour:

- Draw contour




- Select the **Export** column
- The control displays the **Export** column.
- Select **Set graphically** in the **Contour starting point** area
- Select the starting point on the drawn contour
- The control shows the coordinates of the selected start point, the selected contour and the programming direction.



You can adjust the programming direction of the contour with the **Invert direction** function.

- Select the **Generate Klartext** function
- The control generates the contour based on the defined data.

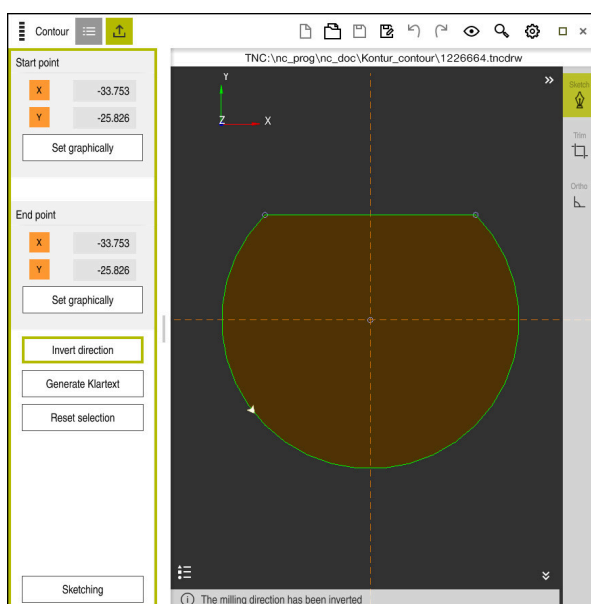Selected contour elements in the **Export** column with defined **Milling direction**

20

User Aids

20.1 Help workspace

Application

In the **Help** workspace the control displays a help graphic for the current syntax element of an NC function or the **TNCguide** integrated product help.

Related topics


- **Help** application
Further information: "Help application", Page 35
- User's Manual as the **TNCguide** integrated product help
Further information: "User's Manual as integrated product help: TNCguide", Page 34

Description of function

The **Help** workspace can be selected in the **Editor** operating mode and in the **MDI** application.

Further information: "Editor operating mode", Page 104


Further information: User's Manual for Setup and Program Run

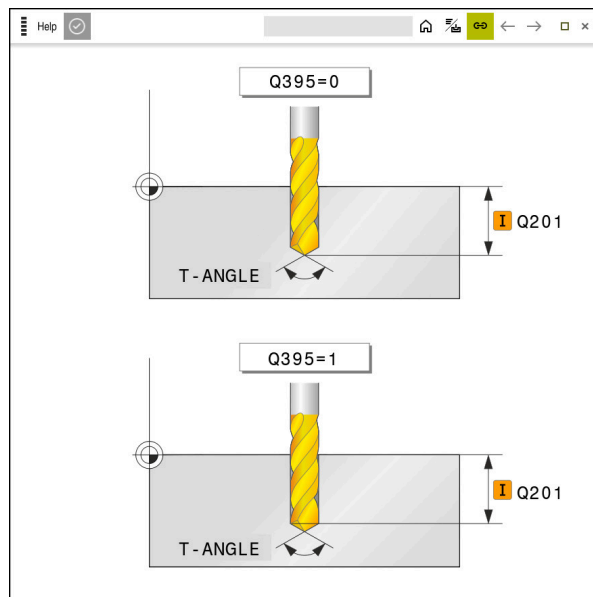

Help workspace with a help graphic for a cycle parameter

If the **Help** workspace is active, the control can display the help screen in it during programming instead of in the **Program** workspace.

Further information: "Program workspace", Page 106

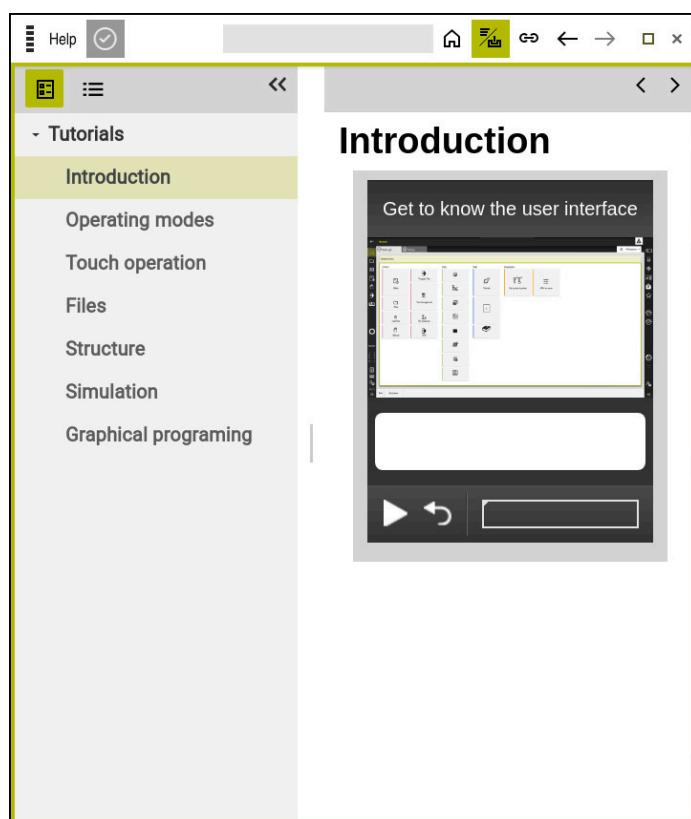




Help workspace with opened **TNCguide**

If the **Help** workspace is active, the control can display the integrated **TNCguide** product help.

Further information: "User's Manual as integrated product help: TNCguide", Page 34

Symbols in the Help workspace

Symbol	Function
	<p>Show start page</p> <p>The start page displays all available documentation. Select the desired documentation, using a navigation tiles, e.g. TNCguide.</p> <p>If only one piece of documentation is available, the control opens the content directly.</p> <p>When a documentation is open, you can use the search function.</p> <p>Further information: "Symbols", Page 36</p>
	<p>Displaying the TNCguide</p> <p>Further information: "User's Manual as integrated product help: TNCguide", Page 34</p>
	<p>Displaying help images during programming</p>

20.2 Virtual keyboard of the control bar

Application

You can use the virtual keyboard for entering NC functions, letters, and numbers, and for navigation.

The virtual keyboard offers the following modes:

- NC input
- Text input
- Formula entry

Description of function


The control opens NC input mode by default after the start procedure.

You can move the keyboard on the screen. The keyboard remains active, even when the operating mode is switched, until the keyboard is closed.

The control remembers the position and mode of the virtual keyboard until it is shut down.

The **Keyboard** workspace provides the same functions as the virtual keyboard.

NC input areas

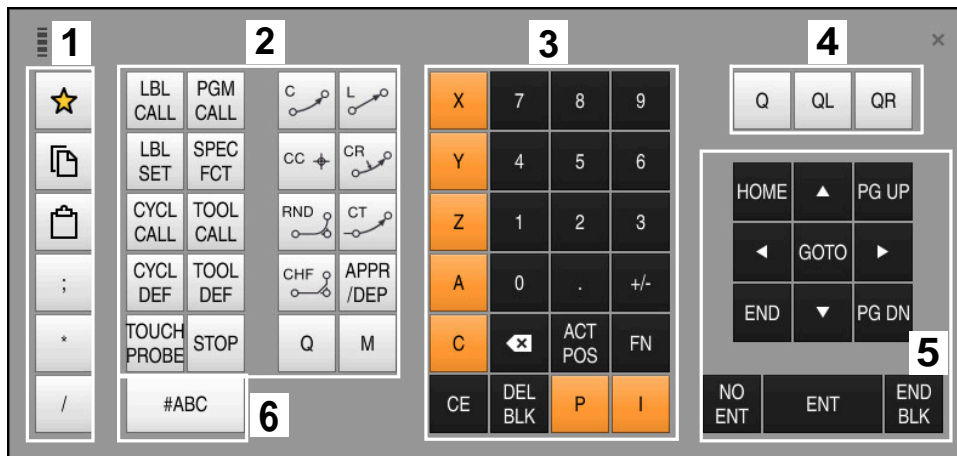

Virtual keyboard in NC input mode

NC input mode contains the following areas:

- 1 File functions
 - Define favorites
 - Copy
 - Paste
 - Add comment
 - Add structure item
 - Hide NC block
- 2 NC functions
- 3 Axis keys and numerical input
- 4 Q parameters
- 5 Navigation and dialog keys
- 6 Switch to text input



If you press the **Q** button in the NC functions area repeatedly, the control cycles through the syntax in the following sequence:

- **Q**
- **QL**
- **QR**

Areas of text input




Virtual keyboard in text input mode

The text input contains the following areas:

- 1 Input
- 2 Navigation and dialog keys
- 3 Copying and pasting
- 4 Switch to formula input

Areas of formula input

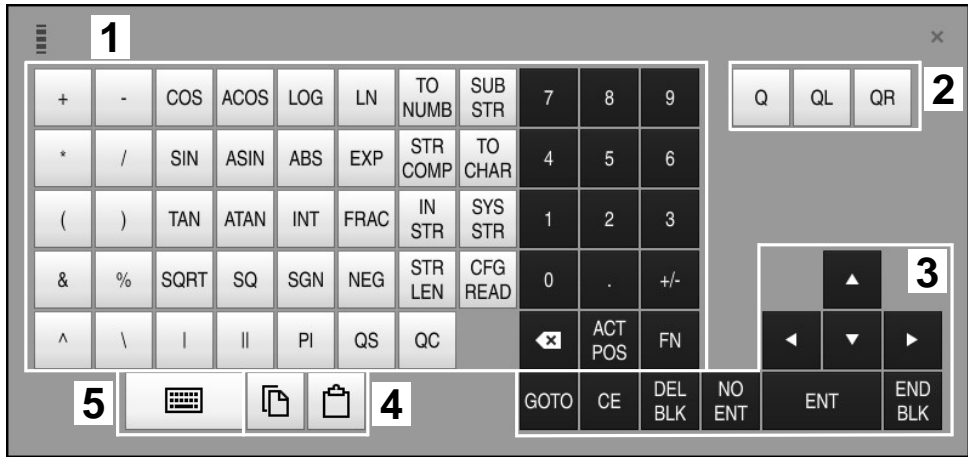

Virtual keyboard in formula input mode

The formula input contains the following areas:

- 1 Input
- 2 Q parameters
- 3 Navigation and dialog keys
- 4 Copying and pasting
- 5 Switch to NC input

20.2.1 Opening and closing the virtual keyboard

To open the virtual keyboard:



- ▶ Select the **virtual keyboard** on the control bar
- The control opens the virtual keyboard.

To close the virtual keyboard:



- ▶ Select the **virtual keyboard** when the virtual keyboard is open



- ▶ Or press **Close** in the virtual keyboard
- The control closes the virtual keyboard.

20.3 GOTO function

Application

With the **GOTO** key or the **GOTO block number** button you define an NC block at which the control positions the cursor. In the **Tables** mode you use the **GOTO record** button to define a table row.

Description of function

If an NC program is open for simulation or execution, the control additionally positions the execution cursor in front of the NC block. The control then starts program run or the simulation beginning from the defined NC block without considering the preceding lines of the NC program.

 
You can enter the block number directly or find it in the NC program with the **Search** function.

20.3.1 Selecting an NC block with GOTO

To select an NC block:



- ▶ Select **GOTO**
- The control opens the **GOTO jump instruction** window.
- ▶ Enter the block number



- ▶ Press **OK**
- The control positions the cursor to the defined NC block.

NOTICE

Danger of collision!

If you select an NC block in program run using the **GOTO** function and then execute the NC program, the control ignores all previously programmed NC functions, e.g. transformations. This means that there is a risk of collision during subsequent traversing movements!

- ▶ Use **GOTO** only when programming and testing NC programs
- ▶ Only use **Block scan** when executing NC programs

Further information: User's Manual for Setup and Program Run

Notes

- You can also use the keyboard shortcut **CTRL+G** instead of the **GOTO** button.
- If the control in the action bar shows an icon for selection, you can open the selection window with **GOTO**.

20.4 Adding comments

Application

You can add comments to an NC program in order to explain program steps or make general notes.

Description of function

You have the following possibilities for adding comments:

- Comment within an NC block
- Comment as a separate NC block
- Define existing NC block as comment

The control marks comments with a preceding **;** character. The control does not execute comments during simulation or program run.

A comment may contain up to 255 characters.




The last character in a comment block must not be a tilde (~).

20.4.1 Adding a comment as an NC block

To add a comment as a separate NC block:


- ▶ Select the NC block after which the comment is to be added


 - ▶ Select **;**
 - ▶ After the selected NC block, the control adds a comment as a new NC block.
 - ▶ Define the comment

20.4.2 Adding a comment in an NC block

To add a comment within an NC block:

- ▶ Edit the desired NC block


 - ▶ Select **;**
 - ▶ The control inserts a **;** character at the end of the block.
 - ▶ Define the comment

20.4.3 Commenting an NC block out or in

Use the **Comment out/in** button to define an existing NC block as a comment or to change a comment back to an NC block.

To comment an existing NC block in or out:

- ▶ Select the desired NC block



- ▶ Select **Comment Off/On**
 - > The control inserts a ; character at the beginning of the block.
 - > If the NC block is already defined as a comment, the control removes the ; character.

20.5 Hiding NC blocks

Application

Use / or the **Hide/Show** button to hide NC blocks.

If you hide NC blocks, you can skip the hidden NC blocks in program run.

Related topics

- **Program Run** operating mode

Further information: User's Manual for Setup and Program Run

Description of function

If you mark an NC block with a / character, then the NC block is hidden. If you activate the **Skip /** switch in the **Program Run** operating mode or in the **MDI** application, the control skips these NC blocks during program run.

Further information: User's Manual for Setup and Program Run

20.5.1 Hiding or showing NC blocks

To hide or show an NC block:

- ▶ Select the desired NC block



- ▶ Select **Skip Off/On**
 - > The control adds a / character before the NC block.
 - > If the NC block is already hidden, the control removes the / character.

20.6 Structuring of NC programs

Application

You can use structure items to make long and complex NC programs more clear and legible, and also to navigate more quickly through an NC program.

Related topics

- **Structure** column of the **Program** workspace

Further information: "Structure column in the Program workspace", Page 542

Description of function

You can use structure items to arrange your NC programs. Structure items are texts that you can use as comments or headlines for the subsequent program lines.

A structure item may contain up to 255 characters.

The control displays the structure items in the **Structure** column.

Further information: "Structure column in the Program workspace", Page 542

20.6.1 Adding a structure item

To insert a structure item:

- ▶ Select the NC block after which you want to add the structure item



- ▶ Select *
- ▶ After the selected NC block, the control adds a structure item as a new NC block.
- ▶ Define the structure text

20.7 Structure column in the Program workspace

Application

When you open an NC program, the control searches the NC program for structure elements and displays these structure elements in the **Structure** column. The structure elements act like links and thus enable fast navigation in the NC program.

Related topics




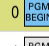





- **Program** workspace, defining contents of the **Structure** column

Further information: "Settings in the Program workspace", Page 109

- Inserting structure items manually

Further information: "Structuring of NC programs", Page 541

Description of function

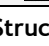Program	  
0	 MM
1	 TNC:\nc_prog\nc_doc\RESET.H
7	 NC_SPOT_DRILL_D8
10	 200 DRILLING
13	 DRILL_D5
16	 200 DRILLING

Structure column with automatically created structure elements

When you open an NC program, the control automatically creates the structure.











In the **Program settings** window, you define which structure elements the control displays in the structure.

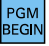



Further information: "Settings in the Program workspace", Page 109

The **Structure** column shows the following information:

- NC block number
- Icon of the NC function
- Function-dependent information




The control displays the following icons within the structure:

Icon	Syntax	Information
	BEGIN PGM	Unit of measurement of the NC program MM or INCH
	TOOL CALL	Depending on the name selected in the TOOL CALL : <ul style="list-style-type: none"> ■ Tool name ■ Number of the tool If you do not specify a name or number in the TOOL CALL , the control does not display any additional information.
	* Structure block	String entered in the NC block
	LBL SET	Depending on the name selected in the dialog: <ul style="list-style-type: none"> ■ Name of the label ■ Number of the label
	LBL 0	Label number 0
	CYCL DEF	Number and name of the defined cycle
	TCH PROBE	Number and name of the defined cycle
	MONITORING SECTION START	String entered in the AS syntax element
	MONITORING SECTION STOP	No additional information
	PGM CALL	Path of the called NC program, e.g. TNC:\Safe.h

Icon	Syntax	Information
	FUNCTION MODE	Selected machining mode MILL or TURN
	STOP or M0	No additional information
	M1	No additional information
	M2 or M30	No additional information

20.7.1 Editing an NC block using the structure

To edit an NC block using the structure:

- ▶ Open an NC program
 -  ▶ Open the **Structure** column
 - ▶ Select structure element
 - ▶ The control positions the cursor on the corresponding NC block in the NC program. The focus of the cursor remains in the **Structure** column.
 -  ▶ Select the right arrow
 - ▶ The focus of the cursor changes to the NC block.
 -  ▶ Select the right arrow
 - ▶ The control edits the NC block.

Notes

- In the case of long NC programs, establishing the structure may take longer than loading the NC program. Even if the structure has not yet been created, you can still work independently of it in the loaded NC program.
- You can navigate within the **Structure** column using the up and down arrow keys.
- The control shows called NC programs in the structure with a white background. If you double-tap or click on such a structure element, the control opens the NC program if necessary in a new tab. When the NC program is open, the control switches to the corresponding tab.

20.8 Search column in the Program workspace

Application


In the **Search** column, you can search the NC program for any character strings, e.g. individual syntax elements. The control lists all the results found.

Related topics

- Search for the same syntax element in the NC program with the arrow keys

Further information: "Searching for the same syntax elements in different NC blocks", Page 113


Description of function

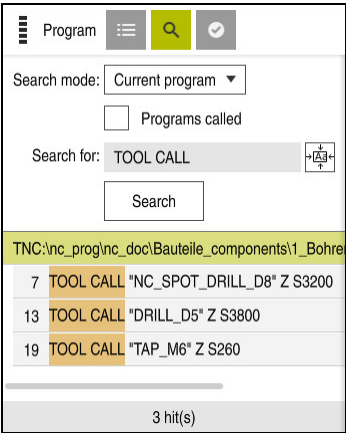

Search column in the **Program** workspace

The control only provides the full range of functions in the **Editor** operating mode. In the **MDI** application and the **Program Run** operating mode, you can only search in the active NC program.

The control provides the following functions, icons and buttons in the **Search** column:

Area	Function
Search in:	<ul style="list-style-type: none">■ Current program Search the current NC program and optionally all called NC programs■ Opened programs Browse all open NC programs■ Search and replace Search for strings and replace them with new strings, e.g. syntax elements Further information: "Search and replace mode", Page 546
Search for:	<p>In the input area, you define the search term. If you have not yet entered any characters, the control provides the last six search terms to choose from.</p>
	<p>Use the Apply selection icon to transfer the currently selected syntax element to the input area. If the selected NC block is not edited, the control accepts the syntax opener.</p>
Search	<p>Use this button to start the search in the Current program and Opened programs modes.</p>

The control shows the following information about the results:

- Number of results
- File paths of the NC programs
- NC block numbers
- Entire NC blocks

The control groups the results according to NC programs. If you select a result, the control positions the cursor on the corresponding NC block.

Search and replace mode

In **Search and replace** mode, you can search for strings and replace the results found with other strings, e.g. syntax elements.

The control performs a syntax check before replacing a syntax element. With the syntax check, the control ensures that the new content results in correct syntax. If the result produces a syntax error, the control does not replace the content and displays a message.

In **Search and replace** mode, the control provides the following checkboxes and buttons:

Checkbox or button	Meaning
Search backward	The control searches the NC program from bottom to top.
Wrap around	The control searches the entire NC program, beyond the start and end of the NC program.
Find next	The control searches the NC program for the search term. The control marks the next result in the NC program.
Replace	The control performs a syntax check and replaces the selected content in the NC program with the content of the Replace with: field.
Replace and find next	If a search has not yet been performed, the control only marks the first result. When a result is highlighted, the control performs a syntax check and automatically replaces the found content with the contents of the Replace with: field. The control then marks the next result.
Replace all	The control performs a syntax check and automatically replaces all found results with the contents of the Replace with: field.

20.8.1 Search for and replace syntax elements

 
To search for and replace syntax elements in the NC program:



- ▶ Select an operating mode, e.g. **Editor**
- ▶ Select the desired NC program
- > The control opens the selected NC program in the **Program** workspace.



- ▶ Open the **Search** column
- ▶ In the **Search in:** field, select the **Search and replace** function
- > The control displays the **Search for:** and **Replace with:** fields.
- ▶ In the **Search for:** field, enter the search content, e.g. **M4**
- ▶ In the **Replace with:** field, enter the desired content, e.g. **M3**
- ▶ Select **Find next**



- > The control marks the first result in the NC program.



- ▶ Select **Replace**
- > The control performs a syntax check and replaces the content if the check is successful.

Notes

- The search results are retained until you shut down the control or search again.
- If you double-tap or click on a search result in a called NC program, the control opens the NC program (on a new tab if not already open). If the NC program is already open, the control switches to the corresponding tab.

20.9 Program comparison

Application


Use the **Program comparison** function to determine differences between two NC programs. You can transfer the deviations to the active NC program. If there are unsaved changes in the active NC program, you can compare the NC program with the last saved version.

Requirements

- Max. 30,000 lines per NC program
The control takes into account the actual lines, not the number of NC blocks. NC blocks can also contain several lines with one block number, e.g. cycles.

Further information: "Contents of an NC program", Page 102

Description of function

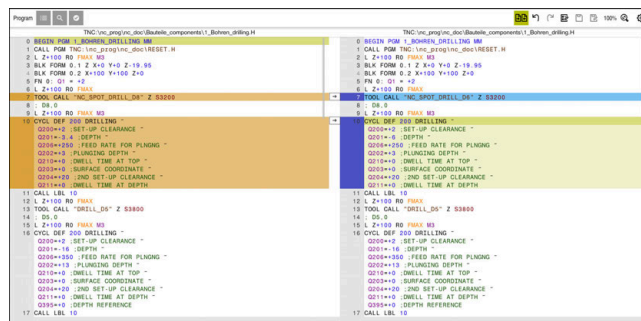

Program comparison of two NC programs

You can use the program comparison only in the **Editor** operating mode in the **Program** workspace.

The control shows the active NC program on the right and the comparison program on the left.

The control marks differences with the following colors:

Color	Syntax element
Gray	Missing NC block or missing line for NC functions of different length
Orange	NC block with difference in comparison program
Blue	NC block with difference in the active NC program

During the program comparison, you can edit the active NC program, but not the comparison program.

If NC blocks differ, you can use an arrow symbol to transfer the NC blocks of the comparison program to the active NC program.

20.9.1 Applying differences to the active NC program

To transfer differences to the active NC program:



- ▶ Select the **Editor** operating mode



- ▶ Open an NC program
- ▶ Select **Program comparison**
- > The control opens a pop-up window for file selection.
- ▶ Select comparison program



- ▶ Select **Select**
- > The control shows both NC programs in the comparison view and marks all differing NC blocks.



- ▶ Select the arrow symbol for the desired NC block
- > The control transfers the NC block to the active NC program.



- ▶ Select **Program comparison**
- > The control closes the comparison view and transfers the differences to the active NC program.

Notes

- If the compared NC programs contain more than 1000 differences, the control cancels the comparison.
- If an NC program contains unsaved changes, the control displays an asterisk in front of the name of the NC program in the tab of the application bar.

20.10 Context menu


Application

With a long-press gesture or by right-clicking with the mouse, the control opens a context menu for the selected element, such as an NC block or file. Use the various functions of the context menu to run commands that affect the currently selected element(s).

Description of function

The functions available in the context menu depend on the selected element as well as the selected operating mode.

General

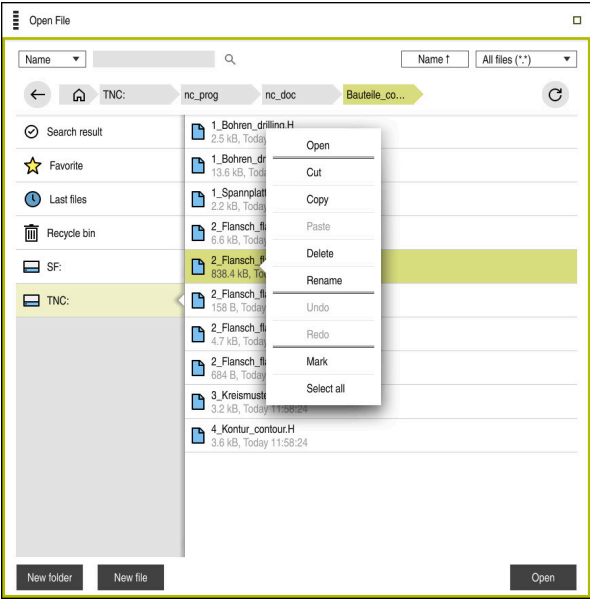

Context menu in the **Open File** workspace

The context menu offers the following functions:


- **Cut**
- **Copy**
- **Paste**
- **Delete**
- **Undo**
- **Redo**
- **Mark**
- **Select all**




If you select the **Mark** or **Select all** functions, the control opens the action bar. The action bar displays all functions that are currently available for selection from the context menu.

As an alternative to the context menu, you can use keyboard shortcuts:

Further information: "Icons on the control's user interface", Page 71

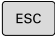Key or keyboard shortcut	Meaning
CTRL+BLANK	Mark the selected line
SHIFT+↑	Additionally mark a line above it
SHIFT+↓	Additionally mark a line below it
	Cancel marking



The keyboard shortcuts do not work in the **Job list** workspace.

Context menu in the Files operating mode

In the **Files** operating mode, the context menu also offers the following functions:

- **Open**
- **Select in Program Run**
- **Rename**

For the navigation functions, the context menu offers the respectively relevant functions, such as **Discard search results**.


Further information: "Context menu", Page 548

Context menu in the Tables operating mode

In the **Tables** operating mode the context menu additionally offers the **Cancel** function. Use the **Cancel** function to abort the marking action.

Further information: "Tables operating mode", Page 592

Context menu in the Job list (option 22) workspace

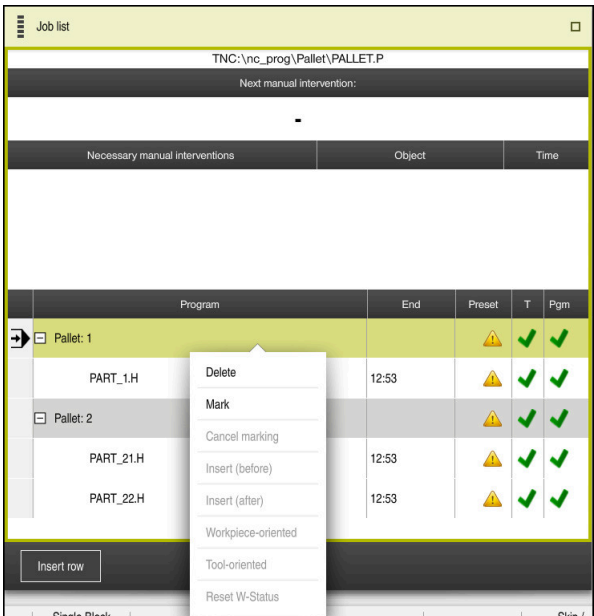


Context menu in the **Job list** workspace

In the **Job list** workspace, the context menu offers the following additional functions:

- **Cancel marking**
- **Insert (before)**
- **Insert (after)**
- **Workpiece-oriented**
- **Tool-oriented**
- **Reset W-Status**

Further information: "Job list workspace", Page 578

Context menu in the Program workspace

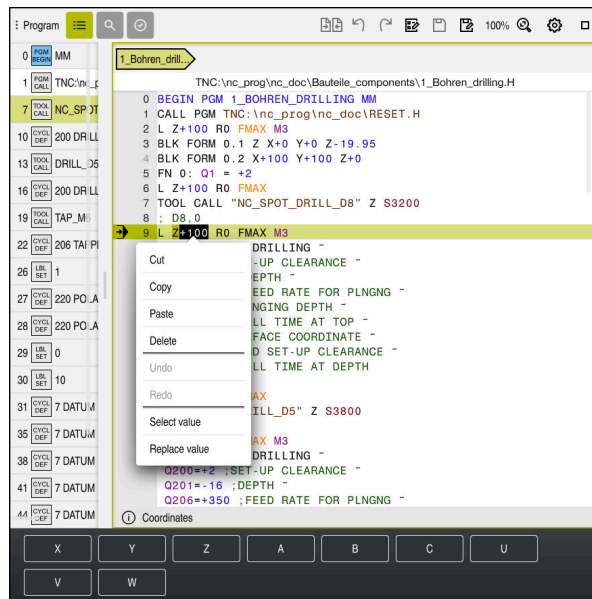

Context menu for selected value in the **Program** workspace of the **Editor** operating mode

In the **Program** workspace, the context menu offers the following additional functions:

- **Edit as sketch**

Only in the **Editor** operating mode

Further information: "Importing contours into graphical programming", Page 524

- **Select value**

Active when you select a value of an NC block.

- **Replace value**

Active when you select a value of an NC block.

Further information: "Program workspace", Page 106



The **Select value** and **Replace value** functions are only available in the **Editor** operating mode and the **MDI** application.

Replace value is also available during editing. In this case the otherwise necessary marking of the value to be replaced is omitted.

For example, you can copy values from the calculator or position display to the clipboard and then paste them with the **Replace value** function.

Further information: "Calculator", Page 552

Further information: User's Manual for Setup and Program Run

If you select an NC block, the control displays marker arrows at the beginning and end of the selected area. Use these marker arrows to change the highlighted area.

Context menu in the configuration editor

In the configuration editor, the context menu also provides the following functions:

- Direct entry of values
- Create copy
- Restore copy
- Change key name
- Open element
- Remove element

Further information: User's Manual for Setup and Program Run

20.11 Calculator

Application

The control offers a calculator on the control bar. You can copy the result to the clipboard and also paste values from the clipboard.

Description of function

The calculator offers the following functions:

- Basic mathematical operations
- Basic trigonometric functions
- Square root
- Exponential calculation
- Reciprocal value



Calculator

You can switch between the radian **RAD** or degrees **DEG** modes.

You can copy the result to the clipboard as well as paste the last stored value from the clipboard to the calculator.

The calculator saves the last ten calculations in the history. You can use these saved results for further calculations. You can clear the history manually.

20.11.1 Opening and closing the calculator

To open the calculator:



- ▶ Select the **calculator** on the control bar
- > The control opens the calculator.

To close the calculator:



- ▶ Select the **calculator** when the calculator is open
- > The control closes the calculator.

20.11.2 Selecting a result from the history

To select a result from the history for further calculations:



- ▶ Select **History**
- > The control opens the calculator's history.
- ▶ Select the desired result



- ▶ Select **History**
- > The control closes the calculator's history.

20.11.3 Deleting the history

To delete the calculator's history:



- ▶ Select **History**
- > The control opens the calculator's history.



- ▶ Select **Delete**
- > The control deletes the calculator's history.

20.12 Cutting data calculator

Application

With the cutting data calculator you can calculate the spindle speed and the feed rate for a machining process. You can load the calculated values into an opened feed rate or spindle speed dialog box in the NC program.

The control offers the **OCM cutting data calculator** for OCM cycles (option 167).

Further information: User's Manual for Machining Cycles

Requirement

- Milling operation **FUNCTION MODE MILL**

Description of function

Window for the **Cutting data calculator**

On the left side of the cutting data calculator you enter the information. On the right side the control displays the calculated results.

If you select a tool defined in the tool management, the control automatically applies the tool diameter and number of teeth. If you activate the **Apply tool number** checkbox, the tool number in the current NC block is overwritten.

You can calculate the spindle speed as follows:

- Cutting speed **VC** in m/min
- Spindle speed **S** in rpm

You can calculate the feed rate as follows:

- Feed per tooth **FZ** in mm
- Feed per revolution **FU** in mm

Or you can use tables to calculate the cutting data.

Further information: "Calculation with tables", Page 555

Applying values

After the cutting data have been calculated, you can specify which values the control should apply.

You can choose among the following for the spindle speed:

- **Cutting speed (VC)**
- **Spindle speed (S)**
- **Do not apply values**

You can choose among the following for the feed rate:

- **Tooth feed (FZ)**
- **Revolution feed (FU)**
- **Contouring feed rate (F)**
- **Do not apply values**

Calculation with tables

You must define the following in order to calculate the cutting data with tables:

- Workpiece material in the table **WMAT.tab**
Further information: "Table for workpiece materials WMAT.tab", Page 608
- Tool cutting material in table **TMAT.tab**
Further information: "Table for tool materials TMAT.tab", Page 608
- Combination of workpiece material and cutting material in the cutting data table ***.cut** or in the diameter-dependent cutting data table ***.cutd**



Using the simplified cutting data table, you can determine speeds and feed rates using cutting data that are independent of the tool radius, e.g. **VC** and **FZ**.

Further information: "Cutting data table *.cut", Page 609

If you require specific cutting data depending on the tool radius for your calculations, use the diameter-dependent cutting data table.

Further information: "Diameter-dependent cutting data table *.cutd", Page 610

- Parameters of the tool in tool management:
 - **R**: Tool radius
 - **LCUTS**: Number of cutting edges
 - **TMAT**: Cutting material from **TMAT.tab**
 - **CUTDATA**: Table row from the ***.cut** or ***.cutd** cutting data table

Further information: User's Manual for Setup and Program Run

20.12.1 Opening the cutting data calculator

To open the cutting data calculator:

- ▶ Edit the desired NC block
- ▶ Select the syntax element for the feed rate or spindle speed
 - ▶ Select **Cutting data calculator**
 - ▶ The control opens the **Cutting data calculator** window.



20.12.2 Calculating the cutting data with tables

The following prerequisites must be fulfilled in order to calculate the cutting data with tables:

- The **WMAT.tab** table exists
- The **TMAT.tab** table exists
- The ***.cut** or ***.cutd** table exists
- Tool material and cutting data table are assigned in the tool management

To calculate the cutting data with tables:

- ▶ Edit the desired NC block



- ▶ Open the **Cutting data calculator**
- ▶ Select **Activate cutting data from table**
- ▶ Use **Select material** to choose the workpiece material
- ▶ Use **Select type of machining** to choose the combination of workpiece material and tool material
- ▶ Select the desired values to be applied
- ▶ Press **Apply**
- The control applies the calculated values in the NC block.



Notes

You cannot calculate the cutting data in turning mode (option 50) because the feed rate and spindle speed data are different in turning mode from milling mode.

In turning operations the feed rates are often defined in millimeters per revolution (mm/1) (**M136**), whereas the cutting data calculator always calculates feed rates in millimeters per minute (mm/min). Furthermore, the radius in the cutting data calculator is referenced to the tool; turning operations, however, require the workpiece diameter.

21

**Simulation
Workspace**

21.1 Fundamentals

Application

In the **Editor** operating mode, you can use the **Simulation** workspace to graphically test whether NC programs are programmed correctly and run without collisions.

In the **Manual** and **Program Run** operating modes, the control shows the current traverse motions of the machine in the **Simulation** workspace.

Requirements

- Tool definitions according to the tool data from the machine
 - Workpiece blank definition that is valid for a test run
- Further information:** "Defining a workpiece blank with BLK FORM", Page 144

Description of function











In the **Editor** operating mode, the **Simulation** workspace can be open for only one NC program at a time. If you want to open the workspace on a different tab, the control prompts you for confirmation.

The functions available in the simulation depend on the following settings:

- Selected type of model, for example **2.5D**
- Selected quality of model, for example **Medium**
- Selected mode, e.g. **Machine**



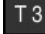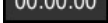


Icons in the Simulation workspace

The following symbols are shown in the **Simulation** workspace:

Symbol	Function
	Visualization options Further information: "Visualization options column", Page 559
	Workpiece options Further information: "Workpiece options column", Page 561
	Pre-defined views Further information: "Pre-defined views", Page 566
	Export simulated workpiece as STL file Further information: "Exporting a simulated workpiece as STL file", Page 567
	Simulation settings Further information: "Simulation settings window", Page 563
	Status of dynamic collision monitoring (DCM) in the simulation Further information: "Visualization options column", Page 559
	Status of the Advanced checks function Further information: "Visualization options column", Page 559
	Selected quality of model Further information: "Simulation settings window", Page 563
	Number of the active tool
	Current program run-time

Visualization options column

In the **Visualization options** column you can define the following display modes and functions:

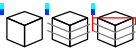Symbol or switch	Function	Requirements
	<p>Select Machine or Workpiece mode</p> <p>If you select the Machine mode, the control displays the defined workpiece, the collision objects, and the tool.</p> <p>In the Workpiece mode the control shows the workpiece to be simulated. Depending on the selected mode, different functions are available.</p>	
Workpiece position	<p>Use this function to define the position of the workpiece preset for the simulation. You can use a button to apply the current workpiece preset from the preset table.</p> <p>Further information: User's Manual for Setup and Program Run</p>	<ul style="list-style-type: none"> ■ Machine mode ■ Type of model: 2.5D
	<p>You can select between the following display modes for the machine:</p> <ul style="list-style-type: none"> ■ Original: Shaded, opaque representation ■ Semitransparent: Transparent representation ■ Wire-frame model: Representation of the machine contours 	<ul style="list-style-type: none"> ■ Workpiece mode ■ Type of model: 2.5D
	<p>You can select between the following display modes for the tool:</p> <ul style="list-style-type: none"> ■ Original: Shaded, opaque representation ■ Semitransparent: transparent representation ■ Invisible: The object is hidden 	<ul style="list-style-type: none"> ■ Workpiece mode ■ Type of model: 2.5D
	<p>You can select between the following display modes for the workpiece:</p> <ul style="list-style-type: none"> ■ Original: Shaded, opaque representation ■ Semitransparent: transparent representation ■ Invisible: the object is hidden 	<ul style="list-style-type: none"> ■ Workpiece mode ■ Type of model: 2.5D
	<p>You can show the tool paths during the simulation. The control displays the center-line path of the tools.</p> <p>You can choose between the following display modes for the tool paths:</p> <ul style="list-style-type: none"> ■ None: Do not show tool paths ■ Feed: Show tool paths with programmed feed rate ■ Feedrate + FMAX: Show tool paths with programmed feed rate and with programmed rapid traverse 	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor
DCM	<p>Use this switch to activate or deactivate collision monitoring (DCM, option 40) for the simulation.</p> <p>Further information: "Dynamic Collision Monitoring (DCM) in the Editor operating mode", Page 355</p>	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor ■ Type of model: 2.5D


Symbol or switch	Function	Requirements
Advanced checks	<p>Use this switch to activate the Advanced checks function.</p> <p>Further information: "Advanced checks in the simulation", Page 361</p>	<ul style="list-style-type: none"> Operating mode: Editor
Skip /	<p>If an NC block is preceded by a / character, then the NC block is hidden.</p> <p>If you activate the Skip / switch, the control skips all hidden NC blocks in the simulation.</p> <p>Further information: "Hiding NC blocks", Page 541</p>	<ul style="list-style-type: none"> Operating mode: Editor
Pause at M1	<p>If you activate this switch, the control pauses the simulation at each M1 miscellaneous function in the NC program.</p> <p>Further information: "Overview of miscellaneous functions", Page 413</p>	<ul style="list-style-type: none"> Operating mode: Editor

Workpiece options column


In the **Workpiece options** column, you can define the following simulation functions for the workpiece:

Switch or button	Function	Requirements
Measuring	Use this function to measure any points on the simulated workpiece. Further information: "Measuring function", Page 569	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor ■ Type of model: 2.5D
Cutout view	Use this function to cut through the simulated workpiece along a plane. Further information: "Cutout view in the simulation", Page 571	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor ■ Type of model: 2.5D
Highlight workpiece edges	Use this function to highlight the edges of the simulated workpiece.	<ul style="list-style-type: none"> ■ Workpiece mode ■ Type of model: 2.5D
Workpiece blank frame	The control uses this function to show the outside lines of the workpiece blank.	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor ■ Type of model: 2.5D
Finished part	Use this function to show a finished part that was defined with the help of the BLK FORM FILE function. Further information: "Cutout view in the simulation", Page 571	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor ■ Type of model: 2.5D
Software limit switches	Use this function to activate the software limit switches of the machine for the active traverse range in the simulation. By simulating the limit switches you can check whether the working space of the machine is sufficient for the simulated workpiece. Further information: "Simulation settings window", Page 563	<ul style="list-style-type: none"> ■ Operating mode: Editor

Switch or button	Function	Requirements
Workpiece coloring	<ul style="list-style-type: none"> ■ Grayscale The control displays the workpiece in various shades of gray. ■ Tool based The control displays the workpiece in color. Each cutting tool is assigned a separate color. ■ Model comparison The control displays a comparison between the workpiece blank and the finished part. Further information: "Model comparison", Page 572 ■ Monitoring The control displays a heat map on the workpiece: <ul style="list-style-type: none"> ■ Component heat map with MONITORING HEAT MAP Further information: "Component Monitoring with MONITORING HEATMAP (option 155)", Page 376 Further information: User's Manual for Machining Cycles ■ Process heat map with SECTION MONITORING Further information: "Process Monitoring (option 168)", Page 378 	<ul style="list-style-type: none"> ■ Type of model: 2.5D ■ Model comparison function only in Workpiece mode ■ Monitoring function only in the Program Run operating mode
Reset the workpiece	Use this function to reset the workpiece back to the workpiece blank	<ul style="list-style-type: none"> ■ Operating mode: Editor ■ Type of model: 2.5D
Reset the tool paths	Use this function to reset the simulated tool paths.	<ul style="list-style-type: none"> ■ Workpiece mode ■ Operating mode: Editor
Remove the chips	Use this function to remove from the simulation those parts of the workpiece that were cut off during machining.	<ul style="list-style-type: none"> ■ Operating mode: Editor ■ Type of model: 3D

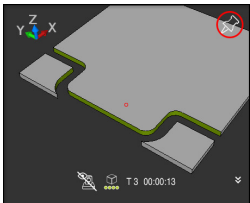

Workpiece before clean-up

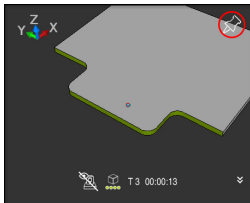

Workpiece after clean-up

Simulation settings window


The **Simulation settings** window is available only in the **Editor** operating mode.

The **Simulation settings** window consists of the following areas:

Area	Function
General	<ul style="list-style-type: none"> ■ Model type <ul style="list-style-type: none"> ■ None: fast line graphics without volume model ■ 2.5D: quick 3D representation without undercuts ■ 3D: realistic 3D representation with undercuts ■ Quality <ul style="list-style-type: none"> ■ Low: low-quality model, low memory use ■ Medium: normal-quality model, average memory use ■ High: high-quality model, uses much memory ■ Highest: best-quality model, uses very much memory ■ Mode <ul style="list-style-type: none"> ■ Milling ■ Turning ■ Grinding ■ Active kinemat. Select the kinematics model for the simulation from a selection menu. The machine manufacturer enables the kinematics models. ■ Generate tool-usage file <ul style="list-style-type: none"> ■ Never Do not generate a tool-usage file ■ Once Generate a tool-usage file for the next simulated NC program ■ Always Generate a tool-usage file for every simulated NC program <p>Further information: User's Manual for Setup and Program Run</p>
Traverse ranges	<ul style="list-style-type: none"> ■ Traverse ranges In this selection menu you can choose one of the traverse ranges defined by the machine manufacturer, such as Limit1. In each traverse range the machine manufacturer defines different software limit switches for each axis of the machine. For example, the machine manufacturer defines traverse ranges for large machines with two separate working spaces. Further information: "Workpiece options column", Page 561 ■ Active traverse ranges This function shows the active traverse range and the values defined for within that range.

Area	Function
Tables	<p>You can select tables specifically for the Editor operating mode. The control uses the selected tables for the simulation. The selected tables are independent of any tables that are active in other operating modes. You use a selection menu to choose the tables.</p> <p>You can select the following tables for the Simulation workspace:</p> <ul style="list-style-type: none">■ Tool table■ Turning tool table■ Datum table■ Preset table■ Grinding tool table■ Dressing tool table <p>Further information: User's Manual for Setup and Program Run</p>

Action bar

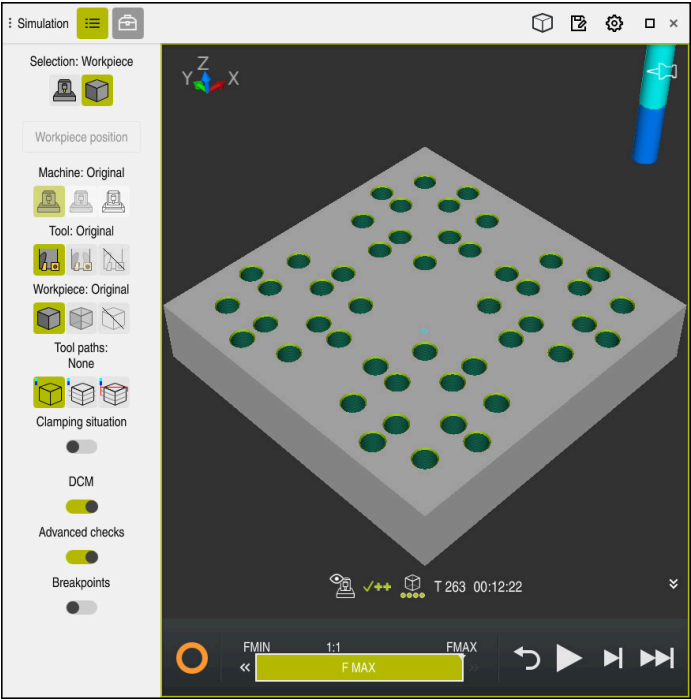

Simulation workspace in the **Editor** operating mode

In the **Editor** operating mode you can test NC programs by simulating them. The simulation helps to detect programming errors or collisions and to check the machining result visually.

The control shows the active tool and the machining time above the action bar.
The action bar contains the following symbols:

Symbol	Function
	Control-in-operation: The control uses the Control-in-operation symbol to show the current simulation status in the action bar and on the tab of the NC program: <ul style="list-style-type: none">■ White: no movement command■ Green: active machining, axes are moving■ Orange: NC program interrupted■ Red: NC program stopped
	Simulation speed Further information: "Simulation speed", Page 574
	Reset Return to the beginning of the program, reset transformations and the machining time
	Start
	Start in Single Block mode
	Run the simulation up to a certain NC block Further information: "Simulating an NC program up to a certain NC block", Page 575

Simulation of tools

The control visualizes the following entries of the tool table in the simulation:

- L
- LCUTS
- LU
- RN
- T-ANGLE
- R
- R2
- KINEMATIC
- Delta values from the tool table

Delta values from the tool table increase or decrease the size of the simulated tool. Delta values from the tool call shift the tool in the simulation.

Further information: "Tool compensation for tool length and radius", Page 304

Further information: User's Manual for Setup and Program Run

The control visualizes the following entries of the turning tool table in the simulation:

- ZL
- XL
- YL
- RS
- T-ANGLE
- P-ANGLE
- CUTLENGTH
- CUTWIDTH

If the **ZL** and **XL** columns are defined in the turning tool table, the indexable insert is displayed and the base body is shown schematically.

Further information: User's Manual for Setup and Program Run

The control visualizes the following entries of the grinding tool table in the simulation:

- R-OVR
- LO
- B
- R_SHAFT

Further information: User's Manual for Setup and Program Run

The control displays the tool in the following colors:

- Turquoise: tool length
- Red: length of cutting edge and tool is engaged
- Blue: length of cutting edge and tool is retracted








21.2 Pre-defined views


Application

In the **Simulation** workspace, you can choose between various pre-defined views in order to align the workpiece. This allows you to position the workpiece more quickly for the simulation.

Description of function

The control provides the following pre-defined views:

Symbol	Function
	Plan view
	Bottom view
	Front view
	Back view
	Side view (left side)
	Side view (right side)
	Isometric view

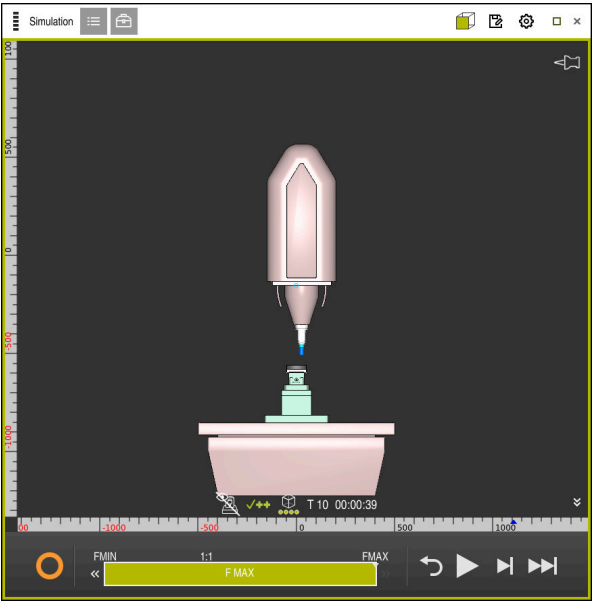

Front view of the simulated workpiece in **Machine** mode

21.3 Exporting a simulated workpiece as STL file

Application


In the simulation, you can use the **Save** function to save the current status of the simulated workpiece as a 3D model in STL format.

The file size of the 3D model depends on the complexity of the geometry and the selected model quality.

Related topics

- Using an STL file as workpiece blank
Further information: "STL file as workpiece blank with BLK FORM FILE", Page 149
- Modifying an STL file in the **CAD-Viewer** (option 152)
Further information: User's Manual for Setup and Program Run


Description of function

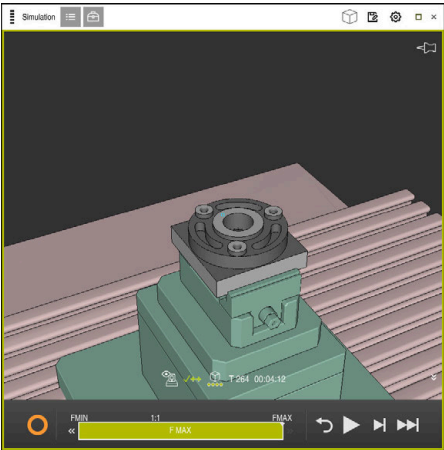

Simulated workpiece

This function can be used only in the **Editor** mode.
The control can only display STL files with up to 30,000 triangles. If the exported 3D model has too many triangles, due to the excessively high model quality, then you cannot use the exported 3D model on the control.
In this case, reduce the model quality in the simulation.
Further information: "Simulation settings window", Page 563
You can also use the **3D mesh** function to reduce the number of triangles (option 152).

Further information: User's Manual for Setup and Program Run

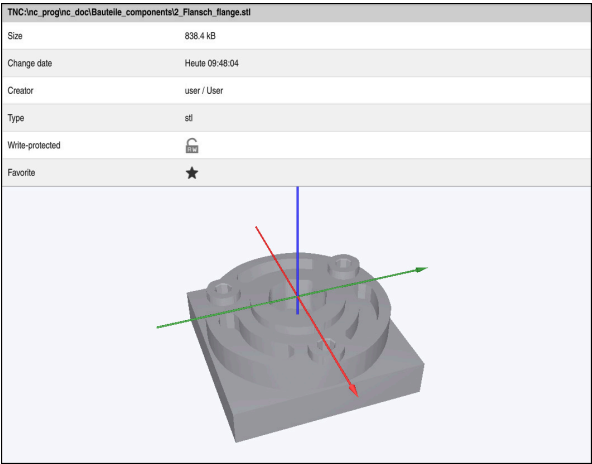

Simulated workpiece as saved STL file

21.3.1 Saving a simulated workpiece as STL file

To save a simulated workpiece as an STL file:



- ▶ Simulate workpiece



- ▶ Select **Save**
- > The control opens the **Save as** window.
- ▶ Enter the desired file name
- ▶ Select **Create**
- > The control saves the created STL file.

21.4 Measuring function

Application


Use the measuring function to measure any points on the simulated workpiece. The control shows various pieces of information about the measured surface.

Requirement

- **Workpiece** mode

Description of function

If you measure a point on the simulated workpiece, the cursor always locks onto the currently selected surface.

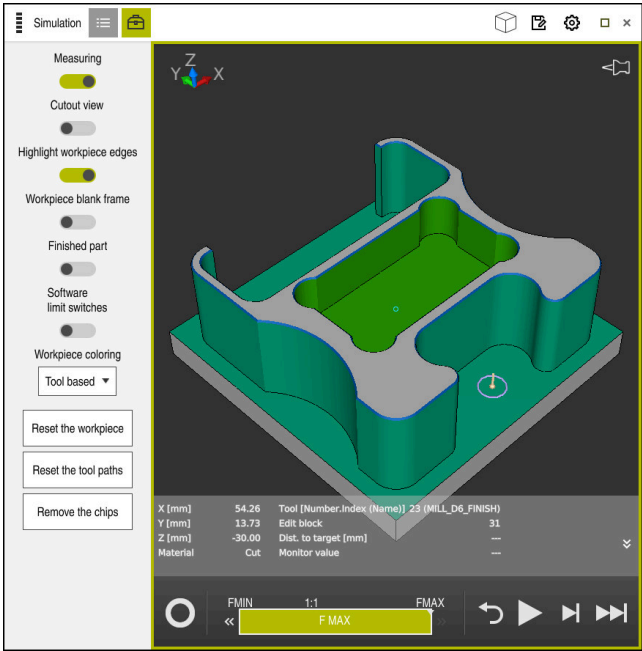

Measured point on simulated workpiece

The control shows the following information about the measured surface:

- Measured positions in the **X**, **Y**, and **Z** axes
- Status of the machined surface
 - **Material Cut** = Surface that has been machined
 - **Material NoCut** = Surface that has not been machined
- Cutting tool
- NC block currently running in the NC program
- Distance between the measured surface and the finished part
- Relevant values of monitored machine components (option 155)

Further information: User's Manual for Setup and Program Run

21.4.1 Measuring the difference between the workpiece blank and the finished part

 
To measure the difference between the workpiece blank and the finished part:

- ▶ Select an operating mode, e.g. **Editor**
- ▶ Open an NC program with a workpiece blank and finished part defined in **BLK FORM FILE**
- ▶ Open the **Simulation** workspace



- ▶ Select the **Tool options** column

- ▶ Activate the **Measuring** switch
- ▶ Select the **Workpiece coloring** selection menu
- ▶ Select **Model comparison**



- ▶ The control displays the workpiece blank and finished part defined in the **BLK FORM FILE** function.
- ▶ Start the simulation
- ▶ The control simulates the workpiece.
- ▶ Select the desired point on the simulated workpiece
- ▶ The control displays the difference in the dimension between the simulated workpiece and the finished part.



The control uses the **Model comparison** function to identify dimensional differences between the simulated workpiece and the finished part first in color, starting with differences greater than 0.2 mm.

Notes

- If you need to compensate for tools, you can use the measuring function to determine the tool to be compensated for.
- If you notice an error in the simulated workpiece, you can use the measuring function to determine the NC block that causes the error.

21.5 Cutout view in the simulation

Application

In the Cutout view you can cut through the simulated workpiece along any axis. This enables you to check holes and undercuts in the simulation, for example.

Requirement

- **Workpiece** mode

Description of function


The Cutout view can be used only in the **Editor** mode.

The position of the sectional plane is shown as a percent value when it is shifted in the simulation. The sectional plane is retained until the control is restarted.

21.5.1 Shifting the sectional plane

To shift the sectional plane:

- ▶ Select the **Editor** operating mode
- ▶ Open the **Simulation** workspace
- ▶ Select the **Visualization options** column
- ▶ Select **Workpiece** mode
- ▶ The control shows the workpiece view.
- ▶ Select **Workpiece options**
- ▶ Activate the **Cutout view** switch
- ▶ The control activates the **Cutout view**.
- ▶ Use the selection menu to choose the desired sectional axis, such as the Z axis
- ▶ Use the slider to specify the desired percent value
- ▶ The control simulates the workpiece with the selected sectional settings.

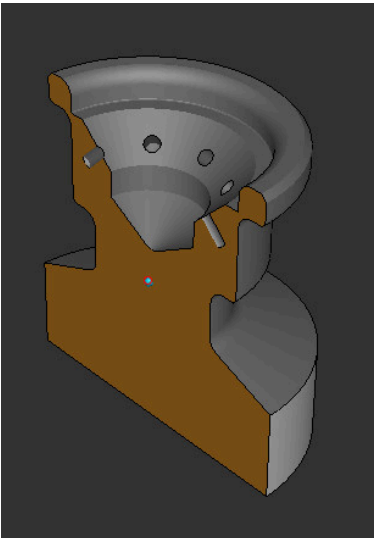

Simulated workpiece in the **Cutout view**

21.6 Model comparison

Application

With the **Model comparison** function you can compare the blank and finished part in STL or M3D format with each other.


Related topics

- Programming the blank and finished part with STL files
- **Further information:** "STL file as workpiece blank with BLK FORM FILE", Page 149

Requirements

- STL file or M3D file of workpiece blank and finished part
- **Workpiece** mode
- Workpiece blank definition with **BLK FORM FILE**

Description of function

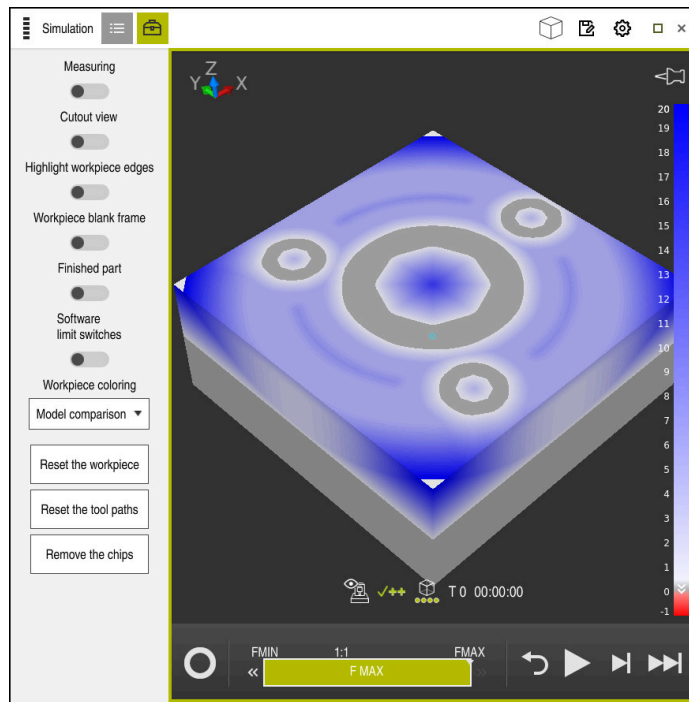

The control uses the **Model comparison** function to show the difference in material between the models being compared. The control uses a color transition from white to blue to show the difference in material. The more material there is covering the finished part model, the deeper the blue is. When material is removed from the finished part model, the control displays this removal in red.

Notes

- The control uses the **Model comparison** function to identify dimensional differences between the simulated workpiece and the finished part, starting with differences greater than 0.2 mm.
- Use the measuring function to measure the exact dimensional difference between the workpiece blank and the finished part.

Further information: "Measuring the difference between the workpiece blank and the finished part", Page 571

21.7 Center of rotation in the simulation




Application

By default, the center of rotation in the simulation is at the center of the model. When you zoom in, the center of rotation is always shifted to the center of the model. If you want to rotate the simulation around a specific point, then you can define the center of rotation manually.

Description of function


Use the **Center of rotation** function to manually set the center of rotation for the simulation.

The control shows the **Center of rotation** symbol as follows, depending on the status:

Symbol	Function
	The center of rotation is at the center of the model.
	The symbol blinks. The center of rotation can be shifted.
	The center of rotation was set manually.

21.7.1 Setting the center of rotation to a corner of the simulated workpiece


To set the center of rotation to a corner of the workpiece:

- ▶ Select an operating mode, e.g. **Editor**
- ▶ Open the **Simulation** workspace
- > The center of rotation is at the center of the model.
- 
 - ▶ Select **Center of rotation**
 - > The control switches the **Center of rotation** symbol. The symbol blinks.
 - ▶ Select a corner of the simulated workpiece
 - > The center of rotation is defined. The control switches the **Center of rotation** symbol to "set".

21.8 Simulation speed

Application

You can use a slider to select any speed for the simulation.

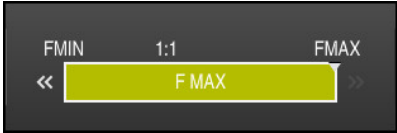






Description of function

This function can be used only in the **Editor** operating mode.

The standard speed for the simulation is set to **FMAX**. If you change the simulation speed, then this change is retained until the control is restarted.

You can change simulation speed before as well as during the simulation.

The control provides the following options:

Button	Functions
	Activate minimum feed rate (0.01*T)
	Reduce the feed rate
	Feed-rate at 1:1 (real-time)
	Increase the feed rate
	Activate maximum feed rate (FMAX)

21.9 Simulating an NC program up to a certain NC block

Application


If you want to check a critical point in the NC program then you can simulate the NC program up to a specific NC block that you specify. Once the NC block is reached in the simulation, the control stops the simulation automatically. Starting from this NC block you can then continue the simulation, for example in **Single Block** mode or at a lower simulation speed.

Related topics

- Possibilities in the action bar
Further information: "Action bar", Page 565
- Simulation speed
Further information: "Simulation speed", Page 574

Description of function

This function can be used only in the **Editor** operating mode.

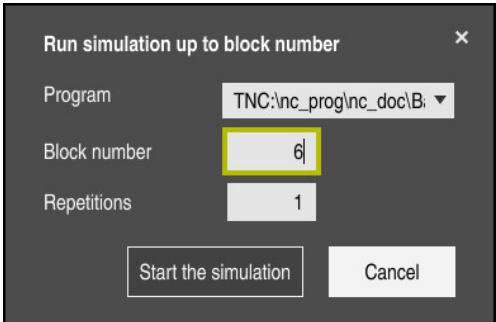

The **Run simulation up to block number** window with a defined NC block

The following settings options are offered in the **Run simulation up to block number** window:

 
- **Program**
This field offers a selection menu in which you can choose to simulate up to a specific NC block in the active main program or in a called program.
- **Block number**
In the **Block number** field, you enter the number of the NC block up to which the simulation should run. The number of the NC block refers to the NC program selected in the **Program** field.
- **Repetitions**
Use this field if the desired NC block is located within a program-section repeat. Enter in this field up to which iteration of the program-section repeat the simulation should run.
If you enter **1** or **0** in the **Repetitions** field, the control simulates up to the first iteration of the program section (repetition "0").

Further information: "Program-section repeats", Page 213

21.9.1 Simulating an NC program up to a certain NC block

To simulate up to a specific NC block:

- ▶ Open the **Simulation** workspace
- ▶▶
- ▶ Select **Run simulation up to block number**
 - ▶ The control opens the **Run simulation up to block number** window.
 - ▶ Use the selection menu in the **Program** field to specify the main program or called program
 - ▶ Enter the number of the desired NC block in the **Block number** field
 - ▶ If the block involves a program-section repeat, enter the number of the iteration of the program-section repeat in the **Repetitions** field
- ▶▶
- ▶ Select **Start the simulation**
 - ▶ The control simulates the workpiece up to the selected NC block.



22

**Pallet Machining
and Job Lists**

22.1 Fundamentals



Refer to your machine manual.
Pallet table management is a machine-dependent function. The standard functional range is described below.

Pallet tables (.p) are mainly used in machining centers with pallet changers. The pallet tables call the different pallets (PAL), optionally the fixtures (FIX), and the associated NC programs (PGM). The pallet tables activate all defined presets and datum tables.

Without a pallet changer, you can use pallet tables to successively run NC programs with different presets with just one press of **NC Start**. This type of usage is also called job list.

Tool-oriented machining is possible with pallet tables and with job lists. The control will reduce the number of tool changes, thereby reducing the machining time.

Further information: "Tool-oriented machining", Page 586

22.1.1 Pallet counter

You can define a pallet counter on the control. This allows you to define a variable number of parts produced, for example during pallet machining with automatic workpiece change.

For this purpose, you define a value in the **TARGET** column of the pallet table. The control repeats the NC programs of this pallet until the nominal value has been reached.

By default, every NC program that has been executed increases the actual value by 1. If, for example, an NC program produces more than one workpiece, you define the value in the **COUNT** column of the pallet table.

Further information: "Pallet table", Page 611

The control displays the defined nominal value and the current actual value in the **Job list** workspace.

Further information: "Information about the pallet table", Page 579

22.2 Job list workspace

22.2.1 Fundamentals

Application

In the **Job list** workspace, you edit and execute pallet tables.

Related topics

- Contents of a pallet table
Further information: "Pallet table", Page 611
- **Form** workspace for pallets
Further information: "Form workspace for pallets", Page 585
- Tool-oriented machining
Further information: "Tool-oriented machining", Page 586

Description of function

In the **Job list** workspace, the control displays the individual rows of the pallet table and the status.

Further information: "Information about the pallet table", Page 579

If you activate the **Edit** switch, the **Insert row** button will be displayed in the action bar and allows you to insert a new table row.

Further information: "Insert row window", Page 581

When you open a pallet table in **Editor** or **Program Run** operating mode, the control will automatically display the **Job list** workspace. You cannot close this workspace.





Information about the pallet table

When you open a pallet table, the following information will be displayed in the **Job list** workspace:

Column	Meaning
No column name	Status of the pallet, fixture, or NC program In the Program Run operating mode: execution cursor Further information: "Status of the pallet, fixture, or NC program", Page 579
Program	Information about the pallet counter: <ul style="list-style-type: none"> ■ For rows of the PAL type: Current actual value (COUNT) and defined nominal value (TARGET) of the pallet counter. ■ For rows of the PGM type: Value indicating by how much the actual value will be incremented after the execution of the NC program. Further information: "Pallet counter", Page 578 Machining method: <ul style="list-style-type: none"> ■ Workpiece-oriented machining ■ Tool-oriented machining Further information: "Machining method", Page 580
Sts	Machining status Further information: "Machining status", Page 580



Status of the pallet, fixture, or NC program

The control uses the following icons to display the status:

Icon	Meaning
	The Pallet , Clamping , or Program is locked
	The Pallet or Clamping is not enabled for machining
	This line is currently being executed in Program run, single block or Program run, full sequence mode and cannot be edited
	In this line, the program was interrupted manually

Machining method


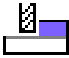


The control uses the following icons to display the machining method:

Icon	Meaning
No icon	Workpiece-oriented machining
	Tool-oriented machining
	
	■ Start
	■ End


Machining status

The control updates the machining status during program run.

The control uses the following icons to display the machining status:

Icon	Meaning
	Workpiece blank, machining required
	Partially machined, requires further machining
	Completely machined, no further machining required
	Skip machining

Insert row window

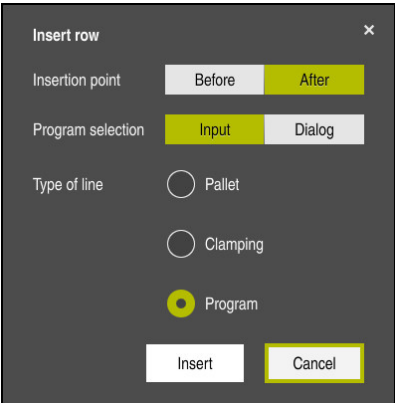

Insert row window with **Program** selected

The **Insert row** window provides the following settings:

Setting	Meaning
Insertion point	■ Before: Insert a new row before the current cursor position
	■ After: Insert a new row after the current cursor position
Program selec- tion	■ Input: Enter the path of the NC program
	■ Dialog: Select the NC program via a selection window
Type of line	Corresponds to the TYPE column of the pallet table Insert a Pallet , Clamping or Program

You can edit the contents and settings of a row in the **Form** workspace.

Further information: "Form workspace for pallets", Page 585

Program Run operating mode

You can open the **Program** workspace in addition to the **Job list** workspace. After you have selected a table row with an NC program, the control displays the program contents in the **Program** workspace.

The control uses the execution cursor to indicate which table row is marked for running or is currently being run.

Use the **GOTO Cursor** button to move the execution cursor to the currently selected row of the pallet table.

Further information: "Mid-program startup at any NC block", Page 582

Mid-program startup at any NC block

To perform a block scan for mid-program startup at an NC block:

- ▶ Open the pallet table in **Program Run** operating mode
- ▶ Open the **Program** workspace
- ▶ Select the table row with the desired NC program
 - ▶ Select **GOTO Cursor**
 - The control marks the table row with the execution cursor.
 - The control displays the contents of the NC program in the **Program** workspace.
 - ▶ Select the desired NC block
 - ▶ Select **Block scan**
 - The control opens the **Block scan** window displaying the values of the NC block.
- ▶ Press the **NC Start** key
 - The control starts the block scan.



Notes

- After you have opened a pallet table in **Program Run** operating mode, you can no longer edit this pallet table in **Editor** operating mode.
- In the machine parameter **stopAt** (no. 202101), the machine manufacturer defines when the control will stop program run during the execution of a pallet table.
- In the machine parameter **editTableWhileRun** (no. 202102), the machine manufacturer defines whether you will be allowed to edit the pallet table during program run.
- In the optional machine parameter **resumePallet** (no. 200603), the machine manufacturer defines whether the control will continue program execution after an error message.

22.2.2 Batch Process Manager (option 154)

Application

Batch Process Manager enables you to plan production orders on a machine tool.

The Batch Process Manager software option allows the control to display the following additional information in the **Job list** workspace:

- Times at which manual interventions at the machine are necessary
- Run time of the NC programs
- Availability of the tools
- Whether the NC program is free of errors

Related topics

- **Job list** workspace
Further information: "Job list workspace", Page 578
- Editing a pallet table in the **Form** workspace
Further information: "Form workspace for pallets", Page 585
- Contents of the pallet table
Further information: "Pallet table", Page 611

Requirements

- Software option 22: Pallet Management
- Software option 154: Batch Process Manager

Batch Process Manager is an expansion to the pallet management feature. Batch Process Manager provides you with all functions available in the **Job list** workspace.
- Tool usage test is active

The tool usage test function has to be enabled and switched on to ensure you get all information!

Further information: User's Manual for Setup and Program Run

Description of function

The screenshot shows the 'Job list' workspace with the following components:

- File information bar (1):** Displays 'TN 1' and the path 'c:\prog\nc_doc\Pallet\PYRAMIDE_Haus_House.P'.
- Necessary manual interventions table (2):**

Necessary manual interventions	Object	Time
External tool	NC_SPOT_DRILL_D16	09:39
External tool	DRILL_D16	09:40
External tool	NC_SPOT_DRILL_D16	09:43
- Program table (3):**

Program	Duration	End	Preset	T	Pgm	Sta
Pallet:	16m 20s		✓	✗	✓	
Haus_house.h	4m 5s	09:40	✓	✗	✓	
Haus_house.h	4m 5s	09:44	3	✗	✓	
Haus_house.h	4m 5s	09:48	✓	✗	✓	
Haus_house.h	4m 5s	09:53	✓	✗	✓	
TNC:\nc_prog\RESET.H	0s	09:53	✓	✓	✓	
- Action bar (4):** Contains an 'Insert row' button.

Job list workspace with **Batch Process Manager** (option 154)

When Batch Process Manager is enabled, the **Job list** workspace provides the following areas:

- 1 File information bar

In the file information bar, the control shows the path of the pallet table.
- 2 Information about necessary manual interventions
 - Time until the next manual intervention
 - Type of intervention
 - Affected object
 - Time of manual intervention
- 3 Information about and status of the pallet table

Further information: "Information about the pallet table", Page 584
- 4 Action bar

If the **Edit** switch is active, you can add a new row.

If the **Edit** switch is inactive, you can use the Dynamic Collision Monitoring (DCM) feature (option 40) to check all NC programs of the pallet table in **Program Run** operating mode.








Information about the pallet table

When you open a pallet table, the following information is displayed in the **Job list** workspace:



Column	Meaning
No column name	Status of the pallet, fixture, or NC program In the Program Run operating mode: execution cursor Further information: "Status of the pallet, fixture, or NC program", Page 579
Program	Name of the pallet, fixture, or NC program Information about the pallet counter: <ul style="list-style-type: none"> ■ For rows of the PAL type: Current actual value (COUNT) and defined nominal value (TARGET) of the pallet counter. ■ For rows of the PGM type: Value indicating by how much the actual value will be incremented after the execution of the NC program. Further information: "Pallet counter", Page 578 Machining method: <ul style="list-style-type: none"> ■ Workpiece-oriented machining ■ Tool-oriented machining Further information: "Machining method", Page 580
Duration	Duration of the NC program Only in the Editor operating mode
End	Expected point in time when the execution of the NC program will have been completed In the Editor operating mode, this column displays a duration, not a point in time
Preset	Status of the workpiece preset: <ul style="list-style-type: none"> ■ Workpiece preset is defined ■ Check input Further information: "Status of the workpiece preset, the tools, and the NC program", Page 585
T	Status of the tools used: <ul style="list-style-type: none"> ■ Test completed ■ Test not yet completed ■ Test failed This column is populated only in the Program Run operating mode Further information: "Status of the workpiece preset, the tools, and the NC program", Page 585
Pgm	Status of the NC program: <ul style="list-style-type: none"> ■ Test completed ■ Test not yet completed ■ Test failed Further information: "Status of the workpiece preset, the tools, and the NC program", Page 585
Sts	Machining status Further information: "Machining status", Page 580

Status of the workpiece preset, the tools, and the NC program

The control displays the status using the following icons:

Icon	Meaning
	Test completed
	Test completed Program simulation with active Dynamic Collision Monitoring (DCM) , option 40)
	Test failed (e.g., because of expired tool life, danger of collision)
	Test not yet completed
	Incorrect program structure (e.g., pallet does not contain any subprograms)
	Workpiece preset is defined
	Check input You can assign a workpiece preset either to the pallet or to all NC subprograms.

Note

If you edit the job list, the Collision checking completed  status is reset to Check completed .

22.3 Form workspace for pallets

Application

In the **Form** workspace, the control shows the contents of the pallet table for the selected row.

Related topics

- **Job list workspace**
Further information: "Job list workspace", Page 578
- **Contents of the pallet table**
Further information: "Pallet table", Page 611
- **Tool-oriented machining**
Further information: "Tool-oriented machining", Page 586

Description of function

The screenshot shows a 'Form' workspace with the following fields:

- Program:** A text field containing 'Haus_house.h' with a selection icon on the right.
- Preset:** A text field containing '21' with a selection icon on the right.
- Pallet preset (PALPRES):** A text field with a selection icon on the right.
- Locked:** A toggle switch currently in the 'off' position.
- Machining status? (W-STATUS):** A dropdown menu currently showing 'BLANK'.
- Datum table:** A text field with a selection icon on the right.

Form workspace with the contents of a pallet table

A pallet table can have the following types of rows:

- **Pallet**
- **Clamping**
- **Program**

In the **Form** workspace, the control shows the contents of the pallet table. The control shows the contents relevant to the respective type of the selected row. You can edit the settings in the **Form** workspace or in **Tables** operating mode. The control synchronizes the contents.

By default, the names of the table columns are used to designate the settings options in the form.

The switches provided in the form correspond to the following table columns:

- The **Locked** switch corresponds to the column **LOCK**
- The **Machinable** switch corresponds to the column **LOCATION**

If the control displays an icon next to the input field, a selection window for selecting the contents is available

The **Form** workspace can be selected for pallet tables in **Editor** or **Program Run** operating mode.

22.4 Tool-oriented machining

Application

Tool-oriented machining allows you to machine several workpieces together even on a machine without pallet changer, which reduces tool-change times. You can thus use the pallet management feature even on machines without a pallet changer.

Related topics

- Contents of the pallet table
Further information: "Pallet table", Page 611
- Block scan for mid-program startup in a pallet table
Further information: User's Manual for Setup and Program Run

Requirements

- Software option 22: Pallet Management
- Tool-change macro for tool-oriented machining
- **METHOD** column with the values **TO** or **TCO**
- NC programs with identical tools
The tools being used must, at least in part, be the same tools.
- **W-STATUS** column with the values **BLANK** or **INCOMPLETE**
- NC programs must not contain the following functions:
 - **FUNCTION TCPM** or **M128** (option 9)
Further information: "Compensating the tool angle of inclination with FUNCTION TCPM (option 9)", Page 295
 - **M144** (option 9)
Further information: "Factoring the tool offset into the calculations with M144 (option 9)", Page 442
 - **M101**
Further information: "Automatically inserting a replacement tool with M101", Page 447
 - **M118**
Further information: "Activating handwheel superimpositioning with M118", Page 426
 - Changing the pallet preset
Further information: "Pallet preset table", Page 589

Description of function

The following columns of the pallet table are effective for tool-oriented machining:

- **W-STATUS**
- **METHOD**
- **CTID**
- **SP-X** to **SP-W**

You can enter safety positions for the axes. The control only approaches these positions if the machine tool builder processes them in the NC macros.

Further information: "Pallet table", Page 611

In the **Job list** workspace, you can activate or deactivate tool-oriented machining for each NC program via the context menu. This will also cause the control to update the **METHOD** column.

Further information: "Context menu", Page 548

Sequence of tool-oriented machining

- 1 The entries TO and CTO tell the control that tool-oriented machining is effective for these rows of the pallet table
- 2 The control executes the NC program with the entry TO up to the TOOL CALL
- 3 The W-STATUS changes from BLANK to INCOMPLETE and the control enters a value into the CTID field
- 4 The control executes all other NC programs with the entry CTO up to the TOOL CALL
- 5 The control uses the next tool for the following machining steps if one of the following situations applies:
 - The next table row contains the entry PAL
 - The next table row contains the entry TO or WPO
 - There are rows in the table that do not yet contain the entry ENDED or EMPTY
- 6 The control updates the entry in the CTID field with each machining operation
- 7 If all table rows of the group contain the entry ENDED, the control processes the next rows of the pallet table

Block scan for mid-program startup

You can also return to a pallet table after an interruption. The control can show the rows and the NC block at which the interruption occurred.

The control saves the mid-program startup information in the **CTID** column of the pallet table.

The block scan in the pallet table is workpiece-oriented.

After a block scan, the control can resume tool-oriented machining if the tool-oriented machining method TO and CTO is defined in the following rows.

Further information: "Pallet table", Page 611

The following functions require special attention, particularly for mid-program startup:

- Changing the machine statuses with a miscellaneous function (e.g. M13)
- Writing to the configuration (e.g. WRITE KINEMATICS)
- Traverse range switchover
- Cycle **32**
- Cycle **800**
- Tilting the working plane

Notes

NOTICE

Danger of collision!

Not all pallet tables and NC programs are suitable for tool-oriented machining. With tool-oriented machining, the control no longer executes the NC programs continuously, but divides them at the tool calls. The division of the NC programs allows functions that were not reset to be effective across programs (machine states). This leads to a danger of collision during machining!

- ▶ Consider the stated limitations
- ▶ Adapt pallet tables and NC programs to the tool-oriented machining
 - Reprogram the program information after each tool in every NC program (e.g. **M3** or **M4**).
 - Reset special functions and miscellaneous functions before each tool in every NC program (e. g., **Tilt the working plane** or **M138**)
- ▶ Carefully test the pallet table and associated NC programs in the **Program run, single block** operating mode

- If you want to start machining again, change the W-STATUS to BLANK or remove the previous input.

Notes on mid-program startup

- The entry in the CTID field remains there for two weeks. After this time, mid-programs startup is no longer possible.
- Do not change or delete the entry in the CTID field.
- The data from the CTID field become invalid after a software update.
- The control saves the preset numbers for mid-program startup. If you change this preset, machining is shifted, too.
- Mid-program startup is no longer possible after editing an NC program within tool-oriented machining.

22.5 Pallet preset table

Application

Pallet presets are an easy way to compensate e.g. mechanical differences between individual pallets.

The machine manufacturer defines the pallet preset table.

Related topics

- Contents of the pallet table
Further information: "Pallet table", Page 611
- Workpiece preset management
Further information: User's Manual for Setup and Program Run

Description of function

If a pallet preset is active, the workpiece preset is referenced to it.

In the **PALPRES** column of the pallet table, you can enter the corresponding pallet preset for a pallet.

You can also completely align the coordinate system to the pallet by e.g. positioning the pallet preset in the center of a clamping tower.

If a pallet preset is active, the control does not display an icon. You can check the active pallet preset and the defined values in the **Setup** application.

Further information: User's Manual for Setup and Program Run

Note

NOTICE
<p>Danger of collision!</p> <p>Despite a basic rotation based on the active pallet preset, the control does not display an icon in the status display. There is a risk of collision during all subsequent axis movements!</p> <ul style="list-style-type: none">▶ Check the traverse movements of the machine▶ Use pallet presets only in conjunction with pallets

If the pallet preset changes, you need to reset the workpiece preset.

Further information: User's Manual for Setup and Program Run

23

Tables

23.1 Tables operating mode

Application

In the **Tables** operating mode you can open various tables and edit them as necessary.

Description of function

If you select **Add**, the control will display the **Quick selection** and **Open File** workspaces.

In the **Quick selection** workspace, you can open some tables directly.

Further information: "Quick selection workspace", Page 344

In the **Open File** workspace, you can open an existing table or create a new table.

Further information: "Open File workspace", Page 343

Multiple tables can be open at the same time. The control displays each table in a separate workspace.

If a table is selected for program run or simulation, the control shows the status **M** or **S** on the tab of the application.

You can open the **Table** and **Form** workspaces in every application.

Further information: "Table workspace", Page 593

Further information: "Form workspace for tables", Page 597

You can select various functions by using the context menu (e.g., **Copy**).

Further information: "Context menu", Page 548

Buttons

The **Tables** operating mode provides the following buttons in the function bar:

Button	Meaning
Activate the preset	Activate the selected row of the preset table as a preset. Further information: User's Manual for Setup and Program Run
Undo	Undo the last change
Redo	Redo the last undone change
GOTO record	The control opens the GOTO jump instruction window. The control jumps to the row number you have defined.
Edit	If the switch is active, you can edit the table.
Insert tool	The control opens the Insert tool window that allows you to add a new tool to tool management. Further information: User's Manual for Setup and Program Run When you select the Append check box, the control will insert the tool below the last row of the table.
Insert line	The control inserts a row at the end of the table.
Reset row	The control resets all data contained in the row.
Delete tool	The control deletes the tool selected in tool management Further information: User's Manual for Setup and Program Run
Delete row	The control deletes the currently selected row.
T INSPECT	The control inspects a tool.
T OUT	The control unloads a tool.
T IN	The controls loads a tool.

23.1.1 Editing the contents of tables

To edit the contents of a table:

- Select the desired table cell



- Activate **Edit**
- > The control enables the values for editing.



If the **Edit** switch is active, you can edit the contents in both the **Table** workspace and the **Form** workspace.

23.2 Table workspace

Application

In the **Table** workspace, the control shows the contents of a table. The control displays a column with filters and a search function on the left side of some tables.

Description of function

all tools

tools in magazines

all tool types

milling tools

drilling tools

tapping tools

threadmilling tools

turning tools

touchprobes

dressing tools

grinding tools

undefined tools

T	P	NAME	TYP
0		NULLWERKZEUG	MILL_R
1	1.1	MILL_D2_ROUGH	MILL_R
2	1.2	MILL_D4_ROUGH	MILL_R
3	1.3	MILL_D6_ROUGH	MILL_R
4	1.4	MILL_D8_ROUGH	MILL_R
5	1.5	MILL_D10_ROUGH	MILL_R
6	0.0	MILL_D12_ROUGH	MILL_R
7	1.7	MILL_D14_ROUGH	MILL_R
8	1.8	MILL_D16_ROUGH	MILL_R
9	1.9	MILL_D18_ROUGH	MILL_R
10	1.10	MILL_D20_ROUGH	MILL_R
11	1.11	MILL_D22_ROUGH	MILL_R
12	1.12	MILL_D24_ROUGH	MILL_R
13	1.13	MILL_D26_ROUGH	MILL_R
14	1.14	MILL_D28_ROUGH	MILL_R

Tool name?Min:Max:

Table workspace

In **Tables** operating mode, the **Table** workspace is open in every application by default.






The control displays the name and path of the file above the header of the table.

When you select the title of a column, the control will sort the table contents by this column.

If the table allows it, you can also edit the table contents in this workspace.

Icons and shortcuts

The **Table** workspace provides the following icons or shortcuts:

Icon or shortcut	Function
	Open the filters Further information: "Filters in the Table workspace", Page 595
	Open the search function Further information: "Search column in the Table workspace", Page 596
100%	Font size of the table <div> When you select the percent value, the control will display icons for increasing and decreasing the font size.</div>
	Set the font size of the table to 100%
	Open the settings in the Tables window Further information: "Settings in the Table workspace", Page 596
CTRL+A	Mark all rows
CTRL+BLANK	Mark the active row or end the marking function
SHIFT+↑	Additionally mark the row above
SHIFT+↓	Additionally mark the row below

Filters in the Table workspace

You can filter the tool tables and the **Pocket table**.

Filtering in Tool management

The following filter options are available for tool management:

- **All tools**
- **Magazine tools**

Depending on the filter you have selected (all tools or magazine tools), you can additionally filter by tool type in this area:

- **All types**
- **Milling cutters**
- **Drills**
- **Taps**
- **Thread cutters**
- **Lathe tools**
- **Touch probes**
- **Dressing tools**
- **Grinding tools**
- **Undefined tools**

Filters in the Pocket table

The following filter options are available for the pocket table:

- **All magazines**
- **Main magazine**
- **Spindle**

Depending on the filter you have selected (all magazines, main magazine, or spindle), you can additionally filter by pockets in this area:

- **All pockets**
- **Empty pockets**
- **Assigned pockets**

Search column in the Table workspace

You can search the **Tool management** and **Pocket table** tables.

You can define multiple search conditions in the search function.

Each condition includes the following information:

- Table column, such as **T** or **NAME**
Use the **Search in** selection menu to select the column.
- Operator, such as **Contains** or **Equal to (=)**
Use the **Operator** selection menu to select the operator.
- Search term in the **Search for** input field

Settings in the Table workspace

In the **Tables** window, you can influence the contents shown in the **Table** workspace.

The **Tables** window consists of the following areas:


- **General**
- **Column sequence**

General area

The setting selected in the **General** area is modally effective.

If the **Synchronize table and form** switch is active, the cursor will move synchronously. If, for example, you select a different table column in the **Table** workspace, the control will move the cursor synchronously in the **Form** workspace.

Column sequence area

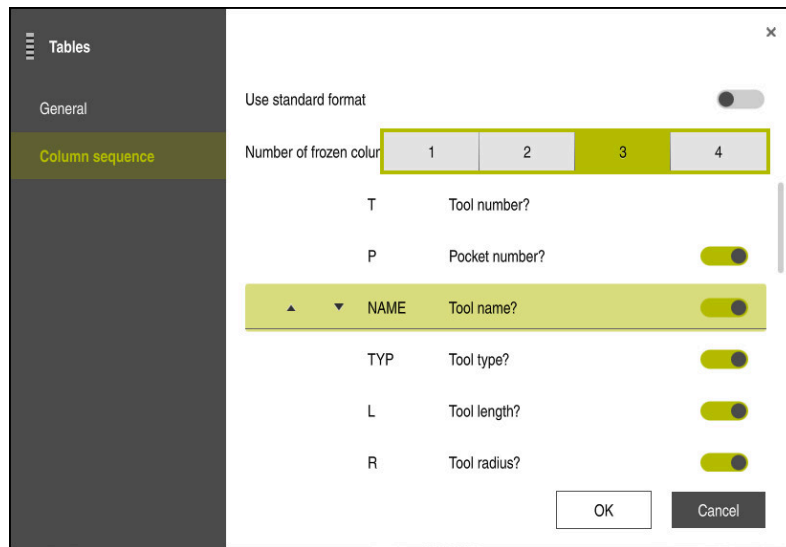

Tables window

In the **Column sequence** area, you define the view for each table.

The **Use standard format** switch allows you to show all columns in the default sequence.

The **Number of frozen columns** switch allows you to define how many columns the control will freeze to the left border of the screen. These columns will remain visible when you navigate further to the right within the table.

The control lists all table columns vertically below each other. Use the switch to select for each column whether it will be shown or hidden.

The control displays a line below the selected number of frozen columns. The control will freeze the columns above this line.


When you select a column, the control will display up and down arrows. Use these arrows to change the sequence of the columns.

23.3 Form workspace for tables

Application

In the **Form** workspace, the control shows all contents of a selected table row. Depending on the table, you can edit the values in the form.

Description of function

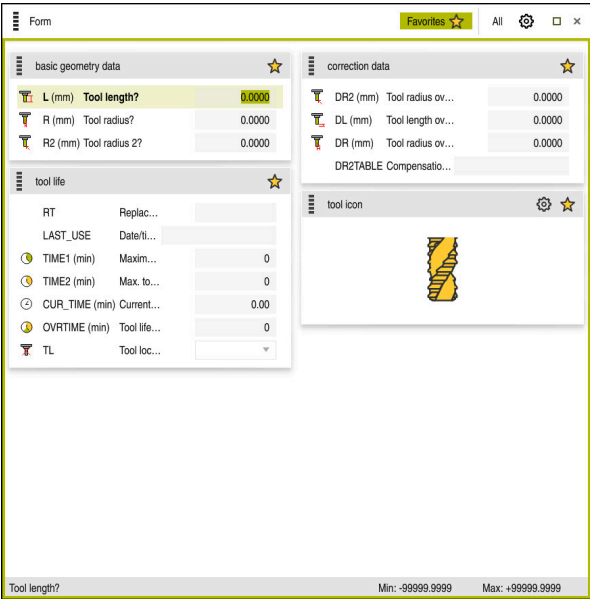

Form workspace in the Favorites view

The control displays the following information for each column:



- Icon of the column as needed
- Name of the column
- Unit of measure as needed
- Column description
- Current value

If an input is invalid, the control will display an icon ahead of the input field. When you tap this icon, the control will show the cause of the error (e.g., **Too many characters**).

The control displays the contents of specific tables in groups within the **Form** workspace. In the **All** view, the control shows all groups. Use the **Favorites** function to select individual groups, in order to configure a customized view. Use the handle to arrange the groups.


Icons

The **Table** workspace provides the following icons:

Icon or shortcut	Function
	Open the settings in the Tables window Further information: "Settings in the Form workspace", Page 599
	Favorite

Settings in the Form workspace

In the **Tables** window, you can select whether the control will show the column descriptions. The selected setting is modally effective.

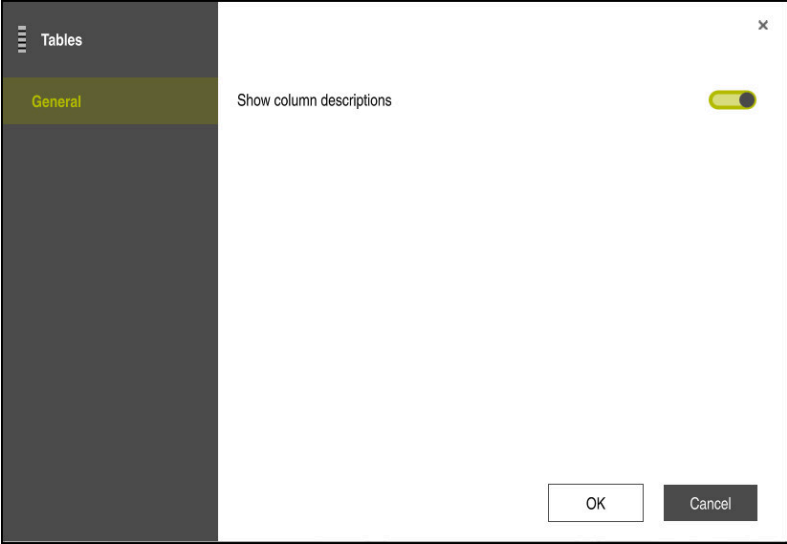

23.4 Accessing table values

23.4.1 Fundamentals

The **TABDATA** functions allow you to access table values. These functions enable automated editing of compensation values from within the NC program, for example.

You can access the following tables:

- Tool table ***.t** (read-only access)
- Compensation table ***.tco** (read and write access)
- Compensation table ***.wco** (read and write access)

In each case, the active table is accessed. Read-only access is always possible, whereas write access is possible only during program run. Write access during simulation or during a block scan has no effect.

The control provides the following functions for accessing the table values:

Syntax	Function	Further information
TABDATA READ	Read the value from a table cell	Page 600
TABDATA WRITE	Write a value to a table cell	Page 601
TABDATA ADD	Add a value to a table value	Page 601

If the unit of measure used in the NC program differs from that used in the table, the control will convert the values from **millimeters** to **inches**, and vice versa.

Related topics

- Fundamentals regarding variables
Further information: "Basics", Page 454
- Tool table
Further information: User's Manual for Setup and Program Run
- Compensation tables
Further information: "Compensation tables", Page 615
- Reading values from freely definable tables
Further information: "Reading a freely definable table with FN 28: TABREAD", Page 483
- Writing values to freely definable tables
Further information: "Writing to a freely definable table with FN 27: TABWRITE", Page 482

23.4.2 Reading table values with TABDATA READ

Application

The function **TABDATA READ** allows you to read a value from a table and save it to a Q parameter.

For example, the **TABDATA READ** function enables you to pre-check the data of the tool to be used to prevent error messages from occurring during program run.

Description of function

Depending on the type of column you want to transfer, you can use **Q**, **QL**, **QR**, or **QS** to save the value. The control will automatically convert the table values to the unit of measure used in the NC program.

Input

11 TABDATA READ Q1 = CORR-TCS COLUMN "DR" KEY "5"	; Save the value in row 5, column DR , from the compensation table to Q1
--	---

The NC function includes the following syntax elements:

Syntax element	Meaning
TABDATA	Syntax initiator for accessing table values
READ	Reading a table value
Q/QL/QR or QS	Type of variable and number in which the control saves the value
TOOL , CORR-TCS , or CORR-WPL	Read the value from the tool table or a compensation table *.tco or *.wco
COLUMN	Column name Fixed or variable name
KEY	Row number Fixed or variable name

23.4.3 Writing table values with TABDATA WRITE

Application

The function **TABDATA WRITE** allows you to write a value from a Q parameter into a table.

You can use the **TABDATA WRITE** function after a touch probe cycle to enter a necessary tool compensation into the compensation table, for example.

Description of function

Depending on the type of column you want to write to, you can use **Q**, **QL**, **QR**, or **QS** as a transfer parameter.

Input

**11 TABDATA WRITE CORR-TCS COLUMN
"DR" KEY "3" = Q1**

; Write the value from **Q1** to row 5, column **DR**, of the compensation table

The NC function includes the following syntax elements:

Syntax element	Meaning
TABDATA	Syntax initiator for accessing table values
WRITE	Writing a table value
CORR-TCS or CORR-WPL	Writing a value to a compensation table *.tco or *.wco
COLUMN	Column name Fixed or variable name
KEY	Row number Fixed or variable name
Q/QL/QR or QS	Type of variable and number that contains the value to be written

23.4.4 Adding table values with TABDATA ADD

Application

The function **TABDATA ADD** allows you to add a value from a Q parameter to a value contained in the table.

You can use the **TABDATA ADD** function to update a tool compensation value after a measurement has been repeated, for example.

Description of function

Depending on the type of column you want to write to, you can use **Q**, **QL**, or **QR** as a transfer parameter.

In order to write into a compensation table, you need to activate the table.

Further information: "Selecting a compensation table with SEL CORR-TABLE",

Page 314

Input

11 TABDATA ADD CORR-TCS COLUMN "DR" KEY "3" = Q1	; Add the value from Q1 to row 5, column DR , of the compensation table
---	---

The NC function includes the following syntax elements:

Syntax element	Meaning
TABDATA	Syntax initiator for accessing table values
ADD	Adding a value to a table value
CORR-TCS or CORR-WPL	Writing a value to a compensation table *.tco or *.wco
COLUMN	Column name Fixed or variable name
KEY	Row number Fixed or variable name
Q/QL/QR	Type of variable and number that contains the value to be added

23.5 Freely definable tables

Application

In freely definable tables you can save and read any information from the NC program. The Q parameter functions **FN 26** to **FN 28** are provided for this purpose.

Related topics

- Variable functions **FN 26** to **FN 28**
Further information: "Functions for freely definable tables", Page 482

Description of function

When you create a freely definable table, the control will provide various table templates for selection.

The machine manufacturers can create their own table templates and store them in the control.

23.5.1 Creating freely definable tables

To create a freely definable table:



- ▶ Select the **Tables** operating mode



- ▶ Select **Add**
- > The control opens the **Quick selection** and the **Open File** workspaces.



- ▶ Select **Create new table**
- > The control opens the **Create new table** window.
- ▶ Select the **tab** folder
- ▶ Select a table template

Select a path

- ▶ Select **Select a path**
- > The control opens the **Save as** window.
- ▶ Select a folder
- ▶ Enter a name

Create

- ▶ Select **Create**
- > The control opens the table.
- ▶ Modify the table as needed

Further information: "Table workspace", Page 593

Note

The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Further information: "Table access with SQL statements", Page 495

23.6 Point table

Application

In a point table, you save randomly distributed points on a workpiece. The control calls a cycle at each point. You can hide individual points and define a clearance height.

Related topics

- Calling point tables, effect with different cycles

Further information: User's Manual for Machining Cycles

Description of function

Parameters in point tables

The point table provides the following parameters:

Parameter	Meaning
NR	Row number in the point table Input: 0...99999
X	X coordinate of a point Input: -99999.9999...+99999.9999
Y	Y coordinate of a point Input: -99999.9999...+99999.9999
Z	Z coordinate of a point Input: -99999.9999...+99999.9999
FADE	Hide? (yes=ENT/no=NO ENT) Y=Yes: The point is hidden during machining. Points that have been hidden will remain hidden until they are manually shown again. N=No: The point is shown for machining. All points of a point table are shown for machining by default. Input: Y, N
CLEARANCE	Clearance height? Safe position in the tool axis to which the control retracts the tool after machining a point. If you do not define a value in the CLEARANCE column, the control will use the value of the cycle parameter Q204 2ND SET-UP CLEARANCE . If you have defined values in both the CLEARANCE column and the Q204 parameter, the control will use the higher of the two values. Input: -99999.9999...+99999.9999

23.6.1 Creating a point table

To create a point table:



- ▶ Select the **Tables** operating mode



 
- ▶ Select **Add**
- The control opens the **Quick selection** and the **Open File** workspaces.



- ▶ Select **Create new table**
- The control opens the **Create new table** window.
- ▶ Select the **pnt** folder



- ▶ Select the desired **prototype**
- The control opens the **Save as** window.
- ▶ Select a folder
- ▶ Enter name
- ▶ Select **Create**



- ▶ Select **OK**
- The control opens the point table.



The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Further information: "Table access with SQL statements", Page 495

23.6.2 Hiding individual points during machining

In the **FADE** column of the point table, you can specify if the defined point will be hidden during the machining process.

To hide points:

- ▶ Select the desired point in the table
- ▶ Select the **FADE** column



- ▶ Activate **Edit**
- ▶ Enter **Y**
- The control hides the point at the cycle call.

If you enter **Y** in the **FADE** column, you can use the **Skip /** switch to skip this point in **Program Run** operating mode.

Further information: User's Manual for Setup and Program Run

23.7 Datum table

Application

A datum table saves positions on the workpiece. To use a datum table, you must activate it. Within an NC program, the datums can be called, e. g. to execute machining processes on several workpieces at the same position. The active row of the preset table serves as the workpiece preset in the NC program.

Related topics

- Contents and preparing a datum table
Further information: "Datum table", Page 605
- Editing a datum table during a program run
Further information: User's Manual for Setup and Program Run
- Preset table
Further information: User's Manual for Setup and Program Run

Description of function

Parameters in datum tables

A datum table provides the following parameters:

Parameter	Meaning
D	Row number in the datum table Input: 0...99999999
X	X coordinate of the datum Input: -99999.99999...+99999.99999
Y	Y coordinate of the datum Input: -99999.99999...+99999.99999
Z	Z coordinate of the datum Input: -99999.99999...+99999.99999
A	A coordinate of the datum Input: -360.0000000...+360.0000000
B	B coordinate of the datum Input: -360.0000000...+360.0000000
C	C coordinate of the datum Input: -360.0000000...+360.0000000
U	U coordinate of the datum Input: -99999.99999...+99999.99999
V	V coordinate of the datum Input: -99999.99999...+99999.99999
W	W coordinate of the datum Input: -99999.99999...+99999.99999
DOC	Comment on shift? Input: Text width 15

23.7.1 Creating a datum table

To create a datum table:



- ▶ Select the **Tables** operating mode



- ▶ Select **Add**
- The control opens the **Quick selection** and the **Open File** workspaces.



 
- ▶ Select **Create new table**
- The control opens the **Create new table** window.
- ▶ Select the **d** folder



- ▶ Select the desired **prototype**
- The control opens the **Save as** window.
- ▶ Select a folder



- ▶ Enter a name
- ▶ Select **Create**



- ▶ Select **OK**
- The control opens the datum table.



The names of tables and table columns must start with a letter and must not contain an arithmetic operator (e.g., +). Due to SQL commands, these characters can cause problems when data are input or read.

Further information: "Table access with SQL statements", Page 495

23.7.2 Editing a datum table

You can edit the active datum table during program run.

Further information: User's Manual for Setup and Program Run

To edit a datum table:



- ▶ Activate **Edit**
- ▶ Select the value
- ▶ Edit the value
- ▶ Save the edited value, e.g. by selecting a different row

NOTICE

Danger of collision!

The control does not consider the changes made to a datum table or compensation table until the values have been saved. You need to activate the datum or compensation value in the NC program again; otherwise, the control will continue using the previous values.

- ▶ Make sure to confirm any changes made to the table immediately, e.g., by pressing the **ENT** key
- ▶ Activate the datum or compensation value in the NC program again
- ▶ Carefully test the NC program after changing the table values

23.8 Tables for cutting data calculation

Application

The following tables allow you to calculate the cutting data of a tool in the cutting data calculator:

- Table for workpiece materials **WMAT.tab**
Further information: "Table for workpiece materials WMAT.tab", Page 608
- Table for tool materials **TMAT.tab**
Further information: "Table for tool materials TMAT.tab", Page 608
- Cutting data table ***.cut**
Further information: "Cutting data table *.cut", Page 609
- Diameter-dependent cutting data table ***.cutd**
Further information: "Diameter-dependent cutting data table *.cutd", Page 610

Related topics

- Cutting data calculator
Further information: "Cutting data calculator", Page 553
- Tool management
Further information: User's Manual for Setup and Program Run

Description of function

Table for workpiece materials WMAT.tab

In the table for workpiece materials **WMAT.tab**, you define the workpiece material. You must save this table in the **TNC:\table** folder.

The table for workpiece materials **WMAT.tab** provides the following parameters:

Parameter	Meaning
WMAT	Workpiece material (e.g., aluminum) Input: Text width 32
MAT_CLASS	Material class Categorize the materials into material classes with the same cutting conditions, e.g., in accordance with DIN EN 10027-2. Input: Text width 32

Table for tool materials TMAT.tab

In the table for tool materials **TMAT.tab**, you define the tool material. You must save this table in the **TNC:\table** folder.

The table for tool materials **TMAT.tab** provides the following parameters:

Parameter	Meaning
TMAT	Tool material (e.g., solid carbide) Input: Text width 32
ALIAS1	Additional designation Input: Text width 32
ALIAS2	Additional designation Input: Text width 32

Cutting data table *.cut

In the cutting data table ***.cut**, you assign the matching cutting data to the workpiece materials and the tool materials. You must save the table in the **TNC: \system\Cutting-Data** folder.

The cutting data table ***.cut** provides the following parameters:

Parameter	Meaning
NR	Sequential number of the table rows Input: 0...999999999
MAT_CLASS	Workpiece material from the table WMAT.tab Further information: "Table for workpiece materials WMAT.tab", Page 608 Selection by means of a selection window Input: 0...9999999
MODE	Machining mode (e.g., roughing or finishing) Input: Text width 32
TMAT	Tool material from the table TMAT.tab Further information: "Table for tool materials TMAT.tab", Page 608 Selection by means of a selection window Input: Text width 32
VC	Cutting speed in m/min Further information: "Cutting data", Page 162 Input: 0...1000
FTYPE	Type of feed: <ul style="list-style-type: none"> ■ FU: Feed per revolution FU in mm/rev ■ FZ: Feed per tooth FZ in mm/tooth Further information: "Feed rate F", Page 164 Input: FU, FZ
F	Feed rate value Input: 0.0000...9.9999

Diameter-dependent cutting data table *.cutd

In the diameter-dependent cutting data table ***.cutd**, you assign the matching cutting data to the workpiece materials and the tool materials. You must save the table in the **TNC:\system\Cutting-Data** folder.

The diameter-dependent cutting data table ***.cutd** provides the following parameters:

Parameter	Meaning
NR	Sequential number of the table rows Input: 0...999999999
MAT_CLASS	Workpiece material from the table WMAT.tab Further information: "Table for workpiece materials WMAT.tab", Page 608 Selection by means of a selection window Input: 0...9999999
MODE	Machining mode (e.g., roughing or finishing) Input: Text width 32
TMAT	Tool material from the table TMAT.tab Further information: "Table for tool materials TMAT.tab", Page 608 Selection by means of a selection window Input: Text width 32
VC	Cutting speed in m/min Further information: "Cutting data", Page 162 Input: 0...1000
FTYPE	Type of feed: <ul style="list-style-type: none"> ■ FU: Feed per revolution FU in mm/rev ■ FZ: Feed per tooth FZ in mm/tooth Further information: "Feed rate F", Page 164 Input: FU, FZ
F_D_0...F_D_9999	Feed rate value for the respective diameter You don't need to define all columns. If a tool diameter is between two defined columns, the control linearly interpolates the feed rate. Input: 0.0000...9.9999

Note

In the corresponding folders, the control provides sample tables for automatic cutting data calculation. You can customize these tables and specify your own data, i.e. materials and tools to be used.

23.9 Pallet table

Application

Pallet tables allow you to define the sequence in which the control will machine the pallets and the NC programs to be used.

Without a pallet changer, you can use pallet tables to successively run NC programs with different presets with just one press of **NC Start**. This type of usage is also called job list.

Tool-oriented machining is possible with pallet tables and with job lists. The control will reduce the number of tool changes, thereby reducing the machining time.

Related topics

- Editing and executing a pallet table in the **Job list** workspace
Further information: "Job list workspace", Page 578
- Tool-oriented machining
Further information: "Tool-oriented machining", Page 586

Requirement

- Software option 22: Pallet Management

Description of function

Pallet tables can be opened in **Tables**, **Editor**, and **Program Run** operating modes. In **Editor** and **Program Run** operating modes, the control opens the pallet table in the **Job list** workspace instead of as a table.

The machine manufacturer defines a prototype for the pallet table. When you create a new pallet table, the control will copy this prototype. This means that the pallet table on your control might not contain all possible parameters.

The prototype can include the following parameters:

Parameter	Meaning
NR	<p>Row number in the pallet table</p> <p>The entry is required for the Line number input field of the BLOCK SCAN function.</p> <p>Further information: User's Manual for Setup and Program Run</p> <p>Input: 0...99999999</p>
TYPE	<p>Pallet type?</p> <p>Contents of the table row:</p> <ul style="list-style-type: none"> ■ PAL: Pallet ■ FIX: Fixture ■ PGM: NC program <p>Selection using a selection menu</p> <p>Input: PAL, FIX, PGM</p>
NAME	<p>Pallet / NC program / Fixture?</p> <p>File name of the pallet, fixture or NC program</p> <p>The machine manufacturer specifies the names of pallets and fixtures as needed. You can define the names of your NC programs yourself.</p> <p>Selection by means of a selection window</p> <p>Input: Text width 32</p>






Parameter	Meaning
DATUM	<p>Datum table?</p> <p>The datum table to be used in the NC program.</p> <p>Selection by means of a selection window</p> <p>Input: Text width 32</p>
PRESET	<p>Preset?</p> <p>Row number in the preset table for the workpiece preset to be activated.</p> <p>Selection by means of a selection window</p> <p>Input: 0...999</p>
LOCATION	<p>Location?</p> <p>The entry MA indicates that there is a pallet or fixture in the working space of the machine and can be machined. Press the ENT key to enter MA. Press the NO ENT key to remove the entry and thus suppress machining. If the column exists, an entry is mandatory.</p> <p>Corresponds to the Machinable switch in the Form workspace.</p> <p>Selection using a selection menu</p> <p>Input: No value, MA</p>
LOCK	<p>Locked?</p> <p>By entering the character *, you can exclude the row of the pallet table from machining. Press the ENT key to enter * for the row. Press the NO ENT key to cancel the lock. You can lock the execution for individual NC programs, fixtures or entire pallets. Unlocked rows (e.g., PGM) in a locked pallet are also not machined.</p> <p>Selection using a selection menu</p> <p>Input: No value, *</p>
W STATUS	<p>Machining status?</p> <p>Relevant to tool-oriented machining</p> <p>The machining status defines the machining progress. Enter BLANK for an unmachined (raw) workpiece. The control changes this entry automatically during machining.</p> <p>The control differentiates between the following entries</p> <ul style="list-style-type: none"> ■ BLANK / no entry: Workpiece blank, requires machining ■ INCOMPLETE: Partly machined, requires further machining ■ ENDED: Machined completely, no further machining required ■ EMPTY: Empty space, no machining required ■ SKIP: Skip machining <p>Further information: "Tool-oriented machining", Page 586</p> <p>Input: No value, BLANK, INCOMPLETE, ENDED, EMPTY, SKIP</p>
PALPRES	<p>Pallet preset</p> <p>Row number in the pallet preset table for the pallet preset to be activated</p> <p>Only required if a pallet preset table has been created on the control.</p> <p>Selection by means of a selection window</p> <p>Input: -1...+999</p>
DOC	<p>Comment</p> <p>Input: Text width 15</p>


Parameter	Meaning
METHOD	Machining method? Machining method The control differentiates between the following entries <ul style="list-style-type: none"> ■ WPO: Workpiece oriented (standard) ■ TO: Tool oriented (first workpiece) ■ CTO: Tool oriented (further workpieces) Further information: "Tool-oriented machining", Page 586 Selection using a selection menu Input: WPO, TO, CTO
CTID	ID no. geometry context? Relevant to tool-oriented machining The control automatically generates the ID number for mid-program startup with block scan. If you delete or change the entry, mid-program startup is no longer possible. Further information: "Tool-oriented machining", Page 586 Input: Text width 8
SP-X	Clearance height? Clearance height in the X axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-Y	Clearance height? Clearance height in the Y axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-Z	Clearance height? Clearance height in the Z axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-A	Clearance height? Clearance height in the A axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-B	Clearance height? Clearance height in the B axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-C	Clearance height? Clearance height in the C axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-U	Clearance height? Clearance height in the U axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999

Parameter	Meaning
SP-V	Clearance height? Clearance height in the V axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
SP-W	Clearance height? Clearance height in the W axis for tool-oriented machining Further information: "Tool-oriented machining", Page 586 Input: -999999.99999...+999999.99999
COUNT	Number of operations For rows of the PAL type: Current actual value for the pallet counter nominal value defined in the TARGET column. For rows of the PGM type: Value indicating by how much the pallet counter actual value will be incremented after the execution of the NC program. Further information: "Pallet counter", Page 578 Input: 0...99999
TARGET	Total number of operations Nominal value for the pallet counter in rows of the PAL type The control repeats the NC programs of this pallet until the nominal value has been reached. Further information: "Pallet counter", Page 578 Input: 0...99999

23.9.1 Creating and opening a pallet table

To create a pallet table:

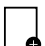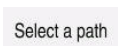- 
- ▶ Select the **Tables** operating mode
- 
- ▶ Select **Add**
> The control opens the **Quick selection** and the **Open File** workspaces.
- 
- ▶ Select **Create new table**
> The control opens the **Create new table** window.
▶ Select the **p** folder
▶ Select table format
▶ Select **Select a path**
> The control opens the **Save as** window.
▶ Select a folder
▶ Enter a name
▶ Select **Create**
> The control opens the table in **Tables** operating mode.
- 
- 



- The file name of a pallet table must always begin with a letter.
- Use the **Select in Program Run** button in **Files** operating mode to open the pallet table in **Program Run** operating mode. In this operating mode, you can edit and execute pallet tables.

Further information: "Job list workspace", Page 578

23.10 Compensation tables

23.10.1 Overview

The control provides the following compensation tables:

Table	Further information
Compensation table *.tco Compensation in the tool coordinate system T-CS	Page 615
Compensation table *.wco Compensation in the working plane coordinate system WPL-CS	Page 617

23.10.2 Compensation table ***.tco**

Application

The compensation table ***.tco** allows you to define compensation values for the tool in the tool coordinate system **T-CS**.

You can use the compensation table ***.tco** for tools of all types of technologies.

Related topics

- Using compensation tables
Further information: "Tool compensation with compensation tables", Page 312
- Contents of the compensation table ***.wco**
Further information: "Compensation table *.wco", Page 617
- Editing compensation tables during program run
Further information: User's Manual for Setup and Program Run
- Tool coordinate system **T-CS**
Further information: "Tool coordinate system T-CS", Page 234

Description of function

Any compensation in the compensation tables with the ***.tco** file name extension applies to the active tool. The table applies to all tool types. Therefore, columns that you may not need for your specific tool type will be displayed during creation.

Enter only those values that are relevant to your tool. If you compensate for values that are not present with the existing tool, the control issues an error message.

The compensation table ***.tco** provides the following parameters:

Parameter	Meaning
NO	Row number in the table Input: 0...999999999
DOC	Comment Input: Text width 16
DL	Tool length oversize? Delta value for parameter L of the tool table Input: -999.9999...+999.9999
DR	Tool radius oversize? Delta value for parameter R of the tool table Input: -999.9999...+999.9999
DR2	Tool radius oversize 2? Delta value for parameter R2 of the tool table Input: -999.9999...+999.9999
DXL	Oversize in tool length 2? Delta value for parameter DXL of the turning tool table Input: -999.9999...+999.9999
DYL	Tool length oversize 3? Delta value for parameter DYL of the turning tool table Input: -999.9999...+999.9999
DZL	Oversize in tool length 1? Delta value for parameter DZL of the turning tool table Input: -999.9999...+999.9999
DL-OVR	Compensation of the overhang Delta value for parameter L-OVR of the grinding tool table Input: -999.9999...+999.9999
DR-OVR	Compensation of the radius Delta value for parameter R-OVR of the grinding tool table Input: -999.9999...+999.9999
DLO	Compensation of the total length Delta value for parameter LO of the grinding tool table Input: -999.9999...+999.9999
DLI	Compensation of the length to the inner edge Delta value for parameter LI of the grinding tool table Input: -999.9999...+999.9999

23.10.3 Compensation table *.wco

Application

The values from the compensation tables with the ***.wco** file name extension are applied as shifts in the working plane coordinate system (**WPL-CS**).

The ***.wco** compensation tables are used mainly for turning (option 50).

Related topics

- Using compensation tables
Further information: "Tool compensation with compensation tables", Page 312
- Contents of the compensation table ***.tco**
Further information: "Compensation table *.tco", Page 615
- Editing compensation tables during program run
Further information: User's Manual for Setup and Program Run
- Working plane coordinate system **WPL-CS**
Further information: "Working plane coordinate system WPL-CS", Page 230

Description of function

The compensation table ***.wco** provides the following parameters:

Parameter	Meaning
NO	Row number in the table Input: 0...999999999
DOC	Comment Input: Text width 16
X	Shift of the working plane coordinate system WPL-CS in X Input: -999.9999...+999.9999
Y	Shift of WPL-CS in Y Input: -999.9999...+999.9999
Z	Shift of WPL-CS in Z Input: -999.9999...+999.9999

23.10.4 Creating a compensation table

To create a compensation table:



- ▶ Select the **Tables** operating mode



- ▶ Select **Add**
- > The control opens the **Quick selection** and the **Open File** workspaces.



- ▶ Select **Create new table**
- > The control opens the **Create new table** window.
- ▶ Select the folder **tco** or **wco**

Select a path

- ▶ Select **Select a path**
- > The control opens the **Save as** window.
- ▶ Select a folder

Create

- ▶ Enter a name
- ▶ Select **Create**
- > The control opens the table.

23.11 *.3DTC compensation table

Application

In a ***.3DTC** compensation table, the control saves the radius deviation of ball-nose cutters from the nominal value at a defined inclination angle. For workpiece touch probes, the control saves the deflection behavior of the touch probe at a defined probing angle.

The control takes into account the saved data during the execution of NC programs and during probing.

Related topics

- 3D radius compensation depending on the tool's contact angle
Further information: "3D radius compensation depending on the tool contact angle (option 92)", Page 330
- 3D calibration of the touch probe
Further information: User's Manual for Setup and Program Run

Requirements

- Advanced Functions Set 2 (software option 9)
- 3D-ToolComp (software option 92)

Description of function

The ***.3DTC** compensation tables must be saved in the **TNC:\system\3D-ToolComp** folder. In the **DR2TABLE** tool management column, you can then assign the tables to a tool.

You create a separate table for each tool.

A compensation table provides the following parameters:

Parameter	Meaning
NR	Sequential row number in the compensation table The control evaluates a maximum of 100 rows in the compensation value table. Input: 0...99999999
ANGLE	Inclination angle of tools or probing angle of workpiece touch probes Input: -99999.999999...+99999.999999
DR2	Radius deviation from the nominal value or deflection of the touch probe Input: -99999.999999...+99999.999999

24

Overviews

24.1 Preassigned error numbers for FN 14: ERROR

With the **FN 14** function you can issue error messages in the NC program.

Further information: "Output error messages with FN 14: ERROR", Page 470

The following error messages are preassigned by HEIDENHAIN:

Error number	Text
1000	Spindle?
1001	Tool axis is missing
1002	Tool radius too small
1003	Tool radius too large
1004	Range exceeded
1005	Start position incorrect
1006	ROTATION not permitted
1007	SCALING FACTOR not permitted
1008	MIRROR IMAGE not permitted
1009	Datum shift not permitted
1010	Feed rate is missing
1011	Input value incorrect
1012	Incorrect sign
1013	Entered angle not permitted
1014	Touch point inaccessible
1015	Too many points
1016	Contradictory input
1017	CYCL incomplete
1018	Plane wrongly defined
1019	Wrong axis programmed
1020	Wrong rpm
1021	Radius comp. undefined
1022	Rounding-off undefined
1023	Rounding radius too large
1024	Program start undefined
1025	Excessive nesting
1026	Angle reference missing
1027	No fixed cycle defined
1028	Slot width too small
1029	Pocket too small
1030	Q202 not defined
1031	Q205 not defined
1032	Q218 must be greater than Q219
1033	CYCL 210 not permitted
1034	CYCL 211 not permitted

Error number	Text
1035	Q220 too large
1036	Q222 must be greater than Q223
1037	Q244 must be greater than 0
1038	Q245 must not equal Q246
1039	Angle range must be under 360°
1040	Q223 must be greater than Q222
1041	Q214: 0 not permitted
1042	Traverse direction not defined
1043	No datum table active
1044	Position error: center in axis 1
1045	Position error: center in axis 2
1046	Hole diameter too small
1047	Hole diameter too large
1048	Stud diameter too small
1049	Stud diameter too large
1050	Pocket too small: rework axis 1
1051	Pocket too small: rework axis 2
1052	Pocket too large: scrap axis 1
1053	Pocket too large: scrap axis 2
1054	Stud too small: scrap axis 1
1055	Stud too small: scrap axis 2
1056	Stud too large: rework axis 1
1057	Stud too large: rework axis 2
1058	TCHPROBE 425: length exceeds max
1059	TCHPROBE 425: length below min
1060	TCHPROBE 426: length exceeds max
1061	TCHPROBE 426: length below min
1062	TCHPROBE 430: diameter too large
1063	TCHPROBE 430: diameter too small
1064	No measuring axis defined
1065	Tool breakage tolerance exceeded
1066	Enter Q247 unequal to 0
1067	Enter Q247 greater than 5
1068	Datum table?
1069	Enter Q351 unequal to 0
1070	Thread depth too large
1071	Missing calibration data
1072	Tolerance exceeded
1073	Block scan active

Error number	Text
1074	ORIENTATION not permitted
1075	3-D ROT not permitted
1076	Activate 3-D ROT
1077	Enter depth as negative
1078	Q303 in meas. cycle undefined!
1079	Tool axis not allowed
1080	Calculated values incorrect
1081	Contradictory meas. points
1082	Incorrect clearance height
1083	Contradictory plunge type
1084	This fixed cycle not allowed
1085	Line is write-protected
1086	Oversize greater than depth
1087	No point angle defined
1088	Contradictory data
1089	Slot position 0 not allowed
1090	Enter an infeed not equal to 0
1091	Switchover of Q399 not allowed
1092	Tool not defined
1093	Tool number not permitted
1094	Tool name not permitted
1095	Software option not active
1096	Kinematics cannot be restored
1097	Function not permitted
1098	Contradictory workpc. blank dim.
1099	Measuring position not allowed
1100	Kinematic access not possible
1101	Meas. pos. not in traverse range
1102	Preset compensation not possible
1103	Tool radius too large
1104	Plunging type is not possible
1105	Plunge angle incorrectly defined
1106	Angular length is undefined
1107	Slot width is too large
1108	Scaling factors not equal
1109	Tool data inconsistent
1110	MOVE not possible
1111	Presetting not allowed!
1112	Thread angle too small!

Error number	Text
1113	3-D ROT status is contradictory!
1114	Configuration is incomplete
1115	No turning tool is active
1116	Tool orientation is inconsistent
1117	Angle not possible!
1118	Radius too small!
1119	Thread runout too short!
1120	Contradictory meas. points
1121	Too many limits
1122	Machining strategy with limits not possible
1123	Machining direction not possible
1124	Check the thread pitch!
1125	Angle cannot be calculated
1126	Eccentric turning not possible
1127	No milling tool is active
1128	Insufficient length of cutting edge
1129	Gear definition is inconsistent or incomplete
1130	No finishing allowance provided
1131	Line does not exist in table
1132	Probing process not possible
1133	Coupling function not possible
1134	Machining cycle is not supported by this NC software
1135	Touch probe cycle is not supported by this NC software
1136	NC program aborted
1137	Touch probe data incomplete
1138	LAC function not possible
1139	Rounding radius or chamfer is too large!
1140	Axis angle not equal to tilt angle
1141	Character height not defined
1142	Excessive character height
1143	Tolerance error: Workpiece rework
1144	Tolerance error: Workpiece scrap
1145	Faulty dimension definition
1146	Illegal entry in compensation table
1147	Transformation not possible
1148	Tool spindle incorrectly configured
1149	Offset of the turning spindle unknown
1150	Global program settings are active
1151	Faulty configuration of OEM macros

Error number	Text
1152	The combination of programmed oversizes is not possible
1153	Measured value not captured
1154	Check the monitoring of the tolerance
1155	Hole is smaller than the stylus tip
1156	Preset cannot be set
1157	Alignment of a rotary table is not possible
1158	Alignment of rotary axes is not possible
1159	Infeed limited to length of cutting edge
1160	Machining depth defined as 0
1161	Tool type is unsuitable
1162	Finishing allowance not defined
1163	Machine datum could not be written
1164	Spindle for synchronization could not be ascertained
1165	Function is not possible in the active operating mode
1166	Oversize defined too large
1167	Number of teeth not defined
1168	Machining depth does not increase monotonously
1169	Infeed does not decrease monotonously
1170	Tool radius not defined correctly
1171	Mode for retraction to clearance height not possible
1172	Gear wheel definition incorrect
1173	Probing object contains different types of dimension definition
1174	Dimension definition contains impermissible characters
1175	Actual value in dimension definition faulty
1176	Starting point of hole too deep
1177	Dimension def.: Nominal value missing for manual pre-positioning
1178	A replacement tool is not available
1179	OEM macro is not defined
1180	Measurement not possible with auxiliary axis
1181	Start position not possible with modulo axis
1182	Function only possible if door is closed
1183	Number of possible records exceeded
1184	Inconsistent machining plane due to axis angle with basic rotation
1185	Transfer parameter contains an impermissible value
1186	Tooth width RCUTS is defined too large
1187	Usable length LU of the tool is too small
1188	The defined chamfer is too large

Error number	Text
1189	Chamfer angle cannot be machined with the active tool
1190	The allowances do not define any stock removal
1191	Spindle angle not unique

24.2 System data

24.2.1 List of FN functions

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Program information				
	10	3	-	Number of the active machining cycle
		6	-	Number of the most recently executed touch probe cycle -1 = None
		7	-	Type of calling NC program: -1 = None 0 = Visible NC program 1 = Cycle/macro, main program is visible 2 = Cycle/macro, there is no visible main program
		8	1	Unit of measure of the directly calling NC program (may also be a cycle). Return codes: 0 = mm 1 = inch -1 = there is no corresponding program
			2	Unit of measure of the NC program visible in the block display from which the current cycle was called directly or indirectly. Return codes: 0 = mm 1 = inch -1 = there is no corresponding program
		9	-	Within an M function macro: Number of the M function. Otherwise -1
		103	Q parameter number	Relevant within NC cycles; for inquiry as to whether the Q parameter given under IDX was explicitly stated in the associated CYCLE DEF.
		110	QS parameter number	Is there a file with the name QS(IDX)? 0 = No, 1 = Yes This function resolves relative file paths.
		111	QS parameter number	Is there a directory with the name QS(IDX)? 0 = no, 1 = Yes Only absolute directory paths are possible.

Group name	Group number ID...	System data number NO....	Index IDX...	Description
System jump addresses				
	13	1	-	Label number or label name (string or QS) jumped to during M2/M30 instead of ending the current NC program. Value = 0: M2/M30 have the normal effect
		2	-	Label number or label name (string or QS) jumped to in the event of FN14: ERROR with the NC CANCEL reaction instead of aborting the NC program with an error message. The error number programmed in the FN14 command can be read under ID992 NR14. Value = 0: FN14 has the normal effect.
		3	-	Label number or label name (string or QS) jumped to in the event of an internal server error (SQL, PLC, CFG) or with erroneous file operations (FUNCTION FILECOPY, FUNCTION FILEMOVE, or FUNCTION FILEDELETE) instead of aborting the NC program with an error message. Value = 0: Error has the normal effect.
Indexed access to Q parameters				
	15	11	Q parameter number	Reads Q(IDX)
		12	QL parameter no.	Reads QL(IDX)
		13	QR parameter no.	Reads QR(IDX)
Machine status				
	20	1	-	Active tool number
		2	-	Prepared tool number
		3	-	Active tool axis 0 = X 6 = U 1 = Y 7 = V 2 = Z 8 = W
		4	-	Programmed spindle speed
		5	-	Active spindle condition -1 = spindle condition not defined 0 = M3 active 1 = M4 active 2 = M5 active after M3 3 = M5 active after M4
		7	-	Active gear range
		8	-	Active coolant status 0 = off, 1 = on
		9	-	Active feed rate

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		10	-	Index of prepared tool
		11	-	Index of active tool
		14	-	Number of active spindle
		20	-	Programmed cutting speed in turning operation
		21	-	Spindle mode in turning mode: 0 = constant speed 1 = constant cutting speed
		22	-	Coolant status M7: 0 = inactive, 1 = active
		23	-	Coolant status M8: 0 = inactive, 1 = active

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Channel data				
	25	1	-	Channel number
Cycle parameters				
	30	1	-	Set-up clearance
		2	-	Hole depth / milling depth
		3	-	Plunging depth
		4	-	Feed rate for plunging
		5	-	First side length of pocket
		6	-	Second side length of pocket
		7	-	First side length of slot
		8	-	Second side length of slot
		9	-	Radius of circular pocket
		10	-	Feed rate for milling
		11	-	Rotational direction of the milling path
		12	-	Dwell time
		13	-	Thread pitch for Cycles 17 and 18
		14	-	Finishing allowance
		15	-	Roughing angle
		21	-	Probing angle
		22	-	Probing path
		23	-	Probing feed rate
		49	-	HSC mode (Cycle 32 Tolerance)
		50	-	Tolerance for rotary axes (Cycle 32 Tolerance)
		52	Q parameter number	Type of transfer parameter for user cycles: -1: Cycle parameter not programmed in CYCL DEF 0: Cycle parameter numerically programmed in CYCL DEF (Q parameter) 1: Cycle parameter programmed as string in CYCL DEF (Q parameter)
		60	-	Clearance height (touch probe cycles 30 to 33)
		61	-	Inspection (touch probe cycles 30 to 33)
		62	-	Cutting edge measurement (touch probe cycles 30 to 33)
		63	-	Q parameter number for the result (touch probe cycles 30 to 33)
		64	-	Q parameter type for the result (touch probe cycles 30 to 33) 1 = Q, 2 = QL, 3 = QR

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		70	-	Multiplier for feed rate (cycles 17 and 18)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Modal status				
	35	1	-	Dimensions: 0 = absolute (G90) 1 = incremental (G91)
		2	-	Radius compensation: 0 = R0 1 = RR/RL 10 = Face milling 11 = Peripheral milling
Data for SQL tables				
	40	1	-	Result code for the last SQL command. If the last result code was 1 (=error), the error code is transferred as the return code.
Data from the tool table				
	50	1	Tool no.	Tool length L
		2	Tool no.	Tool radius R
		3	Tool no.	Tool radius R2
		4	Tool no.	Oversize for tool length DL
		5	Tool no.	Tool radius oversize DR
		6	Tool no.	Tool radius oversize DR2
		7	Tool no.	Tool locked TL 0 = not locked, 1 = locked
		8	Tool no.	Number of the replacement tool RT
		9	Tool no.	Maximum tool age TIME1
		10	Tool no.	Maximum tool age TIME2
		11	Tool no.	Current tool age CUR.TIME
		12	Tool no.	PLC status
		13	Tool no.	Maximum tooth length LCUTS
		14	Tool no.	Maximum plunge angle ANGLE
		15	Tool no.	TT: Number of tool teeth CUT
		16	Tool no.	TT: Wear tolerance for length, LTOL
		17	Tool no.	TT: Wear tolerance for radius, RTOL
		18	Tool no.	TT: Direction of rotation DIRECT 0 = positive, -1 = negative
		19	Tool no.	TT: Offset in plane R-OFFS R = 99999.9999
		20	Tool no.	TT: Offset in length L-OFFS
		21	Tool no.	TT: Breakage tolerance for length, LBREAK
		22	Tool no.	TT: Breakage tolerance for radius, RBREAK

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		28	Tool no.	Maximum speed NMAX
		32	Tool no.	Point angle TANGLE
		34	Tool no.	LIFTOFF allowed (0 = No, 1 = Yes)
		35	Tool no.	Wear tolerance for radius R2TOL
		36	Tool no.	Tool type TYPE (miller = 0, grinder = 1, ... touch probe = 21)
		37	Tool no.	Corresponding line in the touch-probe table
		38	Tool no.	Timestamp of last use
		39	Tool no.	ACC
		40	Tool no.	Pitch for thread cycles
		41	Tool no.	AFC: reference load
		42	Tool no.	AFC: overload early warning
		43	Tool no.	AFC: overload NC stop
		44	Tool no.	Exceeding the tool life
		45	Tool no.	Front-face width of indexable insert (RCUTS)
		46	Tool no.	Usable length of the milling cutter
		47	Tool no.	Neck radius of the milling cutter (RN)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Data from the pocket table				
51	1	Pocket number	Tool number	
	2	Pocket number	0 = no special tool 1 = special tool	
	3	Pocket number	0 = no fixed pocket 1 = fixed pocket	
	4	Pocket number	0 = pocket not locked 1 = pocket locked	
	5	Pocket number	PLC status	
Determine the tool pocket				
52	1	Tool no.	Pocket number	
	2	Tool no.	Tool magazine number	
File information				
56	1	-	Number of lines of the tool table	
	2	-	Number of lines of the active datum table	
	4	-	Number of lines in a freely definable table that has been opened with FN26: TABOPEN	
Tool data for T and S strobes				
57	1	T code	Tool number IDX0 = T0 strobe (store tool), IDX1 = T1 strobe (load tool), IDX2 = T2 strobe (prepare tool)	
	2	T code	Tool index IDX0 = T0 strobe (store tool), IDX1 = T1 strobe (load tool), IDX2 = T2 strobe (prepare tool)	
	5	-	Spindle speed IDX0 = T0 strobe (store tool), IDX1 = T1 strobe (load tool), IDX2 = T2 strobe (prepare tool)	
Values programmed in TOOL CALL				
60	1	-	Tool number T	
	2	-	Active tool axis 0 = X 1 = Y 2 = Z 6 = U 7 = V 8 = W	
	3	-	Spindle speed S	
	4	-	Oversize for tool length DL	
	5	-	Tool radius oversize DR	
	6	-	Automatic TOOL CALL 0 = Yes, 1 = No	

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		7	-	Tool radius oversize DR2
		8	-	Tool index
		9	-	Active feed rate
		10	-	Cutting speed [mm/min]
Values programmed in TOOL DEF				
	61	0	Tool no.	Read the number of the tool change sequence: 0 = Tool already in spindle, 1 = Change between external tools, 2 = Change from internal to external tool, 3 = Change from special tool to external tool, 4 = Load external tool, 5 = Change from external to internal tool, 6 = Change from internal to internal tool, 7 = Change from special tool to internal tool, 8 = Load internal tool, 9 = Change from external tool to special tool, 10 = Change from special tool to internal tool, 11 = Change from special tool to special tool, 12 = Load special tool, 13 = Unload external tool, 14 = Unload internal tool, 15 = Unload special tool
		1	-	Tool number T
		2	-	Length
		3	-	Radius
		4	-	Index
		5	-	Tool data programmed in TOOL DEF 1 = Yes, 0 = No

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Values programmed with FUNCTION TURNDATA				
62		1	-	Tool length oversize DXL
		2	-	Tool length oversize DYL
		3	-	Tool length oversize DZL
		4	-	Cutting radius oversize DRS
Values for LAC and VSC				
71	0	0	0	Index of the NC axis for which the LAC weighing run will be performed or was last performed (X to W = 1 to 9)
			2	Total inertia determined by the LAC weighing run in [kgm²] (with A/B/C rotary axes) or total mass in [kg] (with X/Y/Z linear axes)
		1	0	Cycle 957 Retraction from thread
Freely available memory area for OEM cycles				
72	0-39		0 to 30	Freely available memory area for OEM cycles. The values are only reset by the control during a control reboot (= 0). With "Cancel," the values are not reset to the value that they had at the time of execution. Up to and including 597110-11: only NR 0-9 and IDX 0-9 Starting with 597110-12: NR 0-39 and IDX 0-30
Freely available memory area for user cycles				
73	0-39		0 to 30	Freely available memory area for user cycles. The values are only reset by the control during a control reboot (= 0). With "Cancel," the values are not reset to the value that they had at the time of execution. Up to and including 597110-11: only NR 0-9 and IDX 0-9 Starting with 597110-12: NR 0-39 and IDX 0-30
Read minimum and maximum spindle speed				
90	1		Spindle ID	Minimum spindle speed of the lowest gear stage. If no gear stages are configured, CfgFeedLimits/minFeed of the first parameter set of the spindle is evaluated. Index 99 = active spindle
		2	Spindle ID	Maximum spindle speed from the highest gear stage. If no gear stages are configured, CfgFeedLimits/maxFeed of the first parameter set of the spindle is evaluated. Index 99 = active spindle

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Tool compensation				
200	1	1 = without oversize 2 = with oversize 3 = with oversize and oversize from TOOL CALL	Active radius	
	2	1 = without oversize 2 = with oversize 3 = with oversize and oversize from TOOL CALL	Active length	
	3	1 = without oversize 2 = with oversize 3 = with oversize and oversize from TOOL CALL	Rounding radius R2	
	6	Tool no.	Tool length Index 0= active tool	
Coordinate transformations				
210	1	-	Basic rotation (manual)	
	2	-	Programmed rotation	
	3	-	Active mirror axis. Bits 0 to 2 and 6 to 8: Axes X, Y, Z and U, V, W	
	4	Axis	Active scaling factor Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)	
	5	Rotary axis	3D-ROT Index: 1 - 3 (A, B, C)	
	6	-	Tilt working plane in Program Run operating modes 0 = Not active -1 = Active	
	7	-	Tilt working plane in Manual operating modes 0 = Not active -1 = Active	
	8	QL parameter no.	Angle of misalignment between spindle and tilted coordinate system. Projects the angle specified in the QL parameter from the input coordinate	

Group name	Group number ID...	System data number NO....	Index IDX...	Description
				system to the tool coordinate system. If IDX is omitted, the angle 0 is used for projection.
		10	-	Type of definition of the active tilt: 0 = no tilt—is returned if, both in Manual Operation and in the automatic modes, no tilt is active. 1 = axial 2 = spatial angle
		11	-	Coordinate system for manual movements: 0 = Machine coordinate system M-CS 1 = Working plane coordinate system WPL-CS 2 = Tool coordinate system T-CS 4 = Workpiece coordinate system W-CS
		12	Axis	Correction in working plane coordinate system WPL-CS (FUNCTION TURNDATA CORR WPL or FUNCTION CORRDATA WPL) Index: 1 to 9 (X, Y, Z, A, B, C, U, V, W)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Active coordinate system				
	211	–	-	1 = input system (default) 2 = REF system 3 = tool change system
Special transformations in turning mode				
	215	1	-	Angle for the precession of the input system in the XY plane in turning mode. To reset the transformation the value 0 must be entered for the angle. This transformation is used in connection with Cycle 800 (parameter Q497).
		3	1-3	Reading out of the spatial angle written with NR2 Index: 1 - 3 (rotA, rotB, rotC)
Current datum shift				
	220	2	Axis	Current datum shift in [mm] Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		3	Axis	Read the difference between reference point and preset. Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		4	Axis	Read values for OEM offset.. Index: 1 - 9 (X_OFFS, Y_OFFS, Z_OFFS,...)
Traverse range				
	230	2	Axis	Negative software limit switches Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		3	Axis	Positive software limit switches Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		5	-	Software limit switch on or off: 0 = on, 1 = off For modulo axes, either both the upper and lower limits or no limit at all must be set.
Read the nominal position in the REF system				
	240	1	Axis	Current nominal position in the REF system
Read the nominal position in the REF system, including offsets (handwheel, etc.)				
	241	1	Axis	Current nominal position in the REF system
Read the current position in the active coordinate system				
	270	1	Axis	Current nominal position in the input system When called while tool radius compensation is active, the function supplies the uncompensated positions for the principal axes X, Y, and Z. If the function is called for a rotary axis and tool radius

Group name	Group number ID...	System data number NO....	Index IDX...	Description
				compensation is active, an error message is issued. Index: 1 to 9 (X, Y, Z, A, B, C, U, V, W)
Read the current position in the active coordinate system, including offsets (handwheel, etc.)				
	271	1	Axis	Current nominal position in the input system
Read information to M128				
	280	1	-	M128 active: -1 = Yes, 0 = No
		3	-	Condition of TCPM after Q No.: Q No. + 0: TCPM active, 0 = no, 1 = yes Q No. + 1: AXIS, 0 = POS, 1 = SPAT Q No. + 2: PATHCTRL, 0 = AXIS, 1 = VECTOR Q No. + 3: Feed rate, 0 = F TCP, 1 = F CONT
Machine kinematics				
	290	5	-	0: Temperature compensation not active 1: Temperature compensation active
		7	-	KinematicsComp: 0: Compensations by KinematicsComp not active 1: Compensations by KinematicsComp active
		10	-	Index of the machine kinematics from Channels/ChannelSettings/CfgKin-List/kinCompositeModels programmed in FUNCTION MODE MILL or FUNCTION MODE TURN -1 = Not programmed.
Read data of the machine kinematics				
	295	1	QS parameter no.	Read the axis names of the active 3-axis kinematics. The axis names are written according to QS(IDX), QS(IDX+1), and QS(IDX+2). 0 = Operation successful
		2	0	Is FACING HEAD POS function active? 1 = Yes, 0 = No
		4	Rotary axis	Read whether the defined rotary axis participates in the kinematic calculation. 1 = Yes, 0 = No (A rotary axis can be excluded from the kinematics calculating using M138.) Index: 4, 5, 6 (A, B, C)
		5	Secondary axis	Read whether the given secondary axis is used in the kinematics model. -1 = Axis not in the kinematics model 0 = Axis is not included in the kinematics calculation:

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		6	Axis	Angle head: Displacement vector in the basic coordinate system B-CS through angle head Index: 1, 2, 3 (X, Y, Z)
		7	Axis	Angle head: Direction vector of the tool in the basic coordinate system B-CS Index: 1, 2, 3 (X, Y, Z)
		10	Axis	Determine programmable axes. Determine the axis ID associated with the specified axis index (index from CfgAxis/axisList). Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		11	Axis ID	Determine programmable axes. Determine the index of the axis (X = 1, Y = 2, ...) for the specified axis ID Index: Axis ID (index from CfgAxis/axisList)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Modify the geometrical behavior				
	310	20	Axis	Diameter programming: -1 = on, 0 = off
		126	-	M126: -1 = on, 0 = off
Current system time				
	320	1	0	System time in seconds that have elapsed since 01.01.1970, 00:00:00 (real time).
			1	System time in seconds that have elapsed since 01.01.1970, 00:00:00 (look-ahead calculation).
		3	-	Read the processing time of the current NC program.
Formatting of system time				
	321	0	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: DD.MM.YYYY hh:mm:ss
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: DD.MM.YYYY hh:mm:ss
		1	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: D.MM.YYYY h:mm:ss
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: D.MM.YYYY h:mm:ss
		2	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: D.MM.YYYY h:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: D.MM.YYYY h:mm
		3	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: D.MM.YY h:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: D.MM.YY h:mm

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		4	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: YYYY-MM-DD hh:mm:ss
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: YYYY-MM-DD hh:mm:ss
		5	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: YYYY-MM-DD hh:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: YYYY-MM-DD hh:mm
		6	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: YYYY-MM-DD h:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: YYYY-MM-DD h:mm
		7	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: YY-MM-DD h:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: YY-MM-DD h:mm
		8	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: DD.MM.YYYY
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: DD.MM.YYYY
		9	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: D.MM.YYYY
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: D.MM.YYYY

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		10	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: D.MM.YY
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: D.MM.YY
		11	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: YYYY-MM-DD
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: YYYY-MM-DD
		12	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: YY-MM-DD
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: YY-MM-DD
		13	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: hh:mm:ss
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: hh:mm:ss
		14	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: h:mm:ss
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: h:mm:ss
		15	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: h:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: h:mm

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		16	0	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (real time) Format: DD.MM.YYYY hh:mm
			1	Formatting of: System time in seconds that have elapsed since 00:00:00 UTC on January 1, 1970 (look-ahead calculation) Format: DD.MM.YYYY hh:mm
	20	0	The current calendar week number according to ISO 8601 (real time)	
		1	The current calendar week number according to ISO 8601 (look-ahead calculation)	
Global Program Settings (GPS): Global activation status				
	330	0	-	0 = No GPS setting is active 1 = Any GPS setting is active
Global Program Settings (GPS): Individual activation status				
	331	0	-	0 = No GPS setting is active 1 = Any GPS setting is active
		1	-	GPS: Basic rotation 0 = Off, 1 = On
		3	Axis	GPS: Mirroring 0 = Off, 1 = On Index: 1 - 6 (X, Y, Z, A, B, C)
		4	-	GPS: Shift in the modified workpiece system 0 = Off, 1 = On
		5	-	GPS: Rotation in input system 0 = Off, 1 = On
		6	-	GPS: Feed rate factor 0 = Off, 1 = On
		8	-	GPS: Handwheel superimpositioning 0 = Off, 1 = On
		10	-	GPS: Virtual tool axis VT 0 = Off, 1 = On
		15	-	GPS: Selection of the handwheel coordinate system 0 = Machine coordinate system M-CS 1 = Workpiece coordinate system W-CS 2 = Modified workpiece coordinate system mW-CS 3 = Working plane coordinate system WPL-CS
		16	-	GPS: Shift in the workpiece system 0 = Off, 1 = On
		17	-	GPS: Axis offset 0 = Off, 1 = On

Group name	Group number ID...	System data number NO....	Index IDX...	Description	
Global Program Settings (GPS)					
	332	1	-	GPS: Angle of a basic rotation	
		3	Axis	GPS: Mirroring 0 = Not mirrored, 1 = Mirrored Index: 1 - 6 (X, Y, Z, A, B, C)	
		4	Axis	GPS: Shift in the modified workpiece coordinate system mW-CS Index: 1 - 6 (X, Y, Z, A, B, C)	
		5	-	GPS: Angle of rotation in input coordinate system I-CS	
		6	-	GPS: Feed rate factor	
		8	Axis	GPS: Handwheel superimpositioning Maximum value Index: 1 - 10 (X, Y, Z, A, B, C, U, V, W, VT)	
		9	Axis	GPS: Value for handwheel superimpositioning Index: 1 - 10 (X, Y, Z, A, B, C, U, V, W, VT)	
		16	Axis	GPS: Shift in the workpiece coordinate system W-CS Index: 1 - 3 (X, Y, Z)	
		17	Axis	GPS: Axis offset Index: 4 - 6 (A, B, C)	
TS touch trigger probe					
	350	50	1	Touch probe type: 0: TS120, 1: TS220, 2: TS440, 3: TS630, 4: TS632, 5: TS640, 6: TS444, 7: TS740	
			2	Line in the touch-probe table	
		51	-	Effective length	
			52	1	Effective radius of the stylus tip
		2		Rounding radius	
		53	1	Center offset (reference axis)	
			2	Center offset (minor axis)	
		54	-	Spindle-orientation angle in degrees (center offset)	
			55	1	Rapid traverse
				2	Measuring feed rate
		3		Feed rate for pre-positioning: FMAX_PROBE or FMAX_MACHINE	
		56	1	Maximum measuring range	
			2	Set-up clearance	
		57	1	Spindle orientation possible 0=No, 1=Yes	
			2	Angle of spindle orientation in degrees	

Group name	Group number ID...	System data number NO....	Index IDX...	Description
TT tool touch probe for tool measurement				
	350	70	1	TT: Touch probe type
			2	TT: Line in the tool touch probe table
		71	1/2/3	TT: Touch probe center (REF system)
		72	-	TT: Touch probe radius
		75	1	TT: Rapid traverse
			2	TT: Measuring feed rate with stationary spindle
			3	TT: Measuring feed rate with rotating spindle
		76	1	TT: Maximum probing path
			2	TT: Safety clearance for linear measurement
			3	TT: Safety clearance for radius measurement
			4	TT: Distance from the lower edge of the cutter to the upper edge of the stylus
		77	-	TT: Spindle speed
		78	-	TT: Probing direction
		79	-	TT: Activate radio transmission
			-	TT: Stop probing movement upon stylus deflection

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Preset from touch probe cycle (probing results)				
	360	1	Coordinate	Last preset of a manual touch probe cycle, or last touch point from Cycle 0 (input coordinate system). Compensations: length, radius, and center offset
		2	Axis	Last preset of a manual touch probe cycle, or last touch point from Cycle 0 (machine coordinate system, only axes from the active 3-D kinematics are allowed as index). Compensation: only center offset
		3	Coordinate	Result of measurement in the input system of touch probe Cycles 0 and 1. The measurement result is read out in the form of coordinates. Compensation: only center offset
		4	Coordinate	Last preset of a manual touch probe cycle, or last touch point from Cycle 0 (workpiece coordinate system). The measurement result is read in the form of coordinates. Compensation: only center offset
		5	Axis	Axis values, not compensated
		6	Coordinate / axis	Readout of the measurement results in the form of coordinates / axis values in the input system from probing operations. Compensation: only length
		10	-	Oriented spindle stop
		11	-	Error status of probing: 0: Probing was successful -1: Touch point not reached -2: Touch probe already deflected at the start of the probing process

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Read values from or write values to the active datum table				
	500	Row number	Column	Read values
Read values from or write values to the preset table (basic transformation)				
	507	Row number	1-6	Read values
Read axis offsets from or write axis offsets to the preset table				
	508	Row number	1-9	Read values
Data for pallet machining				
	510	1	-	Active line
		2	-	Current pallet number. Read value of the NAME column of the last PAL-type entry. If the column is empty or does not contain a numerical value, a value of -1 is returned.
		3	-	Active row of the pallet table.
		4	-	Last line of the NC program for the current pallet.
		5	Axis	Tool-oriented editing: Clearance height is programmed: 0 = No, 1 = Yes Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		6	Axis	Tool-oriented editing: Clearance height The value is invalid if ID510 NR5 returns the value 0 with the corresponding IDX. Index: 1 - 9 (X, Y, Z, A, B, C, U, V, W)
		10	-	Row number up to which the pallet table is to be searched during block scan.
		20	-	Type of pallet editing? 0 = Workpiece-oriented 1 = Tool oriented
		21	-	Automatic continuation after NC error: 0 = Locked 1 = Active 10 = Abort continuation 11 = Continuation with the rows in the pallet table that would have been executed next if not for the NC error 12 = Continuation with the row in the pallet table in which the NC error arose 13 = Continuation with the next pallet

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Read data from the point table				
	520	Row number	10	Read value from active point table.
			11	Read value from active point table.
			1-3 X/Y/Z	Read value from active point table.
Read or write the active preset				
	530	1	-	Number of the active preset in the active preset table.
Active pallet preset				
	540	1	-	Number of the active pallet preset. Returns the number of the active preset. If no pallet preset is active, the function returns the value -1.
		2	-	Number of the active pallet preset. As with NR1.
Values for the basic transformation of the pallet preset				
	547	Row number	Axis	Read values of the basic transformation from the pallet preset table. Index: 1 to 6 (X, Y, Z, SPA, SPB, SPC)
Axis offsets from the pallet preset table				
	548	Row number	Offset	Read values of the axis offsets from the pallet preset table. Index: 1 - 9 (X_OFFS, Y_OFFS, Z_OFFS,...)
OEM offset				
	558	Row number	Offset	Read values for OEM offset. Index: 1 - 9 (X_OFFS, Y_OFFS, Z_OFFS,...)
Read and write the machine status				
	590	2	1-30	Freely available; not deleted during program selection.
		3	1-30	Freely available; not deleted during a power failure (persistent storage).
Read/write look-ahead parameter of a single axis (at machine level)				
	610	1	-	Minimum feed rate (MP_minPathFeed) in mm/min
		2	-	Minimum feed rate at corners (MP_min-CornerFeed) in mm/min
		3	-	Feed-rate limit for high speeds (MP_maxG1Feed) in mm/min
		4	-	Max. jerk at low speeds (MP_maxPath-Jerk) in m/s ³
		5	-	Max. jerk at high speeds (MP_maxPath-JerkHi) in m/s ³
		6	-	Tolerance at low speeds (MP_pathTolerance) in mm

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		7	-	Tolerance at high speeds (MP_pathToleranceHi) in mm
		8	-	Max. derivative of jerk (MP_maxPathYank) in m/s ⁴
		9	-	Tolerance factor for curve machining (MP_curveTolFactor)
		10	-	Factor for max. permissible jerk at curvature changes (MP_curveJerkFactor)
		11	-	Maximum jerk with probing movements (MP_pathMeasJerk)
		12	-	Angle tolerance for machining feed rate (MP_angleTolerance)
		13	-	Angle tolerance for rapid traverse (MP_angleToleranceHi)
		14	-	Max. corner angle for polygons (MP_maxPolyAngle)
		18	-	Radial acceleration with machining feed rate (MP_maxTransAcc)
		19	-	Radial acceleration with rapid traverse (MP_maxTransAccHi)
		20	Index of physical axis	Max. feed rate (MP_maxFeed) in mm/min
		21	Index of physical axis	Max. acceleration (MP_maxAcceleration) in m/s ²
		22	Index of physical axis	Maximum transition jerk of the axis in rapid traverse (MP_axTransJerkHi) in m/s ²
		23	Index of physical axis	Maximum transition jerk of the axis during machining free rate (MP_axTransJerk) in m/s ³
		24	Index of physical axis	Acceleration feedforward control (MP_compAcc)
		25	Index of physical axis	Axis-specific jerk at low speeds (MP_axPathJerk) in m/s ³
		26	Index of physical axis	Axis-specific jerk at high speeds (MP_axPathJerkHi) in m/s ³
		27	Index of physical axis	More precise tolerance examination in corners (MP_reduceCornerFeed) 0 = deactivated, 1 = activated
		28	Index of physical axis	DCM: Maximum tolerance for linear axes in mm (MP_maxLinearTolerance)
		29	Index of physical axis	DCM: Maximum angle tolerance in [°] (MP_maxAngleTolerance)
		30	Index of physical axis	Tolerance monitoring for successive threads (MP_threadTolerance)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		31	Index of physical axis	Form (MP_shape) of the axisCutterLoc filter 0: Off 1: Average 2: Triangle 3: HSC 4: Advanced HSC
		32	Index of physical axis	Frequency (MP_frequency) of the axisCutterLoc filter in Hz
		33	Index of physical axis	Form (MP_shape) of the axisPosition filter 0: Off 1: Average 2: Triangle 3: HSC 4: Advanced HSC
		34	Index of physical axis	Frequency (MP_frequency) of the axisPosition filter in Hz
		35	Index of physical axis	Order of the filter for Manual operating mode (MP_manualFilterOrder)
		36	Index of physical axis	HSC mode (MP_hscMode) of the axisCutterLoc filter
		37	Index of physical axis	HSC mode (MP_hscMode) of the axisPosition filter
		38	Index of physical axis	Axis-specific jerk for probing movements (MP_axMeasJerk)
		39	Index of physical axis	Weighting of the filter error for calculating filter deviation (MP_axFilterErrWeight)
		40	Index of physical axis	Maximum filter length of position filter (MP_maxHscOrder)
		41	Index of physical axis	Maximum filter length of CLP filter (MP_maxHscOrder)
		42	-	Maximum feed rate of the axis at machining feed rate (MP_maxWorkFeed)
		43	-	Maximum path acceleration at machining feed rate (MP_maxPathAcc)
		44	-	Maximum path acceleration at rapid traverse (MP_maxPathAccHi)
		45	-	Shape of the smoothing filter (CfgSmoothingFilter/shape) 0 = Off 1 = Average 2 = Triangle
		46	-	Order of smoothing filter (only odd-numbered values) (CfgSmoothingFilter/order)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		47	-	Type of acceleration profile (CfgLaPath/profileType) 0 = Bellshaped 1 = Trapezoidal 2 = Advanced Trapezoidal
		48	-	Type of acceleration profile for rapid traverse (CfgLaPath/profileTypeHi) 0 = Bellshaped 1 = Trapezoidal 2 = Advanced Trapezoidal
		51	Index of physical axis	Compensation of following error in the jerk phase (MP_IpcJerkFact)
		52	Index of physical axis	kv factor of the position controller in 1/s (MP_kvFactor)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Measure the maximum utilization of an axis				
	621	0	Index of physical axis	Conclude measurement of the dynamic load and save the result in the specified Q parameter.
Read SIK contents				
	630	0	Option no.	You can explicitly determine whether the SIK option given under IDX has been set or not. 1 = option is enabled 0 = option is not enabled
		1	-	You can determine whether a Feature Content Level (for upgrade functions) is set, and which one. -1 = No FCL is set <No.> = FCL that is set
		2	-	Read serial number of the SIK -1 = No valid SIK in the system
		10	-	Define the type of control: 0 = iTNC 530 1 = NCK-based control (TNC7, TNC 640, TNC 620, TNC 320, TNC 128, PNC 610, ...)
General data of the grinding wheel				
	780	2	-	Width
		3	-	Overhang
		4	-	Alpha angle (optional)
		5	-	Gamma angle (optional)
		6	-	Depth (optional)
		7	-	Rounding radius at the "Further" edge (optional)
		8	-	Rounding radius at the "Nearer" edge (optional)
		9	-	Rounding radius at the "Nearest" edge (optional)
		10	-	Active edge:
		11	-	Type of grinding wheel (straight / angular)
		12	-	External or internal wheel?
		13	-	Compensation angle of the B axis (with respect to the base angle of the location)
		14	-	Type of angular wheel
		15	-	Total length of the grinding wheel
		16	-	Length of the inner edge of the grinding wheel
		17	-	Minimum wheel diameter (wear limit)
		18	-	Minimum wheel width (wear limit)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		19	-	Tool number
		20	-	Cutting speed
		21	-	Maximum permissible cutting speed
		27	-	Wheel basic type: with relief cut
		28	-	Relief cut on the outside
		29	-	Relief cut on the inside
		30	-	Definition status
		31	-	Radius compensation
		32	-	Compensation of total length
		33	-	Compensation of overhang
		34	-	Compensation for the length to the innermost edge
		35	-	Radius of the shaft of the grinding wheel
		36	-	Initial dressing performed?
		37	-	Dresser location for initial dressing
		38	-	Dresser tool for initial dressing
		39	-	Has the grinding wheel been measured?
		51	-	Dresser tool for dressing on the diameter
		52	-	Dresser tool for dressing on the outer edge
		53	-	Dresser tool for dressing on the inner edge
		54	-	Dressing of the diameter according to the number of calls
		55	-	Dressing of the outer edge according to the number of calls
		56	-	Dressing of the inner edge according to the number of calls
		57	-	Dressing counter of the diameter
		58	-	Dressing counter of the outer edge
		59	-	Dressing counter of the inner edge
		101	-	Radius of grinding wheel

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Detailed geometry (contour) of the grinding wheel				
	783	1	1	Chamfer width of the outer side of the wheel
			2	Chamfer width of the inner side of the wheel
		2	1	Chamfer angle of the outer side of the wheel
			2	Chamfer angle of the inner side of the wheel
		3	1	Corner radius of the outer side of the wheel
			2	Corner radius of the inner side of the wheel
		4	1	Side length of the outer side of the wheel
			2	Side length of the inner side of the wheel
		5	1	Relief length of the outer side of the wheel
			2	Relief length of the inner side of the wheel
		6	1	Relief angle of the outer side of the wheel
			2	Relief angle of the inner side of the wheel
		7	1	Recess length of the outer side of the wheel
			2	Recess length of the inner side of the wheel
		8	1	Departing radius of the outer side of the wheel
			2	Departing radius of the inner side of the wheel
		9	1	Total depth on the outside
			2	Total depth on the inside

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Read Functional Safety (FS) information				
	820	1	-	FS limitations: 0 = No Functional Safety (FS) 1 = Guard door open (SOM1) 2 = Guard door open (SOM2) 3 = Guard door open (SOM3) 4 = Guard door open (SOM4) 5 = All guard doors closed
Write data for unbalance monitoring				
	850	10	-	Activate and deactivate unbalance monitoring 0 = unbalance monitoring not active 1 = unbalance monitoring active
Counter				
	920	1	-	Planned workpieces. In Test Run operating mode the counter generally generates the value 0.
		2	-	Already machined workpieces. In Test Run operating mode the counter generally generates the value 0.
		12	-	Workpieces still to be machined. In Test Run operating mode the counter generally generates the value 0.
Read and write data of current tool				
	950	1	-	Tool length L
		2	-	Tool radius R
		3	-	Tool radius R2
		4	-	Oversize for tool length DL
		5	-	Tool radius oversize DR
		6	-	Tool radius oversize DR2
		7	-	Tool locked TL 0 = not locked, 1 = locked
		8	-	Number of the replacement tool RT
		9	-	Maximum tool age TIME1
		10	-	Maximum tool age TIME2 at TOOL CALL
		11	-	Current tool age CUR.TIME
		12	-	PLC status
		13	-	Tooth length in the tool axis LCUTS
		14	-	Maximum plunge angle ANGLE
		15	-	TT: Number of tool teeth CUT
		16	-	TT: Wear tolerance for length LTOL
		17	-	TT: Wear tolerance for radius RTOL

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		18	-	TT: Direction of rotation DIRECT 0 = positive, -1 = negative
		19	-	TT: Offset in plane R-OFFS R = 99999.9999
		20	-	TT: Offset in length L-OFFS
		21	-	TT: Break tolerance for length LBREAK
		22	-	TT: Break tolerance for radius RBREAK
		28	-	Maximum spindle speed [rpm] NMAX
		32	-	Point angle TANGLE
		34	-	LIFTOFF allowed (0 = No, 1 = Yes)
		35	-	Wear tolerance for radius R2TOL
		36	-	Tool type TYPE (miller = 0, grinder = 1, ... touch probe = 21)
		37	-	Corresponding line in the touch-probe table
		38	-	Timestamp of last use
		39	-	ACC
		40	-	Pitch for thread cycles
		41	-	AFC: reference load
		42	-	AFC: overload early warning
		43	-	AFC: overload NC stop
		44	-	Exceeding the tool life
		45	-	Front-face width of indexable insert (RCUTS)
		46	-	Usable length of the milling cutter
		47	-	Neck radius of the milling cutter (RN)

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Read and write data of current turning tool				
	951	1	-	Tool number
		2	-	Tool length XL
		3	-	Tool length YL
		4	-	Tool length ZL
		5	-	Tool length oversize DXL
		6	-	Oversize in tool length DYL
		7	-	Tool length oversize DZL
		8	-	Tooth radius (RS)
		9	-	Tool orientation (TO)
		10	-	Angle of spindle orientation (ORI)
		11	-	Tool angle P_ANGLE
		12	-	Point angle T_ANGLE
		13	-	Recessing width CUT_WIDTH
		14	-	Type (e.g. roughing, finishing, threading, recessing or button tool)
		15	-	Length of cutting edge CUT_LENGTH
		16	-	Compensation of workpiece diameter WPL-DX-DIAM in the working plane coordinate system WPL-CS
		17	-	Compensation of workpiece diameter WPL-DZL in the working plane coordinate system WPL-CS
		18	-	Recessing width oversize
		19	-	Cutting radius oversize
		20	-	Rotation around spatial angle B for offset recessing tools

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Data of the currently active dresser				
	952	1	-	Tool number
		2	-	Tool length XL
		3	-	Tool length YL
		4	-	Tool length ZL
		5	-	Oversize for tool length DXL
		6	-	Oversize for tool length DYL
		7	-	Oversize for tool length DZL
		8	-	Cutter radius
		9	-	Cutting position
		13	-	Cutter width for plate or roll
		14	-	Type (e.g. diamond, plate, spindle, roll)
		19	-	Cutter radius oversize
		20	-	Shaft speed of a dressing spindle or roll

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Freely available memory area for tool management				
	956	0-9	-	Freely available data area for tool management. The data is not reset when the program is aborted.
Tool usage and tooling				
	975	1	-	Tool usage test for the current NC program: Result -2: Test not possible, function disabled in the configuration Result -1: Test not possible, tool usage file missing Result 0: Test OK, all tools available Result 1: Test not OK
		2	Line	Check availability of the tools required in the pallet from line IDX in the current pallet table. -3 = No pallet is defined in row IDX, or function was called outside of pallet editing -2 / -1 / 0 / 1 see NR1
Lift off the tool at NC stop				
	980	3	-	(This function is obsolete—HEIDENHAIN recommends not to use it any longer. ID980 NR3 = 1 is equivalent to ID980 NR1 = -1, ID980 NR3 = 0 has the same effect as ID980 NR1 = 0. Other values are not permissible.) Enable lift-off to the value defined in CfgLiftOff: 0 = Lock lift-off function 1 = Enable lift-off function
Touch probe cycles and coordinate transformations				
	990	1	-	Approach behavior: 0 = Standard behavior 1 = Approach probing position without compensation. Effective radius, set-up clearance is zero
		2	16	Automatic / Manual machine operating modes
		4	-	0 = Stylus not deflected 1 = Stylus deflected
		6	-	TT tool touch probe active? 1 = Yes 0 = No
		8	-	Momentary spindle angle in [°]
		10	QS parameter no.	Determine the tool number from the tool name. The return value depends on the rules configured for the search of the replacement tool.

Group name	Group number ID...	System data number NO....	Index IDX...	Description
				<p>If there are multiple tools with the same name, the first tool from the tool table will be selected.</p> <p>If the tool selected by these rules is locked, a replacement tool will be returned.</p> <p>-1: No tool with the specified name found in the tool table or all qualifying tools are locked.</p>
		16	0	<p>0 = Transfer control over the channel spindle to the PLC,</p> <p>1 = Assume control over the channel spindle</p>
			1	<p>0 = Pass tool spindle control to the PLC,</p> <p>1 = Take control of the tool spindle</p>
		19	-	<p>Suppress touch prove movement in cycles:</p> <p>0 = Movement will be suppressed (CfgMachineSimul/simMode parameter not equal to FullOperation or Test Run operating mode is active)</p> <p>1 = Movement will be performed (CfgMachineSimul/simMode parameter = FullOperation, can be programmed for testing purposes)</p>

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Status of execution				
	992	10	-	Block scan active 1 = yes, 0 = no
		11	-	Block scan—information on block scan: 0 = NC program started without block scan 1 = Iniprog system cycle is run before block scan 2 = Block scan is running 3 = Functions are being updated -1 = Iniprog cycle was canceled before block scan -2 = Cancellation during block scan -3 = Cancellation of the block scan after the search phase, before or during the update of functions -99 = Implicit cancellation
		12	-	Type of canceling for interrogation within the OEM_CANCEL macro: 0 = No cancellation 1 = Cancellation due to error or emergency stop 2 = Explicit cancellation with internal stop after stop in the middle of the block 3 = Explicit cancellation with internal stop after stop at the end of a block
		14	-	Number of the last FN14 error
		16	-	Real execution active? 1 = execution, 0 = simulation
		17	-	2-D graphics during programming active? 1 = yes 0 = no
		18	-	Live programming graphics (AUTO DRAW soft key) active? 1 = Yes 0 = No
		20	-	Information on combined milling/turning mode of operation: 0 = Milling (after FUNCTION MODE MILL) 1 = Turning (after FUNCTION MODE TURN) 10 = Execute the operations for the turning-to-milling transition 11 = Execute the operations for the milling-to-turning transition
		30	-	Interpolation of multiple axes permitted? 0 = No (e.g. for straight cut control) 1 = yes

Group name	Group number ID...	System data number NO....	Index IDX...	Description
		31	-	R+/R- possible/permitted in MDI mode? 0 = No 1 = Yes
		32	0	Cycle call possible/permitted? 0 = No 1 = Yes
			Cycle number	Single cycle enabled: 0 = No 1 = Yes
		40	-	Copy tables in Test Run operating mode? Value 1 will be set when a program is selected and when the RESET+START soft key is pressed. The iniprog.h system cycle will then copy the tables and reset the system datum. 0 = no 1 = yes
		101	-	M101 active (visible condition)? 0 = no 1 = yes
		136	-	M136 active? 0 = no 1 = yes

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Activate machine parameter subfile				
	1020	13	QS parameter no.	Has a machine parameter subfile with path from QS number (IDX) been loaded? 1 = Yes 0 = No
Configuration settings for cycles				
	1030	1	-	Display the Spindle does not rotate error message? (CfgGeoCycle/displaySpindleErr) 0 = no, 1 = yes
		2	-	Display the Check the algebraic sign for depth! error message? (CfgGeoCycle/displayDepthErr) 0 = no, 1 = yes
Data transfer between HEIDENHAIN cycles and OEM macros				
	1031	1	0	Component monitoring: counter of the measurement. Cycle 238 Measure machine data automatically increments this counter.
			1	Component monitoring: Type of measurement -1 = No measurement. Writing of the value with FN17 concludes Cycle 238. 0 = Circular test 1 = Waterfall diagram 2 = Frequency response 3 = Envelope curve spectrum
			2	Component Monitoring: Index of the axis from CfgAxes\MP_axisList
			3 – 9	Component monitoring: further arguments depend on the measurement
		100	-	Component monitoring: optional names of the monitoring tasks, as specified in System\Monitoring\CfgMonComponent . After completion of the measurement, the monitoring tasks stated here are executed consecutively. When assigning the input parameters, remember to separate the listed monitoring tasks by commas.
User settings for the user interface				
	1070	1	-	Feed rate limit of soft key FMAX; 0 = FMAX is inactive
Bit test				
	2300	Number	Bit number	This function checks whether a bit has been set in a number. The number to be checked is transferred as NR, the bit to be searched for as IDX, with IDX0 designating the least significant bit. To call this function for large numbers, make sure to

Group name	Group number ID...	System data number NO....	Index IDX...	Description
				transfer NR as a Q parameter. 0 = Bit not set 1 = Bit set
Read program information (system string)				
	10010	1	-	Path of the current main program or pallet program.
		2	-	Path of the NC program shown in the block display.
		3	-	Path of the cycle selected with SEL CYCLE or CYCLE DEF 12 PGM CALL , or path of the currently active cycle
		10	-	Path of the NC program selected with SEL PGM "..." .
Indexed access to QS parameters				
	10015	20	QS parameter no.	Reads QS(IDX)
		30	QS parameter no.	Returns the string that you obtain if you replace anything except for letters and digits in QS(IDX) by '_ '.
Read channel data (system string)				
	10025	1	-	Name of machining channel (key)
Read data for SQL tables (system string)				
	10040	1	-	Symbolic name of the preset table.
		2	-	Symbolic name of the datum table.
		3	-	Symbolic name of the pallet preset table.
		10	-	Symbolic name of the tool table.
		11	-	Symbolic name of the pocket table.
		12	-	Symbolic name of the turning tool table

Group name	Group number ID...	System data number NO....	Index IDX...	Description
Values programmed in the tool call (system string)				
	10060	1	-	Tool name
Read machine kinematics (system strings)				
	10290	10	-	Symbolic name of the machine kinematics from Channels/ChannelSettings/CfgKinList/kinCompositeModels programmed in FUNCTION MODE MILL or FUNCTION MODE TURN .
Traverse range switchover (system string)				
	10300	1	-	Key name of the last active range of traverse
Read current system time (system string)				
	10321	1 - 16	-	1: DD.MM.YYYY hh:mm:ss 2: D.MM.YYYY h:mm 3: DD.MM.YY hh:mm 4: YYYY-MM-DD hh:mm:ss 5: YYYY-MM-DD hh:mm 6: YYYY-MM-DD h:mm 7: YY-MM-DD h:mm 8: DD.MM.YYYY 9: D.MM.YYYY 10: D.MM.YY 11: YYYY-MM-DD 12: YY-MM-DD 13: hh:mm:ss 14: h:mm:ss 15: h:mm 16: DD.MM.YYYY hh:mm 20: Calender week as per ISO 8601 As an alternative, you can use DAT in SYSSTR(...) to specify a system time in seconds that is to be used for formatting.
Read data of touch probes (TS, TT) (system string)				
	10350	50	-	Type of TS probe from TYPE column of the touch probe table (tchprobe.tp)
		70	-	Type of TT tool touch probe from CfgTT/type.
		73	-	Key name of the active tool touch probe TT from CfgProbes/activeTT .
Read and write data of touch probes (TS, TT) (system string)				
	10350	74	-	Serial number of the active tool touch probe TT from CfgProbes/activeTT .
Read the data for pallet machining (system string)				
	10510	1	-	Pallet name
		2	-	Path of the selected pallet table.
Read version ID of the NC software (system string)				

Group name	Group number ID...	System data number NO....	Index IDX...	Description
	10630	10	-	The string corresponds to the format of the version ID shown, e.g. 340590 09 or 817601 05 SP1 .
General data of the grinding wheel				
	10780	1	-	Name of wheel
Read information on unbalance cycle (system string)				
	10855	1	-	Path of the unbalance calibration table belonging to the active kinematics
Read data of the current tool (system string)				
	10950	1	-	Current tool name
		2	-	Entry from the DOC column of the active tool
		3	-	AFC control setting
		4	-	Tool-carrier kinematics
		5	-	Entry from the DR2TABLE column – file name of the compensation value table for 3D-ToolComp
Read data from FUNCTION MODE SET (system string)				
	11031	10	-	Returns the selection of the FUNCTION MODE SET <OEM mode> macro as a string.

Index

3

3D-ToolComp.....	330
Compensation table.....	618
3D tool compensation.....	317
Entire tool radius.....	328
Face milling.....	321
Fundamentals.....	317
Peripheral milling.....	326
Straight line LN.....	318
Tool.....	319

A

About the product.....	39
About the User's Manual.....	29
Absolute entries.....	169
Adaptive Feed Control AFC.....	366
Adding table values.....	601
Additional documentation.....	31
Advanced checks.....	361
Advanced Dynamic Prediction (ADP).....	407
AFC.....	366
Programming.....	368
Angle encoder.....	99
Approach function.....	195
APPR CT.....	200
APPR LCT.....	201
APPR LN.....	199
APPR LT.....	198
APPR PCT.....	200
APPR PLCT.....	201
APPR PLN.....	199
APPR PLT.....	198
Axis designation.....	98

B

Basic coordinate system.....	226
Batch Process Manager.....	582
B-CS.....	226
Blank form.....	144
Blank form update.....	150
Block.....	103
Hiding.....	541
Skipping.....	541

C

CAD model.....	400
Calculator.....	552
CAM.....	395
Output.....	401
Output format.....	396
Software options.....	407
CAM program.....	395
Compensation.....	317
Executing.....	403
Cartesian coordinates.....	168

Cartesian coordinate system.....	223
Circle calculation.....	468
Circle center point.....	178
Collision monitoring.....	352
Fixtures.....	358
NC function.....	357
Simulation.....	356
Comment, adding.....	540
Comparison.....	547
Compensation	
Ball-nose cutter.....	330
CAM program.....	317
Tool contact angle.....	330
Turning tool.....	315
Compensation table.....	312
Activating a value.....	314
Columns.....	615
Creating.....	618
Selecting.....	314
tco.....	313
wco.....	313
Compensation table 3DTC.....	618
Component monitoring	
Heatmap.....	376
Contact.....	37
Context menu.....	548
Contour.....	515
Exporting.....	527
First steps.....	530
Importing.....	524
Contour, approaching.....	195
Contour, departing.....	195
Control's user interface.....	58
Coordinate definition	
Absolute.....	169
Cartesian.....	168
Incremental.....	170
Polar.....	168
Coordinate system.....	222
Basics.....	223
Coordinate origin.....	223
Coordinate transformation.....	242
Datum shift.....	242
Mirroring.....	244
Rotation.....	246
Scaling.....	248
Counter.....	494
CR2.....	158
Cutting data.....	162
Cutting data calculator.....	553
Cutting data tables.....	555
Table.....	608
Cutting data table.....	609
Applying.....	555
Cutting speed.....	126

D

Datum shift.....	242
Datum table.....	240, 605
Columns.....	606
Creating.....	607
Selecting.....	241
DCM.....	352
Fixtures.....	358
NC function.....	357
Simulation.....	356
Delta length.....	305
Delta radius.....	305
Delta value.....	304
Departure function.....	195
DEP CT.....	205
DEP LCT.....	206
DEP LN.....	203
DEP LT.....	203
DEP PLCT.....	206
Diameter-dependent cutting data table.....	610
Dressing.....	138
Activating.....	140
Dwell time	
Cyclic.....	373
Once.....	373
Dynamic Collision Monitoring (DCM).....	352
Dynamic Efficiency.....	408
Dynamic Precision.....	409

E

Encoder.....	99
Error message.....	622
Output.....	470

F

Face milling.....	321
Facing head.....	386
FCL.....	52
Feature Content Level.....	52
Feed control.....	366
Feed rate.....	164
Feed-rate limit	
TCPM.....	301
File.....	333
Adapt iTNC 530.....	344
Characters.....	338
iTNC 530 Import.....	344
Managing with FUNCTION FILE.....	348
Opening with OPEN FILE.....	347
File extension.....	339
File format.....	339
File function	
In NC program.....	347
File functions.....	342
File management.....	334

Finding.....	336	Hardware.....	53	For coordinate entries.....	416
File name.....	338	Helix.....	189	For path behavior.....	419
File path.....	338	Example.....	192	For tools.....	447
Absolute.....	338	Help graphic.....	109	Overview.....	413
Relative.....	338	Hiding NC blocks.....	541	Mid-program startup	
File type.....	339			In pallet program.....	582
First steps.....	75	I		Milling mode.....	122
Programming.....	78	Icons, miscellaneous.....	71	Mirroring	
Fixture monitoring.....	358	I-CS.....	232	NC function.....	244
Activating.....	360	If-then-decision.....	469	Miscellaneous function.....	411
CFG file.....	360	Inclined machining.....	293	For coordinate entries.....	416
M3D file.....	359	Inclined-tool machining.....	293	For path behavior.....	419
STL file.....	359	Inclined turning.....	128	For tools.....	447
FN 16.....	471	Incremental entries.....	170	Overview.....	413
Output format.....	471	Input coordinate system.....	232	Miscellaneous functions	
FN 18.....	476	Integrated product help		Fundamentals.....	412
FN 26.....	482	TNCguide.....	34	Model comparison.....	572
FN 27.....	482	Interface.....	58	Monitor.....	53
FN 28.....	483	iTNC 530		Motion control (ADP).....	407
FN 38.....	479	Adapt file.....	344		
Form.....	113	Import tool table.....	344	N	
Freely definable table.....	602			NC block.....	103
Reading.....	483	J		Hiding.....	541
Freely definable tables		Jig grinding.....	138	Skipping.....	541
Access.....	482	Job list.....	577	NC function, editing.....	117
Opening.....	482	Batch Process Manager.....	582	NC function, inserting.....	115
Writing to.....	482	Editing.....	578	NC fundamentals.....	98
FreeTurn.....	132	Tool-oriented.....	586	NC program.....	103
FUNCTION DCM.....	357	Jumping with GOTO.....	539	Appearance.....	108
FUNCTION DRESS.....	140			Calling.....	214
Function STOP.....	412	K		Editing.....	114
Programming.....	412	Keyboard.....	55	Form.....	113
FUNCTION TCPM.....	295	Formula.....	538	Help graphic.....	109
REFPNT.....	300	NC functions.....	537	Search.....	544
Tool location point.....	300	Text.....	538	Selecting.....	216
Fundamentals		Virtual.....	536	Settings.....	109
Programming.....	102	Keys.....	65	Structure, creating.....	541
G		Klartext editor.....	115	Structuring.....	542
Gestures.....	65	Klartext programming.....	102	Using.....	110
GOTO.....	539			NC syntax.....	103
Graphical programming.....	515	L		Nesting.....	218
Contour, exporting.....	527	Label.....	210	Notes, types of.....	32
Contour, importing.....	524	Calling.....	211	O	
First steps.....	530	Defining.....	210	Operating elements.....	65
Graphics.....	557	Length compensation.....	305	Operating mode.....	122
Grinding.....	136	Licensing terms.....	52	Editor.....	104
Dressing.....	138	Liftoff.....	362	Files.....	334
Dressing mode.....	140	Linear block.....	175	Tables.....	592
Fundamentals.....	136	Linear encoder.....	99	Operating modes	
Jig grinding.....	138			Overview.....	59
Program structure.....	137	M		Orthogonal coordinates.....	168
Grinding mode.....	122	M92 datum M92-ZP.....	100	P	
H		Machine coordinate system.....	223	Pallet.....	577
Handwheel superimpositioning		Machine datum.....	100	Batch Process Manager.....	582
M118.....	426	Machining feed rate.....	164	Editing.....	578
		Machining types, milling.....	398	Parameters.....	611
		M-CS.....	223		
		Measuring in the simulation.....	569		
		M function.....	411		

- Table..... 611
 - Tool-oriented..... 586
 - Pallet counter..... 578
 - Pallet table
 - Columns..... 611
 - Creating..... 614
 - Parallel axis..... 382
 - Cycle..... 385
 - Paraxcomp..... 382
 - Paraxmode..... 382
 - Part family..... 465
 - Path..... 338
 - Absolute..... 338
 - Relative..... 338
 - Path function
 - Approach and departure..... 195
 - Chamfer..... 175
 - Circle center point..... 178
 - Circular path C..... 178
 - Circular path CR..... 180
 - Circular path CT..... 181
 - Fundamentals..... 171
 - Overview..... 174
 - Polar coordinates..... 184
 - Rounding..... 177
 - Straight line L..... 175
 - Straight line LN..... 318
 - Peripheral milling..... 326
 - Place of operation..... 41
 - PLANE function..... 250
 - AXIAL..... 280
 - Axis angle definition..... 280
 - EULER..... 265
 - Euler angle definition..... 265
 - Incremental definition..... 275
 - MOVE..... 285
 - Overview..... 251
 - Point definition..... 271
 - POINTS..... 271
 - PROJECTED..... 260
 - Projection angle definition..... 260
 - RELATIV..... 275
 - RESET..... 279
 - Resetting..... 279
 - Rotary axis positioning..... 284
 - SPATIAL..... 255
 - Spatial angle definition..... 255
 - STAY..... 286
 - Tilting solution..... 287
 - Transformation types..... 291
 - TURN..... 285
 - VECTOR..... 268
 - Vector definition..... 268
 - Point table
 - Columns..... 604
 - Creating..... 605
 - Hiding a point..... 605
 - Polar coordinates
 - Circular path CP..... 187
 - Circular path CTP..... 188
 - Fundamentals..... 168
 - Helix..... 189
 - Overview..... 184
 - Pole..... 185
 - Straight line..... 186
 - POLARKIN..... 390
 - Polar kinematics..... 390
 - Position encoder..... 99
 - Postprocessor..... 401
 - Preset
 - Activating in NC program..... 237
 - Copying in NC program..... 238
 - Correcting in NC program..... 239
 - Process Monitoring..... 378
 - Monitoring section..... 379, 379
 - Program..... 103
 - Appearance..... 108
 - Editing..... 114
 - Form..... 113
 - Help graphic..... 109
 - Q parameters..... 454
 - Search..... 544
 - Settings..... 109
 - Structure, creating..... 541
 - Structuring..... 542
 - Using..... 110
 - Program call..... 214
 - Program comparison..... 547
 - Program editor..... 106
 - Programmed dwell time..... 373
 - Programming fundamentals..... 102
 - Programming possibilities..... 101
 - Programming technique..... 209
 - Program run
 - Lifting off..... 362
 - Program section repeat..... 213
 - Proper and intended operation..... 40
 - Pulsing spindle speed..... 372
- ## Q
- Q Info..... 457
 - Q parameter
 - String formula..... 487
 - Q parameter list..... **457**
 - Q parameters..... 454
 - Basic calculation method..... 464
 - Basics..... 454
 - Circle calculation..... 468
 - Formula..... 484
 - Jump..... 469
 - Overview..... 454
 - Pre-assigned..... 459
 - System datum, reading..... 476
 - Text output..... 471
 - Trigonometric function..... 466
- ## R
- Radius compensation..... 305
 - Reading table values..... 600
 - Reciprocating stroke..... 137
 - Recurring dwell time..... 373
 - Reference point..... 100
 - Reference system..... 222
 - Basic coordinate system..... 226
 - Input coordinate system..... 232
 - Machine coordinate system..... 223
 - Tool coordinate system..... 234
 - Working plane coordinate system..... 230
 - Workpiece coordinate system..... 228
 - Replacement tool, inserting..... 447
 - Right-click..... 548
 - Right-hand rule..... 256
 - RL/RR/R0..... 306
 - Rotation
 - NC function..... 246
- ## S
- Safety precaution..... 42
 - Content..... 32
 - Scaling..... 248
 - Search and replace..... 546
 - Selected program, calling..... 216
 - Select function
 - Datum table..... 241
 - Selection function..... 214
 - Call NC program..... 214
 - Compensation table..... 314
 - File..... 347
 - NC program..... 216
 - Overview..... 214
 - Simulation..... 557
 - Center of rotation..... 573
 - Collision test..... 361
 - Cutout view..... 571
 - DCM..... 356
 - Measuring..... 569
 - Model comparison..... 572
 - Settings..... 558
 - Speed..... 574
 - STL file, creating..... 567
 - Tool representation..... 566
 - Simultaneous turning..... 130
 - Skipping NC blocks..... 541
 - Software number..... 45
 - Software option..... **45**
 - Spatial arc..... 183
 - Speed..... 163
 - Speed of the simulation..... 574
 - Spindle speed..... 163
 - Pulsing..... 372
 - Split screen layout of User's

Manual.....	31	TMAT.....	608	Unbalance.....	134
SQL.....	495	Tool.....	153	Working plane.....	124
BIND.....	497	Delta value.....	304	Turning mode.....	122
COMMIT.....	508	Length compensation.....	305	Turning operation	
EXECUTE.....	501	Lifting off.....	362	Facing head.....	386
FETCH.....	505	Overview.....	154	FreeTurn.....	132
INSERT.....	511	Preset.....	154	Turning tool	
Overview.....	497	Radius compensation....	305, 306	Compensating.....	315
ROLLBACK.....	506	Tool angle of inclination			
SELECT.....	499	Compensating.....	295	U	
UPDATE.....	509	Tool axis, aligning.....	254	Unbalance.....	134
STL file as workpiece blank.....	149	Tool call.....	159	USB device.....	345
STOP.....	412	Tool change.....	159	Removing.....	346
Programming.....	412	Tool carrier reference point.....	155	User aids.....	533
Straight line L.....	175	Tool center point TCP.....	157	User interface of the control.....	58
Straight line LN.....	318, 398	Tool change position.....	100	V	
Straight line polar.....	186	Tool compensation.....	304	Variable.....	453
String formula.....	487	Table.....	312	Basic calculation method.....	464
String parameter.....	487	Three-dimensional.....	317	Circle calculation.....	468
Structure item.....	541	Tool contact angle.....	330	Counter.....	494
Structuring.....	542	Turning tool.....	315	Formula.....	484
Creating.....	541	Tool compensation depending on		Information, sending.....	479
Subprogram.....	212	the tool contact angle.....	330	Jump.....	469
Surface-normal vector.....	317	Tool compensation depending on		Local parameters QL.....	456
Swipe menu.....	342	the tool's contact angle		Overview.....	454
Syntax.....	103	Compensation table.....	618	Pre-assigned.....	459
Syntax element.....	103	Tool coordinate system.....	234	Remanent parameters QR.....	456
Syntax highlighting.....	108	TOOL DEF.....	165	SQL statement.....	495
Syntax search.....	113	Tool location point TLP.....	157	String formula.....	487
System datum, reading.....	476	Selection.....	300	String parameter QS.....	487
T		Tool material.....	608	System datum, reading.....	476
TABDATA.....	599	Tool-oriented machining.....	586	Text output.....	471
Table		Tool pre-selection.....	165	Trigonometric function.....	466
3DTC compensation table.....	618	Tool radius 2 center CR2.....	158	Variable programming.....	453
Access from within the NC		Tool radius compensation.....	306	Variables	
program.....	599	Tool rotation point TRP.....	158	Basics.....	454
Compensation table.....	615	Selection.....	300	controlling.....	457
Cutting data calculation.....	608	Tool table		Vector set.....	398
Datum table.....	605	iTNC 530.....	344	Virtual keyboard.....	536
Pallet table.....	611	Tool tip TIP.....	156	Virtual tool axis.....	428
Point table.....	603	Touch probe		W	
SQL access.....	495	Compensation.....	330	W-CS.....	228
Target group.....	30	Touchscreen.....	53	WMAT.....	608
TCP.....	157	Transformation.....	242	Working plane.....	98
TCPM.....	295, 432	Datum shift.....	242	Turning.....	124
REFPNT.....	300	Mirroring.....	244	Working plane, tilting	
Tool location point.....	300	Rotation.....	246	Fundamentals.....	249
T-CS.....	234	Scaling.....	248	Head rotary axis.....	250
Text editor.....	118	Traverse range, switching.....	122	Manually.....	249
Text output.....	471	Trigonometry.....	466	Programming.....	250
Tilting		TRP.....	158	Table rotary axis.....	250
Manually.....	249	Turning.....	124	Working plane coordinate	
Resetting.....	279	Blank form update.....	150	system.....	230
Without rotary axes.....	254	feed rate.....	128	Workpiece blank.....	144
Working plane.....	250	Fundamentals.....	124	Cuboid.....	146
TIP.....	156	Inclined.....	128	Cylinder.....	147
TLP.....	157	Simultaneous.....	130		
		Spindle speed.....	126		

Pipe.....	147
Rotational.....	148
STL file.....	149
Updating.....	150
Workpiece blank definition.....	144
Workpiece coordinate system...	228
Workpiece counter.....	494
Workpiece datum.....	100
Workpiece material.....	608
Workpiece preset.....	100
Activating in NC program.....	237
Copying in NC program.....	238
Correcting in NC program.....	239
Managing.....	237
Workspaces.....	61
Overview.....	62
WPL-CS.....	230
Writing table values.....	601

HEIDENHAIN

DR. JOHANNES HEIDENHAIN GmbH

Dr.-Johannes-Heidenhain-Straße 5

83301 Traunreut, Germany

☎ +49 8669 31-0

FAX +49 8669 32-5061

E-mail: info@heidenhain.de

Technical support FAX +49 8669 32-1000

Measuring systems ☎ +49 8669 31-3104

E-mail: service.ms-support@heidenhain.de

NC support ☎ +49 8669 31-3101

E-mail: service.nc-support@heidenhain.de

NC programming ☎ +49 8669 31-3103

E-mail: service.nc-pgm@heidenhain.de

PLC programming ☎ +49 8669 31-3102

E-mail: service.plc@heidenhain.de

APP programming ☎ +49 8669 31-3106

E-mail: service.app@heidenhain.de

www.heidenhain.com

www.klartext-portal.com

The Information Site for
HEIDENHAIN Controls

Klartext App

Klartext on your
mobile device

Google
Play Store

Apple
App Store



Touch probes from HEIDENHAIN

help you reduce non-productive time and improve the dimensional accuracy of the finished workpieces.


Workpiece touch probes

TS 150, TS 260, Signal transmission by cable
TS 750

TS 460, TS 760 Radio or infrared transmission

TS 642, TS 740 Infrared transmission

- Workpiece alignment
- Preset setting
- Workpiece measurement

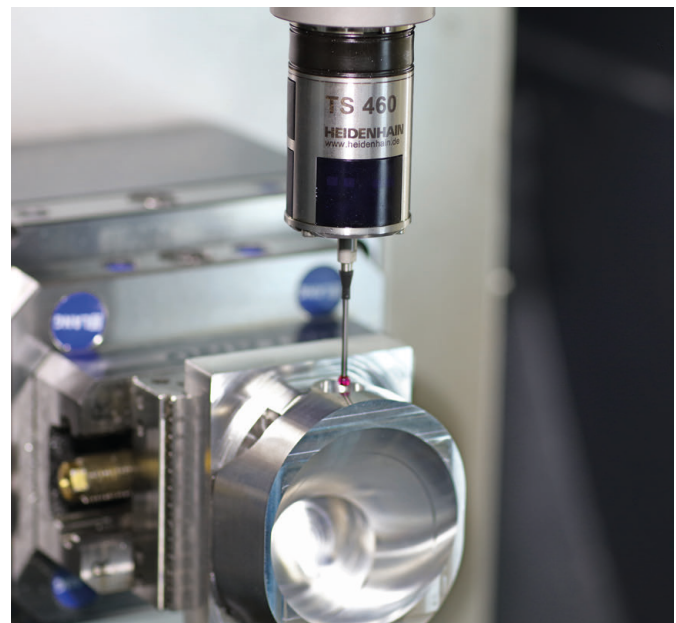

Tool touch probes

TT 160 Signal transmission by cable

TT 460 Infrared transmission

- Tool measurement
- Wear monitoring
- Tool breakage detection

